

ASS. REC. BY:

REF:

AIG/ 22010191/KP

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

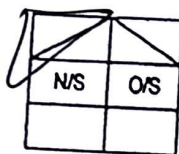

Bal. or Market Value:

853K

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

18

days

Res.: Yes or No

Lum Sum:

20

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

09/29

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

Veh No:

SFL 3731U

Yr Regn: 04, 09

Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Hyundai Avante

c.c 1591

Colour

M. Gold

A/C: Insured / Std / NI / NA

Sp. Reading

307067

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

KM1H0U41BR9U 751805

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: NII / S/Rim / STD A/Rim or

Tyre Size:

F:

R:

195/60R15

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

Rear

R/Bal.

6

mm

R/Bal.

7

mm

L/Bal.

6

mm

L/Bal.

7

mm

D.O.A.

13/10/22

D.O.I.

20/10/2022

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

FR N/S

The U/C / Chassis-frame & Body Structure affected due to collision.

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S + RS. SI

F. + RS

Others

TOTAL

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

Tech Invs (\$

☐

Weekend (\$

Report Format :

Lump Sum / I.B.I: (\$

Cheng Hoe Motor Pte Ltd

Blk 1019, Yishun Industrial Park A #01-374/382, Singapore 768761
TEL: 67556142 (YIS) FAX: 67557719 (YIS) Email: chmotor@singnet.com.sg
GST:201001158E RCB NO:201001158E

SFL 3731U

TP/AIG

M/S : AIG ASIA PACIFIC INSURANCE PTE LTD

78 SHENTON WAY
#07-16 AIG BUILDING
SINGAPORE 079120

TEL: 64193000

FAX: 64153727

ATTN: Motor Claim Department

Estimate No: ES2291083/YISHUN

Date: 20 Oct 2022

Policy No: 5099284273-04

Veh Reg No: SFL3731U

Make/Model: HYUNDAI HYUNDAI
HD AVANTE 1.6 A

Chassis No: KMHU41BR9U751805

Engine No: G4FC9U648208

Reg. Date: 29/04/2009

WS Ref: TP/AIG

Claim Type: Third Party

Accident Date: 13/10/2022

TP Veh Reg No: GBG2506J

Not Notarized

*1/1 Imp &
Patching After Paint
18 days*

Estimate Repair Cost to Vehicle No :SFL3731U

PAGE:1/3

Description	U/Price	Quantity	List Price S\$	Amount S\$
List Price				
1 FRONT BUMPER	461.40	1 PC	<i>Tu</i> 461.40	<i>✓</i>
2 FRONT BUMPER SIDE RETAINERS	18.70	2 PCS	<i>CM</i> 37.40	<i>✓</i>
3 FRONT BUMPER CLIP	3.50	6 PC	<i>na</i> 21.00	<i>✓</i>
4 FRONT BUMPER LOWER GRILLE	47.00	1 PC	<i>bit</i> 47.00	<i>✓</i>
5 FRONT BUMPER LH FOG LAMP GARNISH	25.30	1 PC	<i>na</i> 25.30	<i>✓</i>
6 FRONT BUMPER REINFORCEMENT	254.70	1 PC	<i>Ry</i> 254.70	<i>✓</i>
7 FRONT BUMPER SPONGE	113.40	1 PC	<i>na</i> 113.40	<i>✓</i>
8 FRONT GRILLE	366.00	1 PC	<i>CM</i> 366.00	<i>✓</i>
9 FRONT GRILLE EMBLEM	23.30	1 PC	<i>na</i> 23.30	<i>✓</i>
10 HEADLAMPS	480.00	2 PCS	960.00	<i>✓</i>
11 HEADLAMP LOWER BRACKETS	29.80	2 PCS	59.60	<i>✓</i>
12 HEADLAMP LOWER CLIPS	4.00	2 PCS	8.00	<i>✓</i>
13 FRONT RH FENDER INNER SHIELD	48.00	1 PC	<i>Tu</i> 48.00	<i>✓</i>
14 FRONT RH FENDER INNER SHIELD CLIPS	3.50	6 PCS	<i>na</i> 21.00	<i>✓</i>
15 FRONT FENDER EMBLEM (VVT)	18.20	2 PCS	<i>na</i> 36.40	<i>✓</i>
16 FRONT LH FENDER	521.20	1 PC	<i>Ry</i> 521.20	<i>✓</i>
17 FRONT LH FENDER INNER SHIELD	48.00	1 PC	<i>Tu</i> 48.00	<i>✓</i>
18 FRONT LH FENDER INNER SHIELD CLIPS	3.50	6 PCS	<i>na</i> 21.00	<i>✓</i>
19 FRONT LH FENDER TRIANGLE GARNISH	15.00	1 PC	<i>na</i> 15.00	<i>✓</i>
20 FRONT BUMPER LOWER CENTRE UNDER COVER	44.00	1 PC	<i>na</i> 44.00	<i>✓</i>
21 FRONT BUMPER LOWER CENTRE UNDER COVER CLIPS	3.50	4 PCS	<i>na</i> 14.00	<i>✓</i>
22 FRONT LH INNER PANEL	493.20	1 PC	<i>Ry</i> 493.20	<i>✓</i>
23 BONNET	1,885.60	1 PC	<i>na</i> 1,885.60	<i>✓</i>
24 BONNET HINGES	55.70	2 PCS	<i>bit</i> 111.40	<i>✓</i>
25 BONNET INSULATOR	230.10	1 PC	<i>CM</i> 230.10	<i>50% in</i>
26 BONNET INSULATOR CLIPS	3.50	8 PCS	<i>na</i> 28.00	<i>✓</i>
27 BONNET FRONT RUBBER SEAL	16.00	1 PC	<i>na</i> 16.00	<i>✓</i>
28 FRT SUPPORT PANEL	864.00	1 PC	<i>Ry</i> 864.00	<i>✓</i>
29 FRONT SUPPORT PANEL LH AIR GUIDE	16.00	1 PC	<i>CM</i> 16.00	<i>✓</i>
30 FRONT SUPPORT PANEL RH AIR GUIDE	16.00	1 PC	<i>CM</i> 16.00	<i>✓</i>
31 FRONT SUPPORT PANEL AIR GUIDE CLIPS	3.00	6 PCS	<i>na</i> 18.00	<i>✓</i>
32 HORN - LOW	73.80	1 PC	<i>na</i> 73.80	<i>✓</i>
33 HORN - HIGH	73.80	1 PC	<i>na</i> 73.80	<i>✓</i>
34 FRT BRACE PANEL	52.10	1 PC	<i>Ry</i> 52.10	<i>✓</i>
35 BATTERY TRAY	33.80	1 PC	<i>na</i> 33.80	<i>✓</i>
36 BATTERY BRACKET	15.00	1 PC	<i>na</i> 15.00	<i>✓</i>
37 FUSE BOX TOP COVER	20.00	1 PC	<i>na</i> 20.00	<i>✓</i>
38 FUSE BOX LOWER CASING	71.30	1 PC	<i>na</i> 71.30	<i>✓</i>
39 FUSE BOX BLOCK	796.60	1 PC	796.60	<i>✓</i>
40 AIR-FILTER DUCT	68.40	1 PC	<i>CM</i> 68.40	<i>✓</i>
41 AIR-FILTER DUCT CLIPS	4.80	4 PCS	<i>na</i> 19.20	<i>✓</i>
42 AIR FILTER HOUSING	74.80	1 PC	<i>na</i> 74.80	<i>✓</i>
43 AIR FILTER OUTLET HOSE	246.40	1 PC	<i>na</i> 246.40	<i>✓</i>
44 THROTTLE VALVE	347.60	1 PC	347.60	<i>✓</i>

Cheng Hoe Motor Pte Ltd

Blk 1019, Yishun Industrial Park A #01-374/382, Singapore 768761
 TEL: 67556142 (YIS) FAX: 67557719 (YIS) Email: chmotor@singnet.com.sg
 GST:201001158E RCB NO:201001158E

M/S : AIG ASIA PACIFIC INSURANCE PTE LTD
 78 SHENTON WAY
 #07-16 AIG BUILDING
 SINGAPORE 079120

TEL: 64193000 FAX: 64153727
 ATTN: Motor Claim Department

WS Ref: TP/AIG
 Claim Type: Third Party
 Accident Date: 13/10/2022
 TP Veh Reg No: GBG2506J

Estimate No: ES2291083/YISHUN
 Date: 20 Oct 2022
 Policy No: 5099284273-04
 Veh Reg No: SFL3731U
 Make/Model: HYUNDAI HYUNDAI
 HD AVANTE 1.6 A
 Chassis No: KMH DU41BR9U751805
 Engine No: G4FC9U648208
 Reg. Date: 29/04/2009

Estimate Repair Cost to Vehicle No :SFL3731U

PAGE:2/3

Description	U/Price	Quantity	List Price	Amount
			SS	SS
45 THROTTLE SWITCH	135.50	1 PC	CM 135.50	✓
46 AIR-CON CONDENSER	990.90	1 PC	R 990.90	✓
47 RADIATOR	588.70	1 PC	R 588.70	✓
48 RADIATOR TOP HOSE	41.50	1 PC	Pu 41.50	✓
49 RADIATOR O/FLOW HOSE	42.90	1 PC	7 42.90	✓
50 RADIATOR FAN WITH COWLING	595.90	1 PC	7 595.90	✓
51 RADIATOR TOP MOUNTING WITH BRACKET	15.00	2 PCS	7 30.00	✓
52 DRIVER AIR BAG	1,508.40	1 PC	Burn 1,508.40	✓
53 DRIVER SEAT BELT	850.10	1 PC	Tu 850.10	✓
54 FRONT LH AIR BAG	1,962.40	1 PC	Burn 1,962.40	✓
55 FRONT LH SEAT BELT	850.10	1 PC	Tu 850.10	✓
56 DASHBOARD	1,850.40	1 PC	Tu 1,850.40	✓
57 SRS SPIRAL COIL	203.60	1 PC	Re 203.60	✓
58 SRS ECU	2,317.60	1 PC	Re 2,317.60	✓
59 SRS SENSORS	155.20	2 PCS	Re 310.40	✓
60 FRONT WINDSCREEN GLASS	923.10	1 PC	CM 923.10	✓
61 FRONT WINDSCREEN GLASS MOULDING	53.10	1 PC	Re 53.10	✓
62 FRT LH SUNVISOR	129.30	1 PC	CM 129.30	✓
63 FRONT LH LOWER ARM	326.20	1 PC	R 326.20	✓
64 FRONT LH LOWER ARM BALL JOINT	97.10	1 PC	7 97.10	✓
65 FRONT LH KNUCKLE ARM	309.00	1 PC	7 309.00	✓
66 FRONT LH WHEEL HUB	168.00	1 PC	7 168.00	✓
67 FRONT LH WHEEL HUB BEARING	136.00	1 PC	7 136.00	✓
68 LH DRIVE SHAFT OIL SEAL	29.00	1 PC	7 29.00	✓
69 FRONT LH STABILIZER LINKAGE	83.00	1 PC	7 83.00	✓
70 ENGINE SUPPORT CROSS MEMBER	3,091.40	1 PC	7 3,091.40	✓
71 ENGINE SUPPORT CROSS MEMBER MOUNTING BOLTS	25.00	4 PCS	7 100.00	✓
72 ENGINE LH MOUNTING	299.90	1 PC	7 299.90	✓
73 ENGINE LH MOUNTING BRACKET	178.00	1 PC	7 178.00	✓
74 FRONT LOWER MOUNTING	261.10	1 PC	7 261.10	✓
75 ENGINE RH MOUNTING	303.60	1 PC	7 303.60	✓
76ENGINE RH MOUNTING BRACKET	197.40	1 PC	7 197.40	✓
			27,680.40	
		Less 20%	5,536.08	22,144.32
Special Net				
77 FRONT NUMBER PLATE	35.00	1 PC	R 35.00	✓
78 RADIATOR COOLANT	30.00	1 BTL	Re 30.00	✓
79 BRAKE FLUID	28.00	1 BTL	Re 28.00	✓
80 ATF FLUID (3 LTRS)	96.00	1 UNIT	Re 96.00	✓
			189.00	189.00

BATTERY

CM - B180.00 SIN 5062

Cheng Hoe Motor Pte Ltd

Blk 1019, Yishun Industrial Park A #01-374/382, Singapore 768761
TEL: 67556142 (YIS) FAX: 67557719 (YIS) Email: chmotor@singnet.com.sg
GST:201001158E RCB NO:201001158E

M/S : AIG ASIA PACIFIC INSURANCE PTE LTD
78 SHENTON WAY
#07-16 AIG BUILDING
SINGAPORE 079120

TEL: 64193000 FAX: 64153727
ATTN: Motor Claim Department

WS Ref: TP/AIG
Claim Type: Third Party
Accident Date: 13/10/2022
TP Veh Reg No: GBG2506J

Estimate No: ES2291083/YISHUN
Date: 20 Oct 2022
Policy No: 5099284273-04
Veh Reg No: SFL3731U
Make/Model: HYUNDAI HYUNDAI
HD AVANTE 1.6 A
Chassis No: KMH DU41BR9U751805
Engine No: G4FC9U648208
Reg. Date: 29/04/2009

Estimate Repair Cost to Vehicle No :SFL3731U

PAGE:3/3

Description	U/Price	Quantity	List Price S\$	Amount S\$
Labour				
81 TOWING	50.00	1 LA	50.00	✓
82 REMOVE DAMAGED BODY PARTS & ATTACHMENTS AND REPLACE ALL CHANGING PARTS,PANEL BEATING & REPAIR FRT LH DOOR,DOOR PILLAR,FRT RH FENDER,INNER MEMBERS,INNER PANEL,CHASSIS FRAME,CUT,WELD & REPLACE FRT LH FENDER INNER PANEL AND REALIGN FRT CHASSIS	1,750.00	1 LA	1,750.00	1400
83 REMOVE & REFIX ENGINE,SUPPORT CROSS MEMBER,FRT LH SUSPENSION AND UNDER CARRIAGE PARTS	450.00	1 LA	450.00	320
84 REMOVE & REFIX DASHBOARD	250.00	1 LA	250.00	✓
85 REMOVE AND REFIX AIRCON CONDENSER,PIPE & HOSE,CHECK,VACUUM & REFILL GAS	100.00	1 LA	100.00	✓
86 REMOVE AND REFIX FRONT WINDSCREEN GLASS	120.00	1 LA	120.00	✓
87 REPLACE AIR BAGS,SEAT BELT & SRS COMPONENTS	300.00	1 LA	300.00	200
88 PUTTY & RESPRAY PAINT ON FRT BUMPER,BONNET,FRT FENDERS,WHEEL HOUSING,FRT LH DOOR,DOOR PILLAR,FRT INNER PANEL	1,450.00	1 LA	1,450.00	1200
89 TO CONDUCT COMPUTERIZED WHEEL ALIGNMENT	80.00	1 PC	80.00	60
90 TO REPROGRAMME ECU	200.00	1 LA	200.00	150
91 RUSTPROOFING	100.00	1 LA	100.00	90
			4,850.00	4,850.00

Total S\$ 27,183.32

Add GST @ 7% 1,902.83

Total Amount Payable S\$ 29,086.15

**LKK Auto Consultants hence notify
the Repairer of the following:**

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

For Cheng Hoe Motor Pte Ltd

AUTHORISED SIGNATURE

Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Singapore NRIC
Owner ID: 733G

Vehicle Details

Vehicle No.: SFL3731U
Vehicle to be Exported: No
Intended Deregistration Date: 13 Oct 2022
Vehicle Make: HYUNDAI
Vehicle Model: HD AVANTE 1.6 A
Primary Colour: Beige
Manufacturing Year: 2009
Engine No.: G4FC9U648208
Chassis No.: KMH DU41BR9U751805
Maximum Power Output: 89.7 kW (120 bhp)
Open Market Value: \$11,706.00
Original Registration Date: 29 Apr 2009
First Registration Date: 29 Apr 2009
Transfer Count: 0
Actual ARF Paid: \$11,706.00

Intended PARF Rebate Details

PARF Eligibility: Forfeited

PARF Eligibility Expiry Date: -

PARF Rebate Amount: \$0.00

Intended COE Rebate Details

COE Expiry Date: 28 Apr 2029
COE Category: A - Car (1600cc & below)
COE Period(Years): 10
PQP Paid: \$26,175.00
COE Rebate Amount: \$17,122.00
Total Rebate Amount: \$17,122.00

The information contained herein is correct as at 13 Oct 2022

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This Form must be **completed by the Policyholder and/or the Actual Driver**
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	13/10/2022 18:15 (SGT)
Reported by	Both
Date of Accident	13/10/2022 10:15 (SGT)
Exact Location of Accident	Singapore
Additional Location Information	NON-TRAFFIC JUNCTION OF OLD CHOA CHU KANG RD & JLN LEKAR
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SFL3731U

INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	ONG YEW CHEONG
NRIC No	SXXXX733G
Email Address	ongyewcheong123@yahoo.com.sg
Mobile Phone No	(Phone) +65-81899879
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	Hyundai
Model	HD AVANTE 1.6 A
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Private car
Transmission	Auto
CC	1591

INSURANCE COMPANY

Name of Insurance Company	Income Insurance Limited
Policy Number / Cover Note Number	5099284273-04

DRIVER


Name of Driver	ONG YEW CHEONG
NRIC No	SXXXX733G
Date Of Birth	09/11/1970

Describe Circumstance of the Accident

NOTE : PLEASE TAKE NOTE THAT YOUR INSURER HAVE 14DAYS TIME FRAME for you to submit OWN DAMAGE Claim under your Own Comprehensive policy. Pls check your policy for more information.

() Claim Own Policy (☒) Claim Third party
() Claim OD/ TP at other workshop () Reporting Only

Sketch Plan

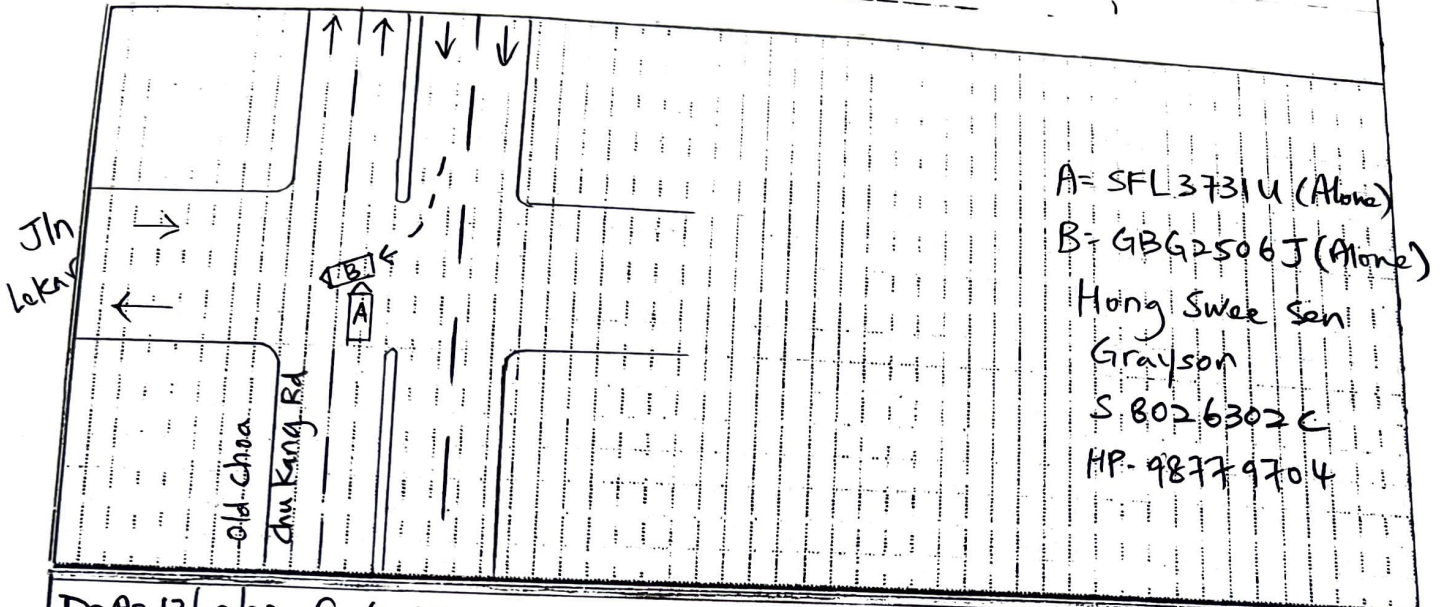

DoA: 13/10/22 @ 10:15am

It is a non-traffic junction, 2 lane 2 way road. I was moving straight at the right along Old Choa Chu Kang Road. Upon reaching the above junction, vehicle B made a right turn abruptly from opposite direction and collided onto the front of my vehicle. The impact has caused my car 2 air-bags being deployed and windscreen crack, etc. The said driver admitted his fault as he was

Declaration thinking of his work issue at the point of time.
I/We declare the foregoing particulars are true in every respect. No one was injured.

Policyholder's Signature / Date & Time

Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel
(Name as in NRIC/ID card)

13/10/22