

ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_  
 Estimated Cost: \_\_\_\_\_  
 OD / TP / WS / TP RES / OD RES / EVA / INV / MV  
 To Inspect Vehicle No: SMZ 9150A  
 at Workshop m/s 2nd  
 of \_\_\_\_\_  
 Insured: YQ 4061L  
 Policy No. \_\_\_\_\_  
 Claims No. CDMCG22002161  
 Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_  
 (Client's Record)  
 Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: \$66k.  
 IDAC Accident Rpt: \_\_\_\_\_ Consistent?: Yes or No  
 GIA / PR Seen: \_\_\_\_\_ Consistent?: Yes or No  
 Est. Repairs: 6 days Res.: Yes or No  
 Lum Sum: 20 % 3 Val.: Yes or No  
 CA / REV / REP. / 24 HRS 7106  
 Date: \_\_\_\_\_ Person Contacted: LTA 34502  
 Vehicle: IN / OUT

Veh No: SMZ 9150A Yr Regn: 17/02/17  
 Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /  
 Truck / Trailer or CA/  
 Make: Mazda 5 c.c. 1998  
 Colour: Grey A/C: Insured / Std / NI / NA  
 Sp. Reading: 90500 T/Radio: Insured / Std / NI / NA  
 Eng/No: \_\_\_\_\_  
 C/No: JM6CW107190125033  
 Gen. Cond: Good / Fair / Poor / Burnt  
 Steering: Inorder / Jammed / Leaked / Burnt or  
 Brake: Inorder / Jammed / Leaked / Burnt or  
 Modi: Nil / S/Rim / STD A/Rim or  
 Tyre Size: F: 205/55R16  
 R: \_\_\_\_\_  
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /  
 TOYO / YOKO or Westlake  
 Front R/Bal. 7 mm Rear R/Bal. 7 mm  
 L/Bal. 7 mm L/Bal. 7 mm  
 D.O.A. 10/10/22 D.O.I. 17/10/22  
 Survey held at \_\_\_\_\_  
 Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or  
 The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction Rep 13K.

3/11/22 4/5 \$6800 in hand AH Long (red 14,544.80, 68%)

Date/Time, File Pass to?  : Preli. Report  
 : Final Report

Days Of Repair: 6  
 Resurvey No. of Trip: 2

1) \_\_\_\_\_  
 Date/Time, File Return to?  
 2) 7/11/22-typist

Add Fee:  : Site Insp (\$ \_\_\_\_\_ )  
 : Interview (\$ \_\_\_\_\_ )  
 : Tech. Invs (\$ \_\_\_\_\_ )  
 : Weekend (\$ \_\_\_\_\_ )

Survey Fee: \_\_\_\_\_  
 Transportation: \_\_\_\_\_  
 TOTAL

Report Format: Merimen  
 Lump Sum /+B+: (\$ 6800 )


> Back to OneMotoring

## Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	710B
Vehicle Details	
Vehicle No.:	SMZ9150A
Vehicle to be Exported:	No
Intended Deregistration Date:	14 Oct 2022
Vehicle Make:	MAZDA
Vehicle Model:	MAZDA5 5-DOOR WAGON 2.0L SP.6EAT SUNROOF
Primary Colour:	Silver
Manufacturing Year:	2016
Engine No.:	PE10427717
Chassis No.:	JM6CW1071G0125033
Maximum Power Output:	111.0 kW (148 bhp)
Open Market Value:	\$19,490.00
Original Registration Date:	17 Feb 2017
First Registration Date:	17 Feb 2017
Transfer Count:	1
Actual ARF Paid:	\$19,490.00 9745
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	16 Feb 2027
PARF Rebate Amount:	\$13,643.00
Intended COE Rebate Details	
COE Expiry Date:	16 Feb 2027
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$48,209.00
COE Rebate Amount:	\$20,919.00
<b>Total Rebate Amount:</b>	<b>\$34,562.00</b>

The information contained herein is correct as at 14 Oct 2022

OK

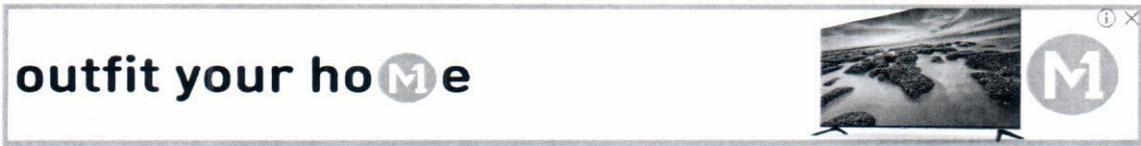

**Post an Advertisement**  
 Sell it yourself! Advertise it at just  
**\$68 until it's SOLD!**

**PORSCHE 911 CARRERA CABRIOLET 3.6 A**



Cheapest in market. Price Dropped by 10K. Immaculate Condition.  
 Prem Roy Motoring StarAd

[Post an Ad](#)
[Advertiser Login](#)
[Ways of Selling](#)

Sort by   results/page

17 vehicles



mazda 5

Any Category

Advanced Search



Search

Make                      Model                      Price                      Depreciation                      Reg Date                      Eng Cap                      Mileage                      Veh Type                      Status

Search Selection

**mazda 5**                      Any                      Any                      2017                      Any                      Any                      Any                      Available



**Mazda 5 2.0A Sunroof**                      **\$74,688**                      \$14,330 /yr                      27-Apr-2017                      1,998 cc                      50,000 km                      MPV                      Available  
 Lowest mileage unit! 01 owner agent maintained unit with genuine low mileage! General cabin & trunk spaces! Perfect MPV for your dail...  
 Car Zone Auto Pte Ltd  
 Posted: 14-Oct-2022

PREMIUM AD



**Mazda 5 2.0A Sunroof**                      **\$71,800**                      \$13,670 /yr                      28-Apr-2017                      1,998 cc                      76,138 km                      MPV                      Available  
 Not Private Hire/Leasing Car, If Not Full Money Back Guaranteed! Genuine Low Mileage Done 76138km! Timely Serviced At Workshop W...  
 Lake View Credit Pte Ltd  
 Posted: 13-Oct-2022

PREMIUM AD



**Mazda 5 2.0A Sunroof**                      **\$67,900**                      \$13,600 /yr                      24-Jan-2017                      1,998 cc                      88,000 km                      MPV                      Available  
 With the borders open, it's time to bring your family on this humble 7 seater MPV with twin power sliding doors. Beautiful Red Mazda 5...  
 Posted: 13-Oct-2022



**Mazda 5 2.0A Sunroof**                      **\$69,800**                      \$13,620 /yr                      13-Mar-2017                      1,998 cc                      80,600 km                      MPV                      Available  
 One of the best cost efficient and spacious 7 seater MPV with dual sliding door. Recommended for family users, 100% full loan available...  
 Posted: 12-Oct-2022



**BC (BR) Coilover Perfect For Street Driving**  
 Fully adjustable in terms of height and damping (30-Levels) & comes with a one year warranty.  
 More info about this product



**Mazda 5 2.0A (OPC)**                      **\$67,800**                      \$11,900 /yr                      29-Sep-2017                      1,998 cc                      45,454 km                      MPV                      Available  
 Only 1 owner, 7 seater MPV, convert to normal plate at only \$76,800 still cheapest in the market, genuine low mileage clocked, best con...  
 Starise Automobile  
 Posted: 11-Oct-2022

PREMIUM AD



**Mazda 5 2.0A Sunroof**                      **\$67,888**                      \$13,050 /yr                      31-Mar-2017                      1,998 cc                      120,000 km                      MPV                      Available  
 New paintwork for next owner! 1 year warranty and servicing package! Want any more? Just ask. Well maintained Mazda 5 up for grabs...  
 Posted: 04-Oct-2022

[Compare](#)                      **Mazda 5 2.0A**                      **\$78,800**                      \$14,450 /yr                      21-Aug-2017                      1,998 cc                      82,000 km                      MPV                      Available  
 Extended Lifetime Warranty Provided Upon Purchase From Us. Buy With Confidence! Full Loan Available! High Trade In, STA/Vicom Eval...

TECHNEAT PTE LTD  
 8 Kaki Bukit Avenue 4  
 (Enter by Gate 2)  
 #03-38/39/40  
 Premier@Kaki Bukit  
 Singapore 415875

Tel : (65) 6384 1996  
 Fax : (65) 6384 1996  
 Hotline : (65) 9691 0887  
 Email: techneatcarcare@yahoo.com.sg  
 Business Hour : 9am to 7pm(Mon to Sat)

**Service - Repair - Rim - Tyres - Battery - Balancing & Alignment**

Work Order: R006531  
 Date: 14.10.22 14:05

Mazda : Mazda5 : 2011-18 (CW) : Rest of World : Standard Suspension

**Front : Left**

Actual	Before	Specified Range
0°08'		-1°42' 0°18'
2°36'		2°15' 4°15'
-0°04'		-0°06' 0°17'
12°24'		
12°32'		

Camber  
 Caster  
 Toe  
 SAI  
 Included Angle  
 Turning Angle Diff.

**Front : Right**

Actual	Before	Specified Range
3°20'		-1°42' 0°18'
3°05'		2°15' 4°15'
2°04'		-0°06' 0°17'
8°42'		
12°02'		

**Front**

Cross Camber  
 Cross Caster  
 Cross SAI  
 Total Toe  
 Cross Turn Diff.

Actual	Before	Specified Range
-3°12'		-1°30' 1°30'
-0°23'		-1°30' 1°30'
3°42'		
2°00'		-0°11' 0°33'

**Rear : Left**

Actual	Before	Specified Range
-2°12'		-2°26' -0°26'
-0°48'		-0°03' 0°19'

Camber  
 Toe

**Rear : Right**

Actual	Before	Specified Range
-0°59'		-2°26' -0°26'
0°49'		-0°03' 0°19'

**Rear**

Cross Camber  
 Total Toe  
 Thrust Angle

Actual	Before	Specified Range
-3°13'		-1°30' 1°30'
0°00'		-0°06' 0°38'
-0°49'		-0°48' 0°48'

TECHNEAT PTE LTD  
 8 Kaki Bukit Avenue 4  
 (Enter by Gate 2)  
 #03-38/39/40  
 Premier@Kaki Bukit  
 Singapore 415875

Tel : (65) 6384 1996

Fax : (65) 6384 1996

Hotline : (65) 9691 0887

Email: techneatcarcare@yahoo.com.sg

Business Hour : 9am to 7pm(Mon to Sat)

**Service - Repair - Rim - Tyres - Battery - Balancing & Alignment**

Work Order: SMIZ 9150A

Date: 28.10.22 12:56

Mazda : Mazda5 : 2011-18 (CW) : Rest of World : Standard Suspension

**Front : Left**

Actual	Before	Specified Range
-0°58'	-0°37'	-1°42' 0°18'
2°50'	2°50'	2°15' 4°15'
0°10'	0°05'	-0°06' 0°17'
-25°47'	-25°48'	
-25°55'	-25°55'	

Camber  
 Caster  
 Toe  
 SAI  
 Included Angle  
 Turning Angle Diff.

**Front : Right**

Actual	Before	Specified Range
-1°04'	-1°03'	-1°42' 0°18'
3°03'	3°03'	2°15' 4°15'
0°05'	-0°17'	-0°06' 0°17'
41°29'	41°30'	
40°25'	40°25'	

**Front**

Cross Camber  
 Cross Caster  
 Cross SAI  
 Total Toe  
 Cross Turn Diff.

Actual	Before	Specified Range
0°56'	0°58'	-1°30' 1°30'
-0°12'	-0°12'	-1°30' 1°30'
-67°17'	-67°18'	
0°15'	-0°12'	-0°11' 0°33'

**Rear : Left**

Actual	Before	Specified Range
-1°57'	-1°57'	-2°26' -0°26'
-0°40'	-0°40'	-0°03' 0°19'

Camber  
 Toe

**Rear : Right**

Actual	Before	Specified Range
-1°39'	-1°09'	-2°26' -0°26'
0°29'	0°30'	-0°03' 0°19'

**Rear**

Cross Camber  
 Total Toe  
 Thrust Angle

Actual	Before	Specified Range
-0°48'	-0°48'	-1°30' 1°30'
-0°10'	-0°11'	-0°06' 0°39'
-0°35'	-0°35'	-0°48' 0°43'

submit to insurance

not allowed  
her  
17/10/22  
4/5 @ 6800/  
6 days.

SMZ9150A Mazda 5

No	Qty	Description	Notes	Price	Total	Status
1	1	Front bumper assy	Dis 11 of 20	\$ 1,283.00	1,283.00	/
2	1	Front bumper reinforcement	<del>sent</del> R	\$ 383.00	383.00	X
3	2	Front bumper side retainer	one	\$ 133.00	266.00	/
4	2	Front bumper bracket	1 1	\$ 177.00	354.00	X
5	1	Front bumper lower grille	7M 165.10	\$ 192.00	192.00	/
6	1	Front bumper tow cover	1 1	\$ 67.00	67.00	X
7	1	Front bumper sponge	1 1	\$ 197.00	197.00	X
8	1	Front bumper center logo	1 1 1	\$ 68.00	68.00	/
9	1	Front bumper lower lip	NS	\$ 380.00	380.00	X
10	1	Front left fog lamp	1 1	\$ 260.00	260.00	X
11	1	Front right fog lamp	1 1	\$ 260.00	260.00	X
12	1	Front left fog lamp garnish	1 1	\$ 105.00	105.00	X
13	1	Front right fog lamp garnish	Torn	\$ 105.00	105.00	/
14	1	Front horn	1 1	\$ 108.00	108.00	X
15	1	Front grille assy	one	\$ 267.00	267.00	/
16	1	Front bonnet assy	Dis 1081.60	\$ 1,421.00	1,421.00	/
17	2	Front bonnet rubber stopper	1 1	\$ 26.00	52.00	X
18	2	Front bonnet hinges	sent/7M	\$ 120.00	240.00	/
19	1	Front bonnet lock mechanism	7M 166.80	\$ 180.00	180.00	/
20	1	Front bonnet lock catch	1 1	\$ 80.00	80.00	X
21	1	Front bonnet rubber seal	1 1	\$ 88.00	88.00	X
22	1	Front bonnet stand	1 1	\$ 158.00	158.00	X
23	1	Front bonnet insulation	1 1	\$ 218.00	218.00	X
24	1	Front left headlamp	1 1	\$ 887.00	887.00	X
25	1	Front right headlamp	1 20	\$ 887.00	887.00	/
26	1	Front left headlamp inner bracket	NS	\$ 95.00	95.00	X
27	1	Front right headlamp inner bracket	NS	\$ 95.00	95.00	X
28	1	Front engine lower cover	Torn 281.50	\$ 380.00	380.00	/
29	1	Front air duct assy	1 1	\$ 192.00	192.00	X
30	1	Front air intake box	1 1	\$ 264.00	264.00	X
31	1	Front air intake hose	1 1	\$ 109.00	109.00	X
32	1	Front wiper tank	Dis	\$ 106.00	106.00	/
33	1	Front wiper top garnish	Torn	\$ 415.00	415.00	/
34	1	Front wiper blade assy	1 1	\$ 160.00	160.00	X
35	1	Front left engine mounting	1 1	\$ 280.00	280.00	X
36	1	Front right engine mounting	1 1	\$ 280.00	280.00	X
37	1	Front support panel assy	one 457.20	\$ 1,163.00	1,163.00	/
38	4	Front support panel rubber stopper	1 1	\$ 66.00	264.00	X
39	1	Front radiator assy	1 1	\$ 1,121.00	1,121.00	X
40	1	Front radiator top hose	1 1	\$ 126.00	126.00	X
41	1	Front radiator bottom hose	1 1	\$ 124.00	124.00	X
42	1	Front cooling fan assy with motor complete assy	1 1	\$ 881.00	881.00	X
43	1	Front air-con condenser	1 1	\$ 1,041.00	1,041.00	X
44	1	Front air-con suction pipe	1 1	\$ 197.00	197.00	X
45	1	Front air-con discharge pipe	1 1	\$ 197.00	197.00	X
46	1	Front left fender	R	\$ 792.00	792.00	X
47	1	Front left fender inner cowling	1 1	\$ 208.00	208.00	X
48	1	Front right fender	Dis 506.10	\$ 792.00	792.00	/
49	1	Front right fender inner cowling	Torn	\$ 208.00	208.00	/
				\$ 17,342.00		
less 20%				\$ 3,468.40		
				\$ 13,873.60		

1pc front knuckle arm o/s sent 392 ✓  
 1pc front knuckle arm bearing o/s sent 165 ✓  
 1pc front lower arm o/s sent 408 ✓  
 1pc front shock absorber o/s sent 399 ✓

SMZ9150A Mazda 5



		<u>Special Nett Items</u>				
1	<del>12</del> 1 set	Front bumper clips	all	\$	60.00	50
2	4	Front bumper lower grille clips	11	\$	30.00	X
3	6	Front grille clips	11	\$	40.00	X
4	1	Front air con gas	11	\$	100.00	X
5	2	Front radiator coolant	11	\$	100.00	X
6	<del>10</del> 1 set	Front engine lower cover clips	all	\$	40.00	/
7	1	Front right wheel rim	But/worped	\$	750.00	500
8	1	Front right tyre	all	\$	400.00	X
9	<del>8</del> 1 set	Front bonnet insulation clips	all	\$	50.00	/
10	6	Front left fender inner cowling clips	all	\$	40.00	X
11	<del>6</del> 1 set	Front right fender inner cowling clips	all	\$	40.00	/
12	1	Front no plate	11	\$	100.00	X
				\$	<u>1,750.00</u>	

**Total parts**

**\$ 15,623.60**

**SMZ9150A Mazda 5**

No	Description	Labour Charges	Handwritten
1	Labour for panel beating, cut, weld, straighten front affected area and replace front damaged parts.	\$ 1,600.00	800
2	To putty and spray painting front portion.	\$ 1,600.00	800
3	To check wiring and focus front headlamp.	\$ 50.00	20
4	To remove and install front bonnet lock mechanism.	\$ 80.00	X
5	To remove and install air con system to facilitate the repair and refill gas.	\$ 180.00	100
6	To remove and install cooling system to facilitate the repair and check for leakage.	\$ 180.00	X
7	To conduct wheel alignment.	\$ 120.00	80
8	To balance front right wheel.	\$ 50.00	X
9	To repair straighten and align front right door.	\$ 180.00	X
10	To conduct chassis alignment.	\$ 350.00	X
11	To apply anti rust proofing to front affected area.	\$ 140.00	60
12	Towing service.	\$ 100.00	X
<b>Total labour :</b>		<b>\$ 4,630.00</b>	

**Total parts : \$ 15,623.60**

**Total labour : \$ 4,630.00**

**Total repair cost : \$ 20,253.60**

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer  
Signature:  
Date:

1-7497-50  
20%  
7-5998  
S.N-680  
L-1860  
8538  
20%  
6830