


PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL: 6366 2323 FAX: 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATE : ACCIDENT REPAIRS
WORKSHOP : UBI ROAD 1
CONTACT NO : 6366 2323
FAX NO : 6841 1183
REFERENCE : PA/OD/01004/2022/EQ
DATE : 15-Nov-22
WIP : 50500

VEHICLE NOT IN WORKSHOP. KINDLY ARRANGE FOR SURVEY ON 22/11/2022

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Motor Claims Dept

OWNER'S NAME : MS TEO CHER IN (ZHANG XUEYING)
ADDRESS : 495 YIO CHU KANG ROAD
#03-02
SINGAPORE 787080
TELEPHONE : HP +65 92958685
TYPE OF CLAIM : OWN DAMAGE CLAIM
POLICY NO : 1800150974-03
VEHICLE NO : SLW 2202 H
MODEL CODE : AUDI A3 SEDAN 1.0 TFSI 8V
MODEL YEAR : 2/2/2018
ENGINE NO : CHZ 644887
CHASSIS NO : WAUZZZ8V3J1044214
MILEAGE : 54,739
DATE IN : 14-Nov-22
ESTIMATED BY : JOHNNY BOO / ALLAN WU
ACCIDENT DATE : 13-Nov-22
PLACE OF ACCIDENT : JUNCTION OF AMK AVE 6 & AVE 8 LEFT TURN
TO AVE 8 (FROM LENTOR TOWARDS MARYMOUNT)

55 UBI ROAD 1, SINGAPORE 408699
TEL: 6366 2323 FAX: 6841 1183
EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG


ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SLW 2202 H

S/N	NATURE OF JOBS	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
1	TO REMOVE, CHECK AND REINSTALL FRONT WIRE HARNESS FOR HEADLIGHTS, HORNS, OUTSIDE TEMPERATURE SENSOR AND HEADLIGHT WASHER ASSY.	S/N \$ 360.00	XNN
2	TO REMOVE AND REINSTALL LHS FRONT SEAT ASSY, AB PILLAR TRIMS, SILL TRIMS, CARPETS, ELECTRONIC COMPONENTS AND FUSE TRAYS.	S/N \$ 1,800.00	? /
3	TO REMOVE AND TRANSFER LHS FRONT DOOR AND LHS REAR DOOR'S MULTI-LOCK SYSTEM AND POWER WINDOW DEVICES. INSPECT FOR DAMAGES.	S/N \$ 700.00	280 / 395
4	TO DISMANTLE AND REINSTALL FRONT BUMPER. TO RENEW LHS FRONT FENDER, LHS FRONT DOOR AND LHS REAR DOOR. TO CUT OUT AND WELD LHS A-PILLAR AND LHS SILL PANEL. TO REPAIR LHS REAR FENDER. RE-ORGANIZE CRASH MANAGEMENT COMPONENTS. REINSTALL ALL PARTS REMOVED.	500 X 6 \$ 6,500.00	3080 /
5	TO RESPRAY LHS FRONT FENDER, LHS FRONT DOOR, DOOR HINGES, DOOR HANDLE, LHS REAR DOOR, LHS A-PILLAR, LHS SILL PANEL, LHS WING MIRROR COVER, DOOR ENTRANCE AND LHS REAR FENDER.	550 X 6 \$ 6,000.00	3300 /
TOTAL LABOUR CHARGES		: \$ 15,360.00	

55 UBI ROAD 1, SINGAPORE 408699
 TEL: 6366 2323 FAX: 6841 1183
 EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE SLW 2202 H

S/N	NATURE OF JOBS		ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATIONS
6	TO RENEW LHS FRONT RIM AND LHS REAR RIM. TO CARRY OUT PRE/POST WHEEL ALIGNMENT.	S/N S	560.00	360/
7	TO INSTALL SOLAR FILM FOR LHS FRONT DOOR WINDOW CLASS.	S/N S	400.00	X 11
8	TO CARRY OUT DIAGNOSTIC CHECK.	S/N S	192.00	
TOTAL LABOUR CHARGES		:	\$	<u>16,512.00</u>



55 UBI ROAD 1, SINGAPORE 408699

TEL: 6366 2323 FAX: 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLW 2202 H


DAMAGED PARTS & PRICES

S/N	PARTS DESCRIPTION	QTY	S/NETT	REMARKS
1	FRONT FENDER - LH <i>bl</i>	1	\$ 954.00	763.20
2	FRONT FENDER RIVET <i>re</i>	5	\$ 19.00	15.20
3	FRONT FENDER ATTACHMENT PARTS <i>Xm</i>	1	\$ 75.00	
4	FRONT FENDER BRACKET - LH CENTER <i>re</i>	1	\$ 46.00	36.40
5	FRONT FENDER BRACE <i>? Xxm</i>	1	\$ 107.00	
6	FRONT FENDER BRACKET - LH <i>re</i>	1	\$ 31.00	24.34
7	FRONT FENDER INSULATION - LH <i>? Xxm</i>	1	\$ 48.00	
8	FRONT FENDER CLOSING ELEMENT - LH <i>? Xxm</i>	1	\$ 37.00	
9	FRONT WHEEL HOUSING LINER - LH <i>de</i>	1	\$ 183.00	146.40
10	FRONT SIDE PANEL - LH <i>lt</i>	1	\$ 4,423.00	3538.40
11	FRONT DOOR - LH <i>bu</i>	1	\$ 3,265.00	2612
12	FRONT DOOR HINGE UPPER PART - LH LOWER <i>? Xxm</i>	1	\$ 53.00	
13	FRONT DOOR HINGE LOWER PART - LH LOWER <i>? Xxm</i>	1	\$ 54.00	
14	FRONT DOOR CATCH - LH <i>? Xxm</i>	1	\$ 116.00	
15	FRONT EXTERIOR WING MIRROR MOUNTING - LH <i>sc</i>	1	\$ 1,115.00	892
16	FRONT DOOR HANDLE BASE <i>? Xxm</i>	1	\$ 182.00	
17	FRONT DOOR BOWDEN CABLE <i>? Xxm</i>	1	\$ 58.00	
18	FRONT WINDOW REGULATOR - LH <i>? Xxm</i>	1	\$ 286.00	228.40
19	FRONT WINDOW REGULATOR MOTOR - LH <i>? Xxm</i>	1	\$ 266.00	
20	FRONT DOOR INNER ADHESIVE COVER - LH <i>? re</i>	1	\$ 14.00	11.04
SUB TOTAL SPARE PARTS		:	\$ 11,332.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL: 6366 2323 FAX: 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG


MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO. SLW 2202 H

S/N	PARTS DESCRIPTION	QTY	DAMAGED PARTS & PRICES		REMARKS
			S/NETT		
21	FRONT WINDOW GUIDE - LH ? x n	1	\$	467.00	
22	FRONT DOOR B-PILLAR TRIM - LH x n	1	\$	117.00	
23	FRONT WINDOW GUIDE TRIM STRIP - LH ? x n	1	\$	287.00	
24	FRONT WINDOW SLOT SEAL TRIM STRIP - LH x n	1	\$	346.00	
25	FRONT DOOR INNER PANEL - LH ? b /	1	\$	2,024.00	169.20
26	AIRBAG / CHILD'S SEAT STICKER x n	1	\$	27.00	
27	REAR DOOR - LH repair	1	\$	3,265.00	
28	REAR OUTER DOOR SEAL - LH x n	1	\$	179.00	
29	BONDING AGENT x n	1	\$	51.00	
30	CLEANING SOLUTION x n	1	\$	74.00	
31	APPLICATOR x n	1	\$	9.00	
32	REAR DOOR CATCH - LH x n	1	\$	105.00	
33	FRONT AND REAR ALUMINIUM RIM - LH 500 /	2	\$	2,606.00	2084.80
34	FRONT AND REAR ALUMINIUM RIM RUBBER VALVE - LH 100 /	2	\$	8.00	5.92
35	FRONT DOOR WINDOW - LH ? x n	1	\$	257.00	
36	ACRYLIC SEALANT n /	S/N	\$	180.00	/
37	CAVITY WAX n /	S/N	\$	140.00	/
38	STONE CHIP n /	S/N	\$	180.00	/
39	METAL FILLER POWDER n /	S/N	\$	280.00	/
40	SUNDRIES ? n /		\$	800.00	43.84
TOTAL SPARE PARTS		:	\$	22,734.00	
TOTAL LABOUR CHARGES		:	\$	16,512.00	
GRAND TOTAL		:	\$	39,246.00	

ALL CHARGES ARE NOT INCLUSIVE OF GST

LEGEND: REMARKS (OK) = APPROVED, REMARKS (X) = NOT APPROVED
SPARE PARTS ARE SPECIAL NETT.

PREMIUM AUTOMOBILES



55 UBI ROAD 1, SINGAPORE 408699

TEL : 6366 2323 FAX : 6841 1183

EMAIL: NORA.KHAI@PREMIUMAUTO.COM.SG / CLAIMS@PREMIUMAUTO.COM.SG

NAME
SURVEYED DATE
AUTHORISED DATE
EXCESS COST
LIABILITY
REMARKS

: Rasu - Hp 90010068
: 22/11/22 @ 1620
: 12 days + 5 = 17 days
: EXCESS: TBA
: Reg before paint
: Revert

PLEASE NOTE

: THIS ESTIMATE IS BASED ON VISUAL INSPECTION OF THE
AFFECTED VEHICLE. SHOULD WE REQUIRE FURTHER
LABOUR CHARGES AND SPARE PARTS IN THE PROGRESS OF
REPAIR, WE SHALL INFORM YOU ACCORDINGLY.
FOR INSPECTION OF VEHICLE, PLEASE REFER TO
MS. NORAH KHAI AT TEL: 6768 9828 / 6768 9911 FOR
APPOINTMENT.

YOURS FAITHFULLY,
PREMIUM AUTOMOBILES PTE LTD

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

JOHNNY BOO
BODY REPAIR MANAGER


ALLAN WU
CLAIMS CONSULTANT

PREMIUM AUTOMOBILES

55 Ubi Road 1, Singapore 408699

Tel : 6366 2323 Fax : 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg



Supplementary Estimate-1

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd

78 Shenton Way

#07-16 AIG Building

Singapore 079120

Attn: Mr. Adrian Ling - Motor Claims Dept

Tel: 6841 0055 / Fax: 6256 4315

Estimate No.

Date

Service Advisor

Pages

Regn No

Model No

PA/OD/01004/2022/EQ

6-Dec-22

CHANG


1 of 1

SLW 2202 H

AUDI A3 SEDAN 1.0 TFSI

Quantity	Description	Unit Price	Amount
<u>Parts</u>			
1	FRONT DOOR BASS LOUDSPEAKER - LH <i>de</i> 1	\$ 158.00	126
GRAND TOTAL		\$ 158.00	

For Premium Automobiles Pte Ltd

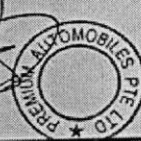

Authorised Signature

Free
06/12/22

55 Ubi Road 1, Singapore 408699

Tel: 6366 2323 Fax: 6841 1183

Email: Nora.khai@premiumauto.com.sg / claims@premiumauto.com.sg

Supplementary Estimate-2

GST Reg No. 19-9902271-W

AIG Asia Pacific Insurance Pte Ltd 78 Shenton Way #07-16 AIG Building Singapore 079120 Attn: Mr. Adrian Ling - Motor Claims Dept Tel: 6841 0055 / Fax: 6256 4315		Estimate No. Date Service Advisor Pages Regn No Model No	PA/OD/01004/2022/EQ 16-Dec-22 CHANG 1 of 1 SLW 2202 H AUDI A3 SEDAN 1.0 TFSI
Quantity	Description	Unit Price	Amount
<u>Parts</u>			
1	FRONT DOOR SEAL - LH <i>nee</i>	\$ 179.00	142.80
GRAND TOTAL		\$ 179.00	

For Premium Automobiles Pte Ltd




Authorised Signature

19/12/22