

(08/11/13) wof

ASS. REC. BY: Am

REF:

CC6/CT122012/18/Rpa3

8713

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SKT 6446at Workshop m/s KRCof TOYOTAInsured: CTI

Policy No. _____

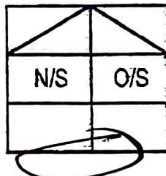
Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: 68K

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SKT 6446 Yr Regn: 2015 / MAYType: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or _____

Make: TOYOTA ESTIMA ACRAS 2.4 c.c. 2362Colour: WHITE A/C: Insured / Std / NI / NASp. Reading: 174796 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: ACR500188958Gen. Cond: Good / Fair / Poor / BurntSteering: Inorder / Jammed / Leaked / Burnt orBrake: Inorder / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim orTyre Size: F: 225/50R18

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or FAIR

Front _____ Rear _____

R/Bal. 6 mm R/Bal. 6 mmL/Bal. 6 mm L/Bal. 6 mmD.O.A. 05/12/12 D.O.I. 05/12/12Survey held at ARCDes. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

Repair Limit - 29K

Date/Time, File Pass to?

☐

Prel. Report

1)

☐

Final Report

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation: _____

Report Format : _____

Lump Sum / I.B.I. (\$) _____

Add Fee:

☐

Site Insp (\$ _____)

☐

Interview (\$ _____)

☐

Tech. Invs (\$ _____)

☐

Weekend (\$ _____)

S + RS \$ _____

Photos

Others

**Automotive Repair Centre Pte Ltd**

CO. Reg. No. : 201312913C

Estimate

48 Toh Guan Road East (Enterprise Hub)

#02-146, Singapore 608586

Tel: 62504489 Fax: 67228585

E-mail: info@automotiverepaircentre.com.sg

ESTIMATE NO. : EST2212-658-TG

DATE : 5-Dec-2022

VEHICLE REG. NO. : **SKT644G**

VEHICLE MAKE : TOYOTA ESTIMA AERAS 2.4 CVT ABS AIR

CHASSIS : ACR500188958

TO Motor Claim Department

China Taiping Insurance (Singapore) Pte. Ltd

3 Anson Road, #15-00 Springleaf Tower

Singapore 079909

Tel: 6389 6116, Fax: 6222 1033

FOR SURVEYOR

ESTIMATE REPAIR COST

NO.	DESCRIPTION	Qty	UNIT COST	TOTAL COST
	SPARE PARTS			
1	Rear Bumper <i>de/</i>	1	\$ 900.00	\$ 900.00
2	Rear Bumper Side Retainer LH <i>can/</i>	1	\$ 100.00	\$ 100.00
3	Rear Bumper Side Retainer RH <i>can/</i>	1	\$ 100.00	\$ 100.00
4	Rear Bumper Sponge ?	2	\$ 122.40	\$ 244.80
5	Rear Bumper Towing Cover LH <i>cut/</i>	1	\$ 52.00	\$ 52.00
6	Rear Bumper Reflector LH <i>not can/</i>	1	\$ 100.00	\$ 100.00
7	Rear Bumper Reflector RH <i>x</i>	1	\$ 100.00	\$ 100.00
8	Rear Fender LH <i>bm/</i>	1	\$ 1,316.00	\$ 1,316.00
9	Rear Fender Innershield LH <i>x</i>	1	\$ 338.00	\$ 338.00
10	Rear Fender Innershield RH <i>x</i>	1	\$ 338.00	\$ 338.00
11	Rear Fender Glass Moulding LH <i>ne/</i>	1	\$ 626.00	\$ 626.00
12	Rear Tailgate <i>bm/</i>	1	\$ 2,116.00	\$ 2,116.00
13	Rear Tailgate Lock ?	1	\$ 610.00	\$ 610.00
14	Rear Tailgate Weatherstrip <i>ne/</i>	1	\$ 434.00	\$ 434.00
15	Rear Tailgate Emblem <i>ne/</i>	1	\$ 109.60	\$ 109.60
16	Rear Tailgate Logo (Estima) <i>ne/</i>	1	\$ 100.00	\$ 100.00
17	Rear Tailgate Logo (Aeras) <i>ne/</i>	1	\$ 116.00	\$ 116.00
18	Rear Tailgate Garnish ?	1	\$ 434.00	\$ 434.00
19	Rear Tailgate Lamp LH <i>2 ?</i>	1	\$ 610.00	\$ 610.00
20	Rear Tailgate Lamp RH <i>2 ?</i>	1	\$ 610.00	\$ 610.00
21	Rear Tailgate Glass Moulding <i>ne/</i>	1	\$ 226.00	\$ 226.00
22	Rear Tailgate Trimboard <i>? de/</i>	1	\$ 754.00	\$ 754.00
23	Rear Tail Lamp LH <i>2 ?</i>	1	\$ 642.00	\$ 642.00
24	Rear Tail Lamp RH <i>2 ?</i>	1	\$ 642.00	\$ 642.00
25	Rear End Panel <i>st/ photo?</i>	1	\$ 786.00	\$ 786.00
26	Rear End Panel Top Garnish ?	1	\$ 434.00	\$ 434.00
27	Rear Spare Wheel Panel <i>regrv</i>	1	\$ 1,220.00	\$ 1,220.00
28	Rear Spare Wheel Top Board ?	2	\$ 514.00	\$ 1,028.00
Parts Less 20%				\$ (3,017.28)
Total Spare Parts				\$ 15,086.40
	SPECIAL NETT			
29	Rear Bumper Clips <i>ne/</i>	10	\$ 5.00	\$ 50.00 30

48 Toh Guan Road East (Enterprise Hub)

#02-146, Singapore 608586

Tel: 62504489 Fax: 67228585

E-mail: info@automotiverepaircentre.com.sg

ESTIMATE NO. : EST2212-658-TG

DATE : 5-Dec-2022

VEHICLE REG. NO. : SKT644G

VEHICLE MAKE : TOYOTA ESTIMA AERAS 2.4 CVT ABS AIR

CHASSIS : ACR500188958

TO Motor Claim Department

China Taiping Insurance (Singapore) Pte. Ltd

3 Anson Road, #15-00 Springleaf Tower

Singapore 079909

Tel: 6389 6116, Fax: 6222 1033

FOR SURVEYOR

ESTIMATE REPAIR COST

NO.	DESCRIPTION	Qty	UNIT COST	TOTAL COST
30	Rear Fender Innershield Clips <i>M /</i>	20	\$ 5.00	\$ 100.00 50
31	Sealant (Rear Fender Glass & Rear Tailgate Glass) <i>M /</i>	2	\$ 60.00	\$ 120.00 80
32	Rear Reverse Sensor <i>A - /</i>	1	\$ 200.00	\$ 200.00
Total Special Nett				\$ 470.00
LABOUR				
33	Remove, Replace, Refit Affected Accident Parts	1	\$ 1,400.00	\$ 1,400.00 1200
34	Spray Paint (Rear Bumper, Rear Tailgate, Rear Fender LH, Rear End Panel, Rear Spare Wheel Panel)	1	\$ 1,400.00	\$ 1,400.00 1200
35	Transfer tailgate fitting and window mechanism to new tailgate	1	\$ 80.00	\$ 80.00 60
36	Remove & Refit upholstery, seats, garnishes, trimming to facilitate repair	1	\$ 200.00	\$ 200.00 80
37	Remove & Refit Petrol Tank	1	\$ 80.00	\$ 80.00 60
38	Realign rear exhaust pipe	1	\$ 40.00	\$ 40.00 X
39	Remove & Refit Rear Fender Glass	1	\$ 100.00	\$ 100.00 60
40	Remove & Refit Rear Tailgate Glass	1	\$ 120.00	\$ 120.00
41	Remove and Refit Reverse Sensor	1	\$ 80.00	\$ 80.00 40
42	To Perform Diagnostic Check	1	\$ 150.00	\$ 150.00 100
43	Apply Rust Proofing on Replaced/Repaired Panel	1	\$ 100.00	\$ 100.00 80
44	Check and Rectify Electrical Wiring	1	\$ 50.00	\$ 50.00 30
Total Labour				\$ 3,800.00
Amount Before Excess				\$ 19,356.40
Add GST @ 7%				1,354.95
Total Amount Payable				\$ 20,711.35

Estimate prepared by: JAMES TAN

The above is an estimate based on our inspection and does not cover any additional parts or labour which may be required after work has been started. Occasionally, worn or damaged parts are discovered which may not be evident on the first inspection. Because of this, the above price are not guaranteed. Quotation on parts and labour are current and subject to change.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

RASUE
Hp 90010068
10 days
L/S
65/12/22 @ 1440
Resy after repair

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Owner ID Type:	Singapore NRIC
Owner ID:	871J
Vehicle No.:	SKT644G
Vehicle to be Exported:	No
Intended Deregistration Date:	07 Dec 2022
Vehicle Make:	TOYOTA
Vehicle Model:	ESTIMA AERAS 2.4 CVT ABS AIRBAG 2WD SR
Primary Colour:	White
Manufacturing Year:	2015
Engine No.:	2AZJ141326
Chassis No.:	ACR500188958
Maximum Power Output:	125.0 kW (167 bhp)
Open Market Value:	\$29,374.00
Original Registration Date:	21 May 2015
First Registration Date:	21 May 2015
Transfer Count:	0
Actual ARF Paid:	\$33,124.00

PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	20 May 2025
PARF Rebate Amount:	\$19,874.00

COE Expiry Date:	20 May 2025
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$78,001.00
COE Rebate Amount:	\$19,122.00
Total Rebate Amount:	\$38,996.00

The information contained herein is correct as at 07 Dec 2022

OK

Toyota Estima 2.4A Aeras Premium Moonroof

Overview

[Financial](#)[Accessories](#)[Similar](#)[Research](#)[Photos](#)[Map](#)

Price	\$64,800		
Depreciation ⓘ	\$20,660 /yr View models with similar depre	Reg Date	24-Mar-2015 (2yrs 3mths 16days COE left)
Mileage	130,000 km (16.9k /yr)	Manufactured ⓘ	2015
Road Tax ⓘ	\$1,638 /yr	Transmission	Auto
Dereg Value ⓘ	\$36,225 as of today (change)	OMV ⓘ	\$30,616
COE ⓘ	\$66,751	ARF ⓘ	\$34,863
Engine Cap	2,362 cc	Power	125.0 kW (167 bhp)
Curb Weight ⓘ	1,790 kg	No. of Owners ⓘ	4
Type of Vehicle	MPV		