

ASS. REC. BY:

REF:

C721

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

8148K

IDAC Accident Report:

Consistent?: Yes or No

GIA / PR Seen:

Consistent?: Yes or No

Est. Repairs:

21

days

Res.: Yes or No

Lum Sum:

20

%

3 Val.: Yes or No

CA / REV /

REP. / 24 HRS

Date:

05/29

Person Contacted:

Vehicle: IN / OUT

Veh No:

SMV 88658 Yr Regn: 06.08

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

AI Sport Car

Make:

Porsche Cayman c.c. 3436

Colour

Matt Gold

A/C: Insured / Std / NI / NA

Sp. Reading

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

WPO 888988 947702190

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: Nil / S/Rlm / STD A/Rlm or

Tyre Size: F:

235/35ZR19

R:

265/35ZR19

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal.

8

mm

Rear

R/Bal.

7

mm

L/Bal.

8

mm

L/Bal.

7

mm

D.O.A.

21/1/23

D.O.I.

6/2/2023

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Frt O/S, N/S Frt & O/S Rear

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Both Plot., Bonnet jammed.
Check body kit intact or not ??

Date/Time, File Pass to?

☐

: Prel. Report

☐

: Final Report

Date/Time, File Return to?

Days Of Repair:

Resurvey No. of Trlp:

Survey Fee:

Transportation

S - RS - SI

Fees

Others

TOTAL

Add Fee:

Site Insp (\$)

Interview (\$)

Tech Invs (\$)

Weekend (\$)

Report Format:

Lump Sum / I.B.I. (\$)

SJE : _____
Date of Survey : _____
Date of ReSurvey: After-Paint: _____
Contacts : _____

Vehicle Nos : SMV 8865 Z
Model : Porsche Cayman S
Year : _____
Chassis No : _____

*** AGREED Cost Of Repair and Repair Day/s with SJE ***

Amount: _____

Working Day: _____

Nos.	PARTS	Qty	Unit S\$	TOTAL S\$
1	Front LH Fender	1	\$ 1,863.50	\$ <u>B₁</u> 1,863.50 ✓
2	Front LH Fender inner shield	1	\$ 585.50	\$ <u>T₁</u> 585.50 ✓
3	Front LH A pillar	1	\$ 3,545.80	\$ <u>R</u> 3,545.80 X
4	Front LH fender inner panel	1	\$ 2,142.60	\$ <u>T</u> <u>R</u> 2,142.60 X
5	Front LH Headlamp	1	\$ 5,405.60	\$ <u>B₀</u> 5,405.60 ✓
6	Front LH Headlamp lower beam	1	\$ 341.20	\$ <u>B₁</u> 341.20 ✓
7	Front Bumper side retainer	2	\$ 225.00	\$ <u>R₁</u> 450.00 ✓
8	Front Bumper sensor	4	\$ 329.00	\$ 1,316.00 7
9	Front Bumper sponge	1	\$ 92.50	\$ <u>mit</u> 92.50 ✓
10	Front Bumper reinforcement	1	\$ 974.60	\$ <u>B₁</u> 974.60 ✓
11	Front Bumper Center grille	1	\$ 425.50	\$ <u>mit</u> 425.50 ✓
12	Front bumper fog lamp	2	\$ 645.00	\$ <u>mit</u> 1,290.00 ✓
13	Front Bumper fog lamp cover	2	\$ 123.00	\$ <u>mit</u> 246.00 ✓
14	Front bumper signal lamp	2	\$ 355.50	\$ <u>mit</u> 711.00 ✓
15	Bonnet	1	\$ 3,730.60	\$ <u>R₁</u> 3,730.60 ✓
16	Bonnet lock	1	\$ 354.80	\$ <u>R</u> 354.80 X
17	Bonnet hinge	2	\$ 243.20	\$ <u>R</u> 486.40 X
18	Bonnet emblem logo	1	\$ 225.00	\$ <u>m</u> 225.00 ✓
19	Bonnet insulator	1	\$ 422.00	\$ <u>B₁</u> 422.00 X
20	Aircon condenser	1	\$ 1,282.20	\$ <u>B₁</u> 1,282.20 ✓
21	Aircon condenser suction pipe	1	\$ 125.00	\$ 125.00 7
22	Aircon condenser discharge pipe	1	\$ 135.00	\$ <u>R₁</u> 135.00 ✓
23	Aircon condenser fan motor	1	\$ 861.00	\$ 861.00 7
24	Aircon condenser fan cowling	1	\$ 346.00	\$ 346.00 7

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Not Authorized
Ex @ 4000k
U/Lmp @
Meowing After Paint

Signature: _____
Date: _____

25	Inter cooler	1	\$	2,885.60	\$	2,885.60	?
26	Inter cooler bracket	1	\$	275.50	\$	275.50	?
27	Inter cooler hose	1	\$	120.00	\$	120.00	?
28	inter cooler pipe	2	\$	220.00	\$	440.00	?
29	Front RH Fender	1	\$	1,863.50	\$	<i>R</i> 1,863.50	✓
30	Front RH A pillar	1	\$	3,545.80	\$	<i>R</i> 3,545.80	X
31	Front RH Fender inner shield	1	\$	585.50	\$	<i>Tn</i> 585.50	✓
32	Front RH Fender inner panel	1	\$	2,142.60	\$	<i>R</i> 2,142.60	X
33	Front RH Headlamp	1	\$	5,405.60	\$	<i>CM</i> 5,405.60	✓
34	Front RH Headlamp lower beam	1	\$	585.20	\$	<i>hit</i> 585.20	✓
35	Fuel Lid	1	\$	365.00	\$	<i>hit</i> 365.00	✓
36	Horn	1	\$	458.00	\$	<i>nd</i> 458.00	✓
37	Radiator	1	\$	1,455.50	\$	1,455.50	?
38	Radiator top pipe	1	\$	125.00	\$	125.00	?
39	Radiator bottom pipe	1	\$	120.00	\$	120.00	?
40	Radiator fan motor	1	\$	861.00	\$	861.00	?
41	Radiator fan cowling	1	\$	346.00	\$	346.00	?
42	Radiator fan blade	1	\$	130.00	\$	130.00	?
43	Front Shock absorber	2	\$	817.00	\$	1,634.00	?
44	Front shock absorber coil spring	2	\$	535.00	\$	1,070.00	?
45	Front brake disc	2	\$	1,835.20	\$	<i>in</i> 3,670.40	X
46	Front brake calliper	2	\$	3,546.50	\$	<i>in</i> 3,546.50	X
47	Front lower arm	2	\$	741.00	\$	1,482.00	?
48	Front knuckle arm	2	\$	828.00	\$	<i>B</i> 1,656.00	✓
49	Front kunckle arm bearing	2	\$	552.00	\$	<i>me</i> 1,104.00	✓
50	Front stabilizer bar	1	\$	446.00	\$	446.00	?
51	Front stabilizer link	1	\$	225.00	\$	225.00	?
52	Front RH drive shaft	1	\$	672.00	\$	672.00	?
53	Front LH drive shaft	1	\$	672.00	\$	672.00	?
54	Front crossmember	1	\$	2,037.00	\$	<i>R</i> 2,037.00	✓
55	Steerling column	1	\$	1,984.00	\$	<i>in</i> 1,984.00	X
56	Steering rack	1	\$	1,566.50	\$	1,566.50	?

57	Tie Rod	1	\$	266.00	\$	266.00	?
58	Tie Rod end	1	\$	185.00	\$	185.00	?
59	Front Windscreen	1	\$	1,855.00	\$	<i>CM</i> 1,855.00	—
60	Front Windscreen glass moulding	1	\$	355.00	\$	<i>Mc</i> 355.00	—
61	Dash board	1	\$	3,598.00	\$	<i>Tn</i> 3,598.00	—
62	Dash board Air bag	1	\$	1,455.00	\$	<i>Bury</i> 1,455.00	—
63	Dash board Air bag control unit	1	\$	855.00	\$	<i>Mc</i> 855.00	—
64	Dash board Air bag sensor	1	\$	505.00	\$	<i>Mc</i> 505.00	—
65	Steering Wheel	1	\$	3,052.00	\$	3,052.00	?
66	Steering Wheel Airbag	1	\$	1,152.00	\$	<i>Bury</i> 1,152.00	—
67	Steering Wheel Airbag control unit	1	\$	735.00	\$	<i>Mc</i> 735.00	—
68	Steering Wheel Airbag sensor	1	\$	553.00	\$	<i>Mc</i> 553.00	—
69	Steering Wheel ring	1	\$	586.00	\$	<i>Mc</i> 586.00	—
70	Seat Belt	2	\$	756.00	\$	<i>Tn</i> 1,512.00	—
71	Seat Belt tensioner	2	\$	355.00	\$	710.00	?
72	Front Door RH	1	\$	4,528.00	\$	<i>R</i> 4,528.00	X
73	Front Door Hinge RH	2	\$	255.00	\$	<i>R</i> 510.00	X
74	Front Door Lock assy RH	1	\$	356.00	\$	<i>R</i> 356.00	✓
75	Front door LH	1	\$	4,528.00	\$	<i>R</i> 4,528.00	X
76	Front door hinge LH	2	\$	255.00	\$	<i>R</i> 510.00	X
77	Front door lock assy LH	1	\$	356.00	\$	<i>R</i> 356.00	✓
78	Rear bumper side retainer	2	\$	215.00	\$	<i>Olson</i> 430.00	✓
79	Rear bumper sensor	4	\$	285.00	\$	<i>Sn</i> 1,140.00	X
80	Taillamp	1	\$	1,145.00	\$	<i>CM</i> 1,145.00	✓
81	Taillamp inner panel	1	\$	562.00	\$	<i>R</i> 562.00	X
82	Rear fender <i>RH</i>	1	\$	1,654.00	\$	<i>Bz</i> 1,654.00	—
83	Rear fender inner trim	1	\$	1,855.00	\$	<i>Sn</i> 1,855.00	X
84	Rear fender side shield	1	\$	485.00	\$	485.00	?
85	Rear fender quarter glass	1	\$	558.00	\$	<i>Sn</i> 558.00	X
86	Rear fender quarter glass moulding	1	\$	124.00	\$	<i>Mc</i> 124.00	—
87	RH Rocker Panel	1	\$	2,855.00	\$	2,855.00	?
88	RH Rocker Panel skirting	1	\$	952.00	\$	952.00	?
89	Rear Shock absorber	1	\$	785.00	\$	785.00	?
90	Rear lower arm	1	\$	712.00	\$	712.00	?
91	Rear knuckle arm	1	\$	658.00	\$	658.00	?
92	Rear kunckle arm bearing	1	\$	443.00	\$	443.00	?
93	Rear stabilizer bar	1	\$	425.00	\$	425.00	?
94	REar stabilizer link	1	\$	210.00	\$	210.00	?

Parts Sub Total : \$ 113,988.00

10%

Discount : \$ 11,398.80

PARTS TOTAL : \$ 102,589.20

Nos.	SPECIAL NETT	Qty	Unit S\$	TOTAL S\$	
1	Sundries	1	\$ 500.00	\$ 500.00	7
2	Front Bumper	1	\$ 8,478.00	\$ <i>mi</i> 8,478.00	✓
3	Front bumper clips	1	\$ 150.00	\$ <i>na</i> 150.00	✓
4	Bonnet insulator clips	1	\$ 120.00	\$ <i>na</i> 120.00	X
5	Front RH fender inner shield clips	1	\$ 120.00	\$ <i>na</i> 120.00	✓
6	Front RH fender sealant	1	\$ 200.00	\$ <i>na</i> 200.00	501n
7	Front Rims	2	\$ 4,850.00	\$ <i>na</i> 9,700.00	✓
8	Front tyre	2	\$ 500.00	\$ <i>na</i> 1,000.00	601n
9	Front Windscreen sealant	1	\$ 300.00	\$ <i>na</i> 300.00	601n
10	Front windscreen inner seal	1	\$ 200.00	\$ <i>na</i> 200.00	301n
11	Front windscreen primer & cleaner	1	\$ 200.00	\$ <i>na</i> 200.00	601n
12	IU Bracket	2	\$ 250.00	\$ <i>na</i> 500.00	261n
13	Rear bumper	1	\$ 6,542.00	\$ <i>CM</i> 6,542.00	✓
14	Rear bumper clips	2	\$ 150.00	\$ <i>na</i> 300.00	✓
15	Rear fender inner trim clips	2	\$ 200.00	\$ <i>na</i> 400.00	X
16	Rear fender sealant	2	\$ 200.00	\$ <i>na</i> 400.00	301n
17	Rear fender side shield clips	1	\$ 120.00	\$ 120.00	?
18	Rear fender quarter glass sealant	1	\$ 100.00	\$ <i>na</i> 100.00	301n
19	RH rocker panel skirting clips	1	\$ 100.00	\$ <i>na</i> 100.00	X
20	Rear Rim RH	1	\$ 4,850.00	\$ <i>na</i> 4,850.00	✓
21	Rear Tyre RH	1	\$ 500.00	\$ <i>na</i> 500.00	601n
SPECIAL NETT TOTAL :				\$ 34,780.00	

Nos.	LABOUR	S\$		
1	R&R Radiator	\$	200.00	} 1800
2	R&R Aircon condenser	\$	200.00	
3	R&R Front undercarriage	\$	800.00	
4	R&R Bonnet fitting	\$	200.00	800
5	R&R Front sensor	\$	150.00	600
6	R&R Front Windscreen	\$	200.00	1200
7	R&R Dashboard	\$	300.00	} 3500
8	R&R Steering Wheel	\$	300.00	
9	R&R Fuel Tank Assy	\$	200.00	800
10	Front Panel beating	\$	1500 3,500.00	1800
11	Front Spray Paint	\$	1800 3,500.00	2400
12	Front rust proofing	\$	N2 200.00	X
13	Check Wiring	\$	200.00	600
14	Wheel alignment	\$	300.00	1200
15	R&R tyre rim and wheel balancing	\$	200.00	500
16	R&R Front door component LH/RH	\$	N2 300.00	X
17	Front Upholstery	\$	300.00	1500
18	Mount work bench	\$	350.00	?
19	Chassis alignment	\$	300.00	?
20	Diagnostic & reset fault code	\$	500.00	3000
21	Conduct water leakage test	\$	100.00	400
22	R&R Rear reverse sensor	\$	200.00	600
23	R&R Rear quarter glass	\$	200.00	600
24	R&R Rear undercarriage	\$	600.00	?
25	Rear Panel Beating	\$	2,000.00	10000
26	Rear rust proofing	\$	N2 200.00	X
27	Rear spray painting	\$	2,500.00	8000
LABOUR TOTAL :		\$	18,000.00	

PARTS TOTAL : \$ 102,589.20
 SPECIAL NETT TOTAL : \$ 34,780.00
 LABOUR TOTAL : \$ 18,000.00
GRAND TOTAL : \$ 155,369.20

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	26/01/2023 16:21 (SGT)
Reported by	Both
Date of Accident	21/01/2023 05:10 (SGT)
Exact Location of Accident	Singapore
Additional Location Information	PIE TOWARDS TUAS BEFORE TOA PAYOH EXIT
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SMV8865Z

INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	CHONG CHAN WOON
NRIC No	SXXXX085A
Email Address	WOON_THE_GREAT@HOTMAIL.COM
Mobile Phone No	(Phone) +65-98777547
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	Porsche
Model	Cayman
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private car
Transmission	Auto
CC	3400

INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance (Singapore) Pte. Ltd.
Policy Number / Cover Note Number	DMPCSNW00103592201

DRIVER

Name of Driver	CHONG CHAN WOON
NRIC No	SXXXX085A
Date Of Birth	21/07/1977
Occupation	Indoor

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Traffic Police Department for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (POPA)**
I understand, acknowledge, agree and consent that:

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

- (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
- (collectively the "Purposes")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and


(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

Policyholder's Signature / Date & Time

Driver's Signature (If driver is not the policyholder) /
Date & Time

Witnessed by Reporting Centre Personnel
(Name as in Nric/ID card)

Sketch Plan

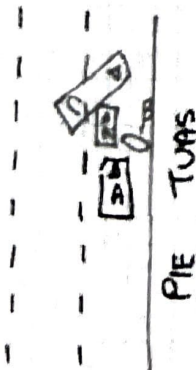

A - SMV 88652

B - PQL 8064

C - SLF 364B