

ASS. REC. BY:

REF:

CL4/AIS23001548/Rpa3

3769

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SDF 5338Pat Workshop m/s TC AUTO CLINICof 25, Lanh KEE RDInsured: AIS

Policy No. _____

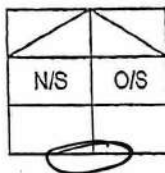
Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: 45K

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SDF 5338P Yr Regn: 2016 / P63Type: Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or _____

Make: NISSAN QASHQAI 1.2 D16-T c.c. 1197Colour: MAROON

A/C: Insured / Std / NI / NA

Sp. Reading: 166525

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: SJNFGA J11 U1583289

Gen. Cond: Good / Fair / Poor / Burnt

Steering: order / Jammed / Leaked / Burnt or _____Brake: order / Jammed / Leaked / Burnt or _____

Modi: Nil / S/Rim / STD A/Rim or _____

Tyre Size: F: 215/60R17

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or _____

Front

Rear

R/Bal. 6 mmR/Bal. 6 mmL/Bal. 6 mmL/Bal. 6 mmD.O.A. 11/02/23D.O.I. 18/02/23Survey held at TC AUTOCLINICDes. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or _____

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

REPAIR LIMIT - 23K

Date/Time, File Pass to?

☐ : Prel. Report☐ : Final Report

1)

Date/Time, File Return to?

2)

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee:

Transportation:

Add Fee:

☐ : Site Insp (\$ _____)☐ : Interview (\$ _____)☐ : Tech. Invs (\$ _____)

S + RS \$ _____

Photos

Others

Repair Format: _____

Lump Sum / L.B.R. / %

TC AUTOCLINIC PTE LTD
25 LENG KEE ROAD
SINGAPORE 159097

ESTIMATE : ACCIDENT/BODY REPAIRS
WORKSHOP : LENG KEE
CONTACT NO : 67038511
REFERENCE : 015/IC/TCAC/SAY/2023
DATE : 11-FEB-2023

ALLIANZ INSURANCE SINGAPORE PTE LTD
79 ROBINSON ROAD #09-01

S(068897)
TEL : 63954779/67143369
FAX : 63953768
ATTN:MOTOR CLAIM MANAGER

OWNER'S NAME : LEE BENG HWEE
ADDRESS : BLK 105 ALJUNIED CRESCENT
#12-227
S(380105)
TELEPHONE NO : 96353576

TYPE OF CLAIM : DIRECT SETTLEMENT / THIRD PARTY CLAIM
POLICY NO : 2100454169
VEHICLE NO : SDF5338P
MODEL CODE : FRLARBZJ11UEA--A--
MODEL/YEAR : NISSAN QASHQAI 1.2
ENGINE NO : HRA2233362A
CHASSIS NO : SJNFEAJ11U1583289
MILEAGE : 166331 KM
DATE IN : 11/02/2023
LIABILITY : 0.00
EXCESS CLAUSE : 0.00
ESTIMATE BY : SAYEDINAH
ACCIDENT DATE : 11/02/2023

TC AUTOCLINIC PTE LTD
25 LENG KEE ROAD
SINGAPORE 159097

ESTIMATED LABOUR CHARGES FOR ACCIDENT VEHICLE REGN NO SDF5338P

S/NO	JOB CODE	NATURE OF JOB	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATION
1	NPI	SUPPLY & INSTALL NUMBER PLATE & HOLDER INCLUDING PARTS	60.00	?
2	RPI	PERFORM RUST PROOFING & TREATMENT FOR AFFECTED PANEL	120.00	/
3	RSI	REPLACE REVERSE SENSOR, NECESSARY ADJUSTMENT & FUNCTION TEST	110.00	/
4	SEALI	APPLY SEALANT TO ALL AFFECTED PANEL JOINTS & RESEAL NECESSARY AREA	200.00	/
5	ZZ/001	CONDUCT 3RD PARTY CLAIM ALLIANZ DATE:11/02/2023 TIME:1240 LOCATION:CTE TOWRDS CITY		
6	ZZ/002	REPAIR/REPLACE REAR BUMPER, END PANEL, TAILGATE, FLOOR PAN, LH FENDER & RH FENDER	2340.00	1170
7	ZZ/003	RESPRAY REAR BUMPER, END PANEL, TAILGATE, FLOORPAN, RH FENDER & LH FENDER	1500.00	750
8	ZZ/004	CONDUCT REAR LIGHTING TEST	48.00	/
9	ZZ/005	SUPPLY/INSTALL REAR WINDSCREEN TINTED FILM	144.00	/
10	ZZ/006	QC & CONSULT CHECK		
11	ZZ/007	CARWASH & VACUUM		
12	ZZ/008	REMOVE/REFIX REAR WINDSCREEN	240.00	/
13	ZZ/009	TRANSFER TAILGATE MECHANISM TO NEW TAILGATE	120.00	/
14	ZZ/10	SUPPLY REVERSE SENSOR 4 EYE SET	360.00	/
TOTAL LABOUR CHARGES			5242.00	

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO SDF5338P

S/NO	PARTS DESCRIPTION	PARTS NUMBER	DAMAGED PARTS & PRICES		
			NETT	LIST	S/NETT REMARKS
1	PANEL-REAR UPPER <i>bt?</i>	G9110-4EAMA	573.80		
2	STAY ASSY-REAR RH <i>?</i>	H5210-4EAMA	152.40		
3	STAY ASSY-REAR LH <i>?</i>	H5211-4EAMA	152.40		
4	RUBBER-DUM <i>m/</i>	G2716-89901	68.90		
5	A FIN BACK DOOR <i>?</i>	90810-4ESOH	380.00		
6	GLASS-TAIL GATE <i>m/ photo</i>	90300-4EA0D	1174.80		
7	WEATHER STRIP <i>m/</i>	90830-4EA0A	198.40		
8	DOOR BACK <i>bt/</i>	K0100-4EAAC	3636.60		
9	STRIKER-TAIL GA <i>X</i>	90570-4EA0A	37.60		
10	A LOCK LIFT <i>?</i>	90502-4EA0B	205.50		
11	RETAINER-BUMPER LH <i>?</i>	79185-4EA0A	27.80		
12	RETAINER-BUMPER RH <i>X</i>	79184-4EA0A	27.80		
13	ENERGY ABSORBER <i>?</i>	85090-4EA0B	168.10		
14	FINISHER-REAR TOW COVER <i>col/</i>	85071-4EA0A	22.40		
15	FASCIA-RR BUMP <i>de/</i>	85022-4EA0H	946.50		
16	REINF-BUMPER RR <i>?</i>	H5030-4EAMA	746.20		
17	LAMP COMB RR,LH TAILGATE <i>X</i>	26555-4EA5D	274.80		
18	COMB LAMP RR RH TAILGATE <i>X</i>	26550-4EA5C	356.10		
19	LAMP COMB RR,LH BODY <i>X</i>	26555-4EA0A	412.10		
20	LAMP COMB RR,RH BODY <i>X</i>	26550-4EA0A	412.10		
21	ORNAMENT-BACK DOOR LETTERING <i>m/</i>	90892-4EA0A	101.90		
22	EMBLEM-REAR <i>?</i>	90890-4EA0A	70.00		
SUB TOTAL			10146.20	0.00	0.00
LESS DISCOUNT (NETT-20.00%, LIST-30.00%, S/NETT-.00%)			2029.24	0.00	0.00
GRAND TOTAL			8116.96	0.00	0.00

MATERIAL LIST FOR ACCIDENT VEHICLE REGN NO SDF5338P

		DAMAGED PARTS & PRICES		
S/NO	PARTS DESCRIPTION	PARTS NUMBER	NETT	LIST S/NETT REMARKS
OVERALL TOTAL			8116.96	

LEGEND: REMARKS(OK) = APPROVED, REMARKS(X) = NOT APPROVED

TC AUTOCLINIC PTE LTD
25 LENG KEE ROAD
SINGAPORE 159097

SUMMARY OF ESTIMATE FOR VEHICLE REGN NO SDF533BP

TOTAL LABOUR CHARGES	5242.00
TOTAL SPARE PARTS CHARGES	8116.96
GRAND TOTAL	13358.96 *

* All charges do2 not include GST.

SURVEYOR'S PARTICULARS

NAME	:	Rasul - 4p 90010068
SURVEYED DATE	:	14/02/23 @ 1146
AUTHORIZED DATE	:	
EXCESS CLAUSE	:	0.00 6 days
LIABILITY	:	0.00
REMARKS	:	Resay before paint

PLS NOTE : This estimate is based on visual inspection of the affected vehicle. Should we require further labour charges & spare parts in the process of repairs, we shall inform you accordingly.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

[➤ Back to OneMotoring](#)

Enquire PARF/COE Rebate for Registered Vehicle

Owner ID Type: Singapore NRIC

Owner ID: 374G

Vehicle No.: SDF5338P

Vehicle to be Exported: No

Intended Deregistration Date: 15 Feb 2023

Vehicle Make: NISSAN

Vehicle Model: QASHQAI 1.2 DIG-T CVT ABS 2WD 5DR

Primary Colour: Purple

Manufacturing Year: 2015

Engine No.: HRA2233362A

Chassis No.: SJNFEAJ11U1583289

Maximum Power Output: 85.0 kW (113 bhp)

Open Market Value: \$18,454.00

Original Registration Date: 27 Feb 2016

First Registration Date: 27 Feb 2016

Transfer Count: 0

Actual ARF Paid: \$13,454.00

PARF Eligibility: Yes

PARF Eligibility Expiry Date: 26 Feb 2026

PARF Rebate Amount: \$8,745.00

COE Expiry Date: 26 Feb 2026

COE Category: A - Car up to 1600cc & 97kW (130bhp)

COE Period(Years): 10

QP Paid: \$43,000.00

COE Rebate Amount: \$13,040.00

Total Rebate Amount: \$21,785.00

The information contained herein is correct as at 15 Feb 2023

OK

Nissan Qashqai 1.2A DIG-T

[Overview](#)[Financial](#)[Accessories](#)[Similar](#)[Research](#)[Photos](#)[Map](#)

COMPLETE CAR TRADE SOLUTIONS

Price **\$45,800**

Depreciation ⓘ **\$13,010 /yr**
View models with similar depre

Reg Date **16-Feb-2016**
(3yrs COE left)

Mileage **124,569 km (17.8k /yr)**

Manufactured ⓘ **2015**

Road Tax ⓘ **\$508 /yr**

Transmission **Auto**

Dereg Value ⓘ **\$22,753 as of today (change)**

OMV ⓘ **\$18,454**

COE ⓘ **\$46,651**

ARF ⓘ **\$13,454**

Engine Cap **1,197 cc**

Power **85.0 kW (113 bhp)**

Curb Weight ⓘ **1,285 kg**

No. of Owners ⓘ **3**