

(08/11/13) wef

ASS. REC. BY: Rome

REF: CS

UO! 23001989/R9y3

2004

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SLQ 6315Xat Workshop m/s BORNEO MOTORof 2, Ponnemon CrescentInsured: UOI

Policy No. _____

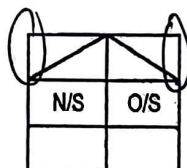
Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: 80K

IDAC Accident Rpt: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: 8 days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SLQ 6315X Yr Regn: 2017 JULY

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: TOYOTA PRIUS Hybrid 1.8 CVT c.c 1798Colour: WHITE A/C: Insured / Std / NI / NASp. Reading: 33 0566 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: 3TDKB3Fu903562198

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Order / Jammed / Leaked / Burnt orBrake: Order / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim orTyre Size: F: 195/65R15

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Kumho

Front

Rear

R/Bal. 6 mmR/Bal. 6 mmL/Bal. 6 mmL/Bal. 6 mmD.O.A. 21/02/23D.O.I. 22/02/23

Survey held at

BORNEO MOTOR

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

N/S FR & O/S FR

The U/C / Chassis/frame / Body Structure affected due to collision.

Date / Time Action / Instruction

Repair Limit - 52K

Rasul finalised final fig \$23147.80, 8 days. (Red \$13614.70, 37%)

Date/Time, File Pass to?

☐ : Prell. Report

1) 16/05 Typist

☐ : Final Report

Date/Time, File Return to?

2) _____

Days Of Repair: 8Resurvey No. of Trip: 1

Survey Fee:

Transportation:

Photos

Others

TOTAL

Add Fee: ☐ : Site Insp (\$☐ : Interview (\$☐ : Tech. Invs (\$☐ : Weekend (\$Report Format : TPLump Sum/ I.B.I: (\$ 23147.80)



Borneo Motors

Inchcape

Co. Reg No. : 196700086Z
GST Reg No. : MR-8500000-9
No. 2 PANDAN CRESCENT
SINGAPORE 128462, Tel no.: 6631 1188



TOYOTA

ESTIMATE

Account Details	Account No.	Customer Details
THIRD PARTY CLAIM	S1000020 / TPCLAIM	M/S Grab Rentals Pte Ltd 3 Media Close #01-03/06 Singapore 138498 Work: 65703925
	Document No. 0	
	Document Date 21/02/2023	

Year	Model	Variant	Reg. Date	Reg. No.	Kilometers	Wip No.	Order No. / Remarks
2017	ZVW50R	AHXEBW Q3	18/07/2017	SLQ6315X	0	20311	75/DS/SLQ6315X
Chassis No.	Engine No.	Terms	SA / Counter	Vehicle In	Collected On		
JTDKB3FU903562198	2ZRS058258	60	Ng Mei Yen	--/--/----	0.00	--/--/----	0.00

L	Cd	Job/Parts Description	Qty	Unit Price	Disc %	Amount
1	Z	BP-GRAB-DS SUNDRIES - FLASH ARRIVE: DD/MM/YY 0000HR TP VEH NO.:WC5617A ACC DATE:21/02/23 TOW IN:21/02/23 EXCESS: DATE-IN: DATE SURVEY: NO OF REPAIR DAYS: BY: AUTHORISED ON: 2 B BP-LAB2 CHECK WIRING AND CONDUCT LEAK TEST 3 B BP-ECU2 TO RESET ECU AND REPROGRAMME 4 B BP-LAB2 REPL ACC AFF AREA STRAIGHTEN AND PANEL BEAT ACC AFF AREA 5 B BP-RES2 RESPRAY ACC AFF AREA 6 L BP-LPO SUPPLY FRONT REGN PLATE (PO#) cm ✓ 7 Z BP-SLANT SUPPLY SEALANT (NETT) 8 B BP-MECH2 R/I AIRCON CONDENSER 9 1 U52119-47962 COVER, FR BUMPER tom ✓ 10 2 U52114-47190 BRACKET, FR BUMPER cm ✓ 11 3 U53112-47240 GRILLE, RADIATOR, cm ✓ 12 4 U53395-47040 SEAL, HOOD TO FR END m ✓ 13 5 U52115-47050 SUPPORT, FR BUMPER m ✓ 14 6 U52116-47050 SUPPORT, FR BUMPER m ✓	1.00 1.00 1.00 1.00 1.00 1.00 1.00	622.20 124.10 204.20 62.00 95.70 95.70		50 100.00 198.00 198.00 6336.00 5248.00 80.00 200.00 1584.00 622.20 124.10 204.20 62.00 95.70 95.70

For & on behalf of	Customer's Signature	Charge Summary	Total
Borneo Motors (Singapore) Pte Ltd	Please acknowledge receipt of vehicle	Parts Labour Sublet Lubrication/Fluid Others	Less Amount Due

Inchcape
 Co. Reg No. : 196700086Z
 GST Reg No. : MR-8500000-9
 No. 2 PANDAN CRESCENT
 SINGAPORE 128462, Tel no.: 6631 1188

ESTIMATE

Account Details		Account No.	Customer Details	
THIRD PARTY CLAIM		S1000020 / TPCLAIM	M/S Grab Rentals Pte Ltd	
		Document No.	3 Media Close	
		Document Date	#01-03/06	
			Singapore 138498	
			Work: 65703925	

Year	Model	Variant	Reg. Date	Reg. No.	Kilometers	Wip No.	Order No. / Remarks
2017	ZVW50R	AHXEBW Q3	18/07/2017	SLQ6315X	0	20311	75/DS/SLQ6315X
Chassis No.		Engine No.	Terms	SA / Counter	Vehicle In		Collected On
JTDKB3FU903562198		2ZRS058258	60	Ng Mei Yen	--/--/----		0.00 --/--/---- 0.00

L	Cd	Job/Parts Description	Qty	Unit Price	Disc %	Amount
15	7	U52161-16010				
16	8	U52127-47907				
17	9	U52128-47906				
18	0	U52618-47090				
19	1	U52611-47140				
20	2	U52132-47010				
21	3	U52102-47020				
22	4	U52103-47010				
23	5	U52021-47110				
24	6	U53101-47081				
25	7	U53301-47110				
26	8	T53341-47041				
27	9	U53801-47080				
28	0	U53802-47100				
29	1	U53827-47050				
30	2	U53828-47070				
31	3	U53807-47020				
32	4	U53808-47020				
33	5	U53875-47070				
34	6	U53876-47110				
		PIECE, RR BUMPER <i>m</i>	10.00	5.40		54.00
		COVER, FR BUMPER <i>m</i>	1.00	35.30		35.30
		COVER, FR BUMPER <i>m</i>	1.00	35.30		35.30
		ABSORBER, FR BUMPER <i>m</i>	1.00	159.40		159.40
		ABSORBER, FR BUMPER <i>m</i>	1.00	95.40		95.40
		REINFORCEMENT, FR <i>m</i>	1.00	295.20		295.20
		EXTENSION SUB-ASSY, <i>m</i>	1.00	144.20		144.20
		EXTENSION SUB-ASSY, <i>m</i>	1.00	144.20		144.20
		REINFORCEMENT <i>m</i>	1.00	144.20		144.20
		GRILLE SUB-ASSY, <i>m</i>	1.00	859.20		859.20
		HOOD SUB-ASSY <i>m</i>	1.00	415.60		415.60
		INSULATOR, HOOD <i>X</i>	1.00	1184.00		1184.00
		FENDER SUB-ASSY, FR <i>lt - RH</i>	1.00	493.40		493.40
		FENDER SUB-ASSY, FR <i>reg. LH</i>	1.00	1177.80		1177.80
		PROTECTOR, FR FENDER <i>?</i>	1.00	1177.80		1177.80
		PROTECTOR, FR FENDER <i>?</i>	1.00	113.00		113.00
		SEAL SUB-ASSY, <i>?</i>	1.00	113.00		113.00
		SEAL SUB-ASSY, <i>?</i>	1.00	62.40		62.40
		LINER, FR FENDER, RH <i>Torn</i>	1.00	62.40		62.40
		LINER, FR FENDER, LH <i>X</i>	1.00	248.10		248.10
			1.00	243.20		243.20

For & on behalf of	Customer's Signature	Charge Summary	Total
Borneo Motors (Singapore) Pte Ltd	Please acknowledge receipt of vehicle	Parts Labour Sublet Lubrication/Fluid Others	
			Less
			Amount Due



Inchcape

Co. Reg No. : 196700086Z

GST Reg No. : MR-8500000-9

No. 2 PANDAN CRESCENT

SINGAPORE 128462, Tel no.: 6634 1168

ESTIMATE

Account Details				Account No.		Customer Details			
THIRD PARTY CLAIM				S1000020 / TPCLAIM		M/S Grab Rentals Pte Ltd 3 Media Close #01-03/06 Singapore 138498 Work: 65703925			
				Document No. 0					
				Document Date 21/02/2023					
Year	Model	Variant	Reg. Date	Reg. No.	Kilometers	Wip No.	Order No. / Remarks		
2017	ZVW50R	AHXEBW Q3	18/07/2017	SLQ6315X	0	20311	75/DS/SLQ6315X		
Chassis No.		Engine No.	Terms	SA / Counter	Vehicle In		Collected On		
JTDKB3FU903562198		2ZRS058258	60	Ng Mei Yen	--/--/----		0.00	--/--/----	
L	Cd	Job/Parts Description			Qty	Unit Price	Disc %	Amount	
35	7	U53510-47140 LOCK ASSY, HOOD ?			1.00	162.20		162.20	
36	8	U85315-47160 JAR, WASHER, A mil			1.00	263.00		263.00	
37	9	U85319-47170 PIPE, WASHER, A			1.00	80.20		80.20	
38	0	U53289-47072 COVER, RADIATOR			1.00	282.80		282.80	
39	1	U16592-37020 GUIDE, RADIATOR AIR, ?			1.00	135.60		135.60	
40	2	U53202-47901 SUPPORT S/A, ?			1.00	294.20		294.20	
41	3	U53205-47900 SUPPORT S/A, ?			1.00	453.60		453.60	
42	4	U53217-47030 BRACE, HOOD LOCK X			1.00	93.60		93.60	
43	5	U53203-47901 SUPPORT S/A, ?			1.00	294.20		294.20	
44	6	U53028-47010 SUPPORT SUB-ASSY, ?			1.00	492.50		492.50	
45	7	U53701-47111 APRON SUB-ASSY, FR ?			1.00	1178.00		1178.00	
46	8	U53702-47101 APRON SUB-ASSY, FR ?			1.00	1178.00		1178.00	
47	9	U81145-47691 UNIT, HEADLAMP com			1.00	3167.20		3167.20	
48	0	U81185-47691 UNIT, HEADLAMP com			1.00	3167.20		3167.20	
49	1	T81210-47020 LAMP ASSY, FOG, RH mil			1.00	1143.60		1143.60	
50	2	U81220-47020 LAMP ASSY, FOG, LH com			1.00	1143.60		1143.60	
51	3	U75310-47060 EMBLEM ASSY, ny			1.00	109.50		109.50	
52	4	U75374-47140 EMBLEM, SIDE PANEL m			1.00	65.60		65.60	
53	5	U75374-47150 EMBLEM, SIDE PANEL m			1.00	65.60		65.60	
54	6	U51420-47030 COVER ASSY, ENGINE X			1.00	223.20		223.20	

For & on behalf of		Customer's Signature		Charge Summary		Total	
Borneo Motors (Singapore) Pte Ltd		Please acknowledge receipt of vehicle		Parts 22,310.20		36,254.20	
KK Auto Consultants hence notify the Repairer of the following: - To resurvey before/after spray painting - To display damaged part(s) during resurvey - Parts prices are subject to confirmation - Third party survey is on a "Without Prejudice" basis - No illegal modification(s) is allowed - Supplementary Item(s) must be resurveyed and is subject to final approval from Insurance Company		Labour 13,864.00		GST 8.00%		2,900.34	
		Sublet 80.00		Less		0.00	
		Lubrication/Fluid 0.00		Amount Due		39,154.54	
		Others 0.00					

Acknowledged by Repairer

Signature:

Date:

Customer Copy

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Company

Owner ID:

200G

Vehicle Details

Vehicle No.:

SLQ6315X

Vehicle to be Exported:

No

Intended Deregistration Date:

22 Feb 2023

Vehicle Make:

TOYOTA

Vehicle Model:

PRIUS HYBRID 1.8 CVT

Primary Colour:

White

Manufacturing Year:

2017

Engine No.:

2ZR5058258

Chassis No.:

JTDKB3FU903562198

Maximum Power Output:

90.0 kW (120 bhp)

Open Market Value:

\$29,007.00

Original Registration Date:

18 Jul 2017

First Registration Date:

18 Jul 2017

Transfer Count:

1

Actual ARF Paid:

\$5,000.00

Intended PARF Rebate Details

PARF Eligibility:

Yes

PARF Eligibility Expiry Date:

17 Jul 2027

PARF Rebate Amount:

\$3,500.00

Intended COE Rebate Details

COE Expiry Date:

17 Jul 2027

COE Category:

B - Car above 1600cc or 97kW (130bhp)

COE Period(Years):

10

QP Paid:

\$54,406.00

COE Rebate Amount:

\$23,945.00

Total Rebate Amount:

\$27,445.00