

(08/11/13) wef

ASS. REC. BY: Marcus

REF:

CS/CT/23002048/Unp3

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SM K8257C

at Workshop m/s Sme

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____

Excess: 0

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: \$45K

IDAC Accident Rpt: _____

Consistent?: Yes or No

GIA / PR Seen: _____

Consistent?: Yes or No

Est. Repairs: 7 days

Res.: Yes or No

Lump Sum: 20 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

7888

Vehicle: IN / OUT

Date: _____

Person Contacted: LIA 31540

Veh No: SM K8257C Yr Regn: 16/07/14

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or CA/

Make: Audi A6 TFSI 1984 c.c.

Colour: Black

A/C: Insured / Std / NI / NA

Sp. Reading: 163434

T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: WAU222466EN11149

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 245/40 R19

R: P.R.

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front 6

Rear 6

R/Bal. 6 mm

R/Bal. 6 mm

L/Bal. 0 mm

L/Bal. 6 mm

D.O.A. 18/02/23

D.O.I. 24/2/23

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Dep 176.

N144 \$13460

repaired by HAN agree to repair at \$13,000

25/3/23 informed AH ying 2/5 @ 13,000 (Red. \$16343.69, 56%)

Date/Time, File Pass to?

☐

Preli. Report

1) 31/3/23

☐

Final Report

Date/Time, File Return to?

2) _____

Report Format: 00

Lump Sum / I.B.I.: (\$ 13000)

Days Of Repair: 7

Resurvey No. of Trip: 2

Add Fee:

☐

Site Insp (\$

☐

Interview (\$

☐

Tech. Invs (\$

☐

Weekend (\$

Survey Fee:

Transportation:

S + RS, SI

Photos

Others

TOTAL

SME Motor Pte Ltd
1 Kaki Bukit Ave 6, BLK D, #02-15
417883

Insurer Reference:
Repairer Reference: 23/CN/OD-090 (02)
Date calculated: 22/02/2023 12:20 PM

Full Report
Registration: SMK8251C
Printed: 22/02/2023 12:21 PM

Summary Information

Claim Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Gary Seah	Currency:	SGD
Claim Reference:		Date of Incident:	18/02/23
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle			
Manufacturer:	AUDI		
Model:	A6 (4G2/4G5)		
Sub Model:	BASE MODEL		
Model Sheet Number:	00 22 01		
Registration:	SMK8251C		
VIN number:	WAUZZZ4G6EN111149		
Odometer:			
Model Specs			
FROM 12.2013	CHROME BADGE	R/ASPHERIC D/MIRROR	L/MIRROR CONVEX
STOP-START SYSTEM	T-GATE WARN-TRIANGLE	HEADLAMP WASHERS	AUTO BOOTLID
MULTIMEDIA INTERFACE	XENON HEADLAMPS	AUTO DIPPING MIRROR	ELEC FOLD DR MIRRORS
AUTO DAY/NIGHT MIRR	MMI RADIO PLUS	ACTIVE LOUD SPEAKER	ULTRASONIC PARK SYS
KEYLESS ENTRY	SPLIT REAR SEAT	SPORT S-WHEEL LEATH	ELECT LUMBAR ADJUST
INTERIOR LAMP PACK	FRONT CENTRE ARMREST	ELEC/SEAT ADJ MEMORY	ALTERNATOR 100-150A
HD COOLING	2.0 LTR 132KW	MULTITRONIC	SPORTS SUSPENSION
CRUISE CONTROL	TYRES 225/55 YR 17	TRIM PARTS ALUMINIUM	ESP PROGRAMME
SALOON	EQUIP LEATHER MILANO	TWO COAT METALLIC	PREPARE OFF VEHICLE

Not Authorized
here
anyway
24/2/23

Excess?

maybe TOTAL LOSS?

1/5 @ 13,000

7 days
the price after repair

Audatex System Using Manufacturer Times

Page 1 of 6

PRINT DATE 22/02/2023

the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:


Vehicle Condition

Vehicle Status

Pre-Accident Damage:
Date of Inspection:

Damage Areas

All ☐
Underbody ☐

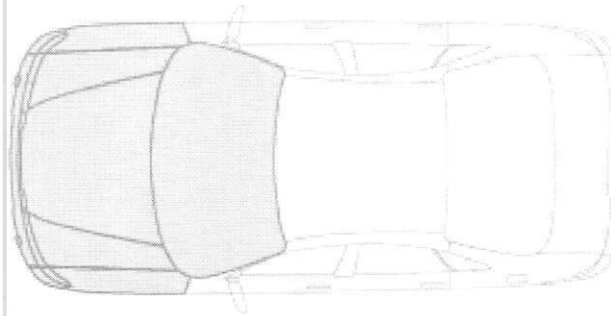

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	-------------------------	------------------------	------------------------	-------------------------	-------------------------	--------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
01 50 00 ZAX	GFS / GUIDED FUNCTION (READ OUT FAULT MEMORY)		3.0	12.60
27 06 27 ZAX	DETACH + REFIT BATTERY		2.0	8.40
44 05 19 00	R + R FRONT WHEEL (WHEELS)		2.0	8.40
10 83 19 00	R + R ENGINE COVER		2.0	8.40
87 03 17 00	DRAIN + REFILL REFRIGERANT (V.A.G. 1770/1771)		5.0	21.00
63 29 19 00	R + R FRONT BUMPER COVER		9.0	37.80
63 29 55 54	RENEW FRONT BUMPER COVER (BUMPER COVER REMOVED)		7.0	29.40
	INCLUDES: R + R VENTILATION GRILLE, RADIATOR GRILLE AND PARKING AID SENSORS			
66 05 55 50	RENEW RADIATOR GRILLE		2.0	8.40
94 15 56 50	RENEW HEADLAMPS (REMOVED)		3.0	12.60
55 22 19 00	REMOVE/REFIT BONNET PANEL		5.0	21.00
	INCLUDES: ADJUST BONNET CLEARANCES			
55 22 55 50	REPLACE BONNET (WITH BONNET PANEL REMOVED)		5.0	21.00

Code	Description	WU	Price SGD
50 38 19 00)	INCLUDES: REMOVE/REFIT ALL COMPONENT PARTS R + R FRONT LOCK CARRIER (COVERING BUMPER AND WHEELS REMOVED) INCLUDES: BUMPER (BUMPER REINFORCER) REMOVE AND REFIT, DETACH + REFIT BATTERY AND DRAIN/REFILL COOLING WITHOUT: ADJUST HEADLAMPS	16.0	67.20
50 38 55 50	RENEW FRONT LOCK CARRIER (REMOVED) INCLUDES: R + R RADIATOR, HEADLAMPS AND LOWER LOCK PARTS	11.0	46.20
64 10 19 00	RENEW FRONT SCREEN INCLUDES: R + R A-PILLAR TRIMS, INTERIOR MIRROR, WIPER ARMS AND COWL TRIM	25.0	105.00
70 67 19 50	R + R LEFT B-PILLAR LOWER TRIM (UPPER TRIM B-PILLAR REMOVED)	1.0	4.20
70 67 19 50	R + R R/LOWER B-PILLAR TRIM (UPPER TRIM B-PILLAR REMOVED)	1.0	4.20
69 11 20 00)	R + R BOTH FRONT THREE POINT SEAT BELTS (LOWER B-PILLAR TRIMS REMOVED)	3.0	12.60
68 17 19 00	R + R CENTRE CONSOLE INCLUDES: R + R ARMREST, HEATER-/AIR CONDITIONING CONTROL, RADIO AND NAVIGATION SYSTEM CONTROL	9.0	37.80
70 18 19 00)	R + R INSTRUMENT PANEL (CENTRE CONSOLE REMOVED) INCLUDES: R + R STEERING WHEEL, AIRBAG UNIT (DRIVER), INSTRUMENT PANEL INSERT, STEERING COLUMN SWITCH, LOWER INSTRUMENT PANEL SHELF AND GLOVE BOX, ADJUST INSTRUMENT PANEL	26.0	109.20
70 18 55 50	RENEW INSTRUMENT PANEL (INSTRUMENT PANEL REMOVED) INCLUDES: R + R PASSENGER AIRBAG AND ATTACHED PARTS	4.0	16.80
69 53 19 50	R + R AIRBAG TRIGGERING UNIT (CENTRE CONSOLE REMOVED)	2.0	8.40
87 50 19 00)	R + R CONDENSER DOES NOT INCLUDE: DRAIN + REFILL REFRIGERANT	4.0	16.80
19 70 55 50	RENEW RADIATOR	1.0	4.20
94 15 16 00	ADJUST HEADLAMPS	2.0	8.40
0742	R/F WING REPAIR	5.0*	21.00
Labour Cost		Hrs	WU
Panel / Mechanical Labour		15.50	155.0
Total of Labour			651.00

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	BONNET NEW PART PAINTING	29.0

Code	Description - TWO COAT METALLIC	WU	Price SGD
	FRONT BUMPER NEW PART PAINT K1R	11.0	
	R/F OUTER SENSOR NEW PART PAINT K1R	3.0	
	R/F INNER SENSOR NEW PART PAINT K1R	3.0	
	R/BUMPER COVER CAP NEW PART PAINT K1R	3.0	
	R/F WING REPAIR PAINTING <50%	11.0	
	FRT TOWING EYE COVER SURFACE PAINT PLAST.	3.0	
	L/F WING SURFACE PAINT	6.0	

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	101.65
0281	FRONT BUMPER NEW PART PAINT K1R	53.63
0304	R/F OUTER SENSOR NEW PART PAINT K1R	0.49
0306	R/F INNER SENSOR NEW PART PAINT K1R	0.49
0462	R/BUMPER COVER CAP NEW PART PAINT K1R	0.49
0742	R/F WING REPAIR PAINTING <50%	14.21
0293	FRT TOWING EYE COVER SURFACE PAINT PLAST.	0.37
0741	L/F WING SURFACE PAINT	10.96

Labour Cost - Paint

Factor	Hrs	WU	Price SGD
Time Paint		69.0	
Preparation Main Work Metal	2.50	25.0	105.00
Preparation Comp. Work Plastic	0.50	5.0	21.00
Total	10 WU/h	99.0	415.80

Material Cost - Paint

	Price SGD
New Part Painting	101.65
New Part Painting - Plastic K1R	55.10
Repair Painting	14.21
Surface-/Blend Paint	10.96
Surface Painting Plastic	0.37
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	219.89

Spare Parts

				prices as at 2015-09-02/23
Code	Description	Part Number	Part Source	Price SGD
0281	FRONT BUMPER	4G0 807 065 A GRU	Original	Dis 1,450.00 ✓
0298	R/F AIR GUIDE GRILLE	4G0 807 682 F 9B9	Original	Che 115.00 ✓
0304	R/F OUTER SENSOR	1S0 919 275 C GRU	Original	shut 185.00 ✓
0306	R/F INNER SENSOR	1S0 919 275 D	Original	nz 185.00 ✓
0320	R/F OUT BUMPER BRKT	4G0 807 284	Original	Che 55.00 ✓

Code	Description	Part Number	Part Source	Price SGD
0340	FRT BUMP IMPACT SUPP	4G0 807 113 A	Original	395.00
0343	FRT BUMPER FILLING	4G0 807 550 J	Original	95.00
0344	FRT BUMPER CLAMP KIT	4G0 098 623 B	Original	50.00
0362	H/LAMP WASHER VALVE	4G0 955 102 B	Original	185.00
0410	GRILLE	4G0 853 651 T94	Original	850.00
0462	R/BUMPER COVER CAP	4G0 955 276 GRU	Original	65.00
0471	BONNET	4G0 823 029 A	Original	2,350.00
0477	BONNET MOUNTING KIT	4G0 098 615	Original	50.00
0488	R/F LOCK BOW	4G0 823 186 A	Original	85.00
0561	LEFT HEADLAMP ASSY	4G0 941 043 D	Original	1,450.00
0562	RIGHT HEADLAMP ASSY	4G0 941 044 D	Original	1,450.00
0930	FRT LOCK CARRIER	4G0 805 594 C	Original	580.00
0935	INN REAR PANEL TRIM	4G0 807 081	Original	95.00
0991	L/LOCK CARRIER BRKT	4G0 807 591 B	Original	75.00
0992	R/LOCK CARRIER BRKT	4G0 807 592 B	Original	75.00
1401	WINDSCREEN	4G0 845 099 F NVB	Original	950.00
1404	APPLICATOR	D 009 500 25		0.00
1405	RAIN SENSOR FOIL	8U0 955 609		0.00
1409	CUTTING FILAMENT	357 853 999 B		0.00
1410	CLEANING SOLUTION	D 009 401 04		0.00
1411	WINDSCREEN BOND KIT	D 004 660 M2		0.00
1413	WINDSCREEN PRIMER	D 009 200 02		0.00
4323	AIRBAG SYSTEM	RENEW	Original	2,950.00
4331	INSTRUMENT PANEL	4G2 857 001 B 24A	Original	2,950.00
4465	CONDENSER	4G0 260 403 B	Original	490.00
4661	L/F SEAT BELT	4G8 857 705 F V04	Original	1,300.00
4662	R/F SEAT BELT	4G8 857 706 M V04	Original	1,300.00
4663	L/F BELT TENSIONER	RENEW	Original	950.00
4664	R/F BELT TENSIONER	RENEW	Original	950.00
7405	DRIVER AIRBAG SYS	RENEW	Original	1,850.00
7435	STRG WHEEL SLIP RING	4G0 953 568 A	Original	850.00
7437	L/AIRBAG SENSOR	4H0 959 651 A	Original	350.00
7438	R/AIRBAG SENSOR	4H0 959 651 A	Original	350.00
7441	AIRBAG CONTROL UNIT	4H0 959 655 C	Original	1,650.00
7754	R/RADIATOR AIR GUIDE	4G0 121 284 AC	Original	55.00
7761	RADIATOR	8K0 121 251 L	Original	550.00
1000	RAIN SENSOR TAPE	1000	Original	95.00
1001	6PC TOP GARNISH CLIP	1001	Original	27.00
f: OEM Parts				0.00
n: Non-OEM Parts				27,457.00
u: Used parts				27,457.00
Savings				
Subtotal				
Total				

Extras

Code	Description	Price SGD
1002	FRT WINDSCREEN GUM 1002	60.00*
1003	ERP BRACKET 1003	15.00*
1004	AIRCON COOLANT 1004	50.00*
1005	RADIATOR COOLANT 1005	25.00*

Code	Description	Price SGD
1006	REPORGRAMME AIRBAG CONTROL UNIT	450.00* 300.00
	Total Extras	600.00

Final Calculation

	SGD	SGD
Parts	27,457.00	
Total Parts		27,457.00
Labour Time Base 10 WU/h		
Total 155.0 WU X 42.00 SGD/h	651.00	
Total of Labour		651.00
Total Of Extras		600.00
Paint Work Time Base 10 WU/h		
Labour Cost 99.0 WU X 42.00 SGD/h	415.80	
Material Cost	219.89	
Total Paint Including Material		635.69
Repair Cost Excludes GST		29,343.69
GST (+8.0%)		2,347.50
Repair Cost Included GST		31,691.19

Comments

* - USER SUPPLIED DATA
 NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

Code	Description	Part Number	Part Source	Price SGD
0477	BONNET MOUNTING KIT	4G0 098 615	Original	50.00
9665	CENTRAL FUSING	8J0 915 459	Original	0.00
1410	CLEANING SOLUTION	D 009 401 04		0.00
4465	CONDENSER	4G0 260 403 B	Original	490.00
1409	CUTTING FILAMENT	357 853 999 B		0.00
7405	DRIVER AIRBAG SYS	RENEW	Original	1,850.00
7787	EXPANSION TANK	4G0 121 403 AG	Original	105.00 ✓
0281	FRONT BUMPER	4G0 807 065 A	Original	1,450.00
		GRU		
0344	FRT BUMPER CLAMP KIT	4G0 098 623 B	Original	50.00
0343	FRT BUMPER FILLING	4G0 807 550 J	Original	95.00
0340	FRT BUMP IMPACT SUPP	4G0 807 113 A	Original	395.00
0930	FRT LOCK CARRIER	4G0 805 594 C	Original	580.00
0410	GRILLE	4G0 853 651 T94	Original	850.00
0362	H/LAMP WASHER VALVE	4G0 955 102 B	Original	185.00
4331	INSTRUMENT PANEL	4G2 857 001 B	Original	2,950.00
		24A		
4663	L/F BELT TENSIONER	RENEW	Original	950.00
4661	L/F SEAT BELT	4G8 857 705 F	Original	1,300.00
		V04		
0561	LEFT HEADLAMP ASSY	4G0 941 043 D	Original	1,450.00
0462	R/BUMPER COVER CAP	4G0 955 276	Original	65.00
		GRU		
0298	R/F AIR GUIDE GRILLE	4G0 807 682 F	Original	115.00
		9B9		
4664	R/F BELT TENSIONER	RENEW	Original	950.00
0306	R/F INNER SENSOR	1S0 919 275 D	Original	185.00
0488	R/F LOCK BOW	4G0 823 186 A	Original	85.00
0320	R/F OUT BUMPER BRKT	4G0 807 284	Original	55.00
0304	R/F OUTER SENSOR	1S0 919 275 C	Original	185.00
		GRU		
4662	R/F SEAT BELT	4G8 857 706 M	Original	1,300.00
		V04		
0992	R/LOCK CARRIER BRKT	4G0 807 592 B	Original	75.00
7761	RADIATOR	8K0 121 251 L	Original	550.00
1405	RAIN SENSOR FOIL	8U0 955 609		0.00
1007	RAIN SENSOR TAPE	1000	Original	95.00
0562	RIGHT HEADLAMP ASSY	4G0 941 044 D	Original	1,450.00
7435	STRG WHEEL SLIP RING	4G0 953 568 A	Original	850.00
1401	WINDSCREEN	4G0 845 099 F	Original	950.00
		NVB		
1411	WINDSCREEN BOND KIT	D 004 660 M3		0.00
1413	WINDSCREEN PRIMER	D 009 200 02		0.00

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings
Subtotal

Total

0.00
26,637.00
26,637.00

67476106
7/m

Extras

Code	Description	Price SGD
1002	FRT WINDSCREEN GUM 1002	40.00 ✓
1003	ERP BRACKET 1003	10.00 ✓
1004	AIRCON COOLANT 1004	50.00 ✓
1005	RADIATOR COOLANT 1005	20.00 ✓

Code	Description	Price SGD
1006	REPORGRAMME AIRBAG CONTROL UNIT	450.00
	Total Extras	570.00

Final Calculation

	SGD	SGD
Parts		
Total Parts	26,637.00	26,637.00
Labour Time Base 10 WU/h		
Total 165.0 WU X 42.00 SGD/h	693.00	
Total of Labour		693.00
Total Of Extras		570.00
Paint Work Time Base 10 WU/h		
Labour Cost 99.0 WU X 42.00 SGD/h	415.80	
Material Cost	219.89	
Total Paint Including Material		635.69
Repair Cost Excludes GST		28,535.69
GST (+8.0%)		2,282.86
Repair Cost Included GST		30,818.55
Deductions (Excludes GST)		
Repair Cost Discount (+20.00%)	-5,707.14	
Total Of Deductions (Excludes GST)		-5,707.14
Grand Total Excludes GST	13,000	22,828.55
GST (+8.0%)	82	1,826.28
Grand Total Included GST		24,654.83

Comments

* - USER SUPPLIED DATA
 NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	789Z
Vehicle Details	
Vehicle No.:	SMK8251C
Vehicle to be Exported:	No
Intended Deregistration Date:	24 Feb 2023
Vehicle Make:	AUDI
Vehicle Model:	A6 2.0 TFSI MU
Primary Colour:	Black
Manufacturing Year:	2014
Engine No.:	CDN403210
Chassis No.:	WAUZZZ4G6EN111149
Maximum Power Output:	132.0 kW (177 bhp)
Open Market Value:	\$38,531.00
Original Registration Date:	16 Jul 2014
First Registration Date:	16 Jul 2014
Transfer Count:	2
Actual ARF Paid:	\$40,944.00 20472
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	15 Jul 2024
PARF Rebate Amount:	\$22,519.00
Intended COE Rebate Details	
COE Expiry Date:	15 Jul 2024
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$64,889.00
COE Rebate Amount:	\$9,021.00
Total Rebate Amount:	\$31,540.00

The information contained herein is correct as at 24 Feb 2023

OK



Search Jobs Vacancies

Let JobStreet fulfil your dreams of a better job. JobStreet Singapore

Open

Post an Advertisement
Sell it yourself! Advertise it at just
\$68 until it's SOLD!

Post an Ad

Advertiser Login

Ways of Selling

\$63,800 May 16 BMW 216d Active Tourer



PML Unit. 6 Free Servicing
Sessions Inclusive.
Republic Auto StarAd



Sort by Date Posted 20 results/page

8 vehicles



Audi A6

Any Category

Advanced Search



Search

Search Selection

Audi A6



BuySafe

Audi A6 2.0A TFSI MU**\$36,800**

\$18,330 /yr

21-Jan-2014

1,984 cc

128,000 km

Luxury

Available

Excellent condition and well maintained. Accident Free! Low depreciation! Exquisite white with black interior. Proce negotiable! Bank or i...

This car comes with 6-mth Sgcarmart Warranty - the best protection for your car. Learn More

Posted: 24-Feb-2023

CONSIGNMENT

**Audi A6 2.0A TFSI MU****\$55,800**

\$19,170 /yr

29-Dec-2014

1,984 cc

107,639 km

Luxury

Available

2 Owners, High Loan Available, Free Servicing, Free Grooming, Accident Free, STA Or Vicom Evaluation Are Welcome, Bank & In House...

This car comes with 6-mth Sgcarmart Warranty - the best protection for your car. Learn More

CARWAY

Posted: 24-Feb-2023

PREMIUM AD

**Audi A6 2.0A TFSI MU****\$53,800**

\$20,520 /yr

14-Oct-2014

1,984 cc

120,000 km

Luxury

Available

Fully stock condition. Well maintained by owner. 100% loan available. Bank/in-house loan and high trade in available. Ex bankruptcy or...

Posted: 20-Feb-2023

**Audi A6 2.0A TFSI MU****\$57,500**

\$20,030 /yr

31-Dec-2014

1,984 cc

130,000 km

Luxury

Available

1 Careful Owner, Full Agent Maintained, Low Depreciation, Super Low Mileage, Fuel Efficiency, Easy Financing, Flexible Loan Available, A...

SG Car Choice Pte Ltd

Posted: 19-Feb-2023

**GET YOUR
COE
RENEWAL
LOAN**

Is your COE expiring? Let us help you renew it!

Getting your COE renewed is easy, fast and affordable. We'll help you renew your COE and get a loan for it. Get the cheapest loan in town and an approval in 2 days without effort! Enquire today.

**Audi A6 2.0A TFSI MU****\$45,800**

\$20,340 /yr

29-May-2014

1,984 cc

-

Luxury

Available

Low depreciation, low mileage, fuel efficiency, 100% accident free. Well take care and maintained by previous owner. No repairs needed...

This car comes with 6-mth Sgcarmart Warranty - the best protection for your car. Learn More

SG Car Choice Pte Ltd

Posted: 19-Feb-2023

**Audi A6 2.0A TFSI MU****\$39,800**

\$21,340 /yr

14-Jan-2014

1,984 cc

94,000 km

Luxury

Available

Great for short term drive. Car in great condition. Call now for viewing.

Posted: 14-Feb-2023

Compare