

ASS. REC. BY:

REF:

AIG/23002086/KY

C

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TP RES/OD RES/EVA/INV/MY

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:


Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

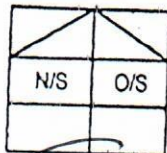

Bal. or Market Value:

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

4

days

Res.: Yes or No

Lum Sum:

1.B.1 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SNIT 50342

Yr Regn:

10, 22

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Toy Yaris Cross

c.c

1490

Colour

M. Gold

A/C:

Insured / Std / NI / NA

Sp. Reading

20093

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

JTDKBAAB3301001797

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD / A/Rim or

Tyre Size:

F:

205/65R16

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or

Front

Rear

R/Bal.

mm

R/Bal.

mm

L/Bal.

mm

L/Bal.

mm

D.O.A.

22/2/23

D.O.I.

23/2/2023

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

20/3 @ 4217.80 Cuh Car

Date/Time, File Pass to?



: Prell. Report

1)



: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trlp:

Survey Fee:

Transportation

S - RS. SI

F. m/s

Others

Add Fee:



: Site Insp (\$



: Interview (\$



Tech Invs (\$



Weekend (\$

Report Format :

Lump Sum / I.B.I: (\$

TOTAL

Date: 22/02/2023

Vehicle No: SNH5034L

Model: TOYOTA YARIS CROSS HYBRID

Chassis: JTDKAB3301001797-2022

Reg.Year: 2022

Third Party Insurer: AIG

Third Party Veh No: SMD7309P

Date of Accident: 22/02/2023

Estimator: TING AN

Surveyor:

Not Noted
Repair B4 pain

4 days

4217.80

ESTIMATE

NO.	DESCRIPTION	QTY	UNIT S\$	AMOUNT S\$
1	REAR TAILGATE <i>1543.90</i>	1		<i>B</i> \$1,724.00
2	REAR TAILGATE "YARIS" EMBLEM	1		<i>na</i> \$60.00
3	REAR TAILGATE "CROSS" EMBLEM	1		<i>na</i> \$60.00
4	REAR TAILGATE "HYBRID" EMBLEM	1		<i>na</i> \$60.00
5	REAR TAILGATE INNER LOCK	1		<i>n</i> \$561.00
6	REAR TAILGATE INNER TRIM BOARD	1		<i>major</i> \$352.00
7	REAR TAILGATE WEATHERSTRIP	1		<i>na</i> \$393.00
8	REAR WINDSCREEN MOULDING	1		<i>na</i> \$90.00
9	REAR BUMPER <i>917.10</i>	1		<i>na</i> \$488.00
10	REAR BUMPER LOWER LIP <i>525.50</i>	1		<i>B</i> \$600.00
11	REAR BUMPER ANTENNA SENSOR	1		<i>cm</i> \$78.00
12	REAR BUMPER SIDE BRACKET LH	1		<i>na</i> \$108.00
13	REAR BUMPER SIDE BRACKET RH	1		<i>na</i> \$108.00
14	REAR END PANEL	1		<i>R</i> \$750.00
15	REAR END PANEL UPPER COVER <i>343.90</i>	1		<i>na</i> \$381.00
16	REAR FLOOR PANEL FOAM TOOLBOX TRAY	1		<i>na</i> \$161.00
17	REAR FLOOR PANEL TOOLBOX TRAY UPPER BOARD	1		<i>n</i> \$465.00
SUB TOTAL				\$6,439.00
LESS 25%				-\$1,609.75
PARTS TOTAL				\$4,829.25

NO.	SPECIAL NETT	QTY	UNIT S\$	AMOUNT S\$
1	REAR WINDSCREEN SEALANT	1		<i>na</i> \$80.00
2	REAR TAILGATE INNER TRIM BOARD CLIPS	1		<i>na</i> \$50.00
3	REAR BUMPER CLIPS	1		<i>na</i> \$50.00
4	REAR BUMPER REVERSE SENSOR	1		<i>na</i> \$300.00
5	REAR END PANEL JOINT SEALANT	1		<i>na</i> \$100.00
6	REAR END PANEL UPPER COVER CLIPS	1		<i>na</i> \$40.00
S/N TOTAL				\$620.00

LABOUR CHARGES:

Head office

6 Kung Chong Road Singapore 159143
Tel: (+65) 6472 1313 | Fax: (+65) 6472 2112

Branch

9A Serangoon North Ave 5 Singapore 554500
Tel: (+65) 6484 9919 | Fax: (+65) 6481 1993

Branch (Motor Insurance Claims)

Blk 10 Ang Mo Kio Ind. Park 2A #01-05 Singapore 568047
Tel: (+65) 6481 1522 | Fax: (+65) 6481 1011



Date: 22/02/2023
Vehicle No: SNH5034L
Model: TOYOTA YARIS CROSS HYBRID
Chassis: JTDKBAB3301001797-2022
Reg.Year: 2022

Third Party Insurer: AIG
Third Party Veh No: SMD7309P
Date of Accident: 22/02/2023
Estimator: TING AN
Surveyor:

LABOUR CHARGES TO REMOVE, REPLACE, REFIX, REPAIR & READJUST REAR ACCIDENT AREAS & ETC.

\$700.00 50d

LABOUR CHARGES FOR PAINTING & TO SUPPLY PAINT & FURNISHING MATERIALS AT REAR TAILGATE, REAR BUMPER, REAR END PANEL & ETC.

\$700.00 60d

LABOUR CHARGES TO REMOVE & REFIX REAR WINDSCREEN GLASS, REAR WINDSCREEN MOULDING, REAR WINDSCREEN SEALANT & ETC.

\$150.00 12d

LABOUR CHARGES TO REMOVE & REINSTALLED REAR TAILGATE INNER MECHANISM & ETC. BACK TO ORIGINAL OPERATIONS.

\$120.00 60d

LABOUR CHARGES TO REMOVE & REPLACE REAR BUMPER REVERSE SENSOR & ETC.

\$120.00 60d

TO TUFF KOTE & UNDERSEAL MATERIALS.

\$120.00 30d

TO DIAGNOSIS FAULT CODE & RESET MEMORY.

~ \$100.00 7

TO CHECK WIRING & ELECTRICAL SYSTEM.

\$80.00 20d

LABOUR TOTAL \$2,090.00

TING AN

TOTAL \$7,539.25

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from insurance Company

Acknowledged by Repairer

Signature:

Date:

Head office

6 Kung Chong Road Singapore 159143
Tel: (+65) 6472 1313 | Fax: (+65) 6472 2112

Branch

9A Serangoon North Ave 5 Singapore 554500
Tel: (+65) 6484 9919 | Fax: (+65) 6481 1993

Branch (Motor Insurance Claims)

Blk 10 Ang Mo Kio Ind. Park 2A #01-05 Singapore 568047
Tel: (+65) 6481 1522 | Fax: (+65) 6481 1011



> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	107N
Vehicle Details	
Vehicle No.:	SNH5034L
Vehicle to be Exported:	No
Intended Deregistration Date:	22 Feb 2023
Vehicle Make:	TOYOTA
Vehicle Model:	YARIS CROSS HYBRID ACTIVE (AT) (2WD)
Primary Colour:	Gold
Manufacturing Year:	2022
Engine No.:	M15AY461712
Chassis No.:	JTDKBAB3301001797
Maximum Power Output:	82.0 kW (109 bhp)
Open Market Value:	\$26,006.00
Original Registration Date:	31 Oct 2022
First Registration Date:	31 Oct 2022
Transfer Count:	0
Actual ARF Paid:	\$13,409.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	30 Oct 2032
PARF Rebate Amount:	\$10,056.00
Intended COE Rebate Details	
COE Expiry Date:	30 Oct 2032
COE Category:	A - Car-Details at OneMotoring
COE Period(Years):	10
QP Paid:	\$86,000.00
COE Rebate Amount:	\$83,318.00
Total Rebate Amount:	\$93,374.00

The information contained herein is correct as at 22 Feb 2023

OK