

(08/11/13) WPT

ASS - REC. BY: ASU

REF:

CL4/GRB23002455/Rpa3

4332

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

SLH 2907L

at Workshop m/s

MOVA

of

Fau Yoonh

Insured:

GRB

Policy No.

Claims No.

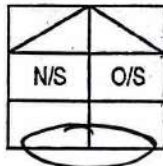
Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

58K

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res.: Yes or No

Lump Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SLH 2907L

Yr Regn:

2016 1049

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

TOYOTA SIENNA / 4DR / 3.5L c.c. 1496

Colour:

WHITE

A/C:

Insured / Std / NI / NA

Sp. Reading

66757

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

NHP 1707051483

Gen. Cond: Good / Fail / Poor / BurntSteering: Inorder / Jammed / Leaked / Burnt orBrake: Inorder / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

185/60R15

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

6

mm

R/Bal.

6

mm

L/Bal.

6

mm

L/Bal.

6

mm

D.O.A.

23/02/23

D.O.I.

09/03/23

Survey held at

MOVA (FY)

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Repair Limit - 36k

Date/Time, File Pass to?

☐

: Prel. Report

☐

: Final Report

1)

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

S + RS. \$

Photos

Others

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech. Invs (\$

☐

: Weekend (\$

Report Format :

Lump Sum / I.B.I. (\$

Estimate

MOVA AUTOMOTIVE PTE LTD 1008 BUKIT MERAH , LANE 3 #01-04 SINGAPORE 159722, Singapore, Singapore, Singapore - 159722. VAT: 198904033G Contact: +65 62723892 Email: NITHA@MOVA.COM.SG	Proforma Invoice No:		Date: Mar 02 2023
	Ticket No: MAP-J000014		Vehicle No: SLH2907L
	Policy No: 000		
	Customer: Quah Kim Hye Vehicle: Toyota Sienta 1.5 G 2016 Kilometer: 66754 Color: WHITE Fuel: PETROL PH: +65 92716113 Email:		
Company Name: INDIA INTERNATIONAL INSURANCE Address: 64 Cecil Street,#04-02 IOB Building City: Singapore Region: Central Singapore Postal Code: 049711 Co.Reg.No: 198703792K			

#	Part Name	Description	GST (%)	Quantity	Unit Price	Payable Amount	Discount	Taxable	Parts Total
1	REAR TAILGATE	Part	8	1.00	1,299.60	974.70	324.90	974.70	1,052.68
2	REAR TAILGATE HINGE LH/RH	Part	8	2.00	94.70	71.03	47.35	142.05	153.41
3	REAR TAILGATE LOGO EMBLEM	Part	8	1.00	91.60	68.70	22.90	68.70	74.20
4	REAR TAILGATE HYBRID EMBLEM	Part	8	1.00	75.10	56.32	18.77	56.32	60.83
5	REAR TAILGATE GARNISH	Part	8	1.00	270.10	202.58	67.53	202.58	218.78
6	REAR TAILGATE INNER LOCK	Part	8	1.00	496.00	372.00	124.00	372.00	401.76
7	REAR TAILGATE INNER LOCK CATCH	Part	8	1.00	59.40	44.55	14.85	44.55	48.11
8	REAR TAILGATE RUBBER	Part	8	1.00	394.70	296.02	98.67	296.02	319.71
9	REAR TAILGATE INNER TRIM	Part	8	1.00	346.20	259.65	86.55	259.65	280.42
10	REAR TAILGATE INNER TRIM CLIPS	Part	8	1.00	40.00	40.00	0.00	40.00	43.20
11	REAR TAILGATE BACK UP LAMP LH	Part	8	1.00	377.50	283.13	94.38	283.13	305.77
12	REAR TAILGATE BACK UP LAMP RH	Part	8	1.00	377.50	283.13	94.38	283.13	305.77
13	REAR REVERSE CAMERA	Part	8	1.00	430.00	430.00	0.00	430.00	464.40
14	REAR WINDSCREEN SEAL	Part	8	1.00	116.00	87.00	29.00	87.00	93.96
15	REAR WINDSCREEN MOULDING	Part	8	1.00	272.40	204.30	68.10	204.30	220.64
16	REAR WINDSCREEN SEALANT	Part	8	1.00	40.00	40.00	0.00	40.00	43.20
17	REAR END PANEL INNER	Part	8	1.00	738.00	553.50	184.50	553.50	597.78
18	REAR END PANEL OUTER	Part	8	1.00	570.10	427.58	142.53	427.58	461.78
19	REAR END PANEL TOP COVERING	Part	8	1.00	256.20	192.15	64.05	192.15	207.52
20	REAR BUMPER	Part	8	1.00	457.30	342.98	114.33	342.98	370.41
21	REAR BUMPER CENTER COVER	Part	8	1.00	241.40	181.05	60.35	181.05	195.53
22	REAR BUMPER SIDE COVER RH	Part	8	1.00	138.60	103.95	34.65	103.95	112.27
23	REAR BUMPER SIDE RETAINER BRACKET RH	Part	8	1.00	87.40	65.55	21.85	65.55	70.79
24	REAR BUMPER REVERSE SENSOR	Part	8	1.00	200.00	200.00	0.00	200.00	216.00
25	REAR BUMPER CLIPS	Part	8	1.00	40.00	40.00	0.00	40.00	43.20
26	REAR TAIL LAMP RH	Part	8	1.00	387.90	290.92	96.97	290.92	314.20
27	REAR NUMBER PLATE	Part	8	1.00	30.00	30.00	0.00	30.00	32.40
28	REAR NUMBER PLATE HOLDER	Part	8	1.00	20.00	20.00	0.00	20.00	21.60
29	REAR LUGGAGE SIDE TRIM COVERING LH	Part	8	1.00	664.60	498.45	166.15	498.45	538.33
30	REAR LUGGAGE SIDE TRIM COVERING RH	Part	8	1.00	664.60	498.45	166.15	498.45	538.33
31	REAR TOOL KIT BOX ASSY	Part	8	1.00	573.90	430.42	143.47	430.42	464.86
32	BATTERY	Part	8	1.00	380.00	380.00	0.00	380.00	410.40

Taxable Value	8,039.13
GST Total	643.13
Discount Total	2,286.37

#	Part Name	Description	GST (%)	Quantity	Unit Price	Payable Amount	Discount	Taxable	Parts Total
							Grand Total		
							8,682.24		

#	Service	Description	GST (%)	Quantity	Unit Price	Payable Amount	Discount	Taxable	Labour Total
33	REAR SPARE TYRE PANEL - REPAIR / REAR TAIL LAMP LOWER PANEL RH - REPAIR / TO REMOVE, REPLACE, REFIT REAR WINDSCREEN GLASS, REAR WINDSCREEN MOULDING, REAR WINDSCREEN SEALANT & ETC. TO EFFECT REPLACE OF REAR TAILGATE	Labour	8	-	120.00	120.00	0.00	120.00	120 120.60
34	TO REMOVE, REPLACE, REFIT REAR REVERSE CAMERA, REAR BUMPER REVERSE SENSOR & ETC. TO EFFECT REPLACE OF REAR TAILGATE & REAR BUMPER	Labour	8	-	180.00	180.00	0.00	180.00	40 194.40
35	TO REMOVE, REPLACE, REFIT REAR TAILGATE INNER MECHANISM SUCH AS REAR TAILGATE INNER LOCK, CENTRAL LOCKING, INNER TRIM & ETC. TO EFFECT REPLACE OF REAR TAILGATE	Labour	8	-	200.00	200.00	0.00	200.00	80 216.00
36	TO REMOVE, REPLACE, REPAIR, READJUST & CHISEL REAR ACCIDENT AREAS SUCH AS REAR TAILGATE, REAR END PANEL INNER, REAR END PANEL OUTER, REAR TAILLAMP LOWER PANEL RH, REAR BUMPER, REAR SPARE TYRE PANEL & ETC. BACK TO ORIGINAL CONDITIONS	Labour	8	-	1,000.00	1,000.00	0.00	1,000.00	900 1,080.00
37	TO SUPPLY PAINT & FURNISHING MATERIALS AT REAR TAILGATE, REAR END PANEL, REAR SPARE TYRE PANEL, REAR TAILLAMP PANEL RH, REAR BUMPER & ETC.	Labour	8	-	1,000.00	1,000.00	0.00	1,000.00	1000 1,080.00
38	TO CHECK WIRING & ELECTRICAL SYSTEM	Labour	8	-	80.00	80.00	0.00	80.00	30 86.40
							Taxable Value		
							2,580.00		
							GST Total		
							206.40		
							Discount Total		
							0.00		
							Grand Total		
							2,786.40		

		Parts Total	8,039.13
		Labour Total	2,580.00
		GST Total	849.53
		Grand Total	11,468.64
		Balance	11,468.64

Customer / Authorized Signatory

Service Advisor Signature

Cashier / Authorized Signature

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Rahul
Hp 92010068
8 days
40
09/03/23 @ 1420
Raj after repair

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Singapore NRIC
Owner ID: 433Z

Vehicle Details

Vehicle No.: SLH2907L
Vehicle to be Exported: No
Intended Deregistration Date: 12 Mar 2023
Vehicle Make: TOYOTA
Vehicle Model: SIENTA HYBRID 1.5G A
Primary Colour: White
Manufacturing Year: 2016
Engine No.: 1NZR419283
Chassis No.: NHP1707051483
Maximum Power Output: 73.0 kW (97 bhp)
Open Market Value: \$26,602.00
Original Registration Date: 28 Oct 2016
First Registration Date: 28 Oct 2016
Transfer Count: 0
Actual ARF Paid: \$5,000.00

Intended PARF Rebate Details

PARF Eligibility: Yes
PARF Eligibility Expiry Date: 27 Oct 2026
PARF Rebate Amount: \$3,250.00

Intended COE Rebate Details

COE Expiry Date: 27 Oct 2026
COE Category: A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years): 10
QP Paid: \$50,000.00
COE Rebate Amount: \$18,118.00
Total Rebate Amount: \$21,368.00

Toyota Sienta 1.5A G

Overview

Insurance

Financial

Accessories

Similar

Research

Photos



**PRECISE AUTO
TRADING**

BUY-SELL-RENT-CONSIGNMENT-FINANCING-INSURANCE COE-RENEWAL-EXPORT-SCRAP

Price **\$55,800** [Get Pre-approved Loan.](#)

Depreciation [?](#) **\$15,410 /yr**
[View models with similar depre](#)

Reg Date **12-Jul-2016**
(3yrs 3mths 29days COE left)

Mileage **86,000 km (12.9k /yr)**

Manufactured [?](#) **2016**

Road Tax [?](#) **\$682 /yr**

Transmission **Auto**

Dereg Value [?](#) **\$24,163 as of today ([change](#))**

OMV [?](#) **\$18,858**

COE [?](#) **\$55,200**

ARF **\$8,858**

Engine Cap **1,496 cc**

Power **80.0 kW (107 bhp)**

Curb Weight [?](#) **1,320 kg**

No. of Owners [?](#) **3**