

(08/11/13) wef

ASS. REC. BY: Rame

REF:

CS/HLA 23002656/RUG3

4872

COC-2026/00

ASSIGNMENT

From:

Date:

Estimated Cost:

☒ OD / TP / WS / TP RES / OD RES / EVA / INV / MVTo Inspect Vehicle No: SLH 31983at Workshop m/s SNG AH TEEof 3, PIONNER RD NORTH #01-18

Insured:

HLA

Policy No.

Claims No.

Sum Insured:

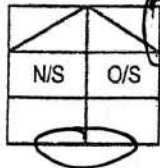
Excess:

300

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

46K

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res.:

Yes or No

Lum Sum:

%

3 Val.:

Yes or No

CA / ☒ REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

REPAIR LIMIT - 15K

Veh No:

SLH 31983

Yr Regn:

2016 / OCTType: ☒ M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

HONDA MOBILIO SV 1.5 CVT c.c 1497

Colour

GREY

A/C:

Insured / Std / NI / NA

Sp. Reading

119641

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

MRHDD4870GP000362

Gen. Cond:

Good / ☒ Poor / Burnt

Steering:

In order / Jammed / Leaked / Burnt or

Brake:

In order / Jammed / Leaked / Burnt or

Mod:

Nil / ☒ Rim / STD A/Rim or

Tyre Size:

F:

195/65R15

R:

BS:

☒ DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

6

mm

R/Bal.

6

mm

L/Bal.

6

mm

L/Bal.

6

mm

D.O.A.

01/03/23

D.O.I.

17/03/23

Survey held at

SNG AH TEE

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

O/S FR & REAR

The U/C / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?

☐ : Prel. Report
☐ : Final Report

1)

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

Add Fee:

☐ : Site Insp (\$
☐ : Interview (\$
☐ : Tech. Invs (\$
☐ : Weekend (\$

) : S + RS : SI

) Photos

) Others

TOTAL

Report Format :

Lump Sum / I.B.I: (\$

Sng Ah Tee Motor & Panel Service Pte Ltd (Co.Reg.No:200810440N)

Blk 3 Pioneer Road North, #01-18

Singapore 628457

Tel: 6268 6183 Fax: 6268 1429 Email: sngahtee@singnet.com.sg; darren@sngahtee.com; janice@sngahtee.com

INSURER: **HL Assurance Pte Ltd (HQ)**

PARTICULARS OF CLAIM

Claim Type: OD (OWN DAMAGE)
Policy No: MP319374
Vehicle Reg. No.: SLH3198J
Driver Age/Info: 60 / FEMALE
TP Injury Involved? NO
Insured/Claimant: TAN GUEK LAI
Driver: TAN GUEK LAI

Ref. No:
Date of Loss: 01/03/2023
Driveable?
Party At Fault: UNKNOWN
Third Party Involved? YES
Contact No: +6597936267

Make/Model: HONDA MOBILIO SV, 1.5 CVT (A) Vehicle Reg. Date: 28/10/2016
Vehicle Colour: GREY
Engine No: L15Z12874028 Chassis No: MRHDD4870GP000362
Odometer: 5 KM

Paint Type:
Total Loss? NO
Est. Duration of Repair (day) 7

Description of Accident/Loss: REFER TO SKETCH
Present Location: SNG AH TEE MOTOR & PANEL SERVICE PTE LTD (PIONEER)

COST OF CLAIMS	Amount
Parts	2,323.60
Miscellaneous Items	0.00
Labour	2,530.00
Paintwork Labour	0.00
Towing	0.00
Gross Total (S\$)	4,853.60
+ GST 8.00% (S\$)	388.29
Nett Amount (S\$)	5,241.89

This claim is handled by: **SAMANTHA TAN YONG SING**

Generated using Merlmen e-Claims Internet Estimation & Adjusting System

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 13 Mar 2023)
 Parts: M1-MPV HONDA MOBILIO SV 1.5 CVT (A) (Catalogue:Merimen Singapore 1.0)
 Labour: Repairer's (Price-denominated Standard List)
 Print Code: Sng Ah Tee Motor & Panel Service Pte Ltd/SLH3198J/13/03/2023 13:46
 Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
 Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1		*FRT BUMPER <i>SCA</i>	0.00	0.00	*160.00 F
2	1		*FRT BUMPER RETAINER RH	0.00	0.00	*8.00 F
3	1		*FRT BUMPER REINFORCEMENT <i>X</i>	0.00	0.00	*140.00 F
4	10		*FRT BUMPER CLIP <i>SCA</i>	0.00	0.00	*20.00 F
5	1		*FRT FOGLAMP RH	0.00	0.00	*140.00 F
6	1		*FRT FOGLAMP COVER RH <i>SCA</i>	0.00	0.00	*55.00 F
7	1		*FRT HEADLAMP RH <i>SCA</i>	0.00	0.00	*520.00 F
8	1		*REAR BUMPER <i>SCA</i>	0.00	0.00	*200.00 F
9	1		*REAR BUMPER RETAINER RH <i>EX</i>	0.00	0.00	*26.00 F
10	1		*REAR BUMPER SIDE ABSORBER RH	0.00	0.00	*34.00 F
11	1		*REAR BUMPER LWR CTR CHROME <i>CA</i>	0.00	0.00	*110.00 F
12	1		*REAR BUMPER LWR SIDE REFLECTOR RH <i>CA</i>	0.00	0.00	*15.00 F
13	10		*REAR BUMPER CLIP <i>SCA</i>	0.00	0.00	*20.00 F
14	1		*REAR BOOT LID <i>SCA</i>	0.00	0.00	*550.00 F
15	1		*REAR BOOT RS STICKER <i>SCA</i>	0.00	0.00	*18.00 F
16	1		*REAR BOOT MOBILIO STICKER <i>SCA</i>	0.00	0.00	*20.00 F
17	1		*REAR BOOT IVTEC STICKER <i>SCA</i>	0.00	0.00	*10.00 F
18	1		*REAR WINDSCREEN MOULDING <i>SCA</i>	0.00	0.00	*30.00 F
19	1		*REAR WINDSCREEN SEALANT <i>SCA</i>	0	0.00	*40.00 FS

F=Franchise part, S=SpcNett.

Sub Total (\$\$)	2,116.00
+ Margin on L,N Items 10.00% (\$\$)	207.60
Total Parts (\$\$)	2,323.60

Sng Ah Tee Motor & Panel Service Pte Ltd/SLH3198J/13/03/2023 13:46. Not valid without Reference section.
 Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

There are no new miscellaneous items selected.

Estimates on Labour

No	Particulars	Lab.Type	Amount
<u>Labour Items</u>			
1	TO PUTTY & SPRAY PAINTING ON AFFECTED AREAS	New	1,200.00
2	TO KNOCK FRT FENDER RH,RR FENDER RH,RR DOOR,WELD,REMOVE & FIX ON ABOVE PARTS	New	1,000.00
3	TO CHECK WIRING	New	30.00
4	TO REMOVE & REFIX REAR WINDSCREEN	New	120.00
5	TO DIAGNOSE & RESET FAULT CODE	New	180.00
Gross Labour Cost (\$)			2,530.00

Sng Ah Tee Motor & Panel Service Pte Ltd/SLH3198J/13/03/2023 13:46. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Panel
4p 90010068
6 days
43
17/03/23 P1430
EXCESS: 300
Revers
Resurvey after repair

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Singapore NRIC

Owner ID: 487Z

Vehicle Details

Vehicle No.: SLH3198J

Vehicle to be Exported: No

Intended Deregistration Date: 19 Mar 2023

Vehicle Make: HONDA

Vehicle Model: MOBILIO SV 1.5 CVT

Primary Colour: Grey

Manufacturing Year: 2016

Engine No.: L15Z12874028

Chassis No.: MRHDD4870GP000362

Maximum Power Output: 88.0 kW (118 bhp)

Open Market Value: \$18,980.00

Original Registration Date: 28 Oct 2016

First Registration Date: 28 Oct 2016

Transfer Count: 0

Actual ARF Paid: \$18,980.00

Intended PARF Rebate Details

PARF Eligibility: Yes

PARF Eligibility Expiry Date: 27 Oct 2026

PARF Rebate Amount: \$12,337.00

Intended COE Rebate Details

COE Expiry Date: 27 Oct 2026

COE Category: A - Car up to 1600cc & 97kW (130bhp)

COE Period(Years): 10

QP Paid: \$51,506.00

COE Rebate Amount: \$18,567.00

Total Rebate Amount: \$30,904.00