

(08/11/13) Web

ASS. REC. BY: [Signature]

REF:

CS/LIP 2300 3020/RVY3

2943

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SLN 17603at Workshop m/s CENTURY MOTORof 6, MARSHALL LNInsured: SMR 1396C LIP

Policy No. _____

Claims No. AVS23/0972


Sum Insured: _____

Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

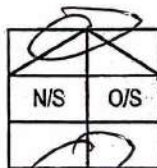Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: 68K

IDAC Accident Rpt: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lump Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____

Person Contacted: _____

Vehicle: IN / OUT

Veh No: SLN 17605 Yr Regn: 2017 / APRType: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: HONDA VEZEL 1.5X HYBRID c.c 1496Colour: WHITE A/C: Insured / Std / NI / NASp. Reading: 106038 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: RU31234484Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim orTyre Size: F: 215/60R16

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or NEXEN

Front

Rear

R/Bal. 6 mmR/Bal. 6 mmL/Bal. 6 mmL/Bal. 6 mmD.O.A. 20/03/23D.O.I. 23/03/23

Survey held at

CENTURY MOTORDes. of Damages: Frnt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

REPAIR LIP 11 42K

19/4/23 Lump Sum \$5200 confirmed by email (red 13,030.78, 71%)

Date/Time, File Pass to?

☐ : Prell. Report☐ : Final ReportDays Of Repair: 8Resurvey No. of Trip: 2

Survey Fee:

Transportation:

S + RS \$

Photos

Others

TOTAL

1)

Date/Time, File Return to?

2) 19/4/23-typist

Report Format: TP

Lump Sum H.B.t: (\$ 5200)

Add Fee: ☐ : Site Insp (\$☐ : Interview (\$☐ : Tech. Invs (\$☐ : Weekend (\$



Century Motors

Century Motors (Singapore) Pte Ltd
6 Marsiling Lane
Singapore 739145



E: claims@autoinsure.com.sg

T: (65) 3157 2626

GST No.: 192800002R

Page No.1

AUTOMOBILE ASSESSMENT REPORT

Our Ref: SLN1760S (CK)

Your ref: SMR1396C

Date: 21-Mar-23

BY EMAIL ONLY
(claims@autoinsure.com.sg)

ATTENTION: MOTOR CLAIMS DEPT

LIBERTY INSURANCE PTE LTD

51 CLUB STREET
#03-00 LIBERTY HOUSE
SINGAPORE : 069428

Assessed Vehicle No : SLN1760S
Car Make and Model : HONDA VEZEL 1.5X HYBRID AT ABS D/AIRBAG 2WD
Date of Accident : 20-Mar-23
Date of Assessment : 21-Mar-23

We have carried out a physical assessment of SLN1760S at our workshop Auto Insure Pte Ltd sustained damages to the FRONT & REAR portion of the vehicle.


4. DESCRIPTION OF DAMAGE

At the time of the inspection observed that this vehicle had sustained damages to the FRONT & REAR portion of the vehicle.

Please see attached schedule for details.

Remarks: NIL

Estimated Amount : L/S
Adjusted Amount : \$ 17,187.38
Est. Repair Days : 9

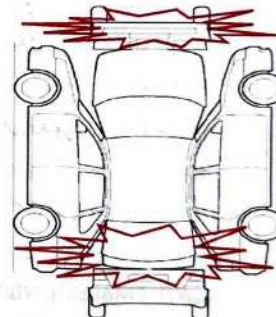

Pursuant to your instruction, we have **NOT AUTHORIZED** repair.
The assessment was conducted on a "**WITHOUT PREJUDICE**" basis.

If we are not notified of anything within 14 Days from the date hereof, this report shall be treated as correct.

Disclaimer

This report is intended for the exclusive use of the addressee solely in relation to the loss of occurrence in which the assessed vehicle is involved.

No liability or responsibility whatsoever shall be held by

Century Motors (Singapore) Pte Ltd For any reliance on this report by any third party.

Our Ref: SLN1760S

Your Ref: SMR1396C

S/NO	QTY	DESCRIPTIONS	ASSESSED CONDITION	EST. BY WORKSHOP
PARTS REPLACEMENT - LIST ITEMS				
1	1	TAILGATE LAMP LH X		\$ 948.90
2	1	TAILGATE LAMP RH X		\$ 948.90
3	1	TAIL LAMP RH X		\$ 850.90
4	1	TAIL LAMP LH X		\$ 850.90
5	1	REAR BUMPER de		\$ 735.90
6	1	REAR BUMPER CORNER LH X		\$ 265.90
7	1	REAR BUMPER CORNER RH repair		\$ 265.90
8	1	REAR BUMPER REFLECTOR LH X		\$ 89.50
9	1	REAR BUMPER REFLECTOR RH ca		\$ 89.50
10	1	REAR BUMPER INNER BRACKET LH X		\$ 68.80
11	1	REAR BUMPER INNER BRACKET RH		\$ 68.80
12	1	REAR BUMPER SIDE RETAINER RH X		\$ 65.90
13	1	REAR BUMPER SIDE RETAINER LH X		\$ 65.90
14	1	REAR END PANEL bt		\$ 637.50
15	1	REAR END PANEL INNER TRIM de		\$ 320.90
16	1	TAILGATE bt		\$ 1,980.80
17	1	TAILGATE HINGE LH X		\$ 85.80
18	1	TAILGATE HINGE RH X		\$ 85.80
19	1	TAILGATE WEATHERSTRIP an		\$ 185.80
20	1	TAILGATE LOCK Sub		\$ 135.50
21	1	TAILGATE LOCK STRIKER X		\$ 45.90
22	1	TAILGATE LOGO an		\$ 85.50
23	1	TAILGATE EMBLEM(VEZEL) an		\$ 55.50
24	1	TAILGATE EMBLEM(HYBRID) an		\$ 55.50
25	1	TAILGATE GARNISH X		\$ 325.90
26	1	TAILGATE INNER TRIM ?		\$ 145.90
27	1	TOOLS BOX ?		\$ 320.90
28	1	SPARE WHEEL COVER X		\$ 455.90
29	1	FRONT BUMPER de		\$ 1,265.90
30	1	FRONT BUMPER TOWING COVER cut		\$ 45.80
31	1	FRONT BUMPER REINFORCEMENT ?		\$ 665.90
32	1	FRONT BUMPER SKIRT ?		\$ 398.90
33	1	FRONT BUMPER LOWER GRILLE ?		\$ 165.90
34	1	FRONT GRILLE COVER X		\$ 375.90
35	1	FRONT GRILLE ca		\$ 855.90
36	1	FRONT GRILLE LOGO an		\$ 75.50
37	1	FRONT SUPPORT PANEL X		\$ 825.90
38	1	REAR WINDSCREEN MOULDING an		\$ 240.90
SUB TOTAL			\$	15,155.30
LESS 20%			\$	3,031.06
TOTAL AMOUNT			\$	12,124.24

Our Ref: **SLN1760S**

Your Ref: **SMR1396C**

S/NO	QTY	SPECIAL NETT ITEMS	ASSESSED CONDITION	EST. BY WORKSHOP
1	1	WINDSCREEN SEALANT		\$ 60.00
2	1	REVERSE SENSORS L & R		\$ 250.00
3	1	REAR BUMPER CLIPS		\$ 50.00
4	1	FRONT NUMBER PLATE WITH HOLDER		\$ 35.00
5	1	REAR NUMBER PLATE WITH HOLDER		\$ 35.00
SUB TOTAL				\$ 430.00
TOTAL PARTS COST				\$ 12,554.24

40
200
30
X

Our Ref: **SLN1760S**

Your Ref: **SMR1396C**

S/NO	DESCRIPTION	EST. BY WORKSHOP
LABOUR & PAINTWORK		
1	TO REMOVE THE AFFECTED PARTS & FITTINGS TO COMMENCE REPAIRS; PANEL BEAT & RESHAPE THE AFFECTED AREAS AND REPLACED THE DAMAGED PARTS AND COMPONENTS	\$ 1,600.00
2	TO REMOVE & REFIT WIRING SYSTEM AT ACCIDENT AND CHECK FOR PROPER FUNCTIONS	\$ 100.00
3	TO RESPRAY AND SUPPLY EXPANDABLE ITEMS & PUFFY ON PARTS REPLACED	\$ 1,200.00
4	TO PERFORM ANTI-RUST TREATMENT ON AFFECTED AREAS	\$ 100.00
5	TO REMOVE & REFIT TAILGATE MECHANISM	\$ 100.00
6	TO REMOVE & REFIT WINDSCREEN	\$ 100.00
7	SUNDRIES (SAND PAPER, WELDING WIRE ETC.)	\$ 50.00
8	TO VACUUM, WAXING & CLEAN	\$ 50.00
9	TO PERFORM WATER SEEPAGE TEST ON REPAIRED PORTIONS	\$ 60.00
TOTAL BEFORE GST		\$ 15,914.24
GST 8%		\$ 1,273.14
TOTAL (PARTS & LABOUR):		\$ 17,187.38

900
40
900
60
60
20
X
30

Adjustments / Recommendations

Our estimator have thoroughly inspected each and every item on the estimate against physical damage found on the vehicle and have listed the breakdown of our finding and recommendation.

Our Workshop has agreed to undertake the job at a sum of \$ 17,187.38 for lump sum with the third party insurance.

Yours Faithfully,

Ck Loh
Claims Estimator

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Rashid
Hp 90010068
8 days
L/S
23/03/23 @ 1230
Repay after repair

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Singapore NRIC

Owner ID:

294J

Vehicle Details

Vehicle No.:

SLN1760S

Vehicle to be Exported:

No

Intended Deregistration Date:

21 Mar 2023

Vehicle Make:

HONDA

Vehicle Model:

VEZEL 1.5X HYBRID AT ABS D/AIRBAG 2WD

Primary Colour:

White

Manufacturing Year:

2016

Engine No.:

LEB5934498

Chassis No.:

RU31234484

Maximum Power Output:

112.0 kW (150 bhp)

Open Market Value:

\$25,717.00

Original Registration Date:

25 Apr 2017

First Registration Date:

25 Apr 2017

Transfer Count:

0

Actual ARF Paid:

\$5,000.00

Intended PARF Rebate Details

PARF Eligibility:

Yes

PARF Eligibility Expiry Date:

24 Apr 2027

PARF Rebate Amount:

\$3,500.00

Intended COE Rebate Details

COE Expiry Date:

24 Apr 2027

COE Category:

B - Car above 1600cc or 97kW (130bhp)

COE Period(Years):

10

QP Paid:

\$54,405.00

COE Rebate Amount:

\$22,260.00

Total Rebate Amount:

\$25,760.00

The information contained herein is correct as at 21 Mar 2023

OK

Honda Vezel Hybrid 1.5A X

[Overview](#)[Insurance](#)[Financial](#)[Accessories](#)[Similar](#)[Research](#)[Photos](#)

**PRECISE AUTO
TRADING**

BUY·SELL·RENT·CONSIGNMENT·FINANCING·INSURANCE·COE·RENEWAL·EXPORT·SCRAP

Price **\$73,800**

Depreciation  \$16,400 /yr
[View models with similar depre](#)

Reg Date 31-Jul-2017
(4yrs 4mths 4days COE left)

Mileage 60,000 km (10.6k /yr)

Manufactured  2017

Road Tax  \$682 /yr

Transmission Auto

Dereg Value  \$25,131 as of today (change)

Fuel Type Petrol-Electric

COE  \$49,899

OMV  \$24,969

Engine Cap 1,496 cc

ARF  \$5,000

Curb Weight  1,280 kg

Power 112.0 kW (150 bhp)