

TONG LUCK AUTO PTE LTD

160 SIN MING DRIVE #07-01/06 SIN MING AUTOCITY, SINGAPORE 575722

Tel: 6250 0088 Fax: 6250 5545

Email: operation@tlauto.com.sg

GST No: 201700521W UEN No: 201700521W

PAGE: 1

M/S : ALLIANZ INSURANCE SINGAPORE PTE TLD
79, ROBINSON ROAD #09-01
SINGAPORE 068897

ATTN : MOTOR CLAIMS DEPT
TEL : FAX :


YOUR REF NO :
CLAIM TYPE : OWN DAMAGE
ACCIDENT DATE : 24/03/2023

ESTIMATE

NO : QUOT202304-000003(00)
DATE : 04/04/2023
POLICY NO : SP2003907937
VEH REG NO : SMS7156J
MAKE/MODEL : MERCEDES BENZ GLA180
PROGRESSIVE
CHASSIS NO : W1N2477842J376497
ENGINE NO : 28291480792942
REG. DATE : 2022

Estimate Repair Cost to Vehicle No : SMS7156J

Description	Quantity	Unit Price	Amount
		<u>S\$</u>	<u>S\$</u>
PARTS			
1 Rear windscreen	1	650.00	650.00
2 Tailgate	1	1,350.00	1,350.00
3 Tailgate centre logo	1	42.00	42.00
4 Tailgate "GLA180" emblem	1	68.00	68.00
5 Tailgate weatherstrip	1	210.00	210.00
6 Tailgate absorber - RH / LH	2	420.00	840.00
7 Tailgate stopper - LH	1	16.00	16.00
8 Tailgate speaker trimboard	1	198.00	198.00
9 Tailgate wiper arm	1	78.00	78.00
10 Tailgate wiper blade	1	32.00	32.00
11 Tailgate inner trimboard	1	128.00	128.00
12 Tailgate inner trimboard clips	12	6.50	78.00
13 Tailgate handle trimboard	1	85.00	85.00
14 Tailgate handle trimboard clips	8	6.50	52.00
15 Tailgate outer trim - LH	1	112.00	112.00
16 Tailgate reflector - LH	1	268.00	268.00
17 Rear end panel	1	750.00	750.00
18 Rear end panel top garnish	1	78.00	78.00
19 Rear end panel top garnish clips	8	6.50	52.00
20 Rear floorboard panel	1	680.00	680.00
21 Rear floorboard top cover	1	225.00	225.00
22 Rear fender - LH	1	1,680.00	1,680.00
23 Rear fender inner trim - LH	1	360.00	360.00
24 Rear fender inner shield - LH	1	115.00	115.00
25 Rear fender inner shield clips - LH	20	5.50	110.00
26 Rear fender air duct - LH	1	56.00	56.00
27 Rear fender sub panel - LH	1	580.00	580.00
28 Rear petrol flap	1	118.00	118.00
29 Rear petrol cover	1	95.00	95.00
30 Rear petrol cover push button	1	50.00	50.00
31 Rear wheel arch garnish - LH	1	110.00	110.00
32 Taillamp assy - LH	1	480.00	480.00
33 Taillamp panel - LH	1	178.00	178.00

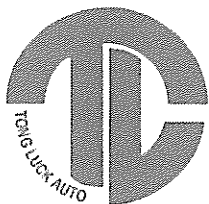

TONG LUCK AUTO PTE LTD

160 SIN MING DRIVE #07-01/06 SIN MING AUTOCITY, SINGAPORE 575722

Tel: 6250 0088 Fax: 6250 5545

Email: operation@tlauto.com.sg

GST No: 201700521W UEN No: 201700521W

PAGE: 2

M/S : ALLIANZ INSURANCE SINGAPORE PTE TLD

79, ROBINSON ROAD #09-01
SINGAPORE 068897

ATTN : MOTOR CLAIMS DEPT

TEL : FAX :

YOUR REF NO :

CLAIM TYPE : OWN DAMAGE

ACCIDENT DATE : 24/03/2023

ESTIMATE

NO : QUOT202304-000003(00)

DATE : 04/04/2023

POLICY NO : SP2003907937

VEH REG NO : SMS7156J

MAKE/MODEL : MERCEDES BENZ GLA180
PROGRESSIVE

CHASSIS NO : W1N2477842J376497

ENGINE NO : 28291480792942

REG. DATE : 2022

Estimate Repair Cost to Vehicle No : SMS7156J

Description	Quantity	Unit Price	Amount
		S\$	S\$
34 Taillamp lower bracket - LH	1	38.00	38.00
35 Rear bumper - upper	1	780.00	780.00
36 Rear bumper - lower	1	260.00	260.00
37 Rear bumper reinforcement	1	350.00	350.00
38 Rear bumper top chrome	1	228.00	228.00
39 Rear bumper inner frame	1	95.00	95.00
40 Rear bumper lower chrome	1	112.00	112.00
41 Rear bumper side retainer - LH	1	65.00	65.00
42 Rear bumper lower bracket - centre	1	68.00	68.00
43 Rear bumper lower bracket - RH / LH	1	24.00	24.00
44 Rear bumper switch module	1	155.00	155.00
45 Rear bumper switch module wire	1	135.00	135.00
46 Rear bumper reverse sensor	6	135.00	810.00
47 Rear bumper reverse sensor seals	6	8.00	48.00
48 Rear bumper sensor cable	1	108.00	108.00
49 Rear bumper clips	15	6.50	97.50
50 Rear exhaust end chrome - LH	1	78.00	78.00
51 Rear exhaust end chrome bracket - LH	1	48.00	48.00
52 Rear exhaust heating seal	1	168.00	168.00
53 Rear shock absorber - LH	1	265.00	265.00
54 Rear lower arm - LH	1	82.00	82.00
55 Rear lower arm cover (top) - LH	1	28.00	28.00
56 Rear lower arm cover (bottom) - LH	1	28.00	28.00
57 Rear training arm - LH	1	156.00	156.00
58 Rear spring link - LH	1	165.00	165.00
59 Rear spring link lower cover - LH	1	12.00	12.00
60 Rear under cover - LH	1	78.00	78.00
61 Rear sport rim - LH	1	680.00	680.00
62 Steering air bag	1	1,480.00	1,480.00
63 knee air bag	1	780.00	780.00
64 Air bag control unit	1	480.00	480.00
65 Front safety belt - RH / LH	2	420.00	840.00
66 Front safety belt catch - RH / LH	2	160.00	320.00
67 Rear safety belt - RH / LH	2	298.00	596.00



TONG LUCK AUTO PTE LTD

160 SIN MING DRIVE #07-01/06 SIN MING AUTOCITY, SINGAPORE 575722

Tel: 6250 0088 Fax: 6250 5545

Email: operation@tlauto.com.sg

GST No: 201700521W UEN No: 201700521W

PAGE: 3

M/S : ALLIANZ INSURANCE SINGAPORE PTE TLD

79, ROBINSON ROAD #09-01
SINGAPORE 068897

ATTN : MOTOR CLAIMS DEPT

TEL : FAX :

YOUR REF NO :

CLAIM TYPE : OWN DAMAGE

ACCIDENT DATE : 24/03/2023

ESTIMATE

NO : QUOT202304-000003(00)

DATE : 04/04/2023

POLICY NO : SP2003907937

VEH REG NO : SMS7156J

MAKE/MODEL : MERCEDES BENZ GLA180
PROGRESSIVE

CHASSIS NO : W1N2477842J376497

ENGINE NO : 28291480792942

REG. DATE : 2022

Estimate Repair Cost to Vehicle No : SMS7156J

Description	Quantity	Unit Price	Amount
		S\$	S\$
68 Rear safety belt - centre	1	255.00	255.00
69 Rear safety belt catch - RH / LH	2	145.00	290.00
70 Front windscreen moulding - RH	1	85.00	85.00
71 Front windscreen moulding clips - RH	6	12.00	72.00
72 Bonnet	1	980.00	980.00
73 Bonnet hinges - RH / LH	2	68.00	136.00
74 Bonnet absorber - RH / LH	2	75.00	150.00
75 Bonnet spring - RH	1	28.00	28.00
76 Bonnet lock - upper	1	92.00	92.00
77 Bonnet lock - lower	1	105.00	105.00
78 Bonnet catch	1	55.00	55.00
79 Bonnet cable	1	52.00	52.00
80 Support panel	1	480.00	480.00
81 Support panel top garnish	1	88.00	88.00
82 Headlamp assy - RH	1	1,850.00	1,850.00
83 Headlamp control unit - RH	1	450.00	450.00
84 Front grille	1	450.00	450.00
85 Front grille beam	1	198.00	198.00
86 Front grille beam moulding - RH / LH	1	58.00	58.00
87 Front grille centre logo	1	95.00	95.00
88 Front grille logo base	1	320.00	320.00
89 Front grille inner support - top	1	178.00	178.00
90 Front grille inner support garnish - top	1	86.00	86.00
91 Front grille inner support - lower	1	165.00	165.00
92 Front grille inner support cover - lower	1	68.00	68.00
93 Front fender - RH	1	520.00	520.00
94 Front fender inner shield (front) - RH	1	128.00	128.00
95 Front fender inner shield clips - RH	20	5.50	110.00
96 Front fender rail - RH	1	24.00	24.00
97 Front fender wheel arch garnish - RH	1	125.00	125.00
98 Front bumper	1	780.00	780.00
99 Front bumper reinforcement	1	350.00	350.00
100 Front bumper reinforcement bracket - RH	1	125.00	125.00
101 Front bumper lower member - centre	1	310.00	310.00



TONG LUCK AUTO PTE LTD

160 SIN MING DRIVE #07-01/06 SIN MING AUTOCITY, SINGAPORE 575722

Tel: 6250 0088 Fax: 6250 5545

Email: operation@tlauto.com.sg

GST No: 201700521W UEN No: 201700521W

PAGE: 4

M/S : ALLIANZ INSURANCE SINGAPORE PTE TLD

79, ROBINSON ROAD #09-01
SINGAPORE 068897

ATTN : MOTOR CLAIMS DEPT

TEL : FAX :

YOUR REF NO :

CLAIM TYPE : OWN DAMAGE

ACCIDENT DATE : 24/03/2023

ESTIMATE

NO : QUOT202304-000003(00)

DATE : 04/04/2023

POLICY NO : SP2003907937

VEH REG NO : SMS7156J

MAKE/MODEL : MERCEDES BENZ GLA180
PROGRESSIVE

CHASSIS NO : W1N2477842J376497

ENGINE NO : 28291480792942

REG. DATE : 2022

Estimate Repair Cost to Vehicle No : SMS7156J

Description	Quantity	Unit Price	Amount
		S\$	S\$
102 Front bumper lower member - RH	1	60.00	60.00
103 Front bumper sponge	1	118.00	118.00
104 Front bumper side retainer - RH / LH	2	12.00	24.00
105 Front bumper centre garnish	1	88.00	88.00
106 Front bumper fog lamp cover - RH	1	112.00	112.00
107 Front bumper centre grille	1	90.00	90.00
108 Front bumper lower chrome	1	228.00	228.00
109 Front bumper radar sensor	1	780.00	780.00
110 Front bumper towing cover	1	38.00	38.00
111 Front bumper sensor	3	138.00	414.00
112 Front bumper sensor seals	6	8.00	48.00
113 Front bumper sensor cable	1	152.00	152.00
114 Front bumper lower side garnish - RH	1	68.00	68.00
115 Front bumper under cover	1	175.00	175.00
116 Front bumper under cover - RH	1	36.00	36.00
117 Front bumper clips	15	6.50	97.50
118 Front number plate garnish	1	92.00	92.00
119 Air-con condenser	1	750.00	750.00
120 Radiator assy	1	850.00	850.00
121 Radiator top cover	1	75.00	75.00
122 Radiator lower cover	1	45.00	45.00
			33,180.00
		Add 10%	3,318.00
			36,498.00
SPECIAL NET			
123 Rear windscreen sealant	1	60.00	60.00
124 Tailgate " C&C" emblem	1	38.00	38.00
125 Rear tyre - LH	1	480.00	480.00
126 Rear number plate	1	40.00	40.00
127 Front number plate	1	40.00	40.00
128 Radiator coolant (tin)	2	60.00	120.00
			778.00
LABOUR			
129 To remove and refit rear windscreen	1	150.00	150.00



TONG LUCK AUTO PTE LTD

160 SIN MING DRIVE #07-01/06 SIN MING AUTOCITY, SINGAPORE 575722

Tel: 6250 0088 Fax: 6250 5545

Email: operation@tlauto.com.sg

GST No: 201700521W UEN No: 201700521W

PAGE: 5

M/S : ALLIANZ INSURANCE SINGAPORE PTE TLD

79, ROBINSON ROAD #09-01
SINGAPORE 068897

ATTN : MOTOR CLAIMS DEPT

TEL : FAX :

YOUR REF NO :

CLAIM TYPE : OWN DAMAGE

ACCIDENT DATE : 24/03/2023

ESTIMATE

NO : QUOT202304-000003(00)

DATE : 04/04/2023

POLICY NO : SP2003907937

VEH REG NO : SMS7156J

MAKE/MODEL : MERCEDES BENZ GLA180
PROGRESSIVE

CHASSIS NO : W1N2477842J376497

ENGINE NO : 28291480792942

REG. DATE : 2022

Estimate Repair Cost to Vehicle No : SMS7156J

Description	Quantity	Unit Price	Amount
		S\$	S\$
130 To remove and refit rear cushion seats, interior garnish and trimboard to facilitates the repairs	1	480.00	480.00
131 To transfer damaged tailgate interior mechanism to new tailgate	1	180.00	180.00
132 To remove and refit petrol tank to facilitates the repairs	1	280.00	280.00
133 To remove and refit air- con condenser, radiator and refill air-con gas	1	150.00	150.00
134 To remove and refit steering air bag, knee air bag, front & rear safety belt and air bag control unit	1	880.00	880.00
135 To remove and refit centre console box to enable to remove air bag control unit	1	180.00	180.00
136 To remove and refit rear bumper sensor	1	200.00	200.00
137 To check and rectify wiring system	1	120.00	120.00
138 To panel beat and straighten rear chassis frame, LH rear fender inner panel, RH front fender inner panel, RH front chassis frame, to cut and weld rear end panel, rear floorboard panel, LH rear fender, including replacement of parts and align where necessary, to refit and adjust the same	1	2,800.00	2,800.00
139 To putty and spray paint on affected areas	1	2,800.00	2,800.00
140 To reset and reprogram headlamp module and air bag control unit	1	680.00	680.00
			8,900.00
		TOTAL	S\$ 46,176.00
		ADD GST @ 8%	3,694.08
		GRAND TOTAL	S\$ 49,870.08

SINGAPORE DOLLAR FORTY-NINE THOUSAND EIGHT HUNDRED SEVENTY AND CENTS EIGHT ONLY

FOR TONG LUCK AUTO PTE LTD

AUTHORISED SIGNATURE

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	27/03/2023 15:31 (SGT)
Reported by	Actual Driver
Date of Accident	24/03/2023 17:15 (SGT)
Exact Location of Accident	PIE, Singapore
Additional Location Information	-
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SMS7156J
-----------------------------	----------

INSURED/POLICYHOLDER

Is company?	Yes
Name Of Registered Owner	MERCEDES-BENZ FLEET MANAGEMENT SINGAPORE PTE LTD
Company Reg No	1XXXXX778Z
Email Address	too_tong.tan@mercedes-benz.com
Mobile Phone No	(Phone) +65-97302314
Alternative Phone No	(Office) +65-82821711

VEHICLE PARTICULARS

Manufacturer	Mercedes
Model	Gla180
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private car
Transmission	Auto
CC	1332

INSURANCE COMPANY

Name of Insurance Company	Allianz Insurance Singapore Pte. Ltd.
Policy Number / Cover Note Number	SP2003907937

DRIVER

Name of Driver	MOHAMMED HARON BIN SAMAT
NRIC No	SXXXX204J
Date Of Birth	09/06/1957

Occupation	Indoor
Date Of Driving Pass	27/11/1981
Driving experience	41 YEARS AND 4 MONTHS
Gender	Male
Mobile Number	(Phone) +65-97302314
Alt. Phone Number	-
Email Address	too_tong.tan@mercedes-benz.com
Address	365 YISHUN RING ROAD #09-1548
Address complement	-
Postcode	760365
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	Hirer
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Chain Collision
Weather Conditions	Raining
Road Surface	Wet

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	Yes
Number of vehicles involved in the accident	4
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No
Translator's name	-
Translator's ID	-
Translator's phone number	-
Translator's email	-
Original language used in the statement	-

FOREIGN VEHICLE 1

Vehicle Registration Number	JUT2250
Vehicle Category	Commercial vehicle

FOREIGN VEHICLE 2

Vehicle Registration Number	JVQ1549
Vehicle Category	Motorcycle

DETAILS OF POLICE ACTION

Was the accident reported to the police?	Yes
Police Station Name	Toa Payoh Neighbourhood Police Centre
Police Station Phone No	(Phone) +65-18002519999
Alt. Police Station Phone No	(Fax) +65-63548749
Police Station Address	93 Toa Payoh Central Toa Payoh Community Building #01-02 Singapore 319194
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

REFER TO POLICE REPORT

ATTACHMENT(S)

Are accident photos available for attachment?
Was there any video captured by Car Camera?

Yes
No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	JUT2250
Vehicle Manufacturer	Nissan
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Commercial vehicle
Name of Driver	HOO CHUN CHAI
Contact Number	(Phone) +60-167253518
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	1

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number	SH9839X
Vehicle Manufacturer	Hyundai
Vehicle Model	Ae ioniq
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Taxi
Name of Driver	SAMUEL CHUA YEOW HUA
NRIC No	SXXXX949C
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	3

DETAILS OF OTHER VEHICLE PROPERTY 3

Vehicle Registration Number	JVQ1549
Vehicle Manufacturer	Honda
Vehicle Model	RSX
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Motorcycle
Name of Driver	-
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	1

SKETCH PLAN**IMPORTANT NOTICE**

1. Please correctly report the details of the accident to speed up the claims process.
2. This Form must be **completed by the Policyholder and/or the Authorized Driver.**
3. Information provided must be as **truthful and accurate as possible.** Any willful misrepresentation or withholding of material facts may allow insurance companies to **repudiate policy liability.**
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the center and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**
I understand, acknowledge, agree and consent that:
 - (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims.
 - (ii) investigating the accident and/or my claims.
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me.
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
 - (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
 - (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third-party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

 Policyholder's Signature / Date &
Time

Sketch Plan

 Driver's Signature (If driver is not the policyholder) / Date
& Time

1900HRS 25 MARCH 2023

**FLASH ACCIDENT
REPORTING OFFICER**

FRO BALAJI


 Witnessed by Reporting Centre
Personnel

 A. SMS7156J
B. JUT2250
C. SH9839X
D. JVQ1549

 PIE TOWARDS
TUAS


Describe Circumstances of the Accident

REFER TO POLICE REPORT.

Declaration

We declare the foregoing particulars are true in every respect.

Policyholder's Signature / Date &
Time

Driver's Signature (If driver is not the policyholder) / Date
& Time

1900HRS 25 MARCH 2023

FLASH ACCIDENT
REPORTING OFFICER

FRC BALAJI



Witnessed by Reporting Centre
Personnel



**SINGAPORE
POLICE FORCE**



T/20230324/2115

1 of 3

Report No. T/20230324/2115

Police Station Of Origin:
Toa Payoh N.P.C
93 Toa Payoh Central #01-02 Toa Payoh
Community Building SINGAPORE 319194
Tel No: 1800-2519999

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 24/03/2023 21:27	Vide Report No.: E/20230324/0113	Station Diary No.: 117
--	-------------------------------------	---------------------------

Informant's Particulars

Name of Informant: MOHAMMED HARON BIN SAMAT	Address: APT BLK 365 YISHUN RING ROAD #09-1548 SINGAPORE 760365
ID Type / ID No.: NRIC NO / S1242204J	Contact No.: Home/Office: Mobile: 97302314
Nationality: SINGAPORE CITIZEN	Email:
Sex: Male Age: 65 Date of Birth: 11/06/1957	Type of Informant: Driver
Race: Malay	Language: English
Occupation: ENGINEERING SUPERVISOR	Driving Licence Information: Class: 2B,2A,2,3 Date of Expiry:

General Information of the Accident

General Information of the Accident				
Type of Accident:	Non-Injury Attended by Police	Drink Drive: No	Date/Time of Accident: 24/03/2023 17:15	Type of Location: Straight Road
Location: PAN-ISLAND EXPRESSWAY				
Weather: Drizzling		Road Surface: Wet		
Traffic Flow: Dual Carriage Way		Traffic Control: Not Controlled		Traffic Volume: Heavy
Type of Collision: Between Moving Vehicles - Head To Rear				Anyone conveyed by ambulance: Yes

Details of Vehicle Involved

Vehicle No.	Type	Make	Model	Color	Condition	No of Passenger
JUT2250	Pick-up truck				Slightly Damaged	0
JVQ1549	Motorcycle				Slightly Damaged	0
SH9839X	Taxi				Slightly Damaged	2
SMS7156J	Car	MERCEDES BENZ		Black	Slightly Damaged	0



**SINGAPORE
POLICE FORCE**



T/20230324/2115

Police Station Of Origin:

Toa Payoh N.P.C

93 Toa Payoh Central #01-02 Toa Payoh

Community Building SINGAPORE 319194

Tel No: 1800-2519999

CONTINUATION OF REPORT

2 of 3

Report No. T/20230324/2115

Details of Person Involved			
Any Pedestrian Involved: No			
No. of Pedestrians Injured: NIL		Use of Pedestrian Crossing: NA	
Driver			
Name	Hoo Chun Chai	ID No.	NIL
Related Vehicle	JUT2250 (Pick-up truck)	Contact No.	+60167253518
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL
Driver			
Name	MOHAMMED HARON BIN SAMAT	ID No.	S1242204J
Related Vehicle	SMS7156J (Car)	Contact No.	97302314
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: 2B,2A,2,3 Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL

Brief Details.

On 23/03/2023 at about 1718hrs, I was travelling in my vehicle, SMS7156J along PIE towards Tuas before exit 17. I was travelling on the first lane. While I was applying the brake, one Malaysian pick-up truck, JUT2250 hit onto the rear portion of my vehicle. The impact caused my car to hit onto the front taxi, SH9839X. I also noticed that after the impact, the Malaysian pick-up truck swerved out of the lane and hit onto one Malaysian motorcycle, JVQ1549.

Ambulance and traffic police came to scene. I wish to inform that as of now I do not have any injury. The traffic police took the SD card for my in-car camera. The tow truck came and my vehicle was towed away.

**SINGAPORE
POLICE FORCE**

T/20230324/2115

3 of 3

Report No. T/20230324/2115

Police Station Of Origin:

Toa Payoh N.P.C

93 Toa Payoh Central #01-02 Toa Payoh

Community Building SINGAPORE 319194

Tel No: 1800-2519999

CONTINUATION OF REPORT

Signature of Officer Recording The Report:

E /

SR STAFF SGT MUHAMMAD

AFIQ BIN SAIFUL BAHRY

Signature Of Interpreter:

Not applicable

Signature Of Informant:

Date/Time:

24/03/2023 21:27

Officer In Charge Of Case:

TP / GIT /

SGT 3 MUHAMMAD ISMAIL BIN AMZAH

Contact No.: 65476185

Classification Of Case:

NP168

**SINGAPORE
POLICE FORCE**

T/20230324/2115

3 of 3

Report No. T/20230324/2115

Police Station Of Origin:

Toa Payoh N.P.C

93 Toa Payoh Central #01-02 Toa Payoh

Community Building SINGAPORE 319194

Tel No: 1800-2519999

CONTINUATION OF REPORT

Signature of Officer Recording The Report:

E /

SR STAFF SGT MUHAMMAD
AFIQ BIN SAIFUL BAHRYSignature Of Interpreter:
Not applicable

Officer In Charge Of Case:

TP / GIT /

SGT 3 MUHAMMAD ISMAIL BIN AMZAH

Contact No.: 65476185

Signature Of Informant:

Date/Time:
24/03/2023 21:27

Classification Of Case:

NP168

Allianz Insurance Singapore Pte. Ltd.

CERTIFICATE OF INSURANCE

ROAD TRANSPORT ACT 1987 (MALAYSIA)
MOTOR VEHICLES (THIRD-PARTY RISKS) RULES 1959 (FEDERATION OF MALAYSIA)
MOTOR VEHICLES (THIRD-PARTY RISKS AND COMPENSATION) ACT (CAP. 189 OF THE REVISED EDITION) (REPUBLIC OF SINGAPORE)
MOTOR VEHICLES (THIRD-PARTY RISKS AND COMPENSATION) RULES 1996 (REPUBLIC OF SINGAPORE)
MOTOR VEHICLES (THIRD-PARTY RISKS AND COMPENSATION) RULES, 1960
OR ANY AMENDMENT, ACT OR ACTS PASSED IN SUBSTITUTION THEREOF

Certificate Number : SP2003907937
Date of Issue : 27 December 2022
Coverage : COMPREHENSIVE - AUTHORISED WORKSHOP
Policyholder : MERCEDES-BENZ FLEET MANAGEMENT SINGAPORE PTE. LTD.
Finance Company : -
Period of Insurance : 01 January 2023 To 31 December 2023 (both dates inclusive)
Registration Number : SMS7156J
Chassis Number of Vehicle : W1N2477842J376497

Persons or Classes of Persons Entitled to Drive*:

- (a) The Policyholder.
- (b) Any other person who is driving on the Policyholder's order or with his/her permission or to whom the vehicle is hired.

* Provided that the person driving is permitted in accordance with the licensing or other laws or regulation to drive the Motor Vehicle or has been permitted and is not disqualified by order of Court of Law or by reason of any enactment or regulations in that behalf from driving the Motor Vehicle. And provided further that the Motor Vehicle is registered under the Road Traffic Act (Cap 276) (Republic of Singapore) and such registration has not been cancelled at the time of accident loss or damage.

Limitation as to Use^:

- (a) Use for carriage of passengers or goods in connection with the Policyholder's business.
- (b) Use for social, domestic and pleasure purposes and business purposes of any person to whom the vehicle is hired.

^ Limitation rendered inoperative by Section 8 of Motor Vehicles (Third-Party Risks and Compensation) Act (Chapter 189) and Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.


Policy does not cover:

- (a) Use for racing, pace-making, reliability trials or speed-testing.
- (b) Use whilst drawing a trailer except the towing (other than for reward) of any one disabled mechanically propelled vehicle.
- (c) Use for the carriage of passengers for hire or reward by any person to whom the vehicle is hired.

I/We hereby certify that the Policy to which this Certificate relates is issued in accordance with the provisions of the Motor Vehicles (Third Party Risks and Compensation) Act (Chapter 189) and Part IV of the Road Transport Act, 1987 (Malaysia).

27 December 2022

Issue Date

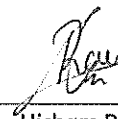

Hicham Raissi
Chief Executive Officer

Allianz Insurance Singapore Pte. Ltd.

Intermediary Code : 0000256 MARSH (SINGAPORE) PTE. LTD.

Excess	: Section 1: Own Damage	S\$	700.00
	: Section 1: Windscreen	S\$	100.00
	: Section 2: Liabilities to Third Parties	S\$	0.00

