

(08/11/13) wsf

ASS. REC. BY: John

REF: CS/CS23004367/Rqy3

9806

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SLW 72269

at Workshop m/s MOTOR MAHE

of LENN KERR

Insured: ECICS

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: _____


(Client's Record)

Make of Veh: _____

(Policy Condition)

11am

Remark: The veh had commenced its repair at the time of inspection.

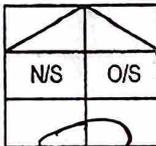

Bal. or Market Value: 83K

IDAC Accident Rpt: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: days Res.: Yes or No

Lum Sum: % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SLW72269 Yr Regn: 2018 / FEB

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: SUBARU FORESTER 2002-L 9/16 c.c 1995

Colour: GRN A/C: Insured / Std / NI / NA

Sp. Reading: 111577 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: JF18J5KCS34103875

Gen. Cond: Good (Fair) / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: Nil (S/Rim) / STD A/Rim or

Tyre Size: F: 225/60R17

R: 17

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or WESTLAKES

Front Rear

R/Bal. 6 mm R/Bal. 6 mm

L/Bal. 6 mm L/Bal. 6 mm

D.O.A. 25/04/23 D.O.I. 03/05/23

Survey held at MOTOR MAHE

Des. of Damages: Frt Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction
REPAIR LIMIT - SSK

Date/Time, File Pass to?

: Preli. Report

Days Of Repair: _____

1)

: Final Report

Resurvey No. of Trip: _____

Date/Time, File Return to?

2)

Add Fee: : Site Insp (\$

: Interview (\$

: Tech. Invs (\$

: Weekend (\$

Survey Fee:

Transportation:

) S + RS SI

) Photos

) Others

Report Format : _____

Lump Sum / I.B.I: (\$ _____)

ESTIMATE : ACCIDENT/BODY REPAIRS
WORKSHOP : LENG KEE
CONTACT NO :
REFERENCE : INS/IC/CHI/0115/2023
DATE : 27-APR-2023

ECICS LIMITED
10 EUNOS ROAD 8
#09-04A SINGAPORE POST CENTER
S(408600)
TEL : 6337 4779
FAX : 6338 9267

OWNER'S NAME : TAN WEE SIANG (CHEN WEIXIANG)
ADDRESS : 38 DAISY AVENUE

TELEPHONE NO : 98892628
S(359514)

TYPE OF CLAIM : THIRD PARTY CLAIM
POLICY NO : 1800020544-05 AIG
VEHICLE NO : SLW7226G
MODEL CODE : SJ5EK7C
MODEL/YEAR : FORESTER 2.0I-L AWD CVT
ENGINE NO : FB20YC41158
CHASSIS NO : JF1SJ5KC5JG103875
MILEAGE : 1 KM
DATE IN : 27/04/2023
LIABILITY : 0.00
EXCESS CLAUSE : 0.00
ESTIMATE BY : DENNIS LEONG JIA HUI
ACCIDENT DATE : 27/04/2023

Print Date : 27/04/2023
Print Time : 10:34:50

DAMAGED PARTS & PRICES

S/NO	PARTS DESCRIPTION	PARTS NUMBER	NETT	LIST	S/NETT	S/LIST
1	EXH PIPE ASSY R <i>OK</i>	44200SG080			765.90	
2	MUFFLER ASSY RH NA <i>OK</i>	44300SG010			617.90	
3	FLOOR PAN R R CP <i>X</i>	52129SG0019P			444.00	
4	SKIRT COMPL REAR END PANEL <i>?</i>	52401SG0109P			296.00	
5	BUMPER FACE REAR FORESTER IL <i>del</i>	57704SG012			610.50	
6	BRKT SD R RH <i>OK</i>	57707SG080			14.80	
7	BRKT SD R LH <i>OK</i>	57707SG090			14.80	
8	BEAM COMPL R EU <i>?</i>	57711SG0219P			296.00	
9	COVER HOOK R <i>X</i>	57731SG010NN			13.00	
10	PANEL CPL R/G NA <i>repair</i>	60809SG0109P			1102.60	
11	GLASS R/G <i>X</i>	63019SG000			821.40	
12	RUBBER DAM GLS <i>X</i>	63232SG000			7.40	
13	RUBBER R/G <i>X</i>	63232SG010			13.00	
14	CLIP Bmpr *9PCS <i>OK</i>	909140007			21.60	
15	CLIP *2PCS <i>OK</i>	909140062			6.00	
16	LETTER MARK FORETOR R <i>OK</i>	93079SG000			40.70	
17	LETTER MK R SUB <i>OK</i>	93079SG030			66.60	
SUB TOTAL			0.00	0.00	5152.20	0
LESS DISCOUNT ()			0.00	0.00	0.00	0
GRAND TOTAL			0.00	0.00	5152.20	0
OVERALL TOTAL			5152.20			

LEGEND: REMARKS(OK) = APPROVED, REMARKS(X) = NOT APPROVED

NO	JOB CODE	NATURE OF JOB	ESTIMATED CHARGES	SURVEYOR'S RECOMMENDATION
1	TPCLAIM	CONDUCT BODYWORK REPAIR (THIRD PARTY CLAIM) AGAINST ECICS LTD INS-SND7677P		
2	ZZ/001	DOA:25/APR/2023 TIME:0700 HRS LOCATION:ADAM ROAD		
3	ZZ/002	REPLACE REAR BUMPER, BUMPER BEAM, END PANEL, SPARE TYRE FLOOR & TAILGATE	3500.00 900	
4	ZZ/003	RESPRAY REAR BUMPER, BUMPER BEAM, END PANEL, SPARE TYRE FLOOR & TAILGATE	3000.00 1200	
5	ZZ/004	TRANSFER TAILGATE MECHANISM	150.00	X
6	ZZ/005	INSTALL REAR WINDSCREEN	300.00	X
7	ZZ/006	SUPPLY & INSTALL REAR WINDSCREEN SOLAR FILM	145.00	X
8	ZZ/007	TRANSFER REVERSE SENSOR (OLD TO NEW BUMPER)	100.00	/
9	ZZ/008	REMOVE & REFIX EXHAUST SYSTEM	150.00	X
10	ZZ/009	CONDUCT REAR ANTI-RUST COATING	580.00	X
11	ZZ/011	SUNDRIES	100.00 20	
12	ZZ/10	FAULT DIAGNOSTIC (RESET)	100.00 080	/
TOTAL LABOUR CHARGES			8125.00	



Handwritten signature and scribbles over the stamp and table entries.

ARY OF ESTIMATE FOR VEHICLE REGN NO SLW7226G

TAL LABOUR CHARGES	8125.00
TAL SPARE PARTS CHARGES	5152.20
GRAND TOTAL	13277.20 *

* All charges do2 not include GST.

SURVEYOR'S PARTICULARS

NAME : *Repair - HP 90010068*
SURVEYED DATE : *03/05/23 @ 1130*
AUTHORIZED DATE :
EXCESS CLAUSE : 0.00 *4 days*
LIABILITY : 0.00
REMARKS : *Resurvey before paint*

PLS NOTE : This estimate is based on visual inspection of the affected vehicle. Should we require further labour charges & spare parts in the process of repairs, we shall inform you accordingly.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed **and** is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Singapore NRIC

Owner ID: 980E

Vehicle Details

Vehicle No.: SLW7226G

Vehicle to be Exported: No

Intended Deregistration Date: 04 May 2023

Vehicle Make: SUBARU

Vehicle Model: FORESTER 2.0I-L CVT AWD SR

Primary Colour: Silver

Manufacturing Year: 2017

Engine No.: FB20YC41158

Chassis No.: JF15J5KC5JG103875

Maximum Power Output: 110.0 kW (147 bhp)

Open Market Value: \$13,108.00

Original Registration Date: 28 Feb 2018

First Registration Date: 28 Feb 2018

Transfer Count: 0

Actual ARF Paid: \$13,108.00

Intended PARF Rebate Details

PARF Eligibility: Yes

PARF Eligibility Expiry Date: 27 Feb 2028

PARF Rebate Amount: \$9,175.00

Intended COE Rebate Details

COE Expiry Date: 27 Feb 2028

COE Category: B - Car above 1600cc or 97kW (130bhp)

COE Period(Years): 10

QP Paid: \$39,000.00

COE Rebate Amount: \$18,782.00

Total Rebate Amount: \$27,957.00

Subaru Forester 2.0i-L Sunroof

[Overview](#)

[Financial](#)

[Insurance](#)

[Accessories](#)

[Similar](#)

[Research](#)

[Photos](#)

CARRO

The Better Place to Buy Cars

Price	\$83,888		
Depreciation ⓘ	\$16,080 /yr View models with similar depre	Reg Date	23-Feb-2018 (4yrs 9mths 18days COE left)
Mileage	54,879 km (10.6k /yr)	Manufactured ⓘ	2017
Road Tax ⓘ	\$1,208 /yr	Transmission	Auto
Dereg Value ⓘ	\$29,525 as of today (change)	OMV ⓘ	\$13,108
COE ⓘ	\$42,322	ARF ⓘ	\$13,108
Engine Cap	1,995 cc	Power	110.0 kW (147 bhp)
Curb Weight ⓘ	1,591 kg	No. of Owners ⓘ	2