

(08/11/13) wef

ASS. REC. BY: Janu

REF:

CS/SMR 23005006/Rqy3

2908

ASSIGNMENT

From:

Date:

Estimated Cost:

OD TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SMK 7846T

at Workshop m/s

KAH MOTOR

of

ALEXANDRA RD

Insured:

SMR

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

N/S	O/S

Bal. or Market Value:

76K

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res.: Yes or No

Lum Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

REPAIR LIMIT - 56K

Veh No:

SMK 7846T

Yr Regn:

2019 APRType: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Honda JAZZ 1.3 CVTc.c 1318

Colour

BLACK

A/C: Insured / Std / NI / NA

Sp. Reading

039589

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

JHMGK3850KS213685

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt orBrake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

175/65R15

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO YOKO or

Front

Rear

R/Bal.

mm

R/Bal.

mm

L/Bal.

mm

L/Bal.

mm

D.O.A.

10/05/23

D.O.I.

30/05/23

Survey held at

KAH motorDes. of Damages: Frt / Rear / O/S / NIS / UIC / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?

☐

: Prell. Report

1)

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech. Invs (\$

☐

: Weekend (\$

) S + RS SI

) Photos

) Others

TOTAL

Report Format :

Lump Sum / I.B.I.: (\$

**KAH MOTOR CO. SDN. BHD.**

(A Member of the Oriental Holdings Berhad)

Service and Body Repair

Tel: +65 6841 3838

Website: www.honda.com.sg

For 24-hours Roadside Assistance, Call 98203838

QUOTATION

GST Reg No.: M200050223

Company Ref. No.: S60FC1380G

Customer : SMRT BUSES LTD
60 WOODLANDS INDUSTRIAL
PARK E4
SINGAPORE 757705

Registration No : SMK7846T

Chassis No : JHMGK3850KS213685

Model : JAZZ 1.3LXR CVT 19YM (EURO 6)

Owner's Name : LIM WEE LEE

Ins Policy No. :

Date of Accident : 10/5/2023

Document No. : SQT23001485 **Page** 1

Date : 16. May 2023

Customer No. : WZS001

Svc Advisor : IVAN TEO BOON KIAT

Engine No : L13B14100896

Date | Time : 16. May 2023 8:43:20 AM

Surveyor Name :

Survey Date :

Authorisation Date :

Item	Description	Qty	Unit Price	Disc %	Amount	8% GST Amount	Amount incld GST
	TP DIRECT SETTLEMENT (J/NO:) OWNER: LIM WEE LEE OWNER INSURER: TOKIO MARINE ACC DATE: 10/05/2023 SURVEYED BY: DATE: REF NO: TP INSURER: SMRT TP VEH: SMB1637S						
67010-T5A-U00ZZ	PANEL COMPR.FR.DOOR <i>4/</i>	1	826.80	25	620.10	49.61	669.71
67324-T5A-003	TAPE SETR.FR.DOOR <i>na</i>	1	35.90	25	26.92	2.15	29.07
72326-T5A-003	SEALFR.DOOR LOWER <i>ne</i>	1	21.10	25	15.82	1.27	17.09
72324-T5A-003	SUB SEALR.FR.DOOR <i>?</i>	1	5.10	25	3.82	0.31	4.13
72410-TD4-003	MOLDING ASSYR.FR.DOOR <i>ne</i>	1	46.10	25	34.57	2.77	37.34
67510-T5A-306ZZ	PANEL COMP,R.RR.DOOR <i>4/</i>	1	814.80	25	611.10	48.89	659.99
67825-T5A-003	TAPER.RR.DOOR SASH <i>ne</i>	1	15.40	25	11.55	0.92	12.47
72825-T5A-013	SUB SEALR.RR.DOOR CENTER <i>at</i>	1	47.00	25	35.25	2.82	38.07
72826-T5A-003	SEALRR.DOOR LOWER <i>ne</i>	1	3.90	25	2.92	0.23	3.15
72840-T5A-003	CHECKER COMPR.RR <i>?</i>	1	40.60	25	30.45	2.44	32.89
67910-SWA-H11ZZ	HINGER.RR.DR.UPPER <i>?</i>	1	37.80	25	28.35	2.27	30.62
67920-SWA-H11ZZ	HINGER.RR.DR.LOWER <i>?</i>	1	37.80	25	28.35	2.27	30.62
04636-T5A-300ZZ	PANEL SETR.RR.OUTSIDE <i>4/</i>	1	610.70	25	458.02	36.64	494.66
04631-T5A-300ZZ	PANEL SETR.SIDE SILL <i>4/</i>	1	253.70	25	190.27	15.22	205.49
04715-T5A-J50ZZ	FACE,RR.BUMPER <i>de</i>	1	496.90	25	372.67	29.81	402.48
71593-T5A-J50	SPACER,R.RR.BUMPER SIDE <i>m</i>	1	18.10	25	13.57	1.09	14.66
71598-T5A-J50	SPACER,L.RR.BUMPER SIDE <i>m</i>	1	18.10	25	13.57	1.09	14.66
76208-T5A-J32	MIRROR ASSY,R. <i>X</i>	1	542.20	25	406.65	32.53	439.18
76201-T5A-J31A2	SKULL CAP,R, ST <i>X</i>	1	55.70	25	41.77	3.34	45.11

Printed on 16/5/2023 9:02:23 AM

This is a computer generated invoice. No signature is required.

Part prices are subjected to change without notice.

The above estimated cost of repair do not include any unforeseen damages.

GST Amount is calculated from individual line(s).

An amount of \$53.50 (incl GST) will be applicable for the request of the above quotation for estimates above \$2,000.00.

However, if the repairs are subsequently done at Kah Motor Co. Sdn. Bhd, it will be refunded.

All quotations and prices are subjected to GST adjustment from 7% to 8% with effect from 1st Jan 2023.



KAH MOTOR CO. SDN. BHD.

(A Member of the Oriental Holdings Berhad)

Service and Body Repair

Tel: +65 6841 3838

Website: www.honda.com.sg

For 24-hours Roadside Assistance, Call 98203838

QUOTATION

GST Reg No.: M200050223

Company Ref. No.: S60FC1380G

Customer : SMRT BUSES LTD
60 WOODLANDS INDUSTRIAL
PARK E4
SINGAPORE 757705
Registration No : SMK7846T
Chassis No : JHMGK3850KS213685
Model : JAZZ 1.3LXR CVT 19YM (EURO 6)
Owner's Name : LIM WEE LEE
Ins Policy No. :
Date of Accident : 10/5/2023

Document No. : SQT23001485 Page 2
Date : 16. May 2023
Customer No. : WZS001
Svc Advisor : IVAN TEO BOON KIAT
Engine No : L13B14100896
Date | Time : 16. May 2023 8:43:20 AM
Surveyor Name :
Survey Date :
Authorisation Date :

Item	Description	Qty	Unit Price	Disc %	Amount	8% GST Amount	Amount incl GST
33500-T5A-J02	TAILLIGHT ASSY.R. <i>X</i>	1	258.40	25	193.80	15.50	209.30
Sum Item					3139.52	251.17	3,390.69
BOSUN	SUNDRIES	1	100.00 <i>30</i>		100.00	8.00	108.00
BML02I	INSPECT RR LIGHTING MECHANISMS. PERFORM WATER	1	280.00 <i>180</i>		280.00	22.40	302.40
BA02R	REMOVE & RENEW REVERSE SENSORS-4 PCS (N)	1	280.00 <i>180</i>		280.00	22.40	302.40
BKDR12R	REMOVE & TRANSFER ITEMS TO NEW FR R DR. ADJUST	1	650.00 <i>500</i>		650.00	52.00	702.00
BKDR22R	REMOVE & TRANSFER ITEMS TO NEW RR R DR. ADJUST	1	650.00 <i>500</i>		650.00	52.00	702.00
BOJSE	BODY JOINT SEALANT FR DOOR	1	120.00 <i>100</i>		120.00	9.60	129.60
BOJSE	BODY JOINT SEALANT RR DOOR	1	120.00 <i>100</i>		120.00	9.60	129.60
BOBC	BODY UNDERSIDE COATING (N)	1	380.00 <i>350</i>		380.00	30.40	410.40
BKFE22K	STRAIGHTEN ALIGN RR R FENDER.	1	5200.00 <i>3250</i>		5200.00	416.00	5616.00
BP06R	SPRAY PAINTING ON REPAIRED OR REPLACED AREAS. (6P)	1	4160.00 <i>2600</i>		4160.00	332.80	4492.80
Sum Labor					11940.00	955.20	12,895.20

Survey By *RASU - Hp 90010068*

Date & Time *30/05/23 01420*

Excess

Status

Signature

8 days
Rey by part
[Signature]

Total Amount 15,079.52 1,206.37 16,285.89

Total (Inclusive of GST) **16,285.89**

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Printed on 16/5/2023 9:02:23 AM

This is a computer generated invoice. No signature is required.

Part prices are subjected to change without notice.

The above estimated cost of repair do not include any unforeseen damages.

GST Amount is calculated from individual line(s).

An amount of \$53.50 (incl GST) will be applicable for the request of the above quotation for estimates above \$2,000.00.

However, if the repairs are subsequently done at Kah Motor Co. Sdn. Bhd, it will be refunded.

All quotations and prices are subjected to GST adjustment from 7% to 8% with effect from 1st Jan 2023.

Enquire PARF/COE Rebate for Registered Vehicle

Owner ID Type:	Singapore NRIC
Owner ID:	790B
Vehicle No.:	SMK7846T
Vehicle to be Exported:	No
Intended Deregistration Date:	30 May 2023
Vehicle Make:	HONDA
Vehicle Model:	JAZZ 1.3 CVT
Primary Colour:	Blue
Manufacturing Year:	2019
Engine No.:	L13B14100896
Chassis No.:	JHMGK3850KS213685
Maximum Power Output:	73.0 kW (97 bhp)
Open Market Value:	\$15,727.00
Original Registration Date:	24 Apr 2019
First Registration Date:	24 Apr 2019
Transfer Count:	0
Actual ARF Paid:	\$5,727.00
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	23 Apr 2029
PARF Rebate Amount:	\$4,295.00
COE Expiry Date:	23 Apr 2029
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$26,170.00
COE Rebate Amount:	\$15,440.00
Total Rebate Amount:	\$19,735.00

The information contained herein is correct as at 30 May 2023

OK


Honda Jazz 1.3A

\$76,800 Instalment \$902/mth

♡ Shortlist

✔ Get Warranty

📄 Loan Calculator

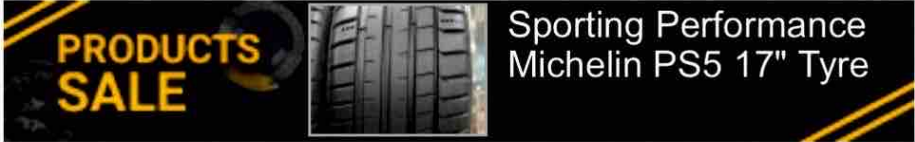

Overview Financial Photo Research

Depreciation	ⓘ \$12,520 / year
Reg. Date	24-Apr-2019 (5yrs 10mths 23days COE left)
Manufactured	ⓘ 2019
Mileage	53,800 km (13.1k / year)
Transmission	Auto
Engine Cap	1,318 cc
Road Tax	ⓘ \$578 / year
Power	73.0 kW (97 bhp) View specs of the Honda Jazz (2014-2021)
Curb Weight	ⓘ 1,052 kg
COE	ⓘ \$26,301
OMV	ⓘ \$15,727
ARF	ⓘ \$5,727
Dereg Value	ⓘ \$19,816 as of today
No. of Owners	ⓘ 1