

ASS. REC. BY:

REF:

LPC

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Rpt:

Consistent?: Yes or No

GIA / PR Seen:

Consistent?: Yes or No

Est. Repairs:

days

Res.: Yes or No

Lum Sum:

1-B.1 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Date / Time

Action / Instruction

Veh No:

SCN 8688D

Yr Regn:

06.15

Type: M/Car / M/Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

M. E250

C.C.

1991

Colour

M. L. Blue

A/C:

Insured / Std / NI / NA

Sp. Reading

147443

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

WDD 2120362 B 747 335

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Mod: Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

245/40R18

R:

265/35R18

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal.

2

mm

Rear

R/Bal.

7

mm

L/Bal.

2

mm

L/Bal.

7

mm

D.O.A.

15/5/23

D.O.I.

22/5/2023

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

FR O/S

The UIC / Chassis frame / Body Structure affected due to collision.

Date/Time, File Pass to?



: Prell. Report

1)



: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

Add Fee:



: Site Insp (\$



: Interview (\$



: Tech Invs (\$



: Weekend (\$

S - RS. SI

F. & S.

Others

TOTAL

Report Format :

Lump Sum / I.B.I. (\$

Not Withheld
 Recovery B4 pricing
 Ex \$500k
 4 days

Your Reference : Z22VP05031243
 Accident Date : 15-May-2023

No. : 32934

Date : 18-May-2023

Our Ref : 023273 / SANDRA

PAGE : 1

LONPAC INSURANCE BHD
 300 BEACH ROAD
 #17-04/07 THE CONCOURSE
 Singapore 199555

ESTIMATED COST OF REPAIR FOR MERCEDES E250 (1991cc) (2015) SCN8688D

1 pc	front bumper				Bu	900.00	c	—
1 pc	front bumper tow cover				Mr	42.00	c	✓
1 pc	RH front bumper parking sensor					110.00	c	?
	-outside							
1 pc	RH front bumper parking sensor					110.00	c	?
	-inner							
1 pc	RH front bumper basic carrier					65.00	c	?
1 pc	front bumper basic carrier					75.00	c	?
	-centre							
1 pc	front bumper inner sponge					105.00	c	?
1 pc	front bumper centre lower grille					70.00	c	?
6 pcs	front bumper parking sensor seal	@ S\$ 5.50			Mr	33.00	c	—
1 pc	RH front bumper side rail bracket					15.00	c	?
1 pc	RH front bumper side stability					15.00	c	?
1 pc	RH front bumper fog cover				Mr	35.00	c	—
1 pc	RH front bumper fog cover chrome moulding				Mr	70.00	c	—
1 pc	front bumper basic carrier -lower					90.00	c	?
1 pc	front bumper reinforcement					315.00	c	?
1 pc	RH front bumper reinforcement bracket					180.00	c	?
1 pc	RH front bumper reinforcement side beam bracket					36.00	c	?

Your Reference : Z22VP05031243
Our Ref : 023273

Page : 2
No. : 32934

1 pc RH front bumper 'L' support		20.00	c	?
8 pcs front bumper clips	@ S\$ 5.50	<i>Ne</i> 44.00	c	—
8 pcs front bumper rivets	@ S\$ 5.50	<i>Ne</i> 44.00	c	—
1 pc radiator top panel		<i>R</i> 90.00	c	X
1 pc RH headlamp panel		<i>R</i> 190.00	c	X
1 pc front grille]		<i>CM</i> 645.00	c	—
1 pc front grille logo]				
1 pc front grille carrier		165.00	c	?
1 pc RH headlamp		<i>Br</i> 1,800.00	c	—
1 pc RH headlamp LED control module		495.00	c	?
1 pc RH headlamp control unit		635.00	c	?
1 pc bonnet		<i>Br</i> 1,350.00	c	—
2 pcs bonnet spring stopper	@ S\$ 14.00	<i>Ne</i> 28.00	c	—
1 pc bonnet logo		<i>Ne</i> 55.00	c	—
1 pc RH bonnet lower lock		<i>R</i> 42.00	c	X
1 pc RH bonnet upper lock catch		<i>R</i> 24.00	c	X
1 pc bonnet pull cable		<i>R</i> 50.00	c	X
1 pc bonnet seal		<i>R</i> 32.00	c	X
2 pcs bonnet hinge (LH/RH)	@ S\$ 90.00	<i>R</i> 180.00	c	X
12 pcs bonnet insulation clip	@ S\$ 6.60	<i>Ne</i> 79.20	c	—
1 pc radar sensor @front bumper		825.00	c	?
1 pc radar sensor bracket @front bumper		28.00	c	?
1 pc SAM control unit		860.00	c	?
		<hr/>		
		9,947.20		
	Add 15% :	1,492.08		
		<hr/>		
		11,439.28		

To remove, cut out damaged parts,
panel beating, welding, align,
refix and to renew affected parts.

680.00 *400*

To putty and respray on affected
portions.

650.00 *600*

Your Reference : Z22VP05031243
Our Ref : 023273

Page : 3
No. : 32934

to conduct on line programming,
rest headlamp modules, reprogram
radar sensor

580.00 ?

To focus headlamps. To check front
wiring and lighting operation.

50.00 2d

Total : S\$13,399.28

Singapore Dollars THIRTEEN THOUSAND THREE HUNDRED
NINETY NINE AND CENTS TWENTY EIGHT Only

Note: Amount quoted above is subject to prevailing GST at time of tax invoice.

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission	16/05/2023 21:02 (SGT)
Reported by	Both Policyholder and Actual Driver
Date of Accident	15/05/2023 18:55 (SGT)
Exact Location of Accident	Singapore
Additional Location Information	Clementi West Street 2 wet market open space carpark
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SCN8688D

INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	Wong Wai Kheong
NRIC No	SXXXXX576G
Email Address	qqk1356@gmail.com
Mobile Phone No	(Phone) +65-92281606
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	Mercedes
Model	E250
Variant	-
Exact purpose for which vehicle was being used at time of accident	-
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private car
Transmission	Auto
CC	1991

INSURANCE COMPANY

Name of Insurance Company	Lonpac Insurance Bhd
Policy Number / Cover Note Number	Z22VP05031243

DRIVER

Name of Driver	Wong Wai Kheong
NRIC No	SXXXXX576G
Date Of Birth	22/10/1966
Occupation	Indoor

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Traffic Police Department for investigation.**
6. This report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this (form) and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;

(ii) investigating the accident and/or my claims;

(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;

(iv) administering my claims (including the making of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or

(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.

(collectively the "Purposes")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and

(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third-party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.




Policyholder's Signature / Date & Time

Actual Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel
(Name as in NRIC/ID card)

Sketch Plan

16/5/23 at 2.15pm

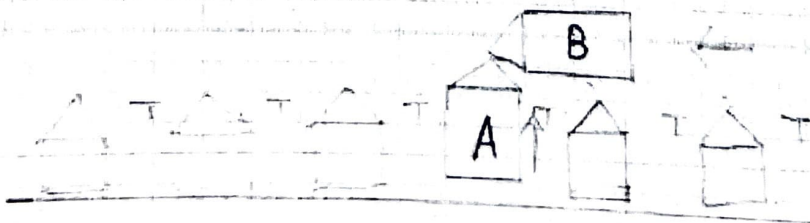

A - SCHLAGE RD

B - SF L108P

PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:	Singapore NRIC
Owner ID:	576G

Vehicle Details

Vehicle No.:	SCN8688D
Vehicle to be Exported:	Yes
Intended Deregistration Date:	16 May 2023
Vehicle Make:	MERCEDES BENZ
Vehicle Model:	E 250 SEDAN (R17)
Primary Colour:	Silver
Manufacturing Year:	2015
Engine No.:	27492030375975
Chassis No.:	WDD2120362B147335
Maximum Power Output:	155.0 kW (207 bhp)
Open Market Value:	\$46,510.00
Original Registration Date:	15 Jun 2015
First Registration Date:	15 Jun 2015
Transfer Count:	1
Actual ARF Paid:	\$52,114.00

Intended PARF Rebate Details

PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	14 Jun 2025
PARF Rebate Amount:	\$31,268.00

Intended COE Rebate Details

COE Expiry Date:	14 Jun 2025
COE Category:	B - Car above 1600cc or 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$75,000.00
COE Rebate Amount:	\$15,594.00
Total Rebate Amount:	\$46,862.00

The information contained herein is correct as at 16 May 2023

OK