

**Automotive Repair Centre Pte Ltd
#05-18, Singapore 757700, 38
Woodlands Industrial Park E1
757700**

Insurer Reference:
Repairer Reference: 061650
Date calculated: 24/06/2023 1:38 PM

Full Report
Registration: SKS2684H
Printed: 24/06/2023 1:38 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	RAYMOND TAN	Currency:	SGD
Claim Reference:		Date of Incident:	
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	MERCEDES-BENZ
Model:	B-CLASS (W246)
Sub Model:	B 180
Model Sheet Number:	03 A1 41
Registration:	SKS2684H
VIN number:	WDD2462422J301543
Odometer:	

Model Specs

FR PRODUCTION START	CONTROL UNIT 3U1	MODIFICAT PACK 14/2	MODEL 2015
A/C THERMATIC	ELECT LUMBAR ADJUST	MIRROR PACKAGE	RAIN SENSOR
DIPPING DOOR MIRROR	COLLISION WARNER	DISTRONIC PLUS	ELECT FOLDING MIRROR
AUDIO SYSTEM 20 CD	DISPLAY 8"	ILLUMINAT AMBIENTE	LED HEADLAMP
LIGHT-/VIEW PACKAGE	LEATHER PAD ARTICO	PARTITION NET	S/WHEEL TIP SWITCHES
DRIVER SEAT MEMORY	PASS SEAT MEMORY	TRIM LINEAR OPTIC	SEAT COMFORT PACKAGE
MEDIA INTERFACE	ILLUM SUN VISOR	DRIVER SEAT TRAY	PASS SEAT ST/BOX
FRT SEAT LUGGAGE NET	POWER REDUCTION	SOCKET 12V	REFRIGERANT R1234YF
EMISSION STD EURO 6	STORAGE PACKAGE	CAMTRONIC	ECO START/STOP
TYRE PRESSURE SENSOR	7 SPEED AUTOMATIC	TYRES 205/55 R16..H	WHEELS 6.5J X 16 ALU
TYRE W/FLAT RUNNING	LOAD COMPART PACKAGE	KNEE AIRBAG	PARKTRONIC
COMPRESSOR VARIABLE	STYLE	LUGGAGE COMP COVER	PREPARE OFF VEHICLE
CLEAR COAT HARD	TWO COAT PEARL/MICA		

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All
Underbody

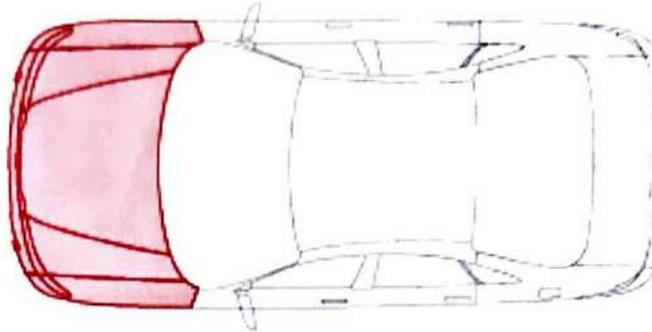

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	-------------------------	------------------------	------------------------	-------------------------	-------------------------	--------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
54-1011 01	SHORT TEST INCLUDES: CONNECT + DISCONNECT STAR DIAGNOSIS, PRINT DATA, DELETE ERROR MEMORY		3.0	12.60
54-7989 01	R + R BATTERY EARTH CABLE (WHEN DISCONNECTING ELECTRIC PLUG AND SOCKET CONNECTIONS)		2.0	8.40
61-1018 01	R + R COMPL LWR ENGINE COMPARTMENT COVER		7.0	29.40
88-2532 ZAX	REPAIR OF FRONT-END DAMAGE INCLUDES: RENEW BUMPER, BONNET, RADIATOR COVER, FRONT WINGS AND FRONT LAMP UNITS, CONVERT ATTACHED PARTS, RENEW IF NECESSARY		36.0	151.20
88-1347 01	ADD TO RENEW FRONT BUMPER (VEHICLE WITH PARK ASSISTENT)		2.0	8.40
88-1153 01	ADDITION TO R + R FRONT BUMPER (VEHICLE WITH COLLISION WARN SYS)		1.0	4.20

Code	Description	WU	Price SGD
30-4226 01	R + R FRONT RADAR SENSOR	3.0	12.60
88-1364 01	ADD FOR DIS + ASS FRONT BUMPER (VEHICLE WITH COLLISION WARN SYS)	1.0	4.20
88-2647 ZAX	R + R L/BONNET HINGE	3.0	12.60
88-2652 ZAX	R + R R/BONNET HINGE	3.0	12.60
88-2629 ZAX	R + R BONNET CABLE	3.0	12.60
60-1331 01	ATTACHED PARTS IN ENGINE COMPART R + R FOR RENEWAL OF THE FRONT MODULE INCLUDES: ALL ATTACHED PARTS IN REPAIR AREA REMOVE AND REFIT	11.0	46.20
54-1558 01)	R + R LOW TONE HORN	1.0	4.20
54-1559 01)	R + R HIGH TON HORN	1.0	4.20
62-1266 01	FRONT CROSS MEMBER AND BRACE BETWEEN THE WHEELHOUSES COMPLETE R + R	14.0	58.80
62-1270 01	R + R RADIATOR CARRIER OR REPLACE (STRIPPED) INCLUDES: L + R CRASHBOX R + R	3.0	12.60
67-1700 01	RENEW FRONT SCREEN INCLUDES: INTERIOR MIRROR, RAIN SENSOR, BOTH WIPER ARMS, COVER WATER BOX, COVER MOULDINGS AND ALL TRIMS REMOVE AND REFIT	29.0	121.80
67-1711 01	RENEW FRONT SCREEN (ADD/WORK) (VEHICLE WITH LIGHT-/RAIN SENSOR)	4.0	16.80
88-9960 01	R + R DRIP MOULDINGS	5.0	21.00
60-1234 01)	R + R RADIATOR	3.0	12.60
20-4000 02)	RENEW RADIATOR (REMOVED)	1.0	4.20
20-6461 01	R + R FAN UNIT	5.0	21.00
83-6541 ZAX	R + R CONDENSER	4.0	16.80
83-7805 ZAX	RENEW REFRIGERANT PIPE A	4.0	16.80
83-7810 ZAX	RENEW REFRIGERANT PIPE B	9.0	37.80
83-7815 ZAX	RENEW REFRIGERANT PIPE C	3.0	12.60
20-1140 01	DRAIN + REFILL COOLANT, LEAKAGE TEST	6.0	25.20
83-1762 01	AIR-CONDITIONING SYSTEM DRAIN FLUID, EXHAUST, REFILL, PRESSURE TEST (FOR ALL WORK ON THE SYSTEM)	6.0	25.20
82-1120 01	ADJUST HEADLAMPS	4.0	16.80
1001	Diagnose Fault Code Diagnostic		200.00*
1481	LEFT FRONT DOOR REPAIR	30.0*	126.00
1482	RIGHT FRONT DOOR REPAIR	30.0*	126.00
Labour Cost			
Panel / Mechanical Labour		Hrs	WU
Fixed Rate		23.70	237.0
Total of Labour			995.40
			200.00
			1,195.40

Paint

Paint Work

SYSTEM AZT

Time Basis 10 WU/h

Code	Description - TWO COAT PEARL/MICA	WU	Price SGD
	BONNET NEW PART PAINTING	21.0	
	LEFT BONNET HINGE NEW PART PAINTING	5.0	
	RIGHT BONNET HINGE NEW PART PAINTING	5.0	

Paint Work

SYSTEM AZT

Time Basis 10 WU/h

Code	Description - TWO COAT PEARL/MICA	WU	Price SGD
	L/F WING NEW PART PAINTING	10.0	
	R/F WING NEW PART PAINTING	10.0	
	FRONT BUMPER COVER NEW PART PAINT K1R	13.0	
	LEFT FRONT DOOR REPAIR PAINTING >50%	26.0	
	RIGHT FRONT DOOR REPAIR PAINTING >50%	26.0	

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	66.05
0475	LEFT BONNET HINGE NEW PART PAINTING	0.52
0476	RIGHT BONNET HINGE NEW PART PAINTING	0.52
0741	L/F WING NEW PART PAINTING	20.12
0742	R/F WING NEW PART PAINTING	20.12
0283	FRONT BUMPER COVER NEW PART PAINT K1R	64.45
1481	LEFT FRONT DOOR REPAIR PAINTING >50%	36.74
1482	RIGHT FRONT DOOR REPAIR PAINTING >50%	36.74

Labour Cost - Paint

Factor	42.00 SGD/h	Hrs	WU	Price SGD
Time Paint			116.0	
Preparation Main Work Metal		2.50	25.0	105.00
Preparation Comp. Work Plastic		0.50	5.0	21.00
Total	10 WU/h	14.60	146.0	613.20

Material Cost - Paint

	Price SGD
New Part Painting	107.33
New Part Painting - Plastic K1R	64.45
Repair Painting	73.48
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	282.86

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2015-06-01 Price SGD
4465	bl/ AIR CON CONDENSER	246 500 0454	Original	
8385	des/ AIR INTAKE HOSE	270 090 0382	Original	765.00
0433	BASE PLATE	164 888 0411	Original	135.00
0471	bl/ BONNET	246 880 0057 64	Original	100.00
0527	me/ BONNET FRONT SEAL	246 887 0098	Original	1,250.00
0515	bl/ BONNET LOCK	246 880 0460	Original	50.00
0501	? BONNET REL CABLE	246 880 5900	Original	125.00
0497	? BONNET SUPPORT	246 887 0072	Original	85.00
0517	? BONNET SWITCH	246 870 0558	Original	65.00
4481	?/ COMP/CONDENSER	246 830 3515	Original	125.00
	?/ PIPE		Original	130.00
4483	? COMPRESSOR PIPE	246 830 5600	Original	200.00

Code	Description	Part Number	Part Source	Price SGD
0930	X CTR FRT REINF X	246 620 0234 64	Original	680.00
0283	to m/ FRONT BUMPER COVER	246 880 4640 9999	Original	1,000.00
1025	na/ FRONT CENTRE BRKT	246 620 0414	Original	30.00
1001	X FRONT CROSSMEMBER	246 620 1100	Original	250.00
0409	com/ FRONT GRILLE COVER	246 888 0173	Original	180.00
0336	cm/ FRONT IMPACT DAMPER	246 885 1037	Original	100.00
0340	FRONT BUMPER C-MEMBER	246 885 0965	Original	150.00
0437	FRRT CTR SENSOR BRKT	246 888 0014	Original	25.00
1415	FRRT SCREEN SUPPORTS	164 742 0097		0.00
0405	cm/ GRILLE	246 888 0460	Original	250.00
7789	HEATER BLOWER	246 500 0093	Original	345.00
8382	INTAKE PIPE	270 090 1029	Original	165.00
8730	INTERCOOLER	246 500 0100	Original	600.00
0289	L/BEARING BRKT REINF	246 885 0016	Original	30.00
1021	L/CENTRE COVER	246 687 0507	Original	20.00
8737	L/CHARGE AIR HOSE	246 520 0001	Original	165.00
0287	na/ L/F BUMPER BRACKET	246 885 1921	Original	45.00
1759	L/F TRIM	246 690 1787	Original	100.00
0741	bf/ L/F WING	246 881 0101	Original	450.00
9643	L/HORN	000 540 9800	Original	150.00
7771	L/LOWER BEARING	246 504 0012	Original	5.00
0413	X L/LOWER GRILLE TRIM	246 888 2185	Original	60.00
7769	L/LWR RADIATOR BRKT	246 504 0540	Original	15.00
1023	L/OUTER AIR DUCT	246 505 0730	Original	35.00
7753	L/RADIATOR AIR GUIDE	246 505 0330	Original	50.00
7773	L/RADIATOR HOSE	246 501 0182	Original	55.00
2427	cm/ L/ROOF CVR MOULDING	246 690 3182	Original	300.00
7765	L/UPPER BEARING	169 504 0114	Original	5.00
0411	bro/ L/UPPER GRILLE TRIM	246 888 1985	Original	60.00
0475	bf/ LEFT BONNET HINGE	246 880 0328	Original	60.00
0561	bro/ LEFT HEADLAMP ASSY	246 906 3501	Original	1,850.00
7752	L/LOWER AIR GUIDE	246 505 1530	Original	50.00
1410	na/ LWR WINDSCREEN SEAL	246 671 0100		0.00
4482	PIPE CONDEN/EXP VALV	246 830 2415	Original	220.00
0290	R/BEARING BRKT REINF	246 885 0116	Original	30.00
8738	R/CHARGE AIR HOSE	246 528 0282	Original	150.00
1022	R/CTR COVER	246 687 0407	Original	20.00
0288	na/ R/F BUMPER BRACKET	246 885 2021	Original	45.00
1760	R/F TRIM	246 690 1887	Original	100.00
0742	bf/ R/F WING	246 881 0201	Original	450.00
9644	R/HORN	000 540 1910	Original	150.00
7772	R/LOWER BEARING	246 504 0012	Original	5.00
0414	R/LOWER GRILLE TRIM	246 888 2285	Original	60.00
7770	R/LWR RADIATOR BRKT	246 504 0240	Original	15.00
1024	R/OUTER AIR DUCT	246 505 0830	Original	35.00
7754	R/RADIATOR AIR GUIDE	246 505 0230	Original	50.00
7776	R/RADIATOR HOSE	246 501 0282	Original	55.00
2428	R/ROOF CVR MOULDING	246 690 3282	Original	300.00
7766	R/UPPER BEARING	169 504 0114	Original	5.00
0412	R/UPPER GRILLE TRIM	246 888 2085	Original	60.00
7761	RADIATOR	246 500 1303	Original	550.00
1005	RADIATOR	246 620 0019	Original	380.00
0476	bf/ CROSSMEMBER			
0562	bro/ RIGHT BONNET HINGE	246 880 0428	Original	60.00
0432	ml/ RIGHT HEADLAMP ASSY	246 906 3601	Original	1,850.00
		218 817 0116	Original	50.00

Code	Description	Part Number	Part Source	Price SGD	
7755	UPPER AIR GUIDE	246 505 1430	Original	50.00	
0503	UPPER BONNET LOCK	246 880 0360	Original	35.00	
1436	WASHER CONTAINER	246 869 0220	Original	135.00	
1401	WINDSCREEN	246 670 9400	Original	800.00	
1411	WINDSCREEN BOND KIT	000 989 4905 11		0.00	
1417	WINDSCREEN SEAL	251 671 0020		0.00	
f: OEM Parts				Savings	0.00
n: Non-OEM Parts				Subtotal	15,970.00
u: Used parts				Total	15,970.00

Extras

Code	Description	Price SGD
1000	CTP ELECTRICAL CTP ELECTRICAL	15 25.00*
1002	CTP TAPE & BRACKET IU	10 15.00*
1003	CTP SUNDRIES CTP SUNDRIES	20 30.00*
1004	CTP SEALANT SEALANT	20 25.00*
1005	CTP AIR-CON CTP AIR-CON	30 50.00*
1006	CTP REPLACE W/S WINDSCREEN	120.00*
Total Extras		265.00

Final Calculation

	SGD	SGD
Parts		
Total Parts	15,970.00	15,970.00
Labour Time Base 10 WU/h		
Total 237.0 WU X 42.00 SGD/h	995.40	
Fixed Rate	200.00	
Total of Labour		1,195.40
Total Of Extras		265.00
Paint Work Time Base 10 WU/h		
Labour Cost 146.0 WU X 42.00 SGD/h	613.20	
Material Cost	282.86	
Total Paint Including Material		896.06
Repair Cost Excludes GST		18,326.46
GST (+8.00%)		1,466.12
Repair Cost Included GST		19,792.58
Deductions (Excludes GST)		
Repair Cost Discount (+20.00%)	-3,665.29	
Total Of Deductions (Excludes GST)		-3,665.29
Grand Total Excludes GST		14,661.17
GST (+8.00%)		1,172.89
Grand Total Included GST		15,834.06

Comments

- * - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
-) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Repair
H# 90010068
11 ~~days~~ days
L/S
27/06/23 @ 1650
EXCESS TBA
Revert
Resurvey after repair

Enquire PARF/COE Rebate for Registered Vehicle

Owner ID Type:	Singapore NRIC
Owner ID:	007H
Vehicle No.:	SKS2684H
Vehicle to be Exported:	No
Intended Deregistration Date:	27 Jun 2023
Vehicle Make:	MERCEDES BENZ
Vehicle Model:	B180 STYLE (R16 LED)
Primary Colour:	White
Manufacturing Year:	2014
Engine No.:	27091030581695
Chassis No.:	WDD2462422J301543
Maximum Power Output:	90.0 kW (120 bhp)
Open Market Value:	\$24,707.00
Original Registration Date:	02 Apr 2015
First Registration Date:	02 Apr 2015
Transfer Count:	0
Actual ARF Paid:	\$16,590.00
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	01 Apr 2025
PARF Rebate Amount:	\$9,124.00
COE Expiry Date:	01 Apr 2025
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$65,001.00
COE Rebate Amount:	\$11,463.00
Total Rebate Amount:	\$20,587.00

The information contained herein is correct as at 27 Jun 2023

OK

Mercedes-Benz B-Class B180 Style

\$43,800 Instalment \$1,536/mth

📄 Apply for 2.28% loan

♡ Shortlist

✔ Get Warranty

mycarforum

TRENDING DISCUSSIONS

**Singapore Reckless Drivers
Part XIV**

[READ MORE >](#)

Overview Financial Photo Research

Depreciation	ⓘ \$20,120 / year
Reg. Date	02-Apr-2015 (1yr 9mths 5days COE left)
Manufactured	ⓘ 2014
Mileage	135,500 km (16.4k / year)
Transmission	Auto
Engine Cap	1,595 cc
Road Tax	ⓘ \$740 / year
Power	90.0 kW (120 bhp) View specs of the Mercedes-Benz B-Class (2012-2019)
Curb Weight	ⓘ 1,425 kg
COE	ⓘ \$65,001