No.33, Ubi Ave 3 #02-15, Vertex Singapore 408868

Tel: (65) 6509 1788 Fax: (65) 6509 6221

Email: motorsurvey@fta.com.sg

Co.Reg No: 200819280D GST Reg No: 200819280D

Our Reference: NTUC19-127774/PRS/BX/ADJ/BX/gh

Your Reference: <u>MT/1075445-001</u>

Date : 19-Aug-2020

Motor Claims Department NTUC Income Insurance Co-operative Limited 73 Bras Basah Road #05-01 NTUC Trade Union House Singapore 189556

Attention : Ms Natalie Lee

Dear Sir/Mdm,

#### SURVEY OF VEHICLE NO. SKA 9789M

Pursuant to your instruction on 18-Aug-2020.

We recommend a repair cost of \$9,000.00 (see report) based on lump sum repair and the estimated duration of repairs would take

06 days.

Please see computation as below:Market Value: \$ 17,900.00
Salvage Value: \$ 12,900.00
Nett Loss: \$ 5,000.00

In our opinion, it is not economical to repair if the repair cost exceeds \$5,000.00.

We also enclosed our note of charges for your consideration.

Thank you for this assignment.

Your faithfully

FormTeam Consultancy Pte Ltd

Adjusters & Surveyors (Licensed Appraiser)

Chow Bo Xiong Automobile Appraiser

(Email: chowbx@fta.com.sg)

Encl. Survey Report

\_\_\_\_\_

### **AUTOMOBILE ASSESSMENT REPORT**

Page No. 1

Our Reference: NTUC19-127774/PRS/BX/ADJ/BX/gh

Your Reference: <u>MT/1075445-001</u>

Date: 19-Aug-20

Attention : Ms Natalic Lcc

TO: Motor Claims Department

NTUC Income Insurance Co-operative Limited

73 Bras Basah Road

#05-01 NTUC Trade Union House

Singapore 189556

Assessment of Vehicle No : SKA 9789M

Date of Accident:11-December-2019Date of Inspection:16-December-2019

Address of Inspection : 160 Sin Ming Drive #03-18 S'575722

We have carried out a physical assessment of SKA 9789M at M/S E M Solution Pte Ltd according to your instructions on 12-Dec-2019, dismantled items on 17-Dec-2019, post repair survey on 22-Dec-2019 and are pleased to submit our report herewith.

#### 1. VEHICLE PARTICULARS

Registration No. : SKA 9789M Make & Model : Chevrolet Cruze

Year of Registration : 2011 Engine Capacity : 1598 cc

Chassis No. : KL1JA69E9BK128501

Engine No. : F16D424888KA

Colour : Red Mileage (km) : 243795

#### 2. VEHICLE CONDITION

Body Paint : Good
Steering : Serviceable
Foot Brake : Serviceable
Parking Brake : Serviceable

### 3. TYRE PARTICULARS & CONDITION

## **Front**

RH Make/Size : Radar 215/50ZR17 - 70% LH Make/Size : Radar 215/50ZR17 - 70%

Rear

RH Make/Size : Radar 215/50ZR17 - 70% LH Make/Size : Radar 215/50ZR17 - 70%

Note: % denotes the remaining percentage of the tyre


Our Reference : NTUC19-127774/PRS/BX/ADJ/BX/gh Page No. 2

Your Reference : <u>MT/1075445-001</u>

Vehicle Number : SKA 9789M

#### 4. DESCRIPTION OF DAMAGE

At the time of inspection, this vehicle sustained damages to the **Front & Rear** portion. Please see attached scheduled for details.

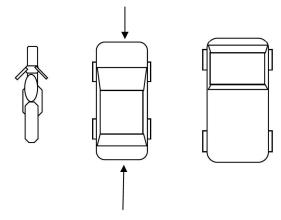

#### 5. REMARKS

 Market Value
 : \$ 17,900.00

 Salvage Value
 : \$ 12,900.00

 Repair Limit (Nett Loss)
 : \$ 5,000.00

 Repairer's estimate
 : Not Provided

Nett Saving : Excess : Sum Insured : -

Our adjusted amount : \$ 9,000.00

Estimated Repair Days : **06 days** 

### Additional photographs will be submitted upon request by our principal.

Pursuant to your instruction, we have **NOT AUTHORIZED** repair.

The assessment was conducted on a "Without Prejudice" basis.

If we are not notified of anything to the contrary within <u>14 days</u> from the date hereof, this report shall be treated as correct.

#### Disclaimer

This report is intended for the exclusive use of the addressee solely in relation to the loss occurrence in which the assessed vehicle is involved. No liability or responsibility whatsoever shall be held by

FormTeam Consultancy Pte Ltd for any reliance on this report by any third party, unless with the permission of the addressee.

Our Reference : NTUC19-127774/PRS/BX/ADJ/BX/gh Page No. 3

Your Reference:  $\underline{MT/1075445-001}$ Vehicle Number:  $\underline{SKA 9789M}$ 

QTY	DESCRIPTION	CONDITION	REPAIRER'S ESTIMATE (S\$)	AS	OUR SESSMENT (S\$)
	PARTS (LIST ITEMS)				
1	Front Bumper Assy	Deformed	-		1,245.00
2	Front Bumper Bracket	Necessary	-		96.00
2	Front Bumper Side Retainer	Necessary	-		96.00
1	Front Bumper Reinforcement	Bent	-		452.00
1	Front Bumper Sponge	Cracked	-		192.00
1	Front Grille Assy	Cracked	-		288.00
1	Front Grille Emblem	Necessary	Э-		88.00
1	Front Bonnet Assy	Bent	-		1,250.00
1	Front Air-con Condenser Assy	Bent	-		1,198.00
1	Front Left Headlamp	Cracked	-		1,420.00
1	Front Right Headlamp	Cracked	-		1,420.00
1	Front Air Duct	Not Consistent			=
1	Front Lock Mechanism	No Damage	-		=
1	Front Support Panel Inner Garnish	Cracked	-		129.00
1	Rear Bumper Assy	Deformed	-		1,100.00
2	Rear Bumper Bracket	No Damage	Ξ.		Ξ
2	Rear Bumper Side Retainer	RH Necessary, LH Not Necessary	-		43.00
1	Rear Bumper Reinforcement	Bent	_		450.00
1	Rear Bumper Tow Cover	Deformed	-		76.00
1	Rear Bootlid Assy	Repair	=		-
1	Rear Bootlid Lock	No Damage	=		=
1	Rear Right Taillamp	Not Consistent	-		-
1	Rear End Lower Panel	Repair	_		-
1	Rear Bootlid Weatherstrip	Not Necessary	-		-
			-		9,543.00
		Less Discount :	0% -	10%	954.30
		Parts Total :	-		8,588.70

Our Reference : NTUC19-127774/PRS/BX/ADJ/BX/gh Page No. 4

Your Reference: MT/1075445-001

Vehicle Number: SKA 9789M

QTY	DESCRIPTION	CONDITION	REPAIRER'S ESTIMATE (S\$)	OUR ASSESSMENT (S\$)
	SPECIAL NETT ITEMS			
10	Front Bumper Clips	Necessary	-	50.00
4	Front Grille Clips	Necessary	-	20.00
1	Front No. Plate With Garnish	Necessary	-	45.00
1	Front Air Con Gas	Refer To Labour	-	-
10	Rear Bumper Clips	Necessary	-	50.00
4	Rear Bumper Reverse Sensor	Malfunction	-	300.00
1	Rear No. Plate With Garnish	Not Necessary	-	-
		Special Nett Total :	-	465.00
		Parts Total :	-	9,053.70

Our Reference : NTUC19-127774/PRS/BX/ADJ/BX/gh Page No. 5

Your Reference:  $\underline{MT/1075445-001}$ Vehicle Number:  $\underline{SKA 9789M}$ 

S/N	DESCRIPTION	REPAIRER'S ESTIMATE (S\$)	OUR ASSESSMENT (S\$)
1	LABOUR To remove, cut out damage portion, straighten, panel beating, welding, align and renew replaced parts. (front)	~	400.00
2	To putty and respray painting on affected areas. (front)	-	400.00
3	To rewire front portion and refocus headlamp beam. (front)	-	30.00
4	To apply undersealing. <b>(front)</b>		20.00
5	To remove, cut out damage portion, straighten, panel beating, welding, align and renew replaced parts. <b>(rear)</b>	-	500.00
6	To putty and respray painting on affected areas. (rear)	-	600.00
7	To rewire rear portion. (rear) (not necessary)	_	-
8	To remove and install rear bootlid lock mechanism. (not necessary)	-	-
9	To remove and refit rear inner garnish and trim to facilitate the repair.	-	60.00
10	To apply undersealing. <b>(rear)</b>	-	30.00
11	To remove, refix reverse sensor. <b>(rear)</b>	-	60.00
12	Towing service.	H	-
13	To remove and install front lock mechanism. (front)	-	-
14	To remove, refix aircon condenser, pipes, drier vacuum and recharge gas. <b>(front)</b>	×	100.00
	Labour Total :	-	2,200.00
	TOTAL (PARTS & LABOUR) :	-	11,253.70

The final adjusted Lump Sum contract amount is \$9,000.00

(SINGAPORE DOLLARS NINE THOUSAND ONLY)

Frankie Pang AMSAE(AUST), AMIRTE, AMSOE, MASPACI, MSAAA Licensed Appraiser Chow Bo Xiong Automobile Appraiser

No.33, Ubi Ave 3, #02-15, Vertex Singapore 408868 Tel : (65) 6509 1788 Fax : (65) 6509 6221 Co.Reg. 200819280D Email : motorsurvey@fta.com.sg Post an Ad

Sian up Login

New Cars **Used Cars** Sell My Car Directory **Products** Insurance **Articles** Forum Resources



Post an Advertisement Sell it yourself! Advertise it at just \$58 until it's SOLD!

Ways of Selling


Advertiser Login

New 5 Years Renewal COE Toyota Wish 2.0A.



2.88% P.A, \$0 Admin, Monthly From \$688, 2 Years Warranty Engine And Gearbox. GV Credit StarAd



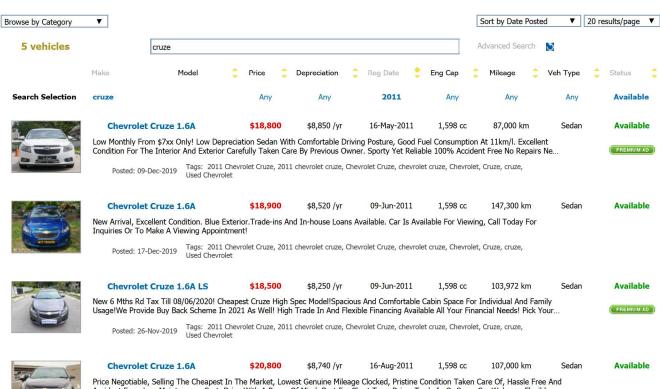



Accident Free, Low Maintenance Cost, Drive With A Peace Of Mind, Best For Short Term Drive, Trade In Or Scrap Car Welcome, Flexible.

Posted: 06-Dec-2019 Tags: 2011 Chevrolet Cruze, 2011 chevrolet cruze, Chev



#### Is your COE expiring? Let us help you renew it!

Getting your COE renewed is easy, fast and affordable. We'll help you renew your COE and get a loan for it. Get the cheapest loan in town and an approval in 2 days without effort! Enquire today.



For old advertisements, view Expired ads

**Chevrolet Cruze 1.6A** 

\$20,800

\$7,560 /yr

20-Oct-2011

1,598 cc

88,000 km

Sedan

Available

20 ▼ results/page

Trade In Welcome, Bank And In House Loan All Available, Interested Please Call For Viewing, Viewing By Appointment Only.

Boeki Auto Pte Ltd

Posted: 20-Nov-2019 Tags: 2011 Chevrolet Cruze, 2011 chevrolet cruze, Chevrolet Cruze, chevrolet cruze, Chevrolet cruze, cruze, cruze, Chevrolet Cruze, cruze, Chevrolet Cruze,

Save this search criteria, to get email alerts whenever a match is found.

Model Depreciation Reg Date Eng Cap Veh Type

Home | New Cars | Used Cars | Sell My Car | Directory | Products | Insurance | Article | Forum | Resources

sgCarMart is the number one car classifieds for parallel import cars, Toyota, Honda, Nissan, Mitsubishi & BMW. There are plenty of cars for sale, from vans, trucks, sedan cars, luxury cars, sports cars or stationwagons, SUV used cruze Singapore, used cruze, used vehicles Singapore or even buy used cruze Singapore. We have new car dealers comprising parallel impc Compare lers on our site. Find new car price lists, new car launches and new car promotions. Visit our partner sites for job openings for Singapore jobs,

### > Back to OneMotoring

## **Enquire PARF/COE Rebate for Registered Vehicle**

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	084D
Vehicle Details	
Vehicle No.:	SKA9789M
Vehicle to be Exported:	No
Intended Deregistration Date:	17 Dec 2019
Vehicle Make:	CHEVROLET
Vehicle Model:	CRUZE 1.6L AUTO ABS D/AB 2WD 4DR
Primary Colour:	Red
Manufacturing Year:	2011
Engine No.:	F16D4242888KA
Chassis No.:	KL1JA69E9BK128501
Maximum Power Output:	91.0 kW (122 bhp)
Open Market Value:	\$12,909.00
Original Registration Date:	19 Apr 2011
First Registration Date:	19 Apr 2011
Transfer Count:	2
Actual ARF Paid:	\$12,909.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	18 Apr 2021
PARF Rebate Amount:	\$7,099.00
Intended COE Rebate Details	
COE Expiry Date:	18 Apr 2021
COE Category:	A - Car (1600cc & below)
COE Period(Years):	10
QP Paid:	\$43,813.00
COE Rebate Amount:	\$5,853.00
Total Rebate Amount:	\$12,952.00

The information contained herein is correct as at 17 Dec 2019

OK