

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	370H
Vehicle Details	
Vehicle No.:	SKZ1370H
Vehicle to be Exported:	Yes
Intended Deregistration Date:	24 Jul 2023
Vehicle Make:	HONDA
Vehicle Model:	SHUTTLE 1.5G CVT SENSING
Primary Colour:	Black
Manufacturing Year:	2019
Engine No.:	L15B6020965
Chassis No.:	GK82100815
Maximum Power Output:	95.0 kW (127 bhp)
Open Market Value:	\$21,535.00
Original Registration Date:	14 Feb 2020
First Registration Date:	14 Feb 2020
Transfer Count:	0
Actual ARF Paid:	\$12,149.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	13 Feb 2030
PARF Rebate Amount:	\$9,111.00
Intended COE Rebate Details	
COE Expiry Date:	13 Feb 2030
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$30,010.00
COE Rebate Amount:	\$19,679.00
Total Rebate Amount:	\$28,790.00

The information contained herein is correct as at 20 Jul 2023

OK

Ding Auto Pte Ltd
Sin Ming Industrial Est. Sec C, Blk
10, #01-20
575645

Insurer Reference:
 Repairer Reference: **062539**
 Date calculated: **20/07/2023 5:03 PM**



Full Report
Registration: SKZ1370H
Printed: 20/07/2023 5:04 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Ding Auto	Currency:	SGD
Claim Reference:		Date of Incident:	05/07/23
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle
 Manufacturer: HONDA
 Model: MOBILIO (DD4/DD5)
 Sub Model: E
 Model Sheet Number: 35 M2 05
 Registration: SKZ1370H
 VIN number:
 Odometer: 0
Model Specs
 1.5 LTR 87 KW

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
 Signature:

Not Acknowledged
11/07/23
Phanny After Paint

EX 84000

Labour

Time Base 10 MU/h Price = 42.00 SGD/h
 WU Price SGD

Code	Description	Time Base	Price
812100	RENEW BONNET INCLUDES: R + R BONNET AND REQUIRED ATTACHED PARTS ASSEMBLE	5.0	21.00
8121B6	R + R L/BONNET SEAL	3.0	12.60
8121B7	R + R R/BONNET HINGE	3.0	12.60
7-21B0	R + R SCREEN WASHER BOTTLE	9.0	37.80
8101A2	RENEW COMPLETE FRONT BUMPER INCLUDES: FRONT BUMPER CPL AND R + R RADIATOR GRILLE.	5.0	21.00
813110)	RENEW RADIATOR GRILLE	3.0	12.60
NO NUMBER	R + R LEFT FRONT WING (BUMPER AND HEADLAMP REMOVED) INCLUDES: R + R LF WHEELHOUSE SHELL	9.0	37.80
NO NUMBER	R + R RIGHT FRONT WING INCLUDES: R + R INNER WING	9.0	37.80
831120	R + R WINDSCREEN INCLUDES: FRT AIR GRILLE, WIPER ARM AND REQUIRED TRIMS REMOVE AND REFIT	31.0	130.20
8101B1	R + R FRONT BUMPER SUPPORT	5.0	21.00
NO NUMBER	RENEW FRONT PANEL CPL	28.0	117.60

Code	Description	WU	Price SGD
NO NUMBER	RENEW LEFT SIDE MEMBER CLOSING PANEL	5.0	21.00
NO NUMBER	RENEW RIGHT SIDE MEMBER CLOSING PANEL	5.0	21.00
NO NUMBER	RENEW ROOF	110.0	462.00
841100)	RENEW DASHBOARD (REMOVED)	22.0	92.40
8201A8	R + R L/DOOR MIRROR	4.0	16.80
8141A6	R + R LEFT ROOF MOULDING	2.0	8.40
8221A0	RENEW R/R DOOR	30.0	126.00
8161A0	RENEW R/F DOOR	32.0	134.40
NO NUMBER	RENEW RIGHT FRONT SIDE FRAME	135.0	567.00
8471A2)	R + R FLOOR CARPET CPL	12.0	50.40
NO NUMBER	R + R TAILGATE SKIN	10.0	42.00
832120)	R + R REAR SCREEN	20.0	84.00
NO NUMBER	R + R LOWER TAILGATE TRIM	1.0	4.20
NO NUMBER	RENEW R/R SIDE PANEL	100.0	420.00
NO NUMBER	R + R LEFT SIDE WINDOW SEAL	3.0	12.60
NO NUMBER	R + R L/R INNER WINDOW CHANNEL SEAL	3.0	12.60
8111A5	RENEW REAR BUMPER	4.0	16.80
	INCLUDES: BUMPER AND ALL REQUIRED ATTACHED PARTS R + R		
NO NUMBER	RENEW R/LOWER INNER A-PILLAR	45.0	189.00
NO NUMBER	RENEW RIGHT B-PILLAR	50.0	210.00
NO NUMBER	RENEW FRONT FLOOR	60.0	252.00
NO NUMBER	R + R L/F SEAT	3.0	12.60
NO NUMBER	R + R LEFT SEAT 3. SEAT ROW	3.0	12.60
NO NUMBER	R + R R/F SEAT	3.0	12.60
NO NUMBER	R + R RIGHT SEAT 3. SEAT ROW	3.0	12.60
219131	R + R LEFT FRONT DRIVE SHAFT CPL	9.0	37.80
219132	R + R RIGHT FRONT DRIVE SHAFT CPL	9.0	37.80
421104)	R + R L/F TYRE AND BALANCE	6.0	25.20
NO NUMBER	R + R L/F WHEEL	1.0	4.20
4161A0)	R + R FRONT AXLE MEMBER	29.0	121.80
416118)	R + R LEFT FRONT LOWER CONTROL ARM	8.0	33.60
4151A7)	RENEW L/F STEERING KNUCKLE	11.0	46.20
4101A3)	RENEW L/F FRONT BRAKE PIPE	1.0	4.20
NO NUMBER	R + R LEFT FRONT SHOCK ABSORBER	3.0	12.60
421104)	R + R R/F TYRE AND BALANCE	6.0	25.20
NO NUMBER	R + R R/F WHEEL	1.0	4.20
416119)	R + R RIGHT FRONT LOWER CONTROL ARM	8.0	33.60
4151A8)	RENEW R/F STEERING KNUCKLE	11.0	46.20
4101A4)	RENEW R/F FRONT BRAKE PIPE	1.0	4.20
NO NUMBER	R + R RIGHT FRONT SHOCK ABSORBER	3.0	12.60
5131J4)	RENEW STEERING GEAR	20.0	84.00
NO NUMBER	BLEED HYDRAULIC BRAKE SYSTEM	5.0	21.00

Labour Cost
Panel / Mechanical Labour

Hrs WU
90.70 907.0 3,809.40

Total of Labour

3,809.40

Paint

Paint Work

SYSTEM AZT

Time Basis 10 WU/h

Code	Description	WU	Price SGD
	BONNET NEW PART PAINTING	16.0	
	L/F WING NEW PART PAINTING	10.0	

Code

Description

Time Basis 10 WU/h
WU Price SGD

R/F WING NEW PART PAINTING	10.0
FRONT PANEL CPL SURFACE PAINT	5.0
L/S-MEMB CLOSING PNL SURFACE PAINT	4.0
R/S-MEMB CLOSING PNL SURFACE PAINT	4.0
RIGHT FRONT DOOR NEW PART PAINTING	15.0
R/R DOOR NEW PART PAINTING	13.0
R/F SIDE FRAME NEW PART PAINTING	41.0
R/OUTER SILL PANEL NEW PART PAINTING	24.0
R/INN/LWR A-PILLAR SURFACE PAINT	5.0
RIGHT B-PILLAR SURFACE PAINT	6.0
ROOF NEW PART PAINTING	65.0
R/RR SIDE PANEL NEW PART PAINTING	25.0
FRONT FLOOR SURFACE PAINT	12.0
FRONT BUMPER NEW PART PAINT K1R	11.0
FRT TOWING EYE COVER NEW PART PAINT K1R	3.0
REAR BUMPER NEW PART PAINT K1R	9.0

Paint Material Per Part

Code	Description	Price SGD
0471	BONNET NEW PART PAINTING	39.49
0741	L/F WING NEW PART PAINTING	15.31
0742	R/F WING NEW PART PAINTING	15.31
1009	FRONT PANEL CPL SURFACE PAINT	5.28
1305	L/S-MEMB CLOSING PNL SURFACE PAINT	1.23
1306	R/S-MEMB CLOSING PNL SURFACE PAINT	1.23
1482	RIGHT FRONT DOOR NEW PART PAINTING	35.06
1782	R/R DOOR NEW PART PAINTING	29.02
2086	R/F SIDE FRAME NEW PART PAINTING	56.81
2102	R/OUTER SILL PANEL NEW PART PAINTING	28.41
2254	R/INN/LWR A-PILLAR SURFACE PAINT	7.04
2288	RIGHT B-PILLAR SURFACE PAINT	9.50
2351	ROOF NEW PART PAINTING	95.27
3482	R/RR SIDE PANEL NEW PART PAINTING	29.72
4251	FRONT FLOOR SURFACE PAINT	33.44
0283	FRONT BUMPER NEW PART PAINT K1R	44.32
0294	FRT TOWING EYE COVER NEW PART PAINT K1R	0.70
2083	REAR BUMPER NEW PART PAINT K1R	34.20

Labour Cost - Paint

Factor

42.00 SGD/h

Time Paint

Hrs WU Price SGD

Preparation Main Work Metal

1.70 17.0 71.40

Preparation Comp. Work Plastic

0.30 3.0 12.60

Total

10 WU/h

29.80 298.0 1,251.60

Material Cost - Paint

New Part Painting
 New Part Painting - Plastic K1R
 Surface-/Blend Paint
 Material-constant Metal
 Material-constant Plastic
Total

Price SGD
 344.40
 79.22
 57.72
 18.10
 9.00
508.44

Spare Parts

				prices as at 2015-06-01/01	
Code	Description	Part Number	Part Source		Price SGD
0257	FRONT NUMBER PLATE	KNPL3	Original	4500	35.00
0258	FRT NO PLATE REINF	KNPL0	Original		45.00
0283	FRONT BUMPER	71101TE7K00ZZ	Original	590.00	✓
0294	FRT TOWING EYE COVER	71104TE7K00ZC	Original	25.00	✓
0321	L/LWR BUMPER BRACKET	71198TG1T01	Original	20.00	✓
0322	R/LWR BUMPER BRACKET	71193TG1T01	Original	20.00	✓
0340	FRT BUMPER SUPPORT	71130SYY000ZZ	Original	240.00	X
0347	L/BUMPER TRIM GRILLE	71107TE7K01	Original	145.00	✓
0348	R/BUMPER TRIM GRILLE	71102TE7K01	Original	145.00	✓
0409	RAD GRILLE BRACKET	71123TE7K01	Original	55.00	?
0410	GRILLE	71121TE7K01	Original	260.00	?
0414	GRILLE MOULDING	71122TE7K01	Original	295.00	?
0431	GRILLE BADGE	75700TE7K00	Original	30.00	?
0471	BONNET	60100TG1T01ZZ	Original	680.00	X
0475	L/BONNET HINGE	60170TG1T00ZZ	Original	40.00	X
0476	R/BONNET HINGE	60120TG1T00ZZ	Original	40.00	X
0493	BONNET LOCK	74120TG1T01	Original	100.00	X
0561	L/F HEADLAMP	33150TG4T01	Original	1,880.00	✓
0562	R/F HEADLAMP	33100TG4T01	Original	1,880.00	✓
0741	L/F WING	60261T4VK10ZZ	Original	185.00	✓
0742	R/F WING	60211T4VK10ZZ	Original	185.00	✓
0841	L/F WHEELHOUSE COVER	74150TE8K20	Original	105.00	✓
0842	R/F WHEELHOUSE COVER	74100TE8K20	Original	105.00	✓
1009	FRONT PANEL CPL	60400TE7K00ZZ	Original	440.00	?
1305	L/S-MEMB CLOSING PNL	60944TF0300ZZ	Original	90.00	?
1306	R/S-MEMB CLOSING PNL	60844TF0300ZZ	Original	90.00	?
1393	COWL PANEL GRILLE	74200TG4U00	Original	195.00	X
1401	WINDSCREEN	73101TG4U01	Original	1,550.00	✓
1411	WINDSCREEN BOND KIT	0871899960EH		0.00	
1413	FRT SCREEN MNTG KIT	91568TF0003		0.00	
1419	WINDSCREEN MOULDING	73125TG1T00	Original	105.00	✓
1421	W-SCREEN CT LWR SEAL	73126SYY000	Original	90.00	30.00
1436	WASHER RESERVOIR	76841TG1T11	Original	70.00	✓
1482	RIGHT FRONT DOOR	67010TE7K00ZZ	Original	545.00	✓
1488	R/F UPPER DOOR HINGE	67410TG4U01ZZ	Original	40.00	✓
1496	R/F LOWER DOOR HINGE	67420TG4U01ZZ	Original	40.00	✓
1510	R/F DOOR SEAL	72310TE7K02	Original	120.00	?
1537	L/F UPPER WING MLDG	75495TG2K10	Original	65.00	✓
1538	R/F UPPER WING MLDG	75490TG2K00	Original	65.00	X

Code	Description	Part Number	Part Source	Price SGD
1548	R/F WINDOW REGULATOR	72211TE7K01	Original	? 180.00
1550	R/F WINDOW MOTOR	72215TG2K11	Original	? 220.00
1580	R/F DOOR LOCK	72110TG2K01	Original	? 180.00 X
1582	R/DOOR STRIKER	72135SDAA01	Original	? 35.00 X
1610	R/R GUIDE FRONT RAIL	72231TG1T01	Original	? 45.00 ?
1620	R/F CHANNEL SEAL	72335TG4U00	Original	GM 100.00
1642	R/DOOR PROTECTION	67326TE8K00	Original	NIP 55.00 X
1737	L/DOOR MIRROR ASSY	76250TG2K01	Original	BN 285.00
1738	R/DOOR MIRROR ASSY	76200TG2K01	Original	BN 285.00
1741	L/D-MIRROR INN COVER	76270TG2K00	Original	BN 55.00
1742	R/D-MIRROR INN COVER	76220TG2K00	Original	BN 55.00
1782	R/R DOOR	67510TE7K00ZZ	Original	BN 540.00
1784	R/R DOOR SEAL	72810TE7K02	Original	120.00 ?
1788	R/R UPPER DOOR HINGE	67910TG4U01ZZ	Original	? 40.00 X
1796	R/R LOWER DOOR HINGE	67920TG4U01ZZ	Original	? 40.00 X
1878	R/R DOOR LOCK	72610TG2K01	Original	? 190.00 X
1948	R/R DOOR MOULDING	67824TE7K00	Original	75.00 ?
2086	R/F SIDE FRAME	04635TE7K00ZZ	Original	340.00 ?
2102	R/OUTER SILL PANEL	04631TE7K00ZZ	Original	? 240.00 X
2254	R/INN/LWR A-PILLAR	63130TE7K00ZZ	Original	? 300.00
2308	RIGHT B-PILLAR	63210TE7K00ZZ	Original	420.00 ?
2351	ROOF	62100TE7K00ZZ	Original	? 700.00
2421	L/ROOF MOULDING	75260TE7K91	Original	BN 75.00
2422	R/ROOF MOULDING	75250TE7K91	Original	BN 75.00
2583	REAR BUMPER	71501TE7K00ZZ	Original	? 660.00 ?
2620	R/R BUMPER BRACKET	71593TE7K01	Original	BN 35.00 X
3049	L/R WINDOW SEAL	73525SYY000	Original	45.00 ?
3050	R/R WINDOW SEAL	73525SYY000	Original	45.00 ?
3151	REAR SCREEN	73201TE7K01	Original	BN 600.00
3159	REAR SCREEN BOND KIT	0871899960EH		0.00
3160	REAR SCREEN FIX SET	USE SINGLE PARTS		0.00
3162	LWR REAR SCREEN SEAL	73225TE7K00	Original	BN 55.00
3284	R/R LAMP	33501TE7T01	Original	CM 320.00
3482	R/RR SIDE PANEL	04636TE7K00ZZ	Original	? 880.00
3804	R/R SIDE WINDOW	73501TE7K01	Original	720.00 ?
3805	L/INN SIDE WDW SEAL	73525SYY000		0.00
3806	R/INN SIDE WDW SEAL	73525SYY000	Original	60.00 ?
3807	L/R SIDE WINDOW SEAL	73525TE7K00		0.00
3808	R/R SIDE WINDOW SEAL	73525TE7K00	Original	45.00 ?
3810	R/LWR S/WINDOW SEAL	73529TE7K00	Original	50.00 ?
3812	R/R SIDE WINDOW SEAL	73528TE7K00	Original	55.00 ?
3861	L/R WDW BONDING KIT	0871899960EH		0.00
3862	R/R WDW BONDING KIT	0871899960EH		0.00
3863	L/SIDE WDW MNTG KIT	USE SINGLE PARTS		
3864	R/SIDE WDW MNTG KIT	USE SINGLE PARTS		0.00
3867	L/FASTENING CLIP	91553TE7K00		0.00
3868	R/FASTENING CLIP	91503TE7K00		0.00
3869	L/FASTENING CLIP	91501TE7K00		0.00
3870	R/FASTENING CLIP	91502TE7K00		580.00 ?
4251	FRONT FLOOR	65100TE7K00ZZ	Original	780.00 ?
4331	INSTRUMENT PANEL	77103TG4K00ZA	Original	BN 220.00
4931	INTERIOR MIRROR	76430SELT01ZA	Original	180.00 ?
4933	L/SUN VISOR	83280TG4K30ZA	Original	180.00 ?
4934	R/SUN VISOR	83230TG4K00ZA	Original	

Code	Description	Part Number	Part Source	Price SGD
4942	R/UPP A-PILLAR TRIM	84101TG4K01ZA	Original	
4950	R/LWR B-PILLAR TRIM	84121TE7K01ZA	Original	R ₁ 65.00 ✓
4952	R/UPP B-PILLAR TRIM	84111TE7K01ZA	Original	R ₁ 90.00 ✓
4957	ROOF COVER PANEL	83200TE7K00ZA	Original	R ₁ 65.00 ✓
7009	FRT BCKT FRT ASSEMB	50200TE7T01	Original	R ₁ 640.00 ✓
7035	L/F DRIVE SHAFT	44306TE7K11	Original	800.00 ?
7036	R/F DRIVE SHAFT	44305TE7K11	Original	790.00 ?
7053	L/F LWR AXLE ARM	51360TE7K00	Original	R ₁ 790.00 ✓
7054	R/F LOWER AXLE ARM	51350TE7K00	Original	160.00 ?
7081	L/F STEERING KNUCKLE	51216TE7K00	Original	R ₁ 160.00 ✓
7082	R/F STEERING KNUCKLE	51211TE7K00	Original	230.00 ?
7089	L/FR SHOCK ABSORBER	51621TE7K03	Original	R ₁ 230.00 ✓
7090	R/FR SHOCK ABSORBER	51611TE7K03	Original	260.00 ?
7091	L/SUPPORT BEARING	51920TG4T01	Original	R ₁ 260.00 ✓
7092	R/SUPPORT BEARING	51920TG4T01	Original	35.00 ?
7131	L/F WHEEL HUB	44600SLNA00	Original	R ₁ 35.00 ✓
7132	R/F WHEEL HUB	44600SLNA00	Original	200.00 ?
7165	L/F BRAKE HOSE	01465TE7K00	Original	R ₁ 200.00 ✓
7166	R/F BRAKE HOSE	01464TE7K00	Original	80.00 X
7201	L/FR WHEEL	42700TE7T01	Original	T ₁ 80.00 ✓
7202	R/FR WHEEL	42700TE7T01	Original	O ₁ 350.00 ✓
7227	L/FR TYRE	185/65 R15..H	Original	R ₁ 350.00 ✓
7228	R/FR TYRE	185/65 R15..H	Original	250.00 ?
7261	FRONT STABILISER	51300TE7K02	Original	R ₁ 250.00 ✓
7271	L/F STABI HANGER	51320TG2T01	Original	D.T 150.00 ✓
7272	R/F STABI HANGER	51320TG2T01	Original	70.00 X
7300	STEERING GEAR	53601TG1T02	Original	R ₁ 70.00 ✓
7309	L/TIE ROD	53010TF0003	Original	B1/T ₁ 1,550.00 ✓
7310	R/TIE ROD	53010TF0003	Original	65.00 X
7311	L/TIE ROD BALL JOINT	53560TF0003	Original	R ₁ 65.00 ✓
7312	R/TIE ROD BALL JOINT	53540TF0003	Original	55.00 ?
1000	FRT SIDE GLASS RH	GLASS	Original	R ₁ 55.00 ✓
1001	F/SIDE GLASS SEAL RH	SEAL	Original	R ₁ 240.00 ✓
1002	AIRBAG - DRIVER	AIRBAG	Original	R ₁ 55.00 ✓
1003	AIRBAG - PASSENGER	AIRBAG	Original	R ₁ 1,150.00 ✓
1004	AIRBAG ECU CPL	ECU	Original	1,280.00 ✓
1005	SEAT BELT ASSY RH	SEAT BELT	Original	880.00 ✓
1006	SEAT BELT ASSY LH	SEAT BELT	Original	420.00 ✓
1007	HEADLINING AIRBAG RH	HEADLINING	Original	T ₁ 420.00 ✓
1008	HEADLINING AIRBAG LH	HEADLINING	Original	T ₁ 420.00 ✓
1009	HEADLAMP BRKT RH	BRACKET	Original	R ₁ 1,400.00 ✓
1010	HEADLAMP BRKT LH	BRACKET	Original	1,400.00 ✓
1011	FOG LAMP ASSY RH	LAMP	Original	35.00 ?
1012	FOG LAMP ASSY LH	LAMP	Original	35.00 ?
1013	SILL PANEL RH	PANEL	Original	CM 375.00 ✓
1014	SILL PANEL LH	PANEL	Original	375.00 ✓
1015	ABS SENSOR FRT RH	SENSOR	Original	CM 380.00 ✓
1016	ABS SENSOR FRT LH	SENSOR	Original	380.00 ?
1018	ENGINE LOWER COVER	COVER	Original	125.00 ?

f: OEM Parts
n: Non-OEM Parts
u: Used parts

Savings
Subtotal

Total

0.00
38,495.00
38,495.00

Extras

Code	Description	Price SGD
1017	ECU - REPROGRAMMING ECU	350.00
	Total Extras	450.00*
		450.00

Final Calculation

	SGD	SGD
Parts		
Total Parts	38,495.00	38,495.00
Labour Time Base 10 WU/h		
Total 907.0 WU X 42.00 SGD/h	3,809.40	
Total of Labour		3,809.40
Total Of Extras		450.00
Paint Work Time Base 10 WU/h		
Labour Cost 298.0 WU X 42.00 SGD/h	1,251.60	
Material Cost	508.44	
Total Paint Including Material		1,760.04
Repair Cost Excludes GST		44,514.44
GST (+8.0%)		3,561.16
Repair Cost Included GST		48,075.60

Comments

- * - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
-) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of Submission 11/07/2023 18:16 (SGT)
Reported by Actual Driver
Date of Accident 05/07/2023 14:10 (SGT)
Exact Location of Accident Woodlands, Singapore
Additional Location Information WOODLANDS AVE 3 towards WOODLANDS AVE 5
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SKZ1370H

INSURED/POLICYHOLDER

Is company? No
Name Of Registered Owner STANLEY KOH KIM WEE
NRIC No SXXXX370H
Email Address STANLEYKOHKW@GMAIL.COM
Mobile Phone No (Phone) +65-97442846
Alternative Phone No -

VEHICLE PARTICULARS

Manufacturer Honda
Model Shuttle
Variant -
Exact purpose for which vehicle was being used at time of accident Private use
Are you claiming under your own insurance policy for repair to your vehicle? Yes
Vehicle Category Private car
Transmission Auto
CC 1496

INSURANCE COMPANY

Name of Insurance Company China Taiping Insurance (Singapore) Pte. Ltd.
Policy Number / Cover Note Number DMPCSNW00015912302

DRIVER

Name of Driver MANNUELA SARAH HOPE KOH
NRIC No TXXXX633I
Date Of Birth 09/01/2002
Occupation Indoor

IMPORTANT NOTICE

SKETCH PLAN

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;

(ii) investigating the accident and/or my claims;

(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;

(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or

(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.

(collectively the "Purposes")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and

(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.




Witnessed by Reporting Centre
Personnel

Policyholder's Signature / Date &
Time

Driver's Signature (if driver is not the policyholder) / Date
& Time

Sketch Plan

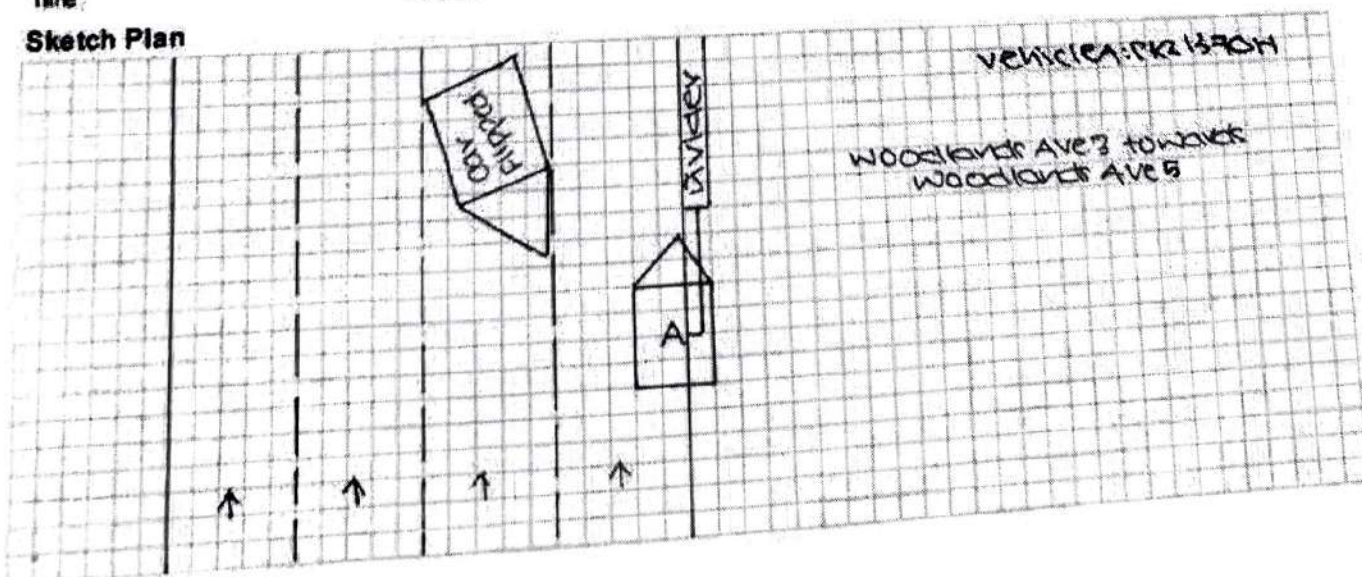


Describe Circumstances of the Accident

was driving on most right lane exiting BKE at woodlands. Dozed off for a second and crashed into the road divider, causing the car to flip and landed upright on the second lane. No other vehicles nor people were harmed.

Declaration

We declare the foregoing particulars are true in every respect.


Policyholder's Signature / Date & Time


Driver's Signature (if driver is not the policyholder) / Date & Time




Witnessed by Reporting Centre Personnel