



Mercedes-Benz

Cycle & Carriage  
Industries Pte Limited  
Authorised Dealer  
Company No. 196400367W  
GST Reg No. MR-8500111-X

## ESTIMATE FOR SGJ165Y

MS FIRST CAPITAL INSURANCE LIMITED

MOTOR CLAIM DEPARTMENT  
6 RAFFLES QUAY  
#21-00  
SINGAPORE 048580  
65073848

Vehicle & Document Information  
WIP No 20231  
Reg No/Reg Date SGJ165Y / 08/11/2019  
Date In/Mileage / 0  
Chassis No WDD2050402R5053768  
Engine No 27491031788544  
Make/Model MB/MB C 180 AVANTGARDE/AVANTGARDE  
Colour/Trim 029 996 DesignoHyc/ 041 115 ARTICOSpSea

Account No	Terms	Date/Time Printed	CSE	Operator	Description of Goods / Services	Qty	Unit Price	Disc%	Amount
WF001862	Credit	19/08/2024/ 15:59	K0	301 / Kerlyn Ong					
Z REQUEST					Customer Request				
M BPNSUN					POLICY NO/ACC DATE : D23MTPV01014524 // 17/08/2024				
					DRIVE IN/TP VEH NO. : 19/08/2024 // SHB5244A - FIRST CAPITAL				
					DATE IN/DATE SURVEY:				
					BY/AUTHORIZED ON :				
A BPILAB					STRAIGHTEN, REMOVE SUPPORT ASSY FROM FRAME IMPACT				6720.00
					DISASSEMBLE AND REPLACE ATTACHED DAMAGED PARTS & REFINISH.				
A BPIRES					RESPRAY RH/ FRONT FENDER, RH/ FRONT DOOR, RH/ REAR DOOR, RH/ REAR				4200.00
					FENDER, REAR BUMPER				
A BPILAB					USING XENTRY DIAGNOSTIC TO CHECK ON CONTROL UNIT RESET MEMORY TO			0.10	380.00
					IDENTIFICATION STANDARD. NETT				
A BPILAB					REMOVE & TRANSFER DOOR MECHANICAL & ELECTRICAL INSTALL TO NEW DOOR.NETT			0.05	800.00
A BPILAB					CHECK REAR LIGHTING SYSTEM AND WATER TEST FOR ANY LEAKAGE. NETT				120.00
A BPILAB					REMOVE & REFIT LUGGAGE COMPARTMENT,TRIM, GARNISH-				960.00
					CARPET FOR NECESSARY REPAIR.NETT				
A BPILAB					BEADS, SEAMS AND FLANGES ON REPLACEMENT BODY PANELS/ COMPONENTS SEAL.				120.00
A BPILAB					CAVITY PRESERVATION ON REPLACED OR REPAIRED BODY PANELS PERFORM. NETT				180.00
A BPILAB					TO INSPECT & CONDUCT WHEEL ALIGNMENT.NETT				540.00
S BPNSUB					TRANSFER RIM AND BALANCING TYRE. NETT				60.00
					PURCHASE ORDER NO:				
M BPNSUN									15.00

Confirmed & accepted by

**Kerlyn Ong Kai Li**  
DID: 6771 4420 HP: 9186 5113  
Email: kerlyn.ong@cyclecarriage.com.sg  
Cycle & Carriage Industries Pte Ltd  
Customer Service Centre - Pandan Loop

Authorized signatory and company stamp

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required.

Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.

Pandan Loop Service Center  
188 Pandan Loop  
Singapore 128378  
Tel: 6777 8388  
Fax: 6779 5383  
www.mercedes-benz.com.sg



and Mercedes-Benz are trademarks of Mercedes-Benz Group AG





Mercedes-Benz

Cycle & Carriage  
Industries Pte Limited  
Authorised Dealer  
Company No. 196400367W  
GST Reg No. MR-8500111-X

## ESTIMATE FOR SGJ165Y

MS FIRST CAPITAL INSURANCE LIMITED

MOTOR CLAIM DEPARTMENT  
6 RAFFLES QUAY  
#21-00  
SINGAPORE 048580  
65073848

WIP No

Reg No/Reg Date

Date In/Mileage

Chassis No

Engine No

Make/Model

Colour/Trim

### Vehicle & Document Information

20231

SGJ165Y / 08/11/2019

WDD2050402R5053768

27491031788544

MB/MB C 180 AVANTGARDE/AVANTGARDE

029 996 DesignoHyac/ 041 115 ARTICOSpSea

Account No	Terms	Date/Time Printed	CSE	Operator	Description of Goods / Services	Qty	Unit Price	Disc%	Amount
WF001862	Credit	19/08/2024/ 15:59	K0	301 / Kerlyn Ong	SUNDY				
					M RH/ FRONT FENDER	1.00	1106.73	00.00	1106.73
					M RH/ FRONT DOOR	1.00	2322.82	00.00	2322.82
					M RH/ FRONT DOOR SEAL	1.00	335.72	00.00	335.72
					M RH/ FRONT DOOR SELF-ADHESIVE TRIM	1.00	29.78	00.00	29.78
					M RH/ FRONT DOOR ORNAMENTAL MOLDING	1.00	232.21	00.00	232.21
					M RH/ FRONT DOOR BASIC CARRIER RAIL	1.00	782.17	00.00	782.17
					M RH/ REAR DOOR	1.00	2876.98	00.00	2876.98
					M RH/ REAR DOOR SEAL	1.00	335.72	00.00	335.72
					M RH/ REAR DOOR SELF-ADHESIVE TRIM	1.00	29.78	00.00	29.78
					M RH/ REAR DOOR ORNAMENTAL MOLDING	1.00	197.21	00.00	197.21
					M RH/ REAR DOOR WINDOW GUIDE	1.00	98.10	00.00	98.10
					M RH/ REAR FENDER	1.00	3104.83	00.00	3104.83
					M RH/ REAR FENDER VENT FLAP	1.00	47.37	00.00	47.37
					M RH/ REAR FENDER INSULATION	1.00	66.63	00.00	66.63
					M REAR BUMPER	1.00	2078.29	00.00	2078.29
					M RH/ REAR BUMPER SIDE STABILITY	1.00	90.85	00.00	90.85
					M RH/ FRONT DOOR CHROME MOULDING	1.00	151.23	00.00	151.23
					M RH/ REAR DOOR CHROME MOULDING	1.00	108.63	00.00	108.63
					M RH/ REAR DISK WHEEL	1.00	690.65	00.00	690.65

Confirmed & accepted by

**Kerlyn Ong Kai Li**

DID: 6771 4420 HP: 9186 5113

Email: kerlyn.ong@cyclecarriage.com.sg

Cycle & Carriage Industries Pte Ltd

Customer Service Centre - Pandan Loop

Authorized signatory and company stamp

Nett	28,780.70
9% GST on	28780.70
28780.70	2590.26
<b>Total Payable</b>	<b>31,370.96</b>

Validity of this estimate is 14 days from date of quote. This is a computer generated document, no signature is required.

Estimated costs quoted are excluding GST. We would mention that the above estimate is based on our initial inspection and does not include any additional parts or labour which may be required after repair work has commenced. Occasionally worn or damaged parts are discovered after work has started and needed for repairs or replacement. However, should this occur, we would advise you. Please be informed that a deposit of 50% of the above estimate is payable before commencement of the work. Payment for this may be made in cash, credit card or cheque. You must also agree to pay full amount for renewal of the windscreen in the event of inadvertent breakage in the course of renewing the rubber seal or other repair requiring the removal of the windscreen.

Pandan Loop Service Center  
188 Pandan Loop  
Singapore 128378  
Tel: 6777 8388  
Fax: 6779 5383  
www.mercedes-benz.com.sg



and Mercedes-Benz are trademarks of Mercedes-Benz Group AG





SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

- 1. Please report correctly the details of the accident to speed up the claims process.
- 2. This Form must be completed by the Policyholder and/or the Actual Driver
- 3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
- 4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
- 5. Any false reporting may be referred to the Police for investigation.
- 6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
- 7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of First Submission 19/08/2024 17:20 (SGT)  
Reported by Both Policyholder and Actual Driver  
Date of Accident 17/08/2024 10:07 (SGT)  
Exact Location of Accident Singapore  
Additional Location Information ALONG CHOA CHU KANG AVE 1 (KEAT HONG MIRAGE)  
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SGJ165Y

INSURED/POLICYHOLDER

Is company? No  
Name Of Registered Owner ONG WEI WAH WINSTON  
NRIC No SXXXX911G  
Email Address  
Mobile Phone No  
Alternative Phone No -

VEHICLE PARTICULARS

Manufacturer Mercedes  
Model C180  
Variant -  
Exact purpose for which vehicle was being used at time of accident -  
Are you claiming under your own insurance policy for repair to your vehicle? No - Claiming third party  
Vehicle Category Private car  
Transmission Auto  
CC 1595  
Vehicle Fuel -  
First Registration Date 08/11/2019  
Chassis no WDD2050402R5053768  
Effective Date/Time of Ownership -

INSURANCE COMPANY

Name of Insurance Company Sompo Insurance Singapore Pte. Ltd.  
Policy Number / Cover Note Number D23MTPV01014524

DRIVER





Name of Driver .....	ONG WEI WAH WINSTON
NRIC No .....	SXXXX911G
Date Of Birth .....	
Occupation .....	Indoor
Driving Pass Date .....	13/10/2011
Driving License Pass Class .....	3
Driving License Validity .....	Valid
Driving experience .....	12 YEARS AND 10 MONTHS
Gender .....	Male
Mobile Number .....	-
Alt. Phone Number .....	-
Email Address .....	-
Address .....	-
Address complement .....	-
Postcode .....	-
Is the driver the policyholder? .....	Yes
If No, Relationship of the Driver with the Insured .....	-
Does Driver Own Other Vehicles? .....	No
Vehicle Registration Number of Other Vehicle Owned by Driver .....	-
Insurance Company of Other Vehicle Owned by Driver .....	-

#### GENERAL INFORMATION OF THE ACCIDENT

Type of Accident .....	Side Swipe
Weather Conditions .....	Clear
Road Surface .....	Dry

#### OTHER INFORMATION

Was any foreign vehicle involved in the accident? .....	No
Number of vehicles involved in the accident .....	2
Was anybody injured in the Accident? .....	No
Was any injured conveyed to hospital by ambulance? .....	-
Was any other vehicle or property damaged? .....	Yes
Number of Passengers (Including Driver) .....	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance? .....	No
Translator's name .....	-
Translator's ID .....	-
Translator's phone number .....	-
Translator's email .....	-
Original language used in the statement .....	-

#### DETAILS OF POLICE ACTION

Was the accident reported to the police? .....	No
Was notice of intended Prosecution given? .....	No
If yes, against whom? .....	-

#### CIRCUMSTANCES OF ACCIDENT

#### REFER TO ATTACHMENT

#### ATTACHMENT(S)

Are accident photos available for attachment? .....	Yes
Was there any video captured by Car Camera? .....	No

#### DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number .....	SHB5244A
Vehicle Manufacturer .....	-



Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Taxi
Name of Driver	LIO YOON FATT
NRIC No	SXXXX177Z
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-



## SKETCH PLAN

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that :

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of :

(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;

(ii) investigating the accident and/or my claims;

(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;

(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or

(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.

(collectively the "Purposes")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and


(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

  
Policyholder's Signature / Date &  
Time 19/08/2024 1406

Driver's Signature (If driver is not the policyholder)  
& Time

Kerlyn Ong Kai Li  
DID: 6771 4420 HP: 9186 5113  
Email: kerlyn.ong@cyclecarriage.com.sg  
Cycle & Carriage Industries Pte Ltd  
Wine Road by Pandan Loop  
Personnel  
KERLYN

### Sketch Plan

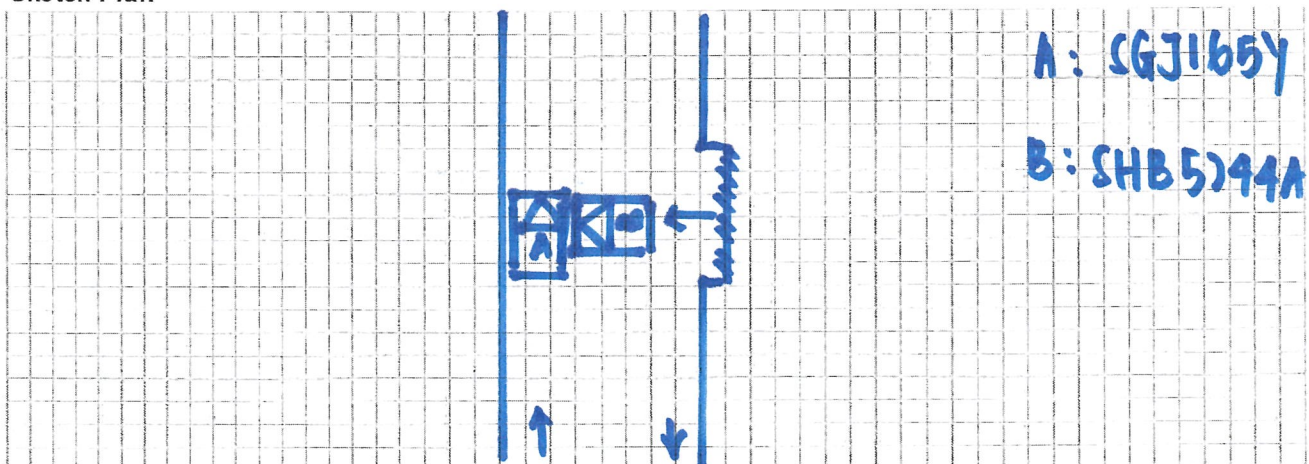



**Describe Circumstances of the Accident**

I WAS DRIVING MY CAR (SGJ165Y) AT CHOA CHU KANG AVE 1 (KEAT HONG MIRAGE) HEADING TO THE EXIT.

VEHICLE B (SHB5244A) STOPPED HIS VEHICLE AT THE RUBBISH CHUTE TO DROP OFF A PASSENGER. THE DRIVER DID NOT NOTICE MY CAR AND MOVED OFF FROM STATIONARY POSITION AND COLLIDED ONTO RIGHT PORTION.

**Declaration**

We declare the foregoing particulars are true in every respect.



Policyholder's Signature / Date &  
Time 19/08/2024 1406

**Kerlyn Ong Kai Li**  
DID: 6771 4420 HP: 9186 5113  
Email: kerlyn.ong@cyclecarriage.com.sg  
Cycle & Carriage Industries Pte Ltd  
Customer Service Reporting Centre  
Personnel KERLYN

Driver's Signature (If driver is not the policyholder) / Date & Time