

ASS. REC. BY:

REF: 072/

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: _____

Policy No. _____

Claims No. _____


Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

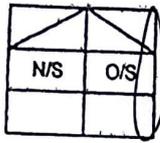

Bal. or Market Value: \$71K

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 09 days Res.: Yes or No

Lum Sum: 1.81 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: GRM 1043C Yr Regn: 10, 22

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Traller or A1

Make: NIS NV350 c.c. 1998

Colour: M. Grey AC: Insured / Std / NI / NA

Sp. Reading: 63281 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: VR 2E26 - 137609

Gen. Cohd: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Mod: NIT / S/Rim / STD A/Rim or

Tyre Size: F: 195/80R15

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front Rear

R/Bal. 4 mm R/Bal. 7 mm

L/Bal. 3 mm L/Bal. 7 mm

D.O.A. 1/10/24 D.O.I. 3/10/2024

Survey held at _____

Des. of Damages: Fnt / Rear / O/S / N/S / UIC / Rooftop or

O/S body

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

1 Check Tyres

Date/Time, File Pass to?

: Prell. Report

Days Of Repair: _____

1) Date/Time, File Return to?

: Final Report

Resurvey No. of Trip: _____

Survey Fee:

2) _____

Add Fee: : Site Insp (\$ _____)

Transportation

: Interview (\$ _____)

S - RS - SI

: Tech Invs (\$ _____)

Others

: Weekend (\$ _____)

TOTAL

Report Format :

Lump Sum / I.B.I: (\$ _____)

Lai Huat (Meng Kee) Motor Pte Ltd
160 Sin Ming Drive, #04-01, #04-02 &
#07-03, Sin Ming Autocity
575722

Insurer Reference: DMCVSNW00081462301
 Repairer Reference: 74751
 Date calculated: 02/10/2024 5:21 PM

Full Report
Registration: GBM1043C
Printed: 02/10/2024 5:21 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	Jenny Lim	Currency:	SGD
Claim Reference:	DMCVSNW00081462301	Date of Incident:	01/10/24
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle			
Manufacturer:	NISSAN		
Model:	NV350 URVAN (E26)		
Sub Model:	BASE MODEL		
Model Sheet Number:	71 1H 01		
Registration:	GBM1043C		
VIN number:			
Odometer:	63281		
Model Specs			
FROM 10.2022	REAR AIR CONDITION	CENTRAL LOCKING	LED HEADLAMP
LED FOG LAMPS	CHROME GRILLE	GRADE DX	L/R SLIDING WINDOW
R/R SLIDING WINDOW	2.5 LTR 94 KW	TYRES 195/80 HR 15	BOX VAN GLAZED
L/SLIDING DOOR	R/SLIDING DOOR	TWO COAT METALLIC	PREPARE OFF VEHICLE

Not available
Assess B & paint
Est @ 150dp
9 days

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
NO NUMBER	R + R FRONT BUMPER		4.0	16.80
	INCLUDES: R + R FRONT GRILL			
UA10A2)	RENEW FRONT BUMPER (BUMPER REMOVED)		3.0	12.60
	INCLUDES: R + R NECESSARY ATTACHED PARTS, RENEW IF NECESSARY			
RE80A2)	R + R R/HEADLAMP CPL		3.0	12.60
WH40A1	ADD WORK FOR H-LAMP LEVEL CONTROL		3.0	12.60
UU26A2)	R + R RIGHT FRONT WING		3.0	12.60
UH10A2	RENEW R/F DOOR		18.0	75.60
	INCLUDES: R + R DOOR, CONVERT ALL ATTACHED PARTS, ADJUST DOOR			
UL10A2	RENEW R/SLIDING DOOR		28.0	117.60
	INCLUDES: R/SLIDING DOOR AND REQUIRED ATTACHED PARTS R + R.			
NO NUMBER	RENEW R/R SIDE PANEL		110.0	462.00

Code	Description	WU	Price SGD
NO NUMBER	R + R REAR BUMPER		
NO NUMBER	R + R TAILGATE	2.0	8.40
RE24A2	R + R RIGHT TAIL LAMP	5.0	21.00
UM24A2	R + R TAILGATE SEAL	2.0	8.40
VA12A2	R + R REAR HEADLINING	2.0	8.40
FB30A2	R + R FUEL FILLER NECK	5.0	21.00
NO NUMBER	R + R RIGHT REAR WHEEL	9.0	37.80
PW10A1)	R + R RIGHT REAR TYRE	2.0	8.40
1406	GLASS SPLINTER REMOVE	3.0	12.60
2086	R/F DOOR FRAME REPAIR	5.0*	21.00
4102	R/R INNER SIDE PANEL REPAIR	15 20.0*	84.00
		15 20.0*	84.00
Labour Cost			
Panel / Mechanical Labour		Hrs	WU
		24.70	247.0
Total of Labour			1,037.40
			1,037.40

Paint

Paint Work

Code	Description - TWO COAT METALLIC	Time Basis 10 WU/h	WU	Price SGD
	R/F OUT BUMPER BRKT SURFACE PAINT		4.0	
	R/F WING NEW PART PAINTING		9.0	
	RIGHT FRONT DOOR NEW PART PAINTING		17.0	
	R/SLIDING DOOR NEW PART PAINTING		18.0	
	R/RR SIDE PANEL NEW PART PAINTING		34.0	
	R/F DOOR FRAME REPAIR PAINTING <50%		15.0	
	R/CTR UPP SIDE PANEL SURFACE PAINT		5.0	
	R/R INNER SIDE PANEL SURFACE PAINT		6.0	

Paint Material Per Part

Code	Description	Price SGD
0322	R/F OUT BUMPER BRKT SURFACE PAINT	1.99
0742	R/F WING NEW PART PAINTING	14.45
1482	RIGHT FRONT DOOR NEW PART PAINTING	50.57
1782	R/SLIDING DOOR NEW PART PAINTING	51.60
3482	R/RR SIDE PANEL NEW PART PAINTING	49.50
2086	R/F DOOR FRAME REPAIR PAINTING <50%	24.23
2408	R/CTR UPP SIDE PANEL SURFACE PAINT	6.97
4102	R/R INNER SIDE PANEL SURFACE PAINT	11.21

Labour Cost - Paint

Factor	42.00 SGD/h	Hrs	WU	Price SGD
Time Paint			108.0	
Preparation Main Work Metal		2.50	25.0	105.00
Total	10 WU/h	13.30	133.0	558.60

Material Cost - Paint
 New Part Painting
 Repair Painting
 Surface-/Blend Paint
 Material-constant Metal Preparation
Total

Price SGD
 166.12
 24.23
 20.17
 28.60
 239.12

Spare Parts

Code	Description	Part Number	Part Source	prices as at 2001-01-01	Price SGD
0281	FRONT BUMPER	62022 5YJ2H	Original	CM ✓	270.00
1738	R/DOOR MIRROR	96301 3XT0A	Original	BU ✓	480.00
0322	R/F OUT BUMPER BRKT	62220 5YE0C	Original	CM ✓	85.00
1830	R/F SIDE DOOR WINDOW	82300 5YE2A	Original	Shorten ✓	480.00
1650	R/F WINDOW MOULDING	80820 3XA0B	Original	Del ✓	75.00
0742	R/F WING	61260 3XA0A	Original	B1 ✓	230.00
3482	R/RR SIDE PANEL	G7422 3XDMA	Original	B1 ✓	950.00
9566	R/RR TYRE	195/80 R 15 .. H	Original	PU ✓	0.00
9552	R/RR WHEEL	40300 5YE1A	Original	B1 ✓	195.00
3848	R/R SIDE WINDOW	83020 5YE0C	Original	Shorten B1 ✓	950.00
1782	R/SLIDING DOOR	H210M 3XDMA	Original	B1 ✓	700.00
1598	R/WINDOW CHANNEL	80330 3XA0C	Original	CM ✓	60.00
1482	RIGHT FRONT DOOR	H010M 5YMMB	Original	B1 ✓	550.00
f: OEM Parts	Savings				0.00
n: Non-OEM Parts	Subtotal				5,025.00
u: Used parts	Total				5,025.00

Extras

Code	Description	Price SGD
1000	COMPANY DATA STICKER	15.00*
1001	R/R TYRE	140.00*
1002	COMPUTERISED WHEEL ALIGNMENT	60.00*
1003	WINDSCREEN SEALANTX2	80.00*
	Total Extras	295.00

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Final Calculation

	SGD	SGD
Parts		
Total Parts	5,025.00	5,025.00
Labour Time Base 10 WU/h		
Total 247.0 WU X 42.00 SGD/h	1,037.40	
Total of Labour		1,037.40
Total Of Extras		295.00
Paint Work Time Base 10 WU/h		
Labour Cost 133.0 WU X 42.00 SGD/h	558.60	
Material Cost	239.12	
Total Paint Including Material		797.72
Repair Cost Excludes GST		7,155.12
GST (+9.00%)		643.96
Repair Cost Included GST		7,799.08

Comments

- * - USER SUPPLIED DATA
- NN - NO MANUFACTURERS CODE EXISTS
-) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This Form must be **completed by the Policyholder and/or the Actual Driver**.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of First Submission	02/10/2024 14:12 (SGT)
Reported by	Actual Driver
Date of Accident	01/10/2024 13:15 (SGT)
Exact Location of Accident	Lor 6 Toa Payoh, Singapore
Additional Location Information	-
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	GBM1043C
INSURED/POLICYHOLDER	
Is company?	Yes
Name Of Registered Owner	ABS Leasing Services Pte Ltd
Company Reg No	2XXXXX528D
Email Address	kimsung@absgroup.sg
Mobile Phone No	(Phone) +65-89220537
Alternative Phone No	(Office) +65-62596590

VEHICLE PARTICULARS

Manufacturer	Nissan
Model	Nv350
Variant	-
Exact purpose for which vehicle was being used at time of accident	Employment
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Goods vehicle
Transmission	Auto
CC	1998
Vehicle Fuel	Petrol
First Registration Date	31/10/2022
Chassis no	VR2E26137604
Effective Date/Time of Ownership	-

INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance (Singapore) Pte. Ltd.
Policy Number / Cover Note Number	DMCVSNW00081462301

DRIVER

IMPORTANT NOTICE

SKETCH PLAN

1. Filled report correct to the details of the accident to produce the claim.
2. This Form must be completed by the Policyholder/Insured/Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may a law insurance companies to rescind its policy.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Traffic Police Department for investigation.**
6. This report will be forwarded by the Insurers to the GIA Claims Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the judgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

6. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:


- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may be permitted to collect, use, disclose and/or process my personal data/personal information set out in this Form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
 (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may be permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.


 Policyholder's Signature / Date & Time
- 2 OCT 2024


 Actual Driver's Signature (if driver is not the policyholder) / Date & Time
- 2 OCT 2024


 Witnessed by Reporting Centre Personnel
 (Name as in NRIC/ID card) **Jenny Lim**

Sketch Plan

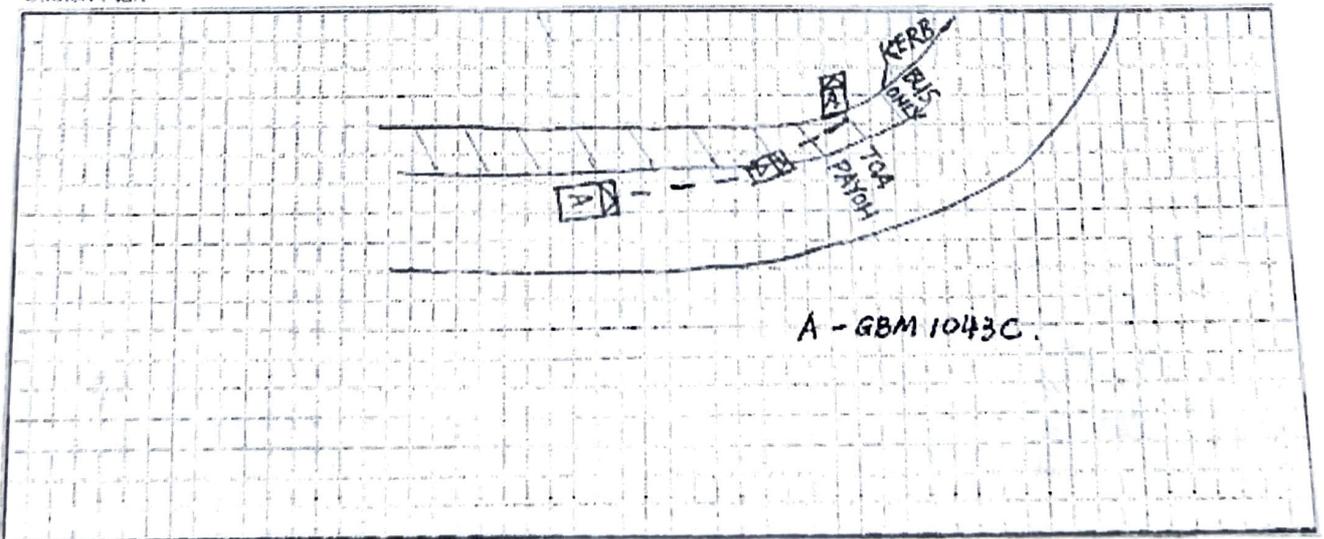

Enquire PARF/COE Rebate for Registered Vehicle
Vehicle Owner Particulars

Owner ID Type:	
Owner ID:	
Vehicle Details	Company
Vehicle No.:	528D
Vehicle to be Exported:	
Intended Deregistration Date:	GBM1043C
Vehicle Make:	Yes
Vehicle Model:	01 Oct 2024
Primary Colour:	NISSAN
Manufacturing Year:	NV350 CARAVAN DX AUTO
Engine No.:	Grey
Chassis No.:	2021
Maximum Power Output:	QR20021609R
Open Market Value:	VR2E26137604
Original Registration Date:	-
First Registration Date:	\$24,068.00
Transfer Count:	31 Oct 2022
Actual ARF Paid:	31 Oct 2022
Intended PARF Rebate Details	0
PARF Eligibility:	\$1,204.00
PARF Eligibility Expiry Date:	No
PARF Rebate Amount:	-
Intended COE Rebate Details	\$0.00
COE Expiry Date:	30 Oct 2032
COE Category:	C - Goods Vehicle & Bus
COE Period(Years):	10
PQP Paid:	\$29,847.00
COE Rebate Amount:	\$23,877.00
Total Rebate Amount:	\$23,877.00

Message

You will not be eligible for any COE rebate from the current COE (including unused COE from any lay-up period/s), if you renew your

The information contained herein is correct as at 01 Oct 2024

OK