

ASS. REC. BY: Taufikh REF: CS/00124/00534/TP3

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD ☒ WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured: GBB 4646B

Policy No. _____

Claims No. M11D00092411

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S
	X

Bal. or Market Value: \$160K

IDAC Accident Report _____ Consistent? : Yes or No

GIA / PR Sent _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: Mee Kee

Vehicle: IN / OUT

Veh No: SLW 4828P Yr Regn: 2022 / 08

Type: ☒ M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: BMW X1 cc 1499

Colour: Blue A/C: Insured / ☒ / HI / IIA

Sp. Reading: 34674 T/Padlock: Insured / ☒ / HI / IIA

Eng/No: _____

C/No: WBA52AA0405V30936

Gen. Cond: ☒ Good / Fair / Poor / Burnt

Steering: In order / Jammed / Locked / Burnt or

Brake: In order / Jammed / Locked / Burnt or

Mod: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 205/60R17

R: 205/60R17

BS / DUN / EXNOVA / GY / FS / LIZA / ☒ MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front: 6 mm

R/Bal. 6 mm

L/Bal. 6 mm

D.O.A. 24/10/24

Survey held at Performance Motor

Des. of Damages: Frt / ☒ Rr / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time	Action / Instruction
5/12/24	Taufikh confirmed final fig \$19,303.94 (Red 6116.30, 24%)

Date/Time, File Pass to? ☐ : Prel. Report ☐ : Final Report

1) _____

Date/Time, File Return to? _____

2) _____

Days Of Repair: 6

Resurvey No. of Trip: _____

Add Fee: ☐ : Site Insp (\$) ☐ : Interview (\$) ☐ : Tech. Invs (\$) ☐ : Weekend (\$)

Survey Fee: _____

Transportation: 8 + RS 81

Photos _____

Others _____

TOTAL _____

Rep. Format: _____

Lump Sum / L.B.B. (T) _____

BMW Dealer

Performance Motors Limited

A Sime Darby Motors Company
Co. Reg. No. 197401559W GST Reg. No M2-0020081-X
Toll-Free Number (1800-2255269)

303, Alexandra Road
Sime Darby Performance Centre
Singapore 159941
Fax. 64747770

280, Kampong Arang Road
East Coast Centre
Singapore 438180
Fax. 63449773

315, Alexandra Road
Sime Darby Business Centre
Singapore 159944
Fax. 64796601 (AfterSales)
64796624 (Motorrad)



GST REG. NO : M2 - 0020081 - X

E S T I M A T E

UOI
25 OCT 2024

Estimate No. : b1 71607

Page No. : 1 of 6

Date Estimated : 25/10/2024

Prepared By : Yap Mee Key

- ESTIMATE REPAIR FOR -

Chew Chee Hou Ignatius (Zhou Zhihao)
31 FERNVALE ROAD
#08-49

SINGAPORE 797417

- ACCOUNT - 40000

Cash Sales - Service
Singapore

REGN. NO.

CHASSIS NO.

REGN. DATE

MODEL

MILEAGE

SLW4828P

WBA32AA0405V30936

25/08/2022

X1 sDrive18i

32714

DESCRIPTION**VALUE**

To replace tailgate, rear bumper, inner support, make good end panel,
trunk floor and attachments. 850

3400 4,250.00

To respray tailgate, rear bumper, end panel, trunk floor and affected
areas. 2076

3,492.00

To supply rear emboss number plate.

? 83.00

To remove and install rear windscreen glass to facilitate
repair. (For glass that are NOT shattered).

✓ 649.00

To conduct water leak tests.

✓ 75.00

To supply and install front windscreen solar film.

? 531.00

To remove and install rear boot compartment interior
carpet and garnish to facilitate repairs.

X 271.00

To check electrical wiring system and lighting at the
rear section for proper function.

✓ 177.00

To transfer lock mechanism from old to new bootlid
including conduct check on new bootlid central locking system
for proper function.

✓ 531.00

To remove and install rear view camera including program and
conduct check for proper function.

? 266.00

To remove old PDC assembly, replace damaged parts and
reconnect to new bumper including conduct check for
proper function.

✓ 177.00

To carry out body cavity preservation.
(Per panel). 2x\$118/panel

118 238.00

Performance Motors Limited

A Sime Darby Motors Company
Co. Reg. No. 197401559W GST Reg. No M2-0020081-X
Toll-Free Number (1800-2255269)

303, Alexandra Road
Sime Darby Performance Centre
Singapore 159941
Fax. 64747770

280, Kampong Arang Road
East Coast Centre
Singapore 438180
Fax. 63449773

315, Alexandra Road
Sime Darby Business Centre
Singapore 159944
Fax. 64796601 (AfterSales)
64796624 (Motorrad)



GST REG. NO : M2 - 0020081 - X

ESTIMATE

Estimate No. : b1 71607
Date Estimated : 25/10/2024
Prepared By : Yap Mee Key

Page No. : 2 of 6

REGN. NO.	CHASSIS NO.	REGN. DATE	MODEL	MILEAGE
SLW4828P	WBA32AA0405V30936	25/08/2022	X1 sDrive18i	32714

DESCRIPTION

VALUE

Sundries.

✓ 150.00

Total Labour 1: 10,890.00

DESCRIPTION

QTY

PRIC

VALUE

COMBINATION NUT	20	1.60	na 32.00
BOOTLID	1	1,419.40	bt 1,419.40
BOOTLID RH HINGE	1	109.00	x 109.00
INTERIOR TAIL TRIM	1	328.40	? 328.40
TAIL PANEL	1	450.80	? 450.80
REAR BUMPER TRIM PANEL (X LINE)	1	241.10	de 241.10
Necessary kit on	1	59.20	nei 59.20
REAR RH BUMPER MOUNT	1	177.55	? 177.55
RR BUMPER CARRIER	1	561.20	? 561.20
MOUNTING SMART OPENER	1	86.70	? 86.70
REAR TRIM UNDERRIDE PROTECTION (X L	1	168.75	cut 168.75
RR BUMPER RH CORNER MOUNTING	1	156.90	? 156.90
Necessary scuff film left	1	2.90	nei 2.90
Necessary scuff film right	1	2.90	nei 2.90
REAR BUMPER PANEL PRIMED	1	964.30	de 964.30
REAR BUMPER MIDDLE TRIM PANEL (PDC)	1	283.55	de 283.55
Necessary Rera pdc sensor	1	66.10	nei 66.10
EMBLEM GROMMET	1	1.00	nei 1.00
BMW PLAQUE WITH ADHESIVE FILM	1	76.55	nei 76.55
LETTERING S DRIVE 18i	1	103.35	nei 103.35
LETTERING X1	1	68.90	nei 68.90
SOFT CLOSE AUTOMATIC	1	688.50	x 688.50
REAR BUMPER TOWING EYE COVER	1	40.85	mis 40.85
REAR WINDOW (ESG)	1	872.15	? 872.15
LOWER TAIL LID TRIM PANEL (SCHWARZ)	1	221.85	? 221.85
BOOTLID SEALING	1	182.05	nei 182.05
PLUG BLACK D=5MM	6	0.95	nei 5.70
CONTROL UNIT SMART OPENER GEN 2	1	442.80	? 442.80
SENSOR WIRE FOR SMART OPENER TOP	1	50.60	? 50.60
SENSOR WIRE FOR SMART OPENER BOTTOM	1	55.65	? 55.65
REAR WINDOW WIPER MOTOR	1	475.55	x 475.55
REAR RH REAR REFLECTOR	1	43.50	x 43.50
REAR RH LIGHT SIDE PANEL LED	1	485.10	x 485.10
REAR LH LIGHT TAILGATE LED	1	509.35	? 509.35
REAR RH LIGHT TAILGATE LED	1	509.35	cut 509.35
RH GUTTER STRIP	1	36.60	? 36.60
NUMBER-PLATE LIGHT LED	2	31.20	x 62.40
ULTRASONIC SENSOR BLACK	2	269.65	? 539.30
DECOUPING RING PDC TORQUE CONVERTER	4	5.65	nei 22.60
REVERSING CAMERA (VALEO)	1	736.95	x 736.95
(DG) CLEANER R1 (100ML)	1	36.25	nei 36.25
(DG/SL) W/SCREEN SEALANT (COLD 1 HOUR)	2	154.00	nei 308.00

Performance Motors Limited

A Sime Darby Motors Company
Co. Reg. No. 197401559W GST Reg. No M2-0020081-X
Toll-Free Number (1800-2255269)

303, Alexandra Road
Sime Darby Performance Centre
Singapore 159941
Fax. 64747770

280, Kampong Arang Road
East Coast Centre
Singapore 438180
Fax. 63449773

315, Alexandra Road
Sime Darby Business Centre
Singapore 159944
Fax. 64796601 (AfterSales)
64796624 (Motorrad)



GST REG. NO : M2 - 0020081 - X

E S T I M A T E

Estimate No. : b1 71607
Date Estimated : 25/10/2024
Prepared By : Yap Mee Key

Page No. : 3 of 6

REGN. NO.	CHASSIS NO.	REGN. DATE	MODEL	MILEAGE
SLW4828P	WBA32AA0405V30936	25/08/2022	X1 sDrive18i	32714

Total Parts : 11,685.65

Tan Kah. 97495749 / 62563561
WP 30/10/24 @ 1215pm
P/P Resurvey before paint
tan kah e/khauto.com
06 days

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:



Labour 1	:	10,890.00
Parts	:	11,685.65
Labour 2	:	0.00
Excess	:	0.00
Total GST @ 9%	:	2,031.81
Grand Total	:	24,607.46

** THIS ESTIMATE IS VALID FOR A PERIOD OF 30 DAYS ONLY**

** PRICE FOR PARTS ARE SUBJECTED TO CHANGE WITHOUT PRIOR NOTICE **

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of First Submission	25/10/2024 17:05 (SGT)
Reported by	Both Policyholder and Actual Driver
Date of Accident	24/10/2024 18:17 (SGT)
Exact Location of Accident	Upper Thomson Rd, Singapore
Additional Location Information	-
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLW4828P
-----------------------------------	----------

INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	CHEW CHEE HOU IGNATIUS
NRIC No	SXXXX532C
Email Address	ignatiuschew@yahoo.com.sg
Mobile Phone No	(Phone) +65-98457592
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	BMW
Model	X1
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Private car
Transmission	Auto
CC	1499
Vehicle Fuel	-
First Registration Date	-
Chassis no	-
Effective Date/Time of Ownership	-

INSURANCE COMPANY

Name of Insurance Company	Auto & General Insurance (Singapore) Pte. Limited.
Policy Number / Cover Note Number	P10936055R01

DRIVER

Name of Driver	CHEW CHEE HOU IGNATIUS
NRIC No	SXXXX532C
Date Of Birth	04/10/1979
Occupation	Indoor
Driving Pass Date	01/08/2005
Driving License Pass Class	3
Driving License Validity	Valid
Driving experience	19 YEARS AND 2 MONTHS
Gender	Male
Mobile Number	(Phone) +65-98457592
Alt. Phone Number	-
Email Address	ignatiuschew@yahoo.com.sg
Address	31 FERNVALE ROAD
Address complement	#08-49
Postcode	797417
Is the driver the policyholder?	Yes
If No, Relationship of the Driver with the Insured	-
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Head to Rear
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	1
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No
Translator's name	-
Translator's ID	-
Translator's phone number	-
Translator's email	-
Original language used in the statement	-

DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

PLEASE REFER TO ATTACHED SKETCH PLAN.

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	Yes

DETAILS OF OTHER VEHICLE PROPERTY

Vehicle Registration Number	GBB4646B
Vehicle Manufacturer	-


Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	White
Vehicle Category	Goods vehicle
Name of Driver	BORY NOYAN
Passport No/FIN	GXXXX416R
Contact Number	(Phone) +65-83447658
Address	-
Address complement	-
Postcode	-
Insurance Company Name	United Overseas Insurance Ltd
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

SKETCH PLAN**IMPORTANT NOTICE**

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

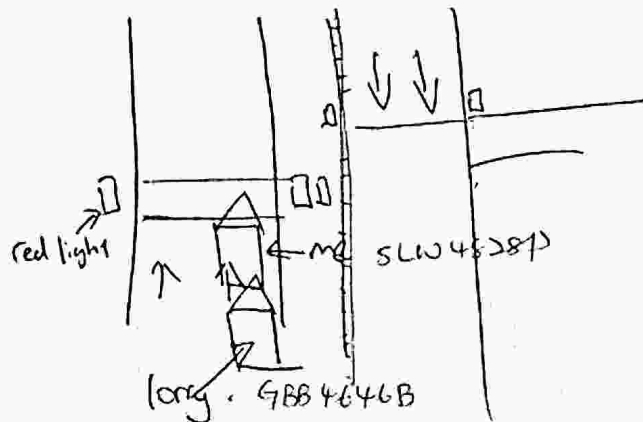

 Policyholder's Signature
 Date & Time: 25/10/24
 840am

Driver's Signature
 (If driver is not the policyholder)
 Date & Time:

Yap Mee Key
 Performance Motors Limited
 393 Alexandra Road
 Singapore Performance Centre
 Singapore 159941
 MYK
 Reporting Centre Personnel's Signature
 Name:
 NRIC/FIN No.:

SKETCH PLAN

upper Thomson Rd.



DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

I stopped at a red light crossing and was banged from behind by the white lorry. The driver came down and apologised that he did not see me and did not brake in time. Incident happened along upper Thomson Road Towards Lorrie Road.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature

Date & Time: 25/10/24 5:40pm

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Yed Men Key
Performance Motors Limited
303 Alexandra Road
Singapore Performance Centre
Singapore 157244

WIK

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.: