

ASS. REC. BY: Kenneth REF: C721

ASSIGNMENT

From: _____ Date: _____
Estimated Cost: _____
OD/TP/WS/TP RES/OD RES/EVA/INV/MV
To Inspect Vehicle No: _____
at Workshop m/s Cheng Lee
of _____
Insured: _____
Policy No. _____
Claims No. _____
Sum Insured: _____ Excess: 500
(Client's Record)
Make of Veh: _____

☒	☒
N/S	O/S
☐	☐

(Policy Condition)
Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: \$58K

IDAC Accident Report: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: 03 days Res.: Yes or No

Lum Sum: 1.81 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: SLU 9006 Y Yr Regn: 12.17
Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
Truck / Trailer or Wagon
Make: Hia Sorento C.C. 2199
Colour: M. Red A/C: Insured / Std / NI / NA
Sp. Reading: 194741 T/Radio: Insured / Std / NI / NA
Eng/No: _____
C/No: KNAPH81BMT 5411495
Gen. Cohd: Good / Fair / Poor / Burnt
Steering: Inopder / Jammed / Leaked / Burnt or
Brake: Inopder / Jammed / Leaked / Burnt or
Modl: NII / SRim / STD A/Rim or

Tyre Size: F: _____ R: 235/60R18

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
TOYO / YOKO or _____

Front: _____ Rear: _____
R/Bal. 7 mm R/Bal. 6 mm
L/Bal. 7 mm L/Bal. 6 mm
D.O.A. 6/11/24 D.O.I. 20/11/2024

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

1 No find parts

Date/Time, File Pass to?

☐ : Prell. Report

1) _____

☐ : Final Report

Date/Time, File Return to?

2) _____

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation: _____

S - RS. \$1

F. P. \$

Others

Add Fee: ☐ : Site Insp (\$)

☐ : Interview (\$)

☐ : Tech Invs (\$)

☐ : Weekend (\$)

TOTAL

Report Format :

Lump Sum / I.B.I. (\$)

SLU 9006Y
00/china

Cheng Hoe Motor Pte Ltd
#01-374/382, Blk 1019, Yishun Industrial Park

A

768761

Insurer Reference: SLU9006Y
Repairer Reference: SLU9006Y
Date calculated: 20/11/2024 2:34 PM

Full Report
Registration: SLU9006Y
Printed: 20/11/2024 2:34 PM

Summary Information

Claim Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	CHENG HOE	Currency:	SGD
Claim Reference:	SLU9006Y	Date of Incident:	06/11/24
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	KIA
Model:	SORENTO (UM/UMA)
Sub Model:	BASE MODEL
Model Sheet Number:	28 SO 01
Registration:	SLU9006Y
VIN number:	
Odometer:	

Model Specs

SEMIAUTO PARKING AID	DRIVE CAMERA 360 DEG	2.2 LTR 147/142 KW	CRUISE CONT ADAPTIVE
PEDESTRIAN PROTECT	LED FOG LAMPS	TWO COAT METALLIC	PREPARE OFF VEHICLE

Not Notified
Repair B4 paint
Ex @ 500/-
3 days

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:

Date:

Insurer Reference: SLU9006Y
Repairer Reference: SLU9006Y
Date calculated: 20/11/2024 2:34 PM

Full Report
Registration: SLU9006Y
Printed: 20/11/2024 2:34 PM

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

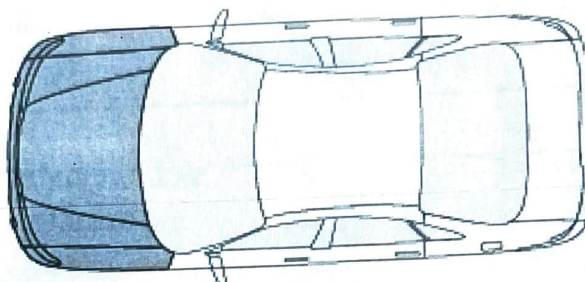

Tyres Condition

Tyre Brand	Tread (Left Middle), Tread (Left Outer), Tread (Left Inner), Tread (Right Inner), Tread (Right Outer), Tread (Right Middle), mm						Condition
	mm	mm	mm	mm	mm	mm	
Spare Tyre Brand	Tread (Spare), mm						

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
96401A0A	CALIBRATE FRONT RADAR		10.0	42.00
95774A0A	CAMERA 360 GRADE ADJUST		10.0	42.00
86510R00	R + R FRONT BUMPER		6.0	25.20
86512R00)	RENEW FRONT BUMPER (BUMPER REMOVED)		12.0	50.40
	INCLUDES: R + R NECESSARY ATTACHED PARTS			
NO NUMBER	R + R FRONT BUMPER SUPPORT		4.0	16.80
92000R0B)	R + R BOTH HEADLAMPS		1.0	4.20
18600A00	ADD WORK FOR H-LAMP LEVEL CONTROL		3.0	12.60
25300R00)	R + R RADIATOR		8.0	33.60
	INCLUDES: WATER PIPE/S, HORNS, ELECTRIC FAN, AIR GUIDE			
	REMOVE AND REFIT AND COOLING SYSTEM DRAIN / FILL			
NO NUMBER	RADIATOR/CONDENSOR SEPARATE		2.0	8.40
28100R00	R + R AIR CLEANER CPL		3.0	12.60
97606R00)	R + R AIR CONDITIONING CONDENSER (BUMPER REMOVED)		2.0	8.40

Insurer Reference: SLU9006Y
 Repairer Reference: SLU9006Y
 Date calculated: 20/11/2024 2:34 PM

Full Report
 Registration: SLU9006Y
 Printed: 20/11/2024 2:34 PM

Code	Description	WU	Price SGD
09760A00	NOT INCLUDED: AIR CONDITIONING DRAIN AND FILL	5.0	21.00
1002	DRAIN/REFILL AIR CONDITIONING RADAR/BLINDSPOT RESET SYSTEM		250.00*
	Labour Cost	Hrs	WU
	Panel / Mechanical Labour	6.60	66.0
	Fixed Rate		277.20
			250.00
	Total of Labour		527.20

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	FRT BUMPER SUPPORT SURFACE PAINT	4.0
	FRONT BUMPER NEW PART PAINT K1R	11.0
	FR LWR BUMPER GRILLE NEW PART PAINT K1R	6.0
	L/F OUT PARK AID SEN NEW PART PAINT K1R	3.0
	R/F OUT PARK AID SEN NEW PART PAINT K1R	3.0
	L/F INNER SENSOR NEW PART PAINT K1R	3.0
	R/F INNER SENSOR NEW PART PAINT K1R	3.0
	GRILLE NEW PART PAINT K1R	6.0

Paint Material Per Part

Code	Description	Price SGD
0340	FRT BUMPER SUPPORT SURFACE PAINT	3.74
0283	FRONT BUMPER NEW PART PAINT K1R	53.14
0365	FR LWR BUMPER GRILLE NEW PART PAINT K1R	19.68
0371	L/F OUT PARK AID SEN NEW PART PAINT K1R	0.49
0372	R/F OUT PARK AID SEN NEW PART PAINT K1R	0.49
0373	L/F INNER SENSOR NEW PART PAINT K1R	0.49
0374	R/F INNER SENSOR NEW PART PAINT K1R	0.49
0410	GRILLE NEW PART PAINT K1R	19.68

Labour Cost - Paint

Factor	42.00 SGD/h	Hrs	WU	Price SGD
Time Paint			39.0	
Preparation Main Work Metal		2.50	25.0	105.00
Preparation Comp. Work Plastic		0.50	5.0	21.00
Total	10 WU/h	6.90	69.0	289.80

Material Cost - Paint

	Price SGD
New Part Painting - Plastic K1R	94.46
Surface-/Blend Paint	3.74
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	135.80

Insurer Reference: SLU9006Y
 Repairer Reference: SLU9006Y
 Date calculated: 20/11/2024 2:34 PM

Full Report
 Registration: SLU9006Y
 Printed: 20/11/2024 2:34 PM

Spare Parts

				prices as at 2015-06-01	Price SGD
Code	Description	Part Number	Part Source		
0365	FR LWR BUMPER GRILLE	86560C5520	Original	CM	95.00 ✓
0283	FRONT BUMPER	86511C5520	Original	CM	300.00 ✓
1003	FRONT BUMPER CLIPS	PARTS	Original	CM	12.00 ✓
0425	FRONT DRIVING CAMERA	95780C5500	Original	CM	350.00 ✓
0391	FRONT SPOILER	86567C6800	Original	CM	55.00 ✓
0341	FRT BUMPER ABSORBER	86520C5500	Original	CM	65.00 ✓
0340	FRT BUMPER SUPPORT	64900C5500	Original	CM	250.00 ✓
0287	FRT LWR BUMPER MLDG	86565C6800	Original	CM	35.00 ✓
0260	FRT NO PLATE BRKT	86519C5500	Original	CM	15.00 ✓
0410	GRILLE	86350C5500	Original	CM	330.00 ✓
0297	L/F BUMPER COVER	86525C5520	Original	CM	45.00 X
0373	L/F INNER SENSOR	96890C5500SWP	Original	CM	130.00 ✓
0371	L/F OUT PARK AID SEN	96890C5500SWP	Original	CM	90.00 ✓
1000	PARK SENSOR(3)	PARTS	Original	CM	90.00 ✓
0374	R/F INNER SENSOR	96890C5500SWP	Original	CM	130.00 ✓
0372	R/F OUT PARK AID SEN	96890C5500SWP	Original	CM	90.00 ✓
7761	RADIATOR	25310C5200	Original	CM	350.00 X
1001	SENSOR(4)	PARTS	Original	CM	90.00 ✓
1007	UP/CVR RADIAT GRILLE	86360C5000	Original	CM	110.00 ✓

f: OEM Parts
 n: Non-OEM Parts
 u: Used parts

Savings
Subtotal
Fixed Sundry Parts Price
Total

0.00
 2,632.00
 100.00
 2,732.00

Extras

Code	Description	Price SGD
1004	FRT NO.PLATE	35.00* ✓
Total Extras		35.00

ASS. RE
127
from:
ultimate
U/TP
Inspe
Works

Insurer Reference: SLU9006Y
Repairer Reference: SLU9006Y
Date calculated: 20/11/2024 2:34 PM

Full Report
Registration: SLU9006Y
Printed: 20/11/2024 2:34 PM

Final Calculation

	SGD	SGD
Parts	2,632.00	
Fixed Sundry Parts Price	100.00	
Total Parts		2,732.00
Labour Time Base 10 WU/h		
Total 66.0 WU X 42.00 SGD/h	277.20	
Fixed Rate	250.00	
Total of Labour		527.20
Total Of Extras		35.00
Paint Work Time Base 10 WU/h		
Labour Cost 69.0 WU X 42.00 SGD/h	289.80	
Material Cost	135.80	
Total Paint Including Material		425.60
Repair Cost Excludes GST		3,719.80
GST (+9.00%)		334.78
Repair Cost Included GST		4,054.58

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Singapore NRIC

Owner ID:

400B

Vehicle Details

Vehicle No.:

SLU9006Y

Vehicle to be Exported:

Yes

Intended Deregistration Date:

18 Nov 2024

Vehicle Make:

KIA

Vehicle Model:

SORENTO 2.2(8AT) CRDI 2WD S/R

Primary Colour:

Blue

Manufacturing Year:

2017

Engine No.:

D4HBHH347428

Chassis No.:

KNAPH81BMJ5411495

Maximum Power Output:

147.0 kW (197 bhp)

Open Market Value:

\$30,470.00

Original Registration Date:

18 Dec 2017

First Registration Date:

18 Dec 2017

Transfer Count:

2

Actual ARF Paid:

\$34,658.00

Intended PARF Rebate Details

PARF Eligibility:

Yes

PARF Eligibility Expiry Date:

17 Dec 2027

PARF Rebate Amount:

\$22,527.00

Intended COE Rebate Details

COE Expiry Date:

17 Dec 2027

COE Category:

B - Car above 1600cc or 97kW (130bhp)

COE Period(Years):

10

QP Paid:

\$57,390.00

COE Rebate Amount:

\$17,670.00

Total Rebate Amount:

\$40,197.00

Message

You will not be eligible for any COE rebate from the current COE (including unused COE from any lay-up period/s), if you renew your COE.

The information contained herein is correct as at 18 Nov 2024

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the Insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the Insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of First Submission	07/11/2024 17:05 (SGT)
Reported by	Both Policyholder and Actual Driver
Date of Accident	06/11/2024 15:40 (SGT)
Exact Location of Accident	450 Tampines Street 42, Singapore 520450
Additional Location Information	CARPARK
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLU9006Y
-----------------------------	----------

INSURED/POLICYHOLDER

Is company?	No
Name Of Registered Owner	NG HAN KWONG (HUANG HANGUANG)
NRIC No	S7145400B
Email Address	walker.ng23@gmail.com
Mobile Phone No	(Phone) +65-88937959
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	Kia
Model	Sorento
Variant	-
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	Yes
Vehicle Category	Private car
Transmission	Auto
CC	2199
Vehicle Fuel	-
First Registration Date	-
Chassis no	-
Effective Date/Time of Ownership	-

INSURANCE COMPANY

Name of Insurance Company	China Taiping Insurance (Singapore) Pte. Ltd.
Policy Number / Cover Note Number	DMPCSNW00135382300

DRIVER

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Traffic Police Department for investigation.
6. This report will be forwarded by the Insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the Insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with any instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
 (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third-party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

Policyholder's Signature / Date & Time

Actual Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel (Name as in NRIC/ID card)

Sketch Plan

BIK 450 TAMPIKAS S7 42 CAR PARK

