

ASS. REC. BY:

REF:

C121

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

05 days

Res.: Yes or No

Lum Sum:

1.81 %

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

SND 8649P

Yr Regn:

01, 22

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Hyundai

Avante

C.C.

1598

Colour

White

AC: Insured / Std / NI / NA

Sp. Reading

48172

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

KMH LN41ETNU 289300

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modl: Nil / S/Rim / STD A/Rim or

Tyre Size: F:

225/45R17

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

9

mm

R/Bal.

9

mm

L/Bal.

9

mm

L/Bal.

9

mm

D.O.A.

28/11/24

D.O.I.

4/12/2024

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Date/Time, File Pass to?

☐

: Prell. Report

Days Of Repair:

1)

☐

: Final Report

Resurvey No. of Trip:

Date/Time, File Return to?

2)

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

Survey Fee:

Transportation:

S + RS. \$

: Fines

: Others

Report Format :

Lump Sum / I.B.I: (\$

TOTAL

00/china

Cheng Hoe Motor Pte Ltd
#01-374/382, Blk 1019, Yishun Industrial Park

A

768761

Insurer Reference: SND8649P
Repairer Reference: SND8649P
Date calculated: 04/12/2024 12:29 PM

Full Report
Registration: SND8649P
Printed: 04/12/2024 12:29 PM

Summary Information

Claim			
Location:	Singapore (SG)	Work Provider:	China Taiping Insurance (Singapore) Pte Ltd
Printed by:	CHENG HOE	Currency:	SGD
Claim Reference:	SND8649P	Date of Incident:	28/11/24
Estimated Repair Time:		Hire Car Start:	
Actual Repair Days:		Hire Car End:	

Vehicle Details

Vehicle

Manufacturer:	HYUNDAI
Model:	AVANTE (CN7)
Sub Model:	ELITE S/R
Model Sheet Number:	30 1L 26
Registration:	SND8649P
VIN number:	
Odometer:	

Model Specs

RADAR FRONT
TWO COAT METALLIC

FRONT PARKING SYSTEM 1.6 LTR 66 KW
PREPARE OFF VEHICLE

TYRES 225/45 R17..W

*Not Authorized
Repair By part
Ex TRA
Sday,*

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Insurer Reference: SND8649P
Repairer Reference: SND8649P
Date calculated: 04/12/2024 12:29 PM

Full Report
Registration: SND8649P
Printed: 04/12/2024 12:29 PM

Vehicle Condition


Vehicle Status

Pre-Accident Damage:

Date of Inspection:

Damage Areas

All ☐
Underbody ☐

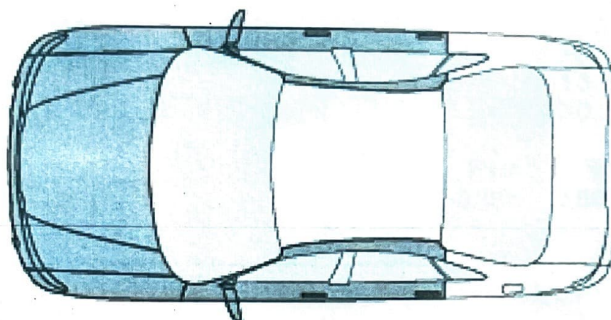

Tyres Condition

Tyre Brand	Tread (Left Middle), mm	Tread (Left Outer), mm	Tread (Left Inner), mm	Tread (Right Inner), mm	Tread (Right Outer), mm	Tread (Right Middle), mm	Condition
------------	----------------------------	---------------------------	---------------------------	----------------------------	----------------------------	-----------------------------	-----------

Spare Tyre Brand	Tread (Spare), mm
------------------	-------------------

Labour

Code	Description	Time Base 10 WU/h	Price = 42.00 SGD/h	
			WU	Price SGD
18600A00	ADD WORK FOR H-LAMP LEVEL CONTROL		3.0	12.60
NO NUMBER	R + R FRONT PANEL		16.0	67.20
96401A0A	CALIBRATE FRONT RADAR		3.0	12.60
86512R00	RENEW FRONT BUMPER		9.0	37.80
	INCLUDES: R + R FRONT BUMPER, GRILLE AND NECESSARY ATTACHED PARTS			
NO NUMBER	ADD/WORK FOR SEALING BONNET		3.0	12.60
79110R0B)	R + R BOTH BONNET HINGES		5.0	21.00
66400R00	RENEW BONNET		8.0	33.60
	INCLUDES: R + R AND ADJUST BONNET			
86150R00	R + R COWL PANEL COVER		3.0	12.60
92000R0B)	R + R BOTH HEADLAMPS CPL		2.0	8.40
66300R0B	RENEW BOTH FRONT WINGS		17.0	71.40
	(BUMPER REMOVED)			
	INCLUDES: BOTH FRONT WINGS R + R AND REQUIRED ATTACHED PARTS ASSEMBLE			
28100R00	R + R AIR CLEANER CPL		3.0	12.60

Insurer Reference: SND8649P
 Repairer Reference: SND8649P
 Date calculated: 04/12/2024 12:29 PM

Full Report
 Registration: SND8649P
 Printed: 04/12/2024 12:29 PM

Code	Description	WU	Price SGD
25300R1H)	R + R RADIATOR	21.0	88.20
09760A00	DRAIN + REFILL AIR CONDITIONING	5.0	21.00
23001A00	DRAIN/REFILL COOLING SYSTEM	5.0	21.00
NO NUMBER	R + R L/F WHEEL	1.0	4.20
NO NUMBER	R + R R/F WHEEL	1.0	4.20
96600R0A	R + R HORN (ADD/WORK)	2.0	8.40
96401RQ0	ADD/TIME FOR MAIN DIAGNOSIS ORDER	3.0	12.60
1121	L/F W-HOUSE REINF REPAIR	10.0*	7 42.00
1122	R/F W-HOUSE REINF REPAIR	10.0*	7 42.00
1001	RESET RADAR SYSTEM REPAIR	30.0*	7 126.00
Labour Cost			
Panel / Mechanical Labour		Hrs	WU
		16.00	160.0
Total of Labour			672.00

Paint

Paint Work	SYSTEM AZT	Time Basis 10 WU/h
Code	Description - TWO COAT METALLIC	WU Price SGD
	FRT BUMPER SUPPORT SURFACE PAINT	5.0
	BONNET NEW PART PAINTING	26.0
	L/F WING NEW PART PAINTING	8.0
	R/F WING NEW PART PAINTING	8.0
	FRONT BUMPER NEW PART PAINT K1R	12.0
	UPPER GRILLE TRIM NEW PART PAINT K1R	3.0
	FRT BUMPER PROT CVR SURFACE PAINT PLAST.	4.0
	UPP BUMPER MOULDING SURFACE PAINT PLAST.	4.0
	L/F W-HOUSE REINF SURFACE PAINT	5.0
	R/F W-HOUSE REINF SURFACE PAINT	5.0
	L/UPP A-PILLAR PR SURFACE PAINT	4.0
	R/UPP A-PILLAR PR SURFACE PAINT	4.0

Paint Material Per Part

Code	Description	Price SGD
0340	FRT BUMPER SUPPORT SURFACE PAINT	5.48
0471	BONNET NEW PART PAINTING	87.72
0741	L/F WING NEW PART PAINTING	12.38
0742	R/F WING NEW PART PAINTING	12.38
0283	FRONT BUMPER NEW PART PAINT K1R	55.10
0413	UPPER GRILLE TRIM NEW PART PAINT K1R	2.46
0295	FRT BUMPER PROT CVR SURFACE PAINT PLAST.	3.66
0313	UPP BUMPER MOULDING SURFACE PAINT PLAST.	6.22
1121	L/F W-HOUSE REINF SURFACE PAINT	4.98
1122	R/F W-HOUSE REINF SURFACE PAINT	4.98
2235	L/UPP A-PILLAR PR SURFACE PAINT	3.24
2236	R/UPP A-PILLAR PR SURFACE PAINT	3.24

Insurer Reference: SND8649P
 Repairer Reference: SND8649P
 Date calculated: 04/12/2024 12:29 PM

Full Report
 Registration: SND8649P
 Printed: 04/12/2024 12:29 PM

Labour Cost - Paint

	Hrs	WU	Price SGD
Factor			
Time Paint		88.0	
Preparation Main Work Metal	2.50	25.0	105.00
Preparation Comp. Work Plastic	0.50	5.0	21.00
Total	10 WU/h	118.0	495.60

Material Cost - Paint

	Price SGD
New Part Painting	112.48
New Part Painting - Plastic K1R	57.56
Surface-/Blend Paint	21.92
Surface Painting Plastic	9.88
Material-constant Metal Preparation	28.60
Material-constant Plastic	9.00
Total	239.44

Spare Parts

prices as at 2001-01-01				
Code	Description	Part Number	Part Source	Price SGD
4465	AIR CON CONDENSER	97606AA010	Original	200.00 ?
0471	BONNET	66400AA000	Original	680.00 ✓
0492	BONNET LOCK	81130AA900	Original	55.00 ?
0283	FRONT BUMPER	86510AABA0	Original	260.00 ✓
0315	FRONT IMPACT DAMPER	86520AAAA0	Original	68.00 ?
0431	FRONT MANUFACT	86311AAAA0	Original	30.00 ✓
	BADGE			
1295	FRONT RADAR SENSOR	99110AA500	Original	750.00 ?
0340	FRT BUMPER SUPPORT	64900BY500	Original	220.00 ✓
0260	FRT NO PLATE REINF	86519AAAA0	Original	18.00 ✓
0410	GRILLE	86350AAA0CA	Original	450.00 ✓
0475	L/BONNET HINGE	66910AA000	Original	35.00 X
0355	L/F UPP BUMPER BRKT	865E1AAAA0	Original	16.00 ?
0741	L/F WING	66310AA500	Original	380.00 X
0561	LEFT HEADLAMP ASSY	92101AA620	Original	1,350.00 ✓
0476	R/BONNET HINGE	66920AA000	Original	35.00 X
0356	R/F UPP BUMPER BRKT	865E2AAAA0	Original	16.00 ?
0742	R/F WING	66320AA500	Original	380.00 X
7761	RADIATOR	253E0BY100	Original	280.00 ?
0562	RIGHT HEADLAMP ASSY	92102AA620	Original	1,350.00 ✓
0409	UP/CVR RADIAT GRILLE	86391AAAA0	Original	75.00 ✓
1009	UPPER FRONT PANEL	64101AA500	Original	350.00 ✓
0413	UPPER GRILLE TRIM	86370AAAA0	Original	130.00 ✓

f: OEM Parts	Savings	0.00
n: Non-OEM Parts	Subtotal	7,128.00
u: Used parts	Fixed Sundry Parts Price	100.00
	Total	7,228.00

Extras

Code	Description	Price SGD
1000	1UNIT COOLANT	25.00* ✓
1002	SUPPLY A/CON GAS	50.00* ✓

Insurer Reference: SND8649P
Repairer Reference: SND8649P
Date calculated: 04/12/2024 12:29 PM

Full Report
Registration: SND8649P
Printed: 04/12/2024 12:29 PM

Code	Description	Price SGD
	Total Extras	75.00

Final Calculation

	SGD	SGD
Parts	7,128.00	
Fixed Sundry Parts Price	100.00	
Total Parts		7,228.00
Labour Time Base 10 WU/h		
Total 160.0 WU X 42.00 SGD/h	672.00	
Total of Labour		672.00
Total Of Extras		75.00
Paint Work Time Base 10 WU/h		
Labour Cost 118.0 WU X 42.00 SGD/h	495.60	
Material Cost	239.44	
Total Paint Including Material		735.04
Repair Cost Excludes GST		8,710.04
GST (+9.00%)		783.90
Repair Cost Included GST		9,493.94

Comments

* - USER SUPPLIED DATA
NN - NO MANUFACTURERS CODE EXISTS
) - WU PARTIAL INCL IN OTHER POSITIONS

Assessment Note

No assessment notes entered.

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:

Singapore NRIC

Owner ID:

593D

Vehicle Details

Vehicle No.:

SND8649P

Vehicle to be Exported:

No

Intended Deregistration Date:

29 Nov 2024

Vehicle Make:

HYUNDAI

Vehicle Model:

CN7 AVANTE 1.6 DOHC CVT S/R

Primary Colour:

White

Manufacturing Year:

2021

Engine No.:

G4FMMU123212

Chassis No.:

KMHLN41ETNU269500

Maximum Power Output:

90.2 kW (120 bhp)

Open Market Value:

\$21,598.00

Original Registration Date:

28 Jan 2022

First Registration Date:

28 Jan 2022

Transfer Count:

0

Actual ARF Paid:

\$7,238.00

Intended PARF Rebate Details

PARF Eligibility:

Yes

PARF Eligibility Expiry Date:

27 Jan 2032

PARF Rebate Amount:

\$5,428.00

Intended COE Rebate Details

COE Expiry Date:

27 Jan 2032

COE Category:

A - Car up to 1600cc & 97kW (130bhp)

COE Period(Years):

10

QP Paid:

\$57,898.00

COE Rebate Amount:

\$41,462.00

Total Rebate Amount:

\$46,890.00

Message

You will not be eligible for any COE rebate from the current COE (including unused COE from any lay-up period/s), if you renew your COE.

The information contained herein is correct as at 29 Nov 2024


OK

Describe Circumstance of the Accident

** NOTE . PLEASE TAKE NOTE THAT YOUR INSURER HAVE 14DAYS TIME FRAME for you to submit OWN DAMAGE Claim under your Own Comprehensive policy. Pls check your policy for more information.

(☒) Claim Own Policy () Claim Third party () Reporting Only
() Claim OD/ TP at other workshop ()

Sketch Plan

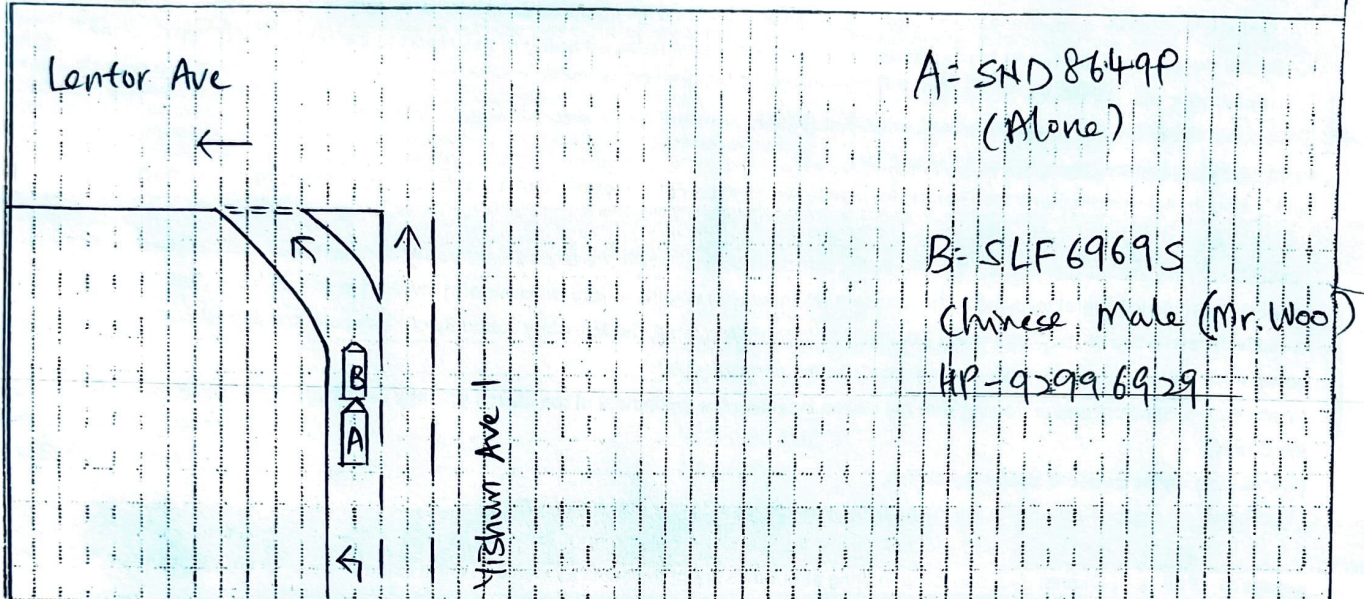

I was driving along Yishun Ave I towards slip road Lontor Ave. It was raining and the road was wet. As I make a fitter to the left most lane, I could not slow down in time and contacted the vehicle ahead of mine. The travelling speed was approximately 50km/h. No injury was sustained for both parties involved.

*I'm aware that I have to bear the admin fee for Audatex in the event if I withdraw my own damage claim.

Declaration

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature / Date & Time

29/11/24 15:58

Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel (Name as in NRIC/ID card) (YS)

29/11/24



SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of First Submission 29/11/2024 17:46 (SGT)
Reported by Both Policyholder and Actual Driver
Date of Accident 28/11/2024 22:20 (SGT)
Exact Location of Accident Singapore
Additional Location Information YISHUN AVE 1
Country/State of Loss Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number SND8649P

INSURED/POLICYHOLDER

Is company? No
Name Of Registered Owner LIM TUAN MENG EDMUND
NRIC No SXXXX593D
Email Address edmundwso@yahoo.com.sg
Mobile Phone No (Phone) +65-96640445
Alternative Phone No

VEHICLE PARTICULARS

Manufacturer Hyundai
Model CN7 AVANTE 1.6 DOHC CVT S/R
Variant
Exact purpose for which vehicle was being used at time of accident Private use
Are you claiming under your own insurance policy for repair to your vehicle? Yes
Vehicle Category Private car
Transmission Auto
CC 1598
Vehicle Fuel
First Registration Date 28/01/2022
Chassis no KMHLN41ETNU269500
Effective Date/Time of Ownership

INSURANCE COMPANY

Name of Insurance Company China Taiping Insurance (Singapore) Pte. Ltd.
Policy Number / Cover Note Number DMPCSNA00004202402

DRIVER