

ASS. REC. BY:

REF: LPC/ CS/LPC24120185/Kvh3(N)

C

Kenneth

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of 2 Refs with 571 6781Insured: SGN 3228J

Policy No. _____


Claims No. 24/24/24/VP05/030260

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

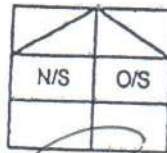Remark: The veh had commenced its
repair at the time of inspection.Bal. or Market Value: \$ 163k

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 06 days Res.: Yes or NoLum Sum: 1.81 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: Sum 80101 Yr Regn: 06, 23Type: M. Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /Truck / Traller or A)Make: Toy Corolla Cross C.C. 1797Colour: N.P. White A/C: Insured / Std / NI / NASp. Reading: 25881 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: ZVG11 1004538Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModl: Nil / S/Rlm / STD A/Rlm orTyre Size: F: 225/50R18

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front _____ Rear _____

R/Bal. 9 mm R/Bal. 9 mmL/Bal. 9 mm L/Bal. 9 mmD.O.A. 28/11/24 D.O.I. 13/12/2024

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

1 Got BZ29/9 @ 9211-65 11, 216-73 Cntr (red 6441.42, 36%)

Date/Time, File Pass to?

☐ : Prell. ReportDays Of Repair: 6

Resurvey No. of Trip: _____

Survey Fee:

1)

☐ : Final Report

Date/Time, File Return to?

Transportation

Add Fee: ☐ : Site Insp (\$☐ : Interview (\$☐ : Tech Invs (\$☐ : Weekend (\$

Fees

Others

Report Format :

Lump Sum / I.B.I. (\$) _____

TOTAL

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of First Submission	29/11/2024 18:56 (SGT)
Reported by	Both Policyholder and Actual Driver
Date of Accident	28/11/2024 08:00 (SGT)
Exact Location of Accident	2 Airport Rd, Singapore 539939
Additional Location Information	KPE TOWARDS ECP AFTER TAMPINES ROAD EXIT
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SNM8010J
INSURED/POLICYHOLDER	
Is company?	No
Name Of Registered Owner	TAN FEI LIN
NRIC No	SXXXX678F
Email Address	angelinetan@flagshipfoods.com.sg
Mobile Phone No	(Phone) +65-93219819
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	Toyota
Model	Corolla
Variant	CROSS HYBRID
Exact purpose for which vehicle was being used at time of accident	Private use
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Private car
Transmission	Auto
CC	1999
Vehicle Fuel	Petrol-CNG
First Registration Date	30/06/2023
Chassis no	ZVG111004538
Effective Date/Time of Ownership	30/06/2023 00:00 (SGT)

INSURANCE COMPANY

Name of Insurance Company	HL Assurance Pte Ltd
Policy Number / Cover Note Number	MP322535

DRIVER

Name of Driver	TAN FEI LIN
NRIC No	SXXXX678F
Date Of Birth	01/01/1966
Occupation	Indoor
Driving Pass Date	21/08/1986
Driving License Pass Class	3
Driving License Validity	Valid
Driving experience	38 YEARS AND 3 MONTHS
Gender	Female
Mobile Number	(Phone) +65-93219819
Alt. Phone Number	-
Email Address	angelinetan@flagshipfoods.com.sg
Address	134 PUNGGOL WALK
Address complement	#09-21
Postcode	828778
Is the driver the policyholder?	Yes
If No, Relationship of the Driver with the Insured	-
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Collision - Head to Rear
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	Yes
Was any injured conveyed to hospital by ambulance?	No
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	2
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No
Translator's name	-
Translator's ID	-
Translator's phone number	-
Translator's email	-
Original language used in the statement	-

PASSENGER 1

Name	ERICA TAY
Gender	Female

DETAILS OF POLICE ACTION

Was the accident reported to the police?	Yes
Police Station Name	Traffic Police
Police Station Phone No	(Phone) +65-65470000
Alt. Police Station Phone No	(Fax) +65-65474900
Police Station Address	10 Ubi Avenue 3 Singapore 408865
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

REFER TO STATEMENT AND POLICE REPORT T/20241202/7046

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SGN3228J
Vehicle Manufacturer	Toyota
Vehicle Model	Corolla
Vehicle Variant	-
Vehicle Colour	Blue
Vehicle Category	Private car
Name of Driver	-
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

INJURED PERSONS DETAILS

INJURED 1

Name of injured person	ERICA TAY
Gender	Female
Phone No	-
Address	-
Address Complement	-
Post Code	-
Approximate Age Years Old	-
Injuries Sustained	-
Injured person in which vehicle?	SNM8010J
Were seat belts worn?	Yes
Was this injured conveyed to hospital by ambulance?	No

INJURED 2

Name of injured person	TAN FEI LIN
Gender	Female
Phone No	-
Address	-
Address Complement	-
Post Code	-
Approximate Age Years Old	-
Injuries Sustained	-
Injured person in which vehicle?	SNM8010J
Were seat belts worn?	Yes
Was this injured conveyed to hospital by ambulance?	No

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' law yers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;

(ii) investigating the accident and/or my claims;

(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;

(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or

(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.

(collectively the "Purposes")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' law yers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and


(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their law yers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

Policyholder's Signature / Date & Time

Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel

Sketch Plan

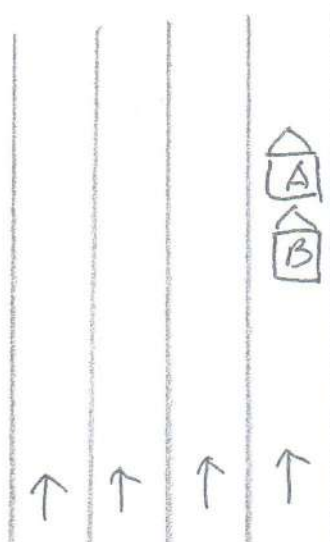

KPE towards
ECP

A = SNM 8010J

B = SGN 3228J

Describe Circumstances of the Accident

Date: 28 Nov 2024


I was driving to work with my daughter, Erica Tay.
We were driving on KPE ~~the~~ towards ECP 9km mark,
just after Tampines Road exit at around 8:00am.
~~The front car~~ There was ~~great~~ usual peak hour and
as I was cruising around 70 km/hr and was focusing
on the road and front car, the car in front of me
~~Toyota Altis S&N 3228J~~ suddenly brake, so I also brake
and the next second I realise I was hit at the
back by a Toyota Altis S&N 3228J. The impact was
great. I feel unwell will consult Doctor later.

Declaration

We declare the foregoing particulars are true in every respect.



Policyholder's Signature / Date &
Time



Driver's Signature (if driver is not the policyholder) / Date
& Time





Witnessed by Reporting Centre
Personnel



SINGAPORE POLICE FORCE



T/20241202/7046

1 of 3


Police Station Of Origin:
Traffic Police
10 Ubi Avenue 3 SINGAPORE 408865
Tel No: 65470000

Report No. T/20241202/7046

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 02/12/2024 12:55	Vide Report No.:	Station Diary No.:
--	------------------	--------------------

Informant's Particulars

Name of Informant: tan fei lin			Address: 134 PUNGGOL WALK #09-21 ECOPOLITAN SINGAPORE 828778		
ID Type / ID No.: NRIC NO / S1705678F			Contact No.: Home/Office: Mobile: 93219819		
Nationality: SINGAPORE CITIZEN			Email: angelinetan@flagshipfoods.com.sg angelinetan@flagshipfoods.com.sg		
Sex: Female	Age: 58	Date of Birth: 01/01/1966	Type of Informant: Driver		
Race: Chinese			Language: English		
Occupation:  Administration manager			Driving Licence Information: Class: 3 Date of Expiry:		

General Information of the Accident

Type of Accident:	Injury Others	Drink Drive: No	Date/Time of Accident: 28/11/2024 08:00	Type of Location: Straight Road
Location: KALLANG PAYA LEBAR EXPRESSWAY				
Weather: Clear		Road Surface: Dry		
Traffic Flow: One Way		Traffic Control: Not Controlled		Traffic Volume: Heavy
Type of Collision: Between Moving Vehicles - Head To Rear				Anyone conveyed by ambulance: No

Details of Vehicle Involved

Vehicle No.	Type	Make	Model	Color	Condition	No of Passenger
SGN3228J	Motor car	TOYOTA	corolla	Blue	Seriously Damaged	1
SNM8010J	Motor car	TOYOTA	cross	White	Seriously Damaged	1

Details of Vehicle Insurance

Vehicle No.	Insurance Company	Insurance No	Effective Date	Expiry Date
SNM8010J	HL Assurance	MP322535	30/06/2024	29/06/2025



**SINGAPORE
POLICE FORCE**



T/20241202/7046

2 of 3

Police Station Of Origin:
Traffic Police
10 Ubi Avenue 3 SINGAPORE 408865
Tel No: 65470000

Report No. T/20241202/7046

CONTINUATION OF REPORT

Details of Person Involved			
Any Pedestrian Involved: No			
No. of Pedestrians Injured: NIL		Use of Pedestrian Crossing: NA	
Driver			
Name	RYAN ONG BOON LIANG	ID No.	S9671820I
Related Vehicle	SGN3228J (Motor car)	Contact No.	NIL
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave (MC)	NIL	Degree of Injury	NIL
Driver			
Name	TAN FEI LIN	ID No.	S1705678F
Related Vehicle	SNM8010J (Motor car)	Contact No.	93219819
Hospital/Clinic	TOWN HALL CLINIC PTE LTD	Class of Driving Licence & Expiry Date	Class: 3 Date of Expiry: NIL
Date Treatment	29/11/2024	Date Discharge	29/11/2024
No. of Days granted Medical Leave (MC)	04	Degree of Injury	Slight
Passenger			
Name	ERICA TAY	ID No.	S9728111D
Related Vehicle	SNM8010J (Motor car)	Contact No.	86921792
Hospital/Clinic	SHENTON MEDICAL GROUP	Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL
Date Treatment	29/11/2024	Date Discharge	29/11/2024
No. of Days granted Medical Leave (MC)	03	Degree of Injury	Slight

Brief Details.

i was driving on the way to work with my daughter as passenger, driving along KPE nearing the 9km mark towards KPE tunnel the traffic was heavy and I was driving about 70km/hr. the car in front of me brake and so i brake when the car behind me hit into my rear. the front car was not hit by me as I brake in time and the driver drove away after checking to make sure that I did not hit his car. My car rear was badly damaged by the impact. My daughter and I were shaken and both of us had backache and whiplash the next day. We went to consulted GP and were given 3 and 4 days MC.



**SINGAPORE
POLICE FORCE**



T/20241202/7046

Police Station Of Origin:
Traffic Police
10 Ubi Avenue 3 SINGAPORE 408865
Tel No: 65470000

3 of 3

Report No. T/20241202/7046

CONTINUATION OF REPORT

Signature Of Officer Recording The Report:
Not applicable

Signature Of Interpreter:
Not applicable

Officer In Charge Of Case:
TP / AEIT /
LEE GUANG HUI
Contact No.: 65476414

Signature Of Informant:

The identity of the person making this report has been authenticated by Singpass. No signature is required.

Date/Time:
02/12/2024 12:55

Classification Of Case:

This report is lodged at Queenstown NPC Kiosk 1
NP168

TTS EUROCARS PTE LTD

2 DEFU SOUTH STREET 1, #04-04 DEFU INDUSTRIAL CITY

Date : 4/12/2024

RE: VEHICLE REPAIR QUOTATION

Vehicle Reg No : **SNM8010J**
 Name of Insured : **TAN FEI LIN**
 Policy Number : **MP322535**
 Date of Accident : **28/11/2024**
 Tyre of Claim : **THIRD PARTY CLAIM**
 Model : **TOYOTA COROLLA CROSS**
 Chassis No : **ZVG111004538**

Not Authorized
Penney B4 pain
6 days

8921465
11,216.73

We are please to submit our estimate of repairs to the above mention vehicle.

PARTS COST		PG 1	
	QTY	UNIT/PC	Parts
1 REAR TAILGATE <i>1980</i>	1	\$2,838.60	<i>R</i> \$2,838.60 ✓
2 REAR TAILGATE HINGES RH	1	\$152.70	<i>R</i> \$152.70 X
3 REAR TAILGATE HINGES LH	1	\$152.70	<i>R</i> \$152.70 X
4 REAR TAILGATE EMBLEM LOGO <i>88</i>	1	\$159.40	<i>na</i> \$159.40 ✓
5 REAR TAILGATE INNER PULL GARNISH	1	\$165.90	<i>in</i> \$165.90 X
6 REAR TAILGATE INNER TRIM BOARD	1	\$802.70	<i>in</i> \$802.70 X
7 RR TAILGATE INNER TRIM BOARD CLIPS	6	\$4.90	<i>na</i> \$29.40 X
8 REAR TAILGATE MECHANISAM LOCK	1	\$1,500.00	<i>R</i> \$1,500.00 X
9 RR TAILGATE MECHANISAM LOCK STRIK	1	\$106.70	<i>R</i> \$106.70 X
10 RR TAILGATE OPEN BUTTON SENSOR	1	\$649.30	<i>in</i> \$649.30 X
11 REAR TAILGATE OUTER GARNISH	1	\$677.40	<i>in</i> \$677.40 X
12 REAR TAILGATR WEATHERSTRIP	1	\$653.70	<i>in</i> \$653.70 X
13 TAILGATE RUBBER GUIDE STOPPER RH	1	\$81.70	<i>in</i> \$81.70 X
14 TAILGATE RUBBER GUIDE STOPPER LH	1	\$81.70	<i>in</i> \$81.70 X
15 TAILGATE WIPER MOTOR	1	\$1,766.90	<i>in</i> \$1,766.90 X
16 TAILGATE WIPER ARM	1	\$311.40	<i>in</i> \$311.40 X
17 TAILLAMP INNER RH	1	\$1,137.20	<i>in</i> \$1,137.20 X
18 TAILLAMP OUTER RH	1	\$1,329.30	<i>in</i> \$1,329.30 X
19 REAR BUMPER	1	\$1,405.40	<i>R</i> \$1,405.40 ✓
20 REAR BUMPER CLIPS	12	\$5.80	<i>na</i> \$69.60 ✓
21 REAR BUMPER SIDE RETAINER RH	1	\$176.10	<i>in</i> \$176.10 X
22 REAR BUMPER SIDE RETAINER LH	1	\$176.10	<i>in</i> \$176.10 X
23 RR BUMPER LOWER SIDE GARNISH RH <i>382.60</i>	1	\$574.20	<i>R</i> \$574.20 ✓
24 RR BUMPER LOWER SIDE GARNISH LH <i>382.60</i>	1	\$574.20	<i>CM</i> \$574.20 ✓
25 REAR BUMPER LOWER COVER	1	\$688.50	<i>R</i> \$688.50 ✓
26 REAR BUMPER SENSOR <i>C 362.80 Del/short 3</i>	3	\$603.90	\$2,415.60 <i>LTT</i>
27 REAR BUMPER TOW COVER	1	\$95.70	<i>mi'</i> \$95.70 ✓
28 REAR BUMPER REFLECTOR RH	1	\$103.70	<i>CM</i> \$103.70 ✓
29 REAR BUMPER REFLECTOR LH	1	\$103.70	<i>in</i> \$103.70 X
30 REAR INNER SHIELD RH <i>312.60</i>	1	\$678.90	<i>CM</i> \$678.90 ✓
31 REAR INNER SHIELD CLIPS	6	\$4.20	<i>na</i> \$25.20 X
32 REAR END PANEL <i>903.80</i>	1	\$1,500.00	<i>R</i> \$1,500.00 ✓
33 RR END PANEL INNER TOP GARNISH	1	\$816.30	<i>in</i> \$816.30 X
LESS 25%			\$21,999.90
			-\$5,499.98
			\$16,499.92

TTS EUROCARS PTE LTD

2 DEFU SOUTH STREET 1, #04-04 DEFU INDUSTRIAL CITY

Date : 4/12/2024

RE: VEHICLE REPAIR QUOTATION

Vehicle Reg No	:	SNM8010J
Name of Insured	:	TAN FEI LIN
Policy Number	:	MP322535
Date of Accident	:	28/11/2024
Tyre of Claim	:	THIRD PARTY CLAIM
Model	:	TOYOTA COROLLA CROSS
Chassis No	:	ZVG111004538

We are please to submit our estimate of repairs to the above mention vehicle.

		B/F	16,499.92		
				PG 2	
<u>PARTS COST</u>		QTY	UNIT/PC	Parts	
34	RR EXHAUST ALUMINIUM HEAT SHIEL	1	\$737.20	<i>R</i> \$737.20	<i>X</i>
35	RR EXHAUST RUBBER MOUNTING	1	\$158.20	<i>Tn</i> \$158.20	<i>✓</i>
36	RR EXHAUST SILENCER BOX	1	\$3,018.40	<i>B</i> \$3,018.40	<i>✓</i>
37	RR EXHAUST SILENCER BOX GASKET	1	\$154.80	<i>na</i> \$154.80	<i>✓</i>
38	REAR FLOOR PANEL	1	\$1,816.30	<i>R</i> \$1,816.30	<i>X</i>
39	RR FLOOR PANEL INNER TOP BOARD	1	\$1,427.10	<i>Sn</i> \$1,427.10	<i>X</i>
40	RR FLOOR PANEL SPONGE TRAY	1	\$840.20	<i>Sn</i> \$840.20	<i>X</i>
41	RR SHOCK ABSORBER	2	\$451.50	<i>Sn</i> \$903.00	<i>X</i>
42	RR SHOCK ABSORBER MOUNTING	2	\$294.80	<i>Sn</i> \$589.60	<i>X</i>
43	RR SHOCK ABSORBER DAMPER	2	\$220.50	<i>Sn</i> \$441.00	<i>X</i>
44	RR SHOCK ABSORBER STOPPER	2	\$185.10	<i>Sn</i> \$370.20	<i>X</i>
45	RR SHOCK ABSORBER DUCT COVER	2	\$155.10	<i>Sn</i> \$310.20	<i>X</i>
				\$10,766.20	
LESS 25%				-\$2,691.55	
				\$8,074.65	

<u>SPECIAL NETT</u>			
1	SEALANT	<i>na</i> \$120.00	<i>408n</i>
2	REAR NO PLATE WITH CASING	<i>Del</i> \$60.00	<i>455n</i>
		\$180.00	

<u>LABOUR</u>			
1	TO DISMANTLE & REFIX REAR SENSOR	\$350.00	<i>601</i>
2	TO CHECK TAILLAMP WIRING SYSTEM & FUNCTION ETC.	\$400.00	<i>201</i>
3	TO APPY TUFF COATING FOR AFFECT	\$500.00	<i>601</i>
4	TO DISMANTLE & REFIX REAR WINDSCREEN GLASS	\$100.00	<i>✓</i>
5	TO DISMANTLE & CHANGE REAR EXHAUST, REAR SHOCK ABSORBER AND ALL NECESSARY	<i>na</i> \$600.00	<i>X</i>
		\$1,950.00	

TTS EUROCARS PTE LTD

2 DEFU SOUTH STREET 1, #04-04 DEFU INDUSTRIAL CITY

Date : 4/12/2024

RE: VEHICLE REPAIR QUOTATION

Vehicle Reg No	:	SNM8010J
Name of Insured	:	TAN FEI LIN
Policy Number	:	MP322535
Date of Accident	:	28/11/2024
Tyre of Claim	:	THIRD PARTY CLAIM
Model	:	TOYOTA COROLLA CROSS
Chassis No	:	ZVG111004538

We are please to submit our estimate of repairs to the above mention vehicle.

		B/F	10,204.65	
<u>PARTS COST</u>			PG 3	
	QTY	UNIT/PC	Parts	
<u>LABOUR</u>				
6	TO PANEL BEATING, DISMANTLE & REFIX TAILGATE, INNER TRIM BOARD REAR BUMPER, END PANEL AND ALL NECESSARY ETC.		\$2,800.00	700/-
7	TO SPRAY PAINTING ON REAR TAILGATE REAR BUMPER AND END PANEL AND ALL NECESSARY ETC		\$2,200.00	800/-
8	TO DIAGNOSIS AND RESET FAULT CODE.		\$500.00	180/-
			<u>\$15,704.65</u>	

The above estimates are base on visual inspection and it is possible that further materials and labour may be required upon dismantling. Should this occur, we will submit supplementary quotation for further approval.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

TTS EUROCARS PTE LTD

2 DEFU SOUTH STREET 1, #04-04 DEFU INDUSTRIAL CITY

Date : 4/6/2025

SUPPLEMENTARY

RE: VEHICLE REPAIR QUOTATION

Insurance Company :

LONPAC INSURANCE BHD

Vehicle Reg No :

SNM8010J

Name of Insured :

TAN FEI LIN

Policy Number :

MP322535

Date of Accident :

28/11/2024

Type of Claim :

THIRD PARTY CLAIM

Model :

TOYOTA COROLLA CROSS

Chassis No :

ZVG111004538

We are please to submit our estimate of repairs to the above mention vehicle.

PARTS COST

		QTY	UNIT/PC	Parts	
1	REAR BUMPER CORNER RH	<i>Required</i> 1	\$570.00	\$570.00	X
2	REAR BUMPER ARM RH	1	\$240.00	<i>By</i> \$240.00	✓
3	REAR BUMPER CENTRE GARNISH	1	\$570.00	<i>By</i> \$570.00	✓
4	REAR BUMPER GARNISH RIGHT	1	\$586.00	<i>By</i> \$586.00	✓
5	REAR BUMPER GARNISH RIGHT	<i>Required</i> 1	\$586.00	\$586.00	X
6	EXHAUST PIPE SUPPORT	1	\$54.00	<i>Del</i> \$54.00	✓
				\$2,606.00	
	LESS 25%			\$651.50	
				<u>\$1,954.50</u>	

Total Parts

\$1,954.50

The above estimates are base on visual inspection and it is possible that further materials and labour may be required upon dismantling. Should this occur, we will submit supplementary quotation for further approval.

TTS EUROCARS PTE LTD

2 DEFU SOUTH STREET 1, #04-04 DEFU INDUSTRIAL CITY

Date : 4/6/2025

FINALIZATION REPORT**RE: VEHICLE REPAIR QUOTATION**

Vehicle Reg No :	SNM8010J
Name of Insured :	TAN FEI LIN
Policy Number :	MP322535
Date of Accident :	28/11/2024
Type of Claim :	THIRD PARTY CLAIM
Model :	TOYOTA COROLLA CROSS
Chassis No :	ZVG111004538

We are please to submit our estimate of repairs to the above mention vehicle.

	<u>PARTS COST</u>	<u>QTY</u>	<u>UNIT/PC</u>	<u>Parts</u>
1	REAR TAILGATE	1	\$2,838.60	\$2,838.60
2	REAR TAILGATE HINGES RH	1	\$152.70	\$0.00
3	REAR TAILGATE HINGES LH	1	\$152.70	\$0.00
4	REAR TAILGATE EMBLEM LOGO	1	\$159.40	\$159.40
5	REAR TAILGATE INNER PULL GARNISH	1	\$165.90	\$0.00
6	REAR TAILGATE INNER TRIM BOARD	1	\$802.70	\$0.00
7	RR TAILGATE INNER TRIM BOARD CLIPS	6	\$4.90	\$0.00
8	REAR TAILGATE MECHANISAM LOCK	1	\$1,500.00	\$0.00
9	RR TAILGATE MECHANISAM LOCK STRIK	1	\$106.70	\$0.00
10	RR TAILGATE OPEN BUTTON SENSOR	1	\$649.30	\$0.00
11	REAR TAILGATE OUTER GARNISH	1	\$677.40	\$0.00
12	REAR TAILGATR WEATHERSTRIP	1	\$653.70	\$0.00
13	TAILGATE RUBBER GUIDE STOPPER RH	1	\$81.70	\$0.00
14	TAILGATE RUBBER GUIDE STOPPER LH	1	\$81.70	\$0.00
15	TAILGATE WIPER MOTOR	1	\$1,766.90	\$0.00
16	TAILGATE WIPER ARM	1	\$311.40	\$0.00
17	TAILLAMP INNER RH	1	\$1,137.20	\$0.00
18	TAILLAMP OUTER RH	1	\$1,329.30	\$0.00
19	REAR BUMPER	1	\$1,405.40	\$1,405.40
20	REAR BUMPER CLIPS	12	\$5.80	\$69.60
21	REAR BUMPER SIDE RETAINER RH	1	\$176.10	\$176.10
22	REAR BUMPER SIDE RETAINER LH	1	\$176.10	\$0.00
23	RR BUMPER LOWER SIDE GARNISH RH	1	\$574.20	\$574.20
24	RR BUMPER LOWER SIDE GARNISH LH	1	\$574.20	\$574.20
25	REAR BUMPER LOWER COVER	1	\$688.50	\$688.50
26	REAR BUMPER SENSOR	3	\$603.90	\$1,811.70
27	REAR BUMPER TOW COVER	1	\$95.70	\$95.70
28	REAR BUMPER REFLECTOR RH	1	\$103.70	\$103.70
29	REAR BUMPER REFLECTOR LH	1	\$103.70	\$0.00
30	REAR INNER SHIELD RH	1	\$678.90	\$678.90
31	REAR INNER SHIELD CLIPS	6	\$4.20	\$0.00
32	REAR END PANEL	1	\$1,500.00	\$1,500.00
33	RR END PANEL INNER TOP GARNISH	1	\$816.30	\$0.00
34	RR EXHAUST ALUMINIUM HEAT SHIEL	1	\$737.20	\$0.00

TTS EUROCARS PTE LTD

2 DEFU SOUTH STREET 1, #04-04 DEFU INDUSTRIAL CITY

Date : 4/6/2025

FINALIZATION REPORT**RE: VEHICLE REPAIR QUOTATION**

Vehicle Reg No :	SNM8010J
Name of Insured :	TAN FEI LIN
Policy Number :	MP322535
Date of Accident :	28/11/2024
Type of Claim :	THIRD PARTY CLAIM
Model :	TOYOTA COROLLA CROSS
Chassis No :	ZVG111004538

We are please to submit our estimate of repairs to the above mention vehicle.

	<u>PARTS COST</u>	<u>QTY</u>	<u>UNIT/PC</u>	<u>Parts</u>
35	RR EXHAUST RUBBER MOUNTING	1	\$158.20	\$158.20
36	RR EXHAUST SILENCER BOX	1	\$3,018.40	\$3,018.40
37	RR EXHAUST SILENCER BOX GASKET	1	\$154.80	\$154.80
38	REAR FLOOR PANEL	1	\$1,816.30	\$0.00
39	RR FLOOR PANEL INNER TOP BOARD	1	\$1,427.10	\$0.00
40	RR FLOOR PANEL SPONGE TRAY	1	\$840.20	\$0.00
41	RR SHOCK ABSORBER	2	\$451.50	\$0.00
42	RR SHOCK ABSORBER MOUNTING	2	\$294.80	\$0.00
43	RR SHOCK ABSORBER DAMPER	2	\$220.50	\$0.00
44	RR SHOCK ABSORBER STOPPER	2	\$185.10	\$0.00
45	RR SHOCK ABSORBER DUCT COVER	2	\$155.10	\$0.00
46	REAR BUMPER CORNER RH	1	\$570.00	\$570.00
47	REAR BUMPER ARM RH	1	\$240.00	\$240.00
48	REAR BUMPER CENTRE GARNISH	1	\$570.00	\$570.00
49	REAR BUMPER GARNISH RIGHT	1	\$586.00	\$586.00
50	REAR BUMPER GARNISH RIGHT	1	\$586.00	\$586.00
51	EXHAUST PIPE SUPPORT	1	\$54.00	\$54.00
				\$16,613.40
	LESS 25%			\$4,153.35
				<u>\$12,460.05</u>

	<u>SPECIAL NETT</u>	
1	SEALANT	\$40.00
2	REAR NO PLATE WITH CASING	\$45.00
		<u>\$85.00</u>

	<u>LABOUR</u>	
1	TO DISMANTLE & REFIX REAR SENSOR	\$60.00
2	TO CHECK TAILLAMP WIRING SYSTEM & FUNCTION ETC	\$20.00
3	TO APPY TUFF COATING FOR AFFECT	\$60.00
4	TO DISMANTLE & REFIX REAR WINDSCREEN GLASS	\$100.00

LABOUR

TTS EUROCARS PTE LTD

2 DEFU SOUTH STREET 1, #04-04 DEFU INDUSTRIAL CITY

Date : 4/6/2025

FINALIZATION REPORT**RE: VEHICLE REPAIR QUOTATION**

Vehicle Reg No :	SNM8010J
Name of Insured :	TAN FEI LIN
Policy Number :	MP322535
Date of Accident :	28/11/2024
Type of Claim :	THIRD PARTY CLAIM
Model :	TOYOTA COROLLA CROSS
Chassis No :	ZVG111004538

We are please to submit our estimate of repairs to the above mention vehicle.

	<u>PARTS COST</u>	<u>QTY</u>	<u>UNIT/PC</u>	<u>Parts</u>
5	TO DISMANTLE & CHANGE REAR EXHAUST, REAR SHOCK ABSORBER AND ALL NECESSARY			\$0.00
6	TO PANEL BEATING, DISMANTLE & REFIX TAILGATE, INNER TRIM BOARD REAR BUMPER, END PANEL AND ALL NECESSARY ETC.			\$700.00
7	TO SPRAY PAINTING ON REAR TAILGATE REAR BUMPER AND END PANEL			\$800.00
8	TO DIAGNOSIS AND RESET FAULT CODE.			\$180.00
			Subtotal labour	<u>\$1,920.00</u>
	TOTAL PARTS AND LABOUR			<u><u>\$14,465.05</u></u>

REPAIR DURATION 6 DAYS

The above estimates are base on visual inspection and it is possible that further materials and labour may be required upon dismantling. Should this occur, we will submit supplementary quotation for further approval.

TTS EUROCARS PTE LTD

2 DEFU SOUTH STREET 1, #04-04 DEFU INDUSTRIAL CITY

Date : 4/6/2025

SUPPLEMENTARY**RE: VEHICLE REPAIR QUOTATION**

Insurance Company :	LONPAC INSURANCE BHD
Vehicle Reg No :	SNM8010J
Name of Insured :	TAN FEI LIN
Policy Number :	MP322535
Date of Accident :	28/11/2024
Type of Claim :	THIRD PARTY CLAIM
Model :	TOYOTA COROLLA CROSS
Chassis No :	ZVG111004538

We are please to submit our estimate of repairs to the above mention vehicle.

PARTS COST

		QTY	UNIT/PC	Parts
1	REAR BUMPER CORNER RH	1	\$570.00	\$570.00
2	REAR BUMPER ARM RH	1	\$240.00	\$240.00
3	REAR BUMPER CENTRE GARNISH	1	\$570.00	\$570.00
4	REAR BUMPER GARNISH RIGHT	1	\$586.00	\$586.00
5	REAR BUMPER GARNISH RIGHT	1	\$586.00	\$586.00
6	EXHAUST PIPE SUPPORT	1	\$54.00	\$54.00
				\$2,606.00
	LESS 25%			\$651.50
				<u>\$1,954.50</u>

Total Parts	<u>\$1,954.50</u>
-------------	-------------------

The above estimates are base on visual inspection and it is possible that further materials and labour may be required upon dismantling. Should this occur, we will submit supplementary quotation for further approval.

SNM 8010J

PARTS	SN	LABOUR	
1980.00	40.00	60.00	9211.73
88.00	45.00	20.00	85.00
1405.40	85.00	60.00	1920.00
69.60		100.00	11216.73 ✓
382.60		700.00	
382.60		800.00	
688.50		180.00	
1088.40		1920.00	
95.70			
103.70			
312.60			
903.80			
158.20			
3018.40			
154.80			
240.00			
570.00			
586.00			
54.00			
12282.30			
0.75			
9211.73			