

(08/11/13) wef

ASS. REC. BY: Marcus

REF:

CS/FC124/20439/4vp3

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SHC 4218C

at Workshop m/s Strides premier

of _____

Insured: SHB 4882?

Policy No. _____

Claims No. D25000067MFCT/CCPL/TPD2

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 5 days Res.: Yes or No

Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

C3691C
Vehicle: IN / OUT

Veh No: SHC 4218C Yr Regn: 12/12/17

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or CA / Hybrid

Make: Toyota prius c.c. 1798

Colour: maroon A/C: Insured / Std / NI / NA

Sp.Reading: 680537 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: JTDKB3FU003576216

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 195/65-R15

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal. 6 mm

L/Bal. 6 mm

D.O.A. 26/12/24

Survey held at

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear N/S
The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

14/1/25 Case noted 11-12-2025 LTA 87040
L/s 5400 informed poh suan (red 10,495.50, 66%)

Date/Time, File Pass to?

☐

Preli. Report

1)

☐

Final Report

Date/Time, File Return to?

2)

Days Of Repair: 5

Resurvey No. of Trip: _____

Add Fee:

☐

Site Insp (\$

☐

Interview (\$

☐

Tech. Invs (\$

☐

Weekend (\$

Survey Fee:

Transportation:

S + RS, SI

Photos

Others

TOTAL

Report Format :

Lump Sum / I.B.I: (\$)

[> Back to OneMotoring](#)

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type:	Company
Owner ID:	369K

Vehicle Details

Vehicle No.:	SHC4218C
Vehicle to be Exported:	No
Intended Deregistration Date:	30 Dec 2024
Vehicle Make:	TOYOTA
Vehicle Model:	PRIUS HYBRID 1.8 CVT
Primary Colour:	Maroon
Manufacturing Year:	2017
Engine No.:	2ZRS111894
Chassis No.:	JTDKB3FU003576216
Maximum Power Output:	90.0 kW (120 bhp)
Open Market Value:	\$29,007.00
Original Registration Date:	12 Dec 2017
First Registration Date:	12 Dec 2017
Transfer Count:	0
Actual ARF Paid:	\$5,000.00

Intended PARF Rebate Details

PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	11 Dec 2025
PARF Rebate Amount:	\$3,000.00

Intended COE Rebate Details

COE Expiry Date:	11 Dec 2025
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	8
PQP Paid:	\$34,159.00
COE Rebate Amount:	\$4,040.00
Total Rebate Amount:	\$7,040.00

Message

Please note that the 8-year COE for this vehicle cannot be further renewed. The vehicle must be deregistered once the COE expires, or when it reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 30 Dec 2024

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of First Submission	26/12/2024 16:47 (SGT)
Reported by	Actual Driver
Date of Accident	26/12/2024 01:25 (SGT)
Exact Location of Accident	302 Jln. Ahmad Ibrahim, Singapore 619594
Additional Location Information	ESSO PETROL STATION @ JALAN AHMAD IBRAHIM
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHC4218C
-----------------------------	----------

INSURED/POLICYHOLDER

Is company?	Yes
Name Of Registered Owner	STRIDES PREMIER TAXI PTE LTD
Company Reg No	1XXXXX369K
Email Address	sparc@stridespremier.com.sg
Mobile Phone No	(Phone) +65-91550072
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	Toyota
Model	Prius
Variant	-
Exact purpose for which vehicle was being used at time of accident	-
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Taxi
Transmission	Auto
CC	1800
Vehicle Fuel	-
First Registration Date	-
Chassis no	-
Effective Date/Time of Ownership	-

INSURANCE COMPANY

Name of Insurance Company	MS First Capital Insurance Ltd
Policy Number / Cover Note Number	D-24102275MFSH

DRIVER

Name of Driver	CHIA HUNG KIANG
NRIC No	SXXXX558A
Date Of Birth	13/12/1966
Occupation	Outdoor
Driving Pass Date	15/01/1993
Driving License Pass Class	3
Driving License Validity	Valid
Driving experience	31 YEARS AND 11 MONTHS
Gender	Male
Mobile Number	(Phone) +65-65446676
Alt. Phone Number	-
Email Address	sparc@stridespremier.com.sg
Address	1
Address complement	-
Postcode	-
Is the driver the policyholder?	No
If No, Relationship of the Driver with the Insured	RELIEF
Does Driver Own Other Vehicles?	No
Vehicle Registration Number of Other Vehicle Owned by Driver	-
Insurance Company of Other Vehicle Owned by Driver	-

GENERAL INFORMATION OF THE ACCIDENT

Type of Accident	Hit and run / Vandalism / Damaged whilst parked
Weather Conditions	Clear
Road Surface	Dry

OTHER INFORMATION

Was any foreign vehicle involved in the accident?	No
Number of vehicles involved in the accident	2
Was anybody injured in the Accident?	No
Was any injured conveyed to hospital by ambulance?	-
Was any other vehicle or property damaged?	Yes
Number of Passengers (Including Driver)	0
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance?	No
Translator's name	-
Translator's ID	-
Translator's phone number	-
Translator's email	-
Original language used in the statement	-

DETAILS OF POLICE ACTION

Was the accident reported to the police?	No
Was notice of intended Prosecution given?	No
If yes, against whom?	-

CIRCUMSTANCES OF ACCIDENT

REFER TO ATTACH

ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	No

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SHB4882P
Vehicle Manufacturer	-

Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Taxi
Name of Driver	-
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	MS First Capital Insurance Ltd
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Traffic Police Department for investigation.**
6. This report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
 (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the insurers and/or GIA to their third-party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.



Policyholder's Signature / Date & Time

[Signature]


Actual Driver's Signature (if driver is not the policyholder) / Date & Time

26 DEC 2024

[Signature]

Witnessed by Reporting Centre Personnel (Name as in NRIC/ID card)

Sketch Plan

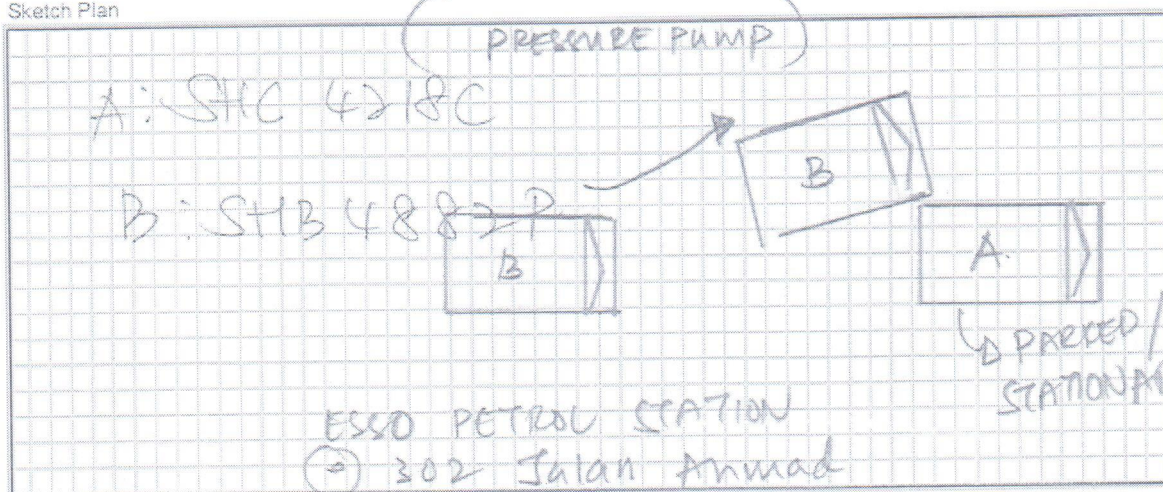

vJun2022

Describe Circumstances of the Accident.

ON 26/12/2024 @ 01:25 HRS, I PARKED MY TAXI (SHC 4218 C) ALONG THE DRIVEWAY @ ESSO – 302 JALAN AHMAD IBRAHIM & LEFT TO THE WASHROOM.

WHEN I RETURNED TO MY TAXI, I DISCOVERED THAT VEHICLE B (SHB 4882 P – CITY CAB TAXI) HAD COLLIDED ONTO THE REAR LEFT OF MY TAXI.

DRIVER OF VEHICLE B CLAIMED HE LOST CONTROL OF HIS TAXI – THUS CAUSING THE RIGHT FRONT OF VEHICLE B TO COLLIDE ONTO THE REAR LEFT OF MY TAXI (WHICH WAS STATIONARY).


DUE TO THE IMPACT, MY TAXI HAD DAMAGES ON THE LEFT REAR & VEHICLE B HAD DAMAGES ON THE RIGHT FRONT.

NO INJURY INVOLVED. NO AMBULANCE AT SCENE.


NO PASSENGERS ONBOARD BOTH VEHICLES.

*SCENE PHOTOS TAKEN

DAMAGES FOUND ON VEHICLE A & VEHICLE B

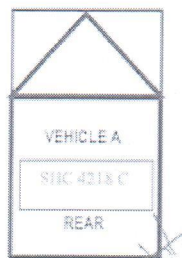

STRIDES
PREMIER
TAXI

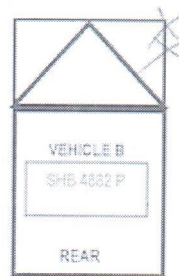

THIRD PARTY
VEHICLE


Driver's Signature

Thursday, December 26, 2024 @ 9:05:56 AM

(attended by )

the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged parts for resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Section A - Accident Details

Registration Number	SHC4218C
Case Reference Number	TAX/12/24/2089
Registration Date	12/12/17
Company Type	Strides Premier Taxi Pte Ltd
Make	TOYOTA
Model	PRIUS4
Name of Driver	CHIA HUNG KIANG
Type of Accident	Side Swipe
Accident Date and Time	26/12/24 1:25 AM
Accident Reported Date and Time	26/12/24 1:21 PM
Is Surveyor Required?	No
Survey by	
Vehicle is Towed Back?	No
Towed Back Date and Time	
Replacement Vehicle issued?	No
Job Card Number	ACGJ24120072
Special Instruction to ARC, if any	DAMAGE TO REAR LEFT OF TAXI TOWED IN
Prepared Date and Time	26/12/24 3:00 PM
Chassis Number	
Mileage	
Work Shop	
Repair Completion Date and Time	

Section B - Summary of Repair Estimates

Summary of Repair Estimates		
	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$1,018.00	\$0.00
Total Spray Cost	\$2,234.00	\$0.00
Total Spare Part Cost	\$7,082.53	\$0.00
Total Other Cost	\$916.00	\$0.00
TOTAL COST	\$11,250.53	\$0.00
Lump Sum Total	\$11,250.00	\$0.00
Number of Repair Days	8.0	
Prepared / Adjusted By	Mun San #	
ARC / Surveyor Sign Off Date		
Signature	8W	x
Remarks		

Section C - Quotation and Accident Invoice Details

Quotation Number		Invoice Number	
Quotation Date		Invoice Date	
Invoice Amount		Prepared Date	

not Authorised
means

90096608

30/1/24 2/5 \$5600

5-day r

take photo after 1 hr

SMRT Accident Vehicle Repair Estimates

SMRT Auto
60 Woodlands I
FAX Number :
Estimator Telep
Accident Repor

Date Generate

User ID

Section D - Details of Repair Estimates

Part 1 - Labour Works		
Job Scope	Quotation from AR	Adjusted by Surveyor, if applicable
TO REPAIR REAR PORTION LH	\$1,018.00	200
Total Labour	\$1,018.00	800

Part 2 - Spray Painting & Panel Beating Related Works		
Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO RESPRAY TAIL GATE	\$378.00	200
TO RESPRAY TAILGATE OUTSIDE GARNISH	\$220.00	100
TO RESPRAY REAR BUMPER	\$378.00	200
TO RESPRAY BUMPER BEAM	\$220.00	11 X
TO RESPRAY REAR END PANEL	\$220.00	100
TO RESPRAY REAR SPARE TYRE PANEL	\$220.00	11 X
TO RESPRAY REAR FENDER LH	\$378.00	200
TO RESPRAY FILLER RR BUMPER LH	\$220.00	50
Total Spray Painting & Panel Beating	\$2,234.00	850

Part 3 - Other Costs - Accident and Accident Repair Related Expense		
Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TOWING CHARGE	\$56.00	3.179 ✓
TO WASH AND VACUUM	\$60.00	17 X
TO TRANSFER REAR TAILGATE MECHANISM	\$120.00	60
TO DO WHEEL ALIGNMENT / TYRE BALANCING	\$120.00	11 X
TO CHECK WIRING AND SYSTEM FUNCTION	\$120.00	20
TO APPLY RUST-PROOFING ON AFFECTED AREA	\$100.00	50
TO REMOVE AND REFIX REAR WINDSCREEN	\$120.00	✓
TO TEST AND REFIX REVERSE SENSOR SYSTEM	\$120.00	30
TO REPLACE SUNDRY PARTS	\$100.00	11 X
Total Other Costs	\$916.00	1986

Part 4 - Spare Parts / Material Usage									
Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Appr
		5215947913	COVER, RR BUMPER ASSY	1.00	\$478.90	25.00	\$359.17	Replace	D.S. ✓
		5202347030	REAR BUMPER REINFORCEMENT	1.00	\$360.10	25.00	\$270.08	Replace	Surf ✓
		5246247030	PAD, RR BUMPER, RH & LH, 1	2.00	\$4.30	8.60	\$6.45	Replace	Surf ✓
		5246247020	PAD, RR BUMPER, RH & LH, 2	2.00	\$4.30	8.60	\$6.45	Replace	Surf ✓
		5246247010	PAD, RR BUMPER, RH & LH, 3	2.00	\$4.30	8.60	\$6.45	Replace	Surf ✓
		5246147010	PAD, RR BUMPER, CTR	3.00	\$2.50	7.50	\$5.63	Replace	D.S. ✓
		5259968030	STOPPER, RR BUMPER, RH & LH	1.00	\$4.80	25.00	\$3.60	Replace	11 X
		5257647040	RETAINER, RR BUMPER, LH	1.00	\$127.40	25.00	\$95.55	Replace	11 X
		5259247040	SEAL, RR BUMPER, LH	1.00	\$95.50	25.00	\$71.63	Replace	Surf ✓
		5216116010	CLIPS PIECE, FRT BUMPER	10.00	\$4.80	48	\$36.00	Replace	Surf ✓
		5245347010	GUARD, RR BUMPER, LOWER	1.00	\$623.50	25.00	\$467.63	Replace	P.S. ✓
		5256647900	FILLER, RR BUMPER, LH	1.00	\$168.60	25.00	\$126.45	Replace	TORR ✓
			SENSOR REVERSE	1.00	\$180.00	0.00	\$180.00	Replace	Surf ✓

SMRT Accident Vehicle Repair Estimates

SMRT Auto
60 Woodlands I
FAX Number :
Estimator Telep
Accident Repor

Date Generate

User ID

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Appr
		9018906029	REAR BUMPER GROMMET SCREW	2.00	\$2.20 4.40	25.00	\$3.30	Replace	me ✓
		8156147151	LENS & BODY, REAR COMBINATION LAMP, LH	1.00	\$489.00	25.00	\$366.75	Replace	me X
		8159147010	LENS & BODY ASSY, RR BUMPER, LH	1.00	\$544.40	25.00	\$408.30	Replace	me ✓
		8149847020	COVER, REAR COMBINATION LAMP, LH	1.00	\$69.90	25.00	\$52.43	Replace	me X
		5839947030	COVER, REAR FLOOR UNDER, LH	1.00	\$261.60	25.00	\$196.20	Replace	me X
		6160247160	PANEL SUB-ASSY, FENDER REAR LH	1.00	\$943.10	25.00	\$707.33	Replace	me X
		6563847060	LINER, REAR FENDER, LH	1.00	\$151.10	25.00	\$113.32	Replace	me X
		6700547440	TAIL GATE PANEL SUB-ASSY, BACK DOOR	1.00	\$1,238.40	25.00	\$928.80	Replace	me ✓
		6788147050	TAIL GATE WEATHERSTRIP, BACK DOOR	1.00	\$402.50	25.00	\$301.88	Replace	me X
		5611750140	TAIL GATE DAM, BACK DOOR GLASS UPPER ADHESIVE	1.00	\$31.10	25.00	\$23.33	Replace	me X
		7680147110A1	TAIL GATE BACK DOOR OUTSIDE GARNISH SUB-ASSY	1.00	\$992.30	25.00	\$744.22	Replace	me ✓
		7544147090	NAME PLATE (HYBRID), LUGGAGE COMPARTMENT DOOR	1.00	\$59.10	25.00	\$44.33	Replace	me ✓
		7544247130	NAME PLATE (PRIUS), LUGGAGE COMPARTMENT DOOR	1.00	\$59.10	25.00	\$44.33	Replace	me ✓
		6810547291	TAIL GATE GLASS SUB-ASSY, BACK DOOR	1.00	\$1,795.00	25.00	\$1,346.25	Replace	me X
		6480147031	TAIL GATE LOWER GLASS SUB-ASSY, BACK DOOR	1.00	\$821.20	25.00	\$615.90	Replace	me X
			SEALANT W/SCREEN (3PCS)	3.00	\$37.00	0.00	\$111.00	Replace S/N	me ✓
		6881047061	TAIL GATE BACK DOOR HINGE ASSY, RH & LH	2.00	\$66.20	25.00	\$99.30	Replace	me X
		7540348010	EMBLEM SUB-ASSY REAR	1.00	\$77.40	25.00	\$58.05	Replace	me X
			STICKER LOGO (TAILGATE)	2.00	\$25.00	0.00	\$50.00	Replace S/N	me ✓
		5830747090	END PANEL SUB-ASSY, BODY LOWER BACK	1.00	\$707.10	25.00	\$530.33	Replace	me ✓
		5831147130	SPARE TYRE PANEL, PAN, REAR FLOOR	1.00	\$630.30	25.00	\$472.72	Replace	me X
			SEALANT SIKAFLEX	1.00	\$37.00	0.00	\$37.00	Replace S/N	me ✓
Total					\$11,499.00		\$8,890.16		

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check
Total									

3406
800
800
336
5192

P- 5412.7
252
P- 4059.52
S.N.T 198
4257.52
202
3406.2

Section A - Accident Details	
Registration Number	SHC4218C
Case Reference Number	TAX/12/24/2089
Registration Date	12/Dec/2017
Company Type	Strides Premier Taxi Pte Ltd
Make	TOYOTA
Model	PRIUS4
Name of Driver	CHIA HUNG KIANG
Type of Accident	Side Swipe
Accident Date and Time	26/Dec/2024 1:25 AM
Accident Reported Date and Time	26/Dec/2024 1:21 PM
Is Surveyor Required?	Yes
Survey by	
Vehicle is Towed Back?	No
Towed Back Date and Time	
Replacement Vehicle issued?	No
Job Card Number	ACGJ24120072
Special Instruction to ARC, if any	DAMAGE TO REAR LEFT OF TAXI TOWED IN
Prepared Date and Time	26/Dec/2024 3:00 PM
Chassis Number	
Mileage	
Work Shop	
Repair Completion Date and Time	

Section B - Summary of Repair Estimates		
Summary of Repair Estimates		
	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$1,018.00	\$800.00
Total Spray Cost	\$2,234.00	\$850.00
Total Spare Part Cost	\$7,112.13	\$3,406.04
Total Other Cost	\$916.00	\$336.00
TOTAL COST	\$11,280.13	\$5,392.04
Lump Sum Total	\$11,300.00	\$5,400.00 (L/S)
Number of Repair Days	8.0	5.0
Prepared / Adjusted By	Mun San #	MARCUS CHUA (LKK) / FCI
ARC / Surveyor Sign Off Date	31/12/2024 8:47 AM	30/12/2024 6:46 PM
Signature	<i>ms</i>	<i>Marcus Chua</i>
Remarks	<p>Expected length of repair (days) = 5 days Expected release date of vehicle after repair (Subject to approval from FM and without Supplementary) = 09-12-2025 REQ TOWING INVOICE L/S REPAIR / AFTER PAINT PHOTO , FOR CHECK ITEM and REPLACE ITEM PLEASE CALL SURVEYOR MARCUS CHUA (LKK) / HP : 9009 6608 / Email : marcuschua@kkauto.com</p>	

✓
L/S \$5400
14/1/25
@ par.

Section C - Quotation and Accident Invoice Details

Quotation Number	E24120188	Invoice Number	
Quotation Date	26/12/2024	Invoice Date	
Invoice Amount		Prepared Date	

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from AR	Adjusted by Surveyor, if applicable
TO REPAIR REAR PORTION LH	\$1,018.00	\$800.00
Total Labour	\$1,018.00	\$800.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO RESPRAY TAIL GATE	\$378.00	\$200.00
TO RESPRAY TAILGATE OUTSIDE GARNISH	\$220.00	\$100.00
TO RESPRAY REAR BUMPER	\$378.00	\$200.00
TO RESPRAY BUMPER BEAM	\$220.00	\$0.00
TO RESPRAY REAR END PANEL	\$220.00	\$100.00
TO RESPRAY REAR SPARE TYRE PANEL	\$220.00	\$0.00
TO RESPRAY REAR FENDER LH	\$378.00	\$200.00
TO RESPRAY FILLER RR BUMPER LH	\$220.00	\$50.00
Total Spray Painting & Panel Beating	\$2,234.00	\$850.00

Part 3 - Other Costs - Accident and Accident Repair Related Expense

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TOWING CHARGE	\$56.00	\$56.00
TO WASH AND VACUUM	\$60.00	\$0.00
TO TRANSFER REAR TAILGATE MECHANISM	\$120.00	\$60.00
TO DO WHEEL ALIGNMENT / TYRE BALANCING	\$120.00	\$0.00
TO CHECK WIRING AND SYSTEM FUNCTION	\$120.00	\$20.00
TO APPLY RUST-PROOFING ON AFFECTED AREA	\$100.00	\$50.00
TO REMOVE AND REFIX REAR WINDSCREEN	\$120.00	\$120.00
TO TEST AND REFIX REVERSE SENSOR SYSTEM	\$120.00	\$30.00
TO REPLACE SUNDRY PARTS	\$100.00	\$0.00
Total Other Costs	\$916.00	\$336.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Approved
			SEALANT SIKAFLEX	1.00	\$37.00	0.00	\$37.00	Replace	Replace
		5831147130	SPARE TYRE PANEL , PAN, REAR FLOOR	1.00	\$630.30	100.00	\$0.00	Replace	Repair

✓
R

Strides Premier Accident Vehicle Repair Estimates

Strides Premier Automotive Services Pte Ltd	
60 Woodlands Industrial Park E4, Singapore 757705	
FAX Number : 63655592	
Estimator Telephone Number : 68662623	
Accident Reporting Number : 68662672	

Date Generated : 09/01/2025

User ID : PohSuan

	5830747090	END PANEL SUB-ASSY, BODY LOWER BACK	1.00	\$707.10	25.00	\$530.33	Replace	Replace	√
		STICKER LOGO (TAILGATE)	2.00	\$25.00	0.00	\$50.00	Replace	Replace	√
	7540348010	EMBLEM SUB-ASSY REAR	0.00	\$77.40	0.00	\$0.00	Replace	Not Given	X
	6881047061	TAIL GATE BACK DOOR HINGE ASSY, RH & LH	0.00	\$66.20	0.00	\$0.00	Replace	Not Given	X
		SEALANT W/SCREEN (3PCS)	3.00	\$37.00	0.00	\$111.00	Replace	Replace	√
	6480147031	TAIL GATE LOWER GLASS SUB-ASSY, BACK DOOR	0.00	\$821.20	0.00	\$0.00	Replace	Not Given	X
	6810547291	TAIL GATE GLASS SUB-ASSY, BACK DOOR	0.00	\$1,795.00	0.00	\$0.00	Replace	Not Given	X
	7544247130	NAME PLATE (PRIUS) , LUGGAGE COMPARTMENT	1.00	\$59.10	25.00	\$44.33	Replace	Replace	√
	7544147090	NAME PLATE (HYBRID) , LUGGAGE COMPARTMENT	1.00	\$59.10	25.00	\$44.33	Replace	Replace	√
	768014710A1	TAIL GATE BACK DOOR OUTSIDE GARNISH SUB-	1.00	\$992.30	25.00	\$744.22	Replace	Replace	√
	5611750140	TAIL GATE DAM, BACK DOOR GLASS UPPER	0.00	\$31.10	0.00	\$0.00	Replace	Not Given	X
	6788147050	TAIL GATE WEATHERSTRIP, BACK	0.00	\$402.50	0.00	\$0.00	Replace	Not Given	X
	6700547440	TAIL GATE PANEL SUB-ASSY, BACK DOOR	1.00	\$1,238.40	25.00	\$928.80	Replace	Replace	√
	6563847060	LINER, REAR FENDER , LH	0.00	\$151.10	0.00	\$0.00	Replace	Not Given	X
	6160247160	PANEL SUB-ASSY, FENDER REAR LH	1.00	\$943.10	100.00	\$0.00	Replace	Repair	R
	5839947030	COVER, REAR FLOOR UNDER , LH	0.00	\$261.60	0.00	\$0.00	Replace	Not Given	X
	8149847020	COVER, REAR COMBINATION LAMP, LH	0.00	\$69.90	0.00	\$0.00	Replace	Not Given	X
	8159147010	LENS & BODY ASSY , RR BUMPER , LH	1.00	\$544.40	25.00	\$408.30	Replace	Replace	√
	8156147151	LENS & BODY, REAR COMBINATION LAMP , LH	0.00	\$489.00	0.00	\$0.00	Replace	Not Given	X
	9018906029	REAR BUMPER GROMMET SCREW	2.00	\$2.20	25.00	\$3.30	Replace	Replace	√
		SENSOR REVERSE	0.00	\$180.00	0.00	\$0.00	Replace	Not Given	X
	5256647900	FILLER, RR BUMPER , LH	1.00	\$168.60	25.00	\$126.45	Replace	Replace	√
	5245347010	GUARD, RR BUMPER, LOWER	1.00	\$623.50	25.00	\$467.63	Replace	Replace	√
	5216116010	CLIPS PIECE, FRT BUMPER	10.00	\$4.80	25.00	\$36.00	Replace	Replace	√
	5259247040	SEAL, RR BUMPER , LH	1.00	\$95.50	25.00	\$71.63	Replace	Replace	√
	5257647040	RETAINER, RR BUMPER, LH	0.00	\$127.40	0.00	\$0.00	Replace	Not Given	X
	5259968030	STOPPER, RR BUMPER, RH & LH	0.00	\$4.80	0.00	\$0.00	Replace	Not Given	X
	5246147010	PAD, RR BUMPER, CTR	3.00	\$2.50	25.00	\$5.63	Replace	Replace	√
	5246247010	PAD, RR BUMPER, RH & LH , 3	2.00	\$4.30	25.00	\$6.45	Replace	Replace	√
	5246247020	PAD, RR BUMPER, RH & LH , 2	2.00	\$4.30	25.00	\$6.45	Replace	Replace	√
	5246247030	PAD, RR BUMPER, RH & LH , 1	2.00	\$4.30	25.00	\$6.45	Replace	Replace	√
	5202347030	REAR BUMPER REINFORCEMENT	1.00	\$360.10	25.00	\$270.08	Replace	Replace	√
	5215947913	COVER, RR BUMPER ASSY	1.00	\$478.90	25.00	\$359.17	Replace	Replace	√
Total				\$11,499.00		\$4,257.55			

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check
Total									

4,257.55

-20%

3406.04

+ 800.00

+ 1186.00

5,392.04

L/S \$5,400/-