

ASS. REC. BY:

REF:

Kenneth

ASSIGNMENT

From:

Date:

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

at Workshop m/s

of

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value:

IDAC Accident Report:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days

Res.: Yes or No

Lum Sum:

%

3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date:

Person Contacted:

Vehicle: IN / OUT

Veh No:

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Colour

Sp. Reading

Eng/No:

C/No:

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modl: Nil / S/Rlm / STD A/Rlm or

Tyre Size:

F:

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

R/Bal.

L/Bal.

D.O.A.

Rear

R/Bal.

L/Bal.

D.O.A.

Survey held at

Des. of Damages: Fnt / Rear / O/S / N/S / UIC / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Date/Time, File Pass to?

☐

: Prel. Report

☐

: Final Report

1)

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Survey Fee:

Transportation:

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech Invs (\$

☐

: Weekend (\$

) S - RS. SI

) F. Invs

) Others

TOTAL

Report Format :

Lump Sum / I.B.I. (\$



WEGA ENGINEERING

automotive workshop and beyond

Blk 176, Sin Ming Drive, #04-16, Sin Ming Autocare, Singapore 575721
TEL : 65-6452 149 FAX : 65-6452 9153 GST REG NO : 1999 00741 Z

TO : India International Insurance Pte Ltd
6 Raffles Quay
#22-00,
Singapore 048580

EMAIL : Jacelyn.lohCL@III.COM.SG
ATTN : MOTOR CLAIMS DEPT

VEHICLE ESTIMATE : TP 07/4485

DATE : 12-Jul-24
Date of Accidents : 9-Jul-24
VEHICLE NO : GBC4092T
MODEL : TOYOTA HIACE
REG DATE : 20-Apr-12
CHASSIS NO : JTFHT02P30004813

S/N	PARTS DESCRIPTION	Qty	Unit Price \$	AMOUNT \$
1	FRONT BUMPER	1	\$468.20	\$468.20 ✓
2	BUMPER RETAINER, RH	1	\$351.30	\$351.30 ✓
3	BUMPER RETAINER, LH	1	\$351.30	\$351.30 X
4	FRONT BUMPER INFORCEMENT	1	\$535.40	\$535.40 ?
5	FRONT BUMPER GRILE, LOWER	1	\$229.20	\$229.20 ✓
6	FRONT BUMPER GRILE CLIP	20	\$5.50	\$110.00 5052
7	FRONT BUMPER GRILE, RADIATOR, LOWER, RH	1	\$91.10	\$91.10 X
8	FRONT BUMPER GRILE, RADIATOR, LOWER, LH	1	\$91.10	\$91.10 X
9	HEADLAMP, RH	1	\$1,257.90	\$1,257.90
10	HEADLAMP, LH	1	\$1,257.90	\$1,257.90
11	HEADLAMP BRACKET, RH	1	\$27.90	\$27.90 X
12	HEADLAMP BRACKET, LH	1	\$27.90	\$27.90 X
13	FOG LAMP COVER, RH	1	\$216.40	\$216.40 X
14	FOG LAMP COVER, LH	1	\$216.40	\$216.40 X
15	LOGO EMBER	1	\$72.50	\$72.50
16	FRONT CORNER PANEL ASSY, RH	1	\$401.20	\$401.20 X
17	FRONT CORNER PANEL ASSY, LH	1	\$401.20	\$401.20 X
18	FRONT BONNET	1	\$1,386.90	\$1,386.90
19	FRONT BONNET HINGE, RH	1	\$80.30	\$80.30
20	FRONT BONNET HINGE, LH	1	\$80.30	\$80.30
21	FRONT BONNET INSULATOR	1	\$121.00	\$121.00
22	FRONT BONNET STAND	1	\$31.60	\$31.60
23	FRONT BONNET LOCK	1	\$127.70	\$127.70
24	FRONT TOP INNER PANEL ASSY	1	\$1,008.50	\$1,008.50
25	FRONT GRILE RADIATOR	1	\$1,142.10	\$1,142.10
26	FRONT RADIATOR GRILLE CLIP	1	\$5.50	\$5.50
27	FRONT RADIATOR GRILLE AIR, GUIDE	1	\$171.45	\$171.45
28	FRONT DOOR PILLAR, RH	1	\$589.10	\$589.10
29	FRONT DOOR PANEL SUB-ASSY, RH	1	\$3,105.10	\$3,105.10
30	FRONT DOOR CHECKER ASSY, RH	1	\$274.10	\$274.10
31	FRONT WINDSCREEN GLASS	1	\$1,217.45	\$1,217.45
32	FRONT WINDSCREEN MOULDING	1	\$172.80	\$172.80
33	FRONT DOOR WINDOW REGULATOR ASSY, RH	1	\$371.70	\$371.70
34	FRONT DOOR WINDSCREEN GLASS SUB-ASSY, RH	1	\$67.20	\$67.20
35	WINDSCREEN SOLAR SLIM	1	\$150.00	\$150.00 12052
36	IU UNIT BRACKET	1	\$40.00	\$40.00 2652
37	IU STICKER	1	\$10.00	\$10.00
38	FRONT WIPER GARNISH	1	\$794.50	\$794.50
39	FRONT WIPER SIDE GARNISH, RH	1	\$39.50	\$39.50

40	FRONT WIPER SIDE GARNISH, LH	P ₂	1	\$39.50	\$39.50	X
41	FRONT WIPER ARM, RH	P ₂	1	\$207.00	\$207.00	X
42	FRONT WIPER ARM, LH	P ₂	1	\$207.00	\$207.00	X
43	FRONT WIPER BLADE	P ₂	1	\$113.70	\$113.70	X
44	FRONT WIPER MOTOR ASSY	P ₂	1	\$1,220.80	\$1,220.80	X
45	FRONT WIPER MOTOR NOZZLE <i>dl</i>	<i>nd/ln</i>	1	\$55.70	\$55.70	7
46	AIR CLEANER HOUSING ASSY		1	\$2,165.80	\$2,165.80	7
47	RADIO ANTENA	P ₂	1	\$371.25	\$371.25	7
48	FRONT DOOR UPPER HINGE ASSY, RH	P ₂	1	\$149.50	\$149.50	7
49	FRONT DOOR LOWER HINGE ASSY, RH	P ₂	1	\$149.50	\$149.50	7
50	FRONT DOOR PILLAR INNER PANEL		1	\$781.90	\$781.90	7
51	FRONT DOOR PILLAR OUTER PANEL	P ₂	1	\$631.15	\$631.15	7
52	FRONT DOOR LOCK ASSY, RH		1	\$787.00	\$787.00	7
53	FRONT DOOR OUTER HANDLE, RH	P ₂	1	\$255.20	\$255.20	X
54	FRONT DOOR INNER HANDLE, RH	P ₂	1	\$98.80	\$98.80	X
55	FRONT DOOR INNER BOARD, RH		1	\$1,359.00	\$1,359.00	7
56	FRONT DOOR POWER WINDOW MOTOR		1	\$1,246.00	\$1,246.00	7
57	SIDE MIRROR ASSY, RH	P ₂	1	\$517.00	\$517.00	7
58	FRONT STEP PLATE COVER, RH	CM	1	\$220.10	\$220.10	7
59	FRONT KNUCKLE ARM, RH		1	\$448.10	\$448.10	7
32	FRONT LOWER ARM, RH		1	\$945.90	\$945.90	7
60	FRONT WHEELING BEARING, RH		1	\$497.70	\$497.70	7
61	FRONT ABSORBER ASSY, RH		1	\$173.10	\$173.10	7
62	FRONT BRAKE CALIPER, RH	P ₂	1	\$1,582.40	\$1,582.40	X
64	FRONT BRAKE DISC ROTOR, RH	P ₂	1	\$745.40	\$745.40	X
65	FRONT WHEEL RIM, RH		1	\$656.90	\$656.90	7
66	FRONT TYRE, RH	P ₂	1	\$100.00	\$100.00	X
67	FRONT STEERING RACK, RH		1	\$7,363.40	\$7,363.40	7
68	FRONT ABSORBER LINKAGE, RH		1	\$294.40	\$294.40	7
69	DASHBOARD ASSY	P ₂	1	\$1,290.70	\$1,290.70	7
70	DASHBOARD ASSY CLIP	CM	10	\$5.50	\$55.00	7
71	AIR FILTER		1	\$122.00	\$122.00	7
72	RADIATOR ASSY		1	\$4,366.80	\$4,366.80	7
73	RADIATOR RESERVE TANK ASSY		1	\$928.20	\$928.20	7
74	MOTOR, COOLING FAN		1	\$999.00	\$999.00	7
75	MOTOR, COOLING FAN, NO.2		1	\$999.00	\$999.00	7
76	WASHER TANK		1	\$94.60	\$94.60	7
77	BRAKE MASTER PUMP		1	\$995.40	\$995.40	7
78	BRAKE BOOSTER		1	\$2,537.00	\$2,537.00	7
79	CLUTCH PEDAL BRACKET	R	1	\$731.45	\$731.45	X
80	BRAKE PEDAL BRACKET	R	1	\$781.00	\$781.00	X
81	ACCELERATOR PEDAL		1	\$721.10	\$721.10	7
82	NUMBER PLATE WITH CASING	nd	1	\$50.00	\$50.00	25m
				Total Part Cost :	\$55,148.15	

258

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

S/N	LABOUR DESCRIPTION	Qty	Unit Price \$	AMOUNT \$
1	TO REMOVE AND REFIT FRONT WINDSCREEN GLASS	1	\$180.00	\$180.00 1200
2	TO DISMANTLE AND REPLACE DASHBOARD ASSY	1	\$250.00	\$250.00 2
3	TO CHECK AND REPAIR HEADLAMP WIRING, POWER WINDOW WIRING AND NECESSARY ETC	1	\$220.00	\$220.00 400
4	TO REPAIR PANEL BEATING & DISMANTLE AND REPLACE ACCIDENT FRONT PORTION AND ALL NECESSARY ETC	1	\$3,000.00	\$3,000.00 1200
5	TO PUTTY & SPRAY PAINTING ON ACCIDENT FRONT PORTION AND AND ALL NECESSARY ETC	1	\$2,000.00	\$2,000.00 1200
6	TO DISMANTLE AND REPLACE FRONT UNDERCARRIGE AND STEERING BRAKE COMPARTMENT	1	\$500.00	\$500.00 ?
7	TO COMPUTIZE 4-WHEEL ALIGNMENT	1	\$80.00	\$80.00 600
8	TO REMOVE AND REFIT AIRCON COMPARTMENT SYSTEM, VACUUM AND TOP UP AIRCON GAS	1	\$250.00	\$250.00 1000
Total Labour Cost :				\$3,650.00

Amount :	\$58,798.15
GST (9%) :	\$5,291.83
Grand Total :	\$64,089.98

ALL PRICES QUOTED ARE IN SINGAPORE DOLLAR AND SUBJECT TO 9% GST

Estimate prepared and authorised by:

Jeremy Goh

Executive

Wega Engineering Pte Ltd

Date: 12/07/2024

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date of First Submission	09/07/2024 14:10 (SGT)
Reported by	Actual Driver
Date of Accident	09/07/2024 07:30 (SGT)
Exact Location of Accident	Singapore
Additional Location Information	HOUGANG AVE 7 TO DEFU LANE AVE 1
Country/State of Loss	Singapore

DETAILS OF OWN VEHICLE

Vehicle Registration Number	GBC4092T
-----------------------------	----------

INSURED/POLICYHOLDER

Is company?	Yes
Name Of Registered Owner	SPH MEDIA LTD
Company Reg No	2XXXXX748H
Email Address	HSALANK@SPH.COM
Mobile Phone No	(Phone) +65-63194097
Alternative Phone No	-

VEHICLE PARTICULARS

Manufacturer	Toyota
Model	Hiace
Variant	-
Exact purpose for which vehicle was being used at time of accident	Employment
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Commercial vehicle
Transmission	Auto
CC	2989

INSURANCE COMPANY

Name of Insurance Company	Great Eastern General Insurance Limited
Policy Number / Cover Note Number	2023-V0118963-VCF

DRIVER

Name of Driver	HASLAN BIN ABDUL KARIM
NRIC No	SXXXX578A
Date Of Birth	30/08/1983
Occupation	Indoor

Great Eastern
Vehicle: GBC 4092T
09/07/2024

IMPORTANT NOTICE

SKETCH PLAN

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to reassess policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Traffic Police Department for investigation.
6. This report will be forwarded by the Insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the Insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;

(ii) investigating the accident and/or my claims;

(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;

(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/postal packages); and/or

(v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and

(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third-party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

Policyholder's Signature / Date & Time

Actual Driver's Signature (if not the policyholder) / Date & Time


Witnesses for Reporting Centre Personnel
(Name as in NRIC/ID card)

Sketch Plan

A : GBC 4092T

B : GBD 8572T

C : CB 356C

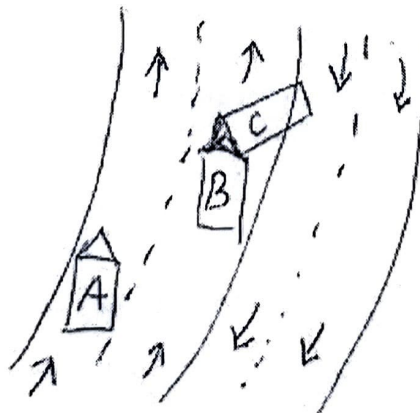



**SINGAPORE
POLICE FORCE**



T/20240709/2036

2 of 3

Report No. T/20240709/2036

Police Station Of Origin:
Hougang N.P.C
60 Hougang Avenue 9 SINGAPORE 538775
Tel No: 1800-4890999

CONTINUATION OF REPORT

Details of Person Involved			
Any Pedestrian Involved: No		Use of Pedestrian Crossing: NA	
No. of Pedestrians Injured: NIL			
Driver			
Name	HASLAN BIN ABDUL KARIM	ID No.	S8325578A
Related Vehicle	GBC4092T (Motor van)	Contact No.	93848784
Hospital/Clinic	NIL	Class of Driving Licence & Expiry	Class: 3 Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of	NIL

Brief Details.

On the above-mentioned date, time and location. I was driving my vehicle (GBC4092T) along the left lane of Hougang Ave 7 toward Defu Ave 1. At that moment, there was a collision between two vans on my right. The van (GBD8572T) on the right lane tried to avoid the collision and swerved on the left lane which I was on thus Van (GBD8572T) left side collided on the front right side of my van.

I wish to state that both traffic police and Paramedics attended to my incident and no government property were damaged. I would like to add that I was unable to retrieve any particulars from the other two drivers as they need urgent medical attention and was escorted to hospital in the ambulance.

I am lodging this report for my insurance.