

(08/11/13) wef

ASS. REC. BY: Marcus

REF:

CS/5MD24070224/Uvp3**ASSIGNMENT**

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD / TP / WS / TP RES / OD RES / EVA / INV / MVTo Inspect Vehicle No: SHB115FSat Workshop m/s SMART

of \_\_\_\_\_

Insured: SLH15844

Policy No. \_\_\_\_\_


Claims No. CMTD2402291/RUC

Sum Insured: \_\_\_\_\_ Excess: \_\_\_\_\_

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

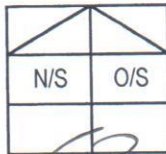Remark: The veh had commenced its  
repair at the time of inspection.

Bal. or Market Value: \_\_\_\_\_

IDAC Accident Rpt: \_\_\_\_\_ Consistent? : Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No

Est. Repairs: \_\_\_\_\_ days Res.: Yes or No

Lum Sum: 1.3.1 % 3 Val.: Yes or NoCA / REV / REP. / 24 HRS C369/c

Vehicle: IN / OUT

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_

Veh No: SHB115FS Yr Regn: 09/109/21Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /Truck / Trailer or ElectricMake: M.G. MG5 EV cc 120kwColour Green A/C: Insured / Std / NI / NASp. Reading 191445 T/Radio: Insured / Std / NI / NA

Eng/No: \_\_\_\_\_

C/No: LSJE24030 MG05/382Gen. Cond: Good / Fair / Poor / BurntSteering: In order / Jammed / Leaked / Burnt orBrake: In order / Jammed / Leaked / Burnt orModi: Nil / S/Rim / STD A/Rim orTyre Size: F: 205/60R16

R: \_\_\_\_\_

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or green trac

Front \_\_\_\_\_ Rear \_\_\_\_\_

R/Bal. 7 mm R/Bal. 7 mmL/Bal. 7 mm L/Bal. 7 mmD.O.A. 11/07/24 D.O.I. 12/7/24

Survey held at \_\_\_\_\_

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

8/8/24 11/2 #6785.09 inform 20h sun (red 9389, 58%)

Date/Time, File Pass to?

☐ : Preli. ReportDays Of Repair: 6

1)

☐ : Final Report

Resurvey No. of Trip: \_\_\_\_\_

Date/Time, File Return to?

2)

Add Fee: ☐ : Site Insp (\$ \_\_\_\_\_) S + RS, SI☐ : Interview (\$ \_\_\_\_\_) Photos☐ : Tech. Invs (\$ \_\_\_\_\_) Others☐ : Weekend (\$ \_\_\_\_\_) TOTAL

Report Format : \_\_\_\_\_

Lump Sum / I.B.I: (\$ \_\_\_\_\_)

Survey Fee:
Transportation:
S + RS, SI
Photos
Others
TOTAL

> Back to OneMotoring

## Enquire PARF/COE Rebate for Registered Vehicle

<b>Vehicle Owner Particulars</b>	
Owner ID Type:	Company
Owner ID:	369K
<b>Vehicle Details</b>	
Vehicle No.:	SHB1158S
Vehicle to be Exported:	No
Intended Deregistration Date:	12 Jul 2024
Vehicle Make:	M.G.
Vehicle Model:	MG5 EV EXCITE T
Primary Colour:	Green
Manufacturing Year:	2021
Engine No.:	-
Chassis No.:	LSJE24030MG051382
Maximum Power Output:	120.0 kW (160 bhp)
Open Market Value:	\$29,058.00
Original Registration Date:	09 Sep 2021
First Registration Date:	09 Sep 2021
Transfer Count:	0
Actual ARF Paid:	\$5,000.00
<b>Intended PARF Rebate Details</b>	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	08 Sep 2031
PARF Rebate Amount:	\$3,750.00
<b>Intended COE Rebate Details</b>	
COE Expiry Date:	08 Sep 2031
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
PQP Paid:	\$46,704.00
COE Rebate Amount:	\$33,424.00
<b>Total Rebate Amount:</b>	<b>\$37,174.00</b>
<b>Message</b>	
You will not be eligible for any COE rebate from the current COE (including unused COE from any lay-up period/s), if you renew your COE.	

The information contained herein is correct as at 12 Jul 2024

OK



## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

Date of First Submission	12/07/2024 11:05 (SGT)
Reported by	Actual Driver
Date of Accident	11/07/2024 15:30 (SGT)
Exact Location of Accident	TPE, Singapore
Additional Location Information	TOWARDS UPPER CHANGI ROAD AND BEDOK TOWN
Country/State of Loss	Singapore

### DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHB1158S
-----------------------------	----------

#### INSURED/POLICYHOLDER

Is company?	Yes
Name Of Registered Owner	Strides Premier Taxi Pte Ltd
Company Reg No	1XXXXX369K
Email Address	sparc@stridespremier.com.sg
Mobile Phone No	(Phone) +65-65446676
Alternative Phone No	-

#### VEHICLE PARTICULARS

Manufacturer	MG
Model	MG5
Variant	-
Exact purpose for which vehicle was being used at time of accident	-
Are you claiming under your own insurance policy for repair to your vehicle?	No - Claiming third party
Vehicle Category	Taxi
Transmission	Auto
CC	1

#### INSURANCE COMPANY

Name of Insurance Company	MS First Capital Insurance Ltd
Policy Number / Cover Note Number	D-24102275MFSH

#### DRIVER

Name of Driver	LIEW CHEE KONG
NRIC No	SXXXX185E
Date Of Birth	05/05/1963
Occupation	Outdoor

Driving Pass Date .....	26/05/1982
Driving experience .....	42 YEARS AND 2 MONTHS
Gender .....	Male
Mobile Number .....	(Phone) +65-65446676
Alt. Phone Number .....	-
Email Address .....	sparc@stridespremier.com.sg
Address .....	11
Address complement .....	-
Postcode .....	-
Is the driver the policyholder? .....	No
If No, Relationship of the Driver with the Insured .....	Hirer
Does Driver Own Other Vehicles? .....	No
Vehicle Registration Number of Other Vehicle Owned by Driver .....	-
Insurance Company of Other Vehicle Owned by Driver .....	-

#### GENERAL INFORMATION OF THE ACCIDENT

Type of Accident .....	Collision - Head to Rear
Weather Conditions .....	Clear
Road Surface .....	Dry

#### OTHER INFORMATION

Was any foreign vehicle involved in the accident? .....	No
Number of vehicles involved in the accident .....	2
Was anybody injured in the Accident? .....	Yes
Was any injured conveyed to hospital by ambulance? .....	No
Was any other vehicle or property damaged? .....	Yes
Number of Passengers (Including Driver) .....	4
Has the driver been approached by unknown person(s) soliciting/offering accident claims assistance? .....	No
Translator's name .....	-
Translator's ID .....	-
Translator's phone number .....	-
Translator's email .....	-
Original language used in the statement .....	-

#### PASSENGER 1

Name .....	STEVEN TAN
Gender .....	Male

#### PASSENGER 2

Name .....	VINCENT NEOH
Gender .....	Male

#### PASSENGER 3

Name .....	JUDY LOW
Gender .....	Female

#### DETAILS OF POLICE ACTION

Was the accident reported to the police? .....	Yes
Police Station Name .....	Toa Payoh Neighbourhood Police Centre
Police Station Phone No .....	(Phone) +65-18002519999
Alt. Police Station Phone No .....	(Fax) +65-63548749
Police Station Address .....	93 Toa Payoh Central Toa Payoh Community Building #01-02 Singapore 319194
Was notice of intended Prosecution given? .....	No
If yes, against whom? .....	-

#### CIRCUMSTANCES OF ACCIDENT

REFER TP POLICE REPORT -T 20240711/2070



## ATTACHMENT(S)

Are accident photos available for attachment?	Yes
Was there any video captured by Car Camera?	Yes
Reasons for not uploading a video of the accident	EXCEEDS SIZE LIMIT

## DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SLL1584U
Vehicle Manufacturer	-
Vehicle Model	-
Vehicle Variant	-
Vehicle Colour	-
Vehicle Category	Private car
Name of Driver	EVELYN LIM HUI LI
Contact Number	-
Address	-
Address complement	-
Postcode	-
Insurance Company Name	-
Nature Of Damage	-
Details of property damaged in accident	-
No. Of Passenger (Including Driver)	-

## INJURED PERSONS DETAILS

## INJURED 1

Name of injured person	LIEW CHEE KONG
Gender	Male
Phone No	-
Address	-
Address Complement	-
Post Code	-
Approximate Age Years Old	-
Injuries Sustained	-
Injured person in which vehicle?	-
Were seat belts worn?	-
Was this injured conveyed to hospital by ambulance?	No

## INJURED 2

Name of injured person	STEVEN TAN
Gender	-
Phone No	-
Address	-
Address Complement	-
Post Code	-
Approximate Age Years Old	-
Injuries Sustained	-
Injured person in which vehicle?	SHB1158S
Were seat belts worn?	-
Was this injured conveyed to hospital by ambulance?	No

## INJURED 3

Name of injured person	-
Gender	-
Phone No	-
Address	-
Address Complement	-
Post Code	-
Approximate Age Years Old	-
Injuries Sustained	-
Injured person in which vehicle?	SHB1158S

Were seat belts worn? .....  
Was this injured conveyed to hospital by ambulance? .....

-  
-

INJURED 4

Name of injured person .....  
Gender .....  
Phone No .....  
Address .....  
Address Complement .....  
Post Code .....  
Approximate Age Years Old .....  
Injuries Sustained .....  
Injured person in which vehicle? .....  
Were seat belts worn? .....  
Was this injured conveyed to hospital by ambulance? .....

STEVEN TAN  
Male  
-  
-  
-  
-  
-  
-  
SHB1158S  
-  
No

INJURED 5

Name of injured person .....  
Gender .....  
Phone No .....  
Address .....  
Address Complement .....  
Post Code .....  
Approximate Age Years Old .....  
Injuries Sustained .....  
Injured person in which vehicle? .....  
Were seat belts worn? .....  
Was this injured conveyed to hospital by ambulance? .....

VINCENT NEOH  
-  
-  
-  
-  
-  
-  
-  
SHB1158S  
-  
No

INJURED 6

Name of injured person .....  
Gender .....  
Phone No .....  
Address .....  
Address Complement .....  
Post Code .....  
Approximate Age Years Old .....  
Injuries Sustained .....  
Injured person in which vehicle? .....  
Were seat belts worn? .....  
Was this injured conveyed to hospital by ambulance? .....

JUDY LOW  
Female  
-  
-  
-  
-  
-  
-  
SHB1158S  
-  
No

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Actual Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Traffic Police Department for investigation.**
6. This report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
- (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
  - (ii) investigating the accident and/or my claims;
  - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
  - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
  - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
- (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third-party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.



*[Signature]*

12/07/24


*[Signature]* 12.7.2024

Policyholder's Signature / Date & Time


Actual Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel  
(Name as in NRIC/ID card)

Sketch Plan

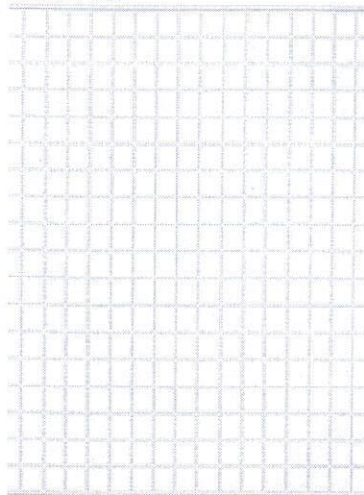

11/7/24 @ 1530 HRS  
A = SHB1158S  
B = SLH 1584U  
↑ | ↑  
TPE TOWARD toyang

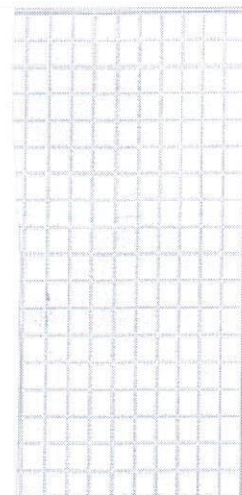

vJun2022





**SINGAPORE  
POLICE FORCE**



T/20240711/2070

1 of 4

Police Station Of Origin:  
Toa Payoh N.P.C  
93 Toa Payoh Central #01-02 Toa Payoh  
Community Building SINGAPORE 319194  
Tel No: 1800-2519999

Report No. T/20240711/2070

## REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 11/07/2024 19:46		Vide Report No.:		Station Diary No.: 86
<b>Informant's Particulars</b>				
Name of Informant: LIEW CHEE KONG		Address: APT BLK 422 FAJAR ROAD #10-499 SINGAPORE 670422		
ID Type / ID No.: NRIC NO / S1594185E		Contact No.: Home/Office: Mobile: 97110932		
Nationality: SINGAPORE CITIZEN		Email:		
Sex: Male	Age: 61	Date of Birth: 05/05/1963	Type of Informant: Driver	
Race: Chinese		Language:		
Occupation: TAXI DRIVER		Driving Licence Information: Class: 3 Date of Expiry:		

<b>General Information of the Accident</b>				
Type of Accident:	Injury Others	Drink Drive: No	Date/Time of Accident: 11/07/2024 15:30	Type of Location: Straight Road
Location:  TAMPINES EXPRESSWAY				
Weather: Clear		Road Surface: Dry		
Traffic Flow: One Way		Traffic Control: Not Controlled		Traffic Volume: Heavy
Type of Collision: Between Moving Vehicles - Head To Rear				Anyone conveyed by ambulance: No

<b>Details of Vehicle Involved</b>						
Vehicle No.	Type	Make	Model	Color	Condition	No of Passenger
SHB1158S	Motor car	MG	MG5 EV EXCITE T		Slightly Damaged	3
SLL1584U	Motor car	MERCEDES BENZ	GLA180 (R18 BI)		Slightly Damaged	0

<b>Details of Person Involved</b>	
Any Pedestrian Involved: No	
No. of Pedestrians Injured: NIL	Use of Pedestrian Crossing: NA





**SINGAPORE  
POLICE FORCE**



T/20240711/2070

2 of 4

Police Station Of Origin:

Toa Payoh N.P.C

93 Toa Payoh Central #01-02 Toa Payoh

Community Building SINGAPORE 319194

Tel No: 1800-2519999

Report No. T/20240711/2070

## CONTINUATION OF REPORT

Driver			
Name	LIEW CHEE KONG	ID No.	S1594185E
Related Vehicle	SHB1158S (Motor car)	Contact No.	97110932
Hospital/Clinic	HORIZON MEDICAL CENTRE	Class of Driving Licence & Expiry	Class: 3 Date of Expiry: NIL
Date Treatment	11/07/2024	Date Discharge	NIL
No. of Days granted Medical Leave	04	Degree of	Slight
Driver			
Name	EVELYN LIM HUI LI	ID No.	S8302185C
Related Vehicle	SLL1584U (Motor car)	Contact No.	84684356
Hospital/Clinic	NIL	Class of Driving Licence & Expiry	Class: NIL Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of	NIL

**Brief Details.**

On 11 July 2024 at 1530hrs, I was travelling along the slip road of Tampines Expressway, exit 2A towards PIE(TUAS), Upper Changi Road East and Bedok Town. This is a 2-lane road, and I was travelling along lane 2. I wish to state that I have 03 passengers in my taxi.

As there was heavy traffic, the speed was slow, and I had to stop. As the vehicles in front moved forward, I began to accelerate from a stopped position on lane 2. Out of a sudden, I felt a hard impact hitting my taxi from behind. Moments later, another impact was felt. I then realized that I have been involved in an accident, and the same vehicle behind me has hit my taxi twice. I checked on my passengers before getting down from my vehicle.

I then exchanged particulars with the other driver. As a result of the accident, my taxi sustained a big dent on the rear boot area. No police or ambulance was called to the scene. I continued to drop-off the 03 passengers at their destination. They also informed me that they will seek medical assistance on their own. I felt discomfort on my neck and back area, as well as giddiness.

I then visited Horizon Medical Pte Ltd and was given 04 days Unfit for Duty from 11 July 2024 to 14 July 2024. I have a in car camera inside my taxi with the front and rear view. I am lodging this report for Traffic Police to assist me in the matter.

Details of Passengers:



SINGAPORE  
POLICE FORCE



T/20240711/2070

Police Station Of Origin:

Toa Payoh N.P.C

93 Toa Payoh Central #01-02 Toa Payoh

Community Building SINGAPORE 319194

Tel No: 1800-2519999

3 of 4

Report No. T/20240711/2070

CONTINUATION OF REPORT

1: Steven Tan HP: 90295672

2: Vincent Neoh HP: 83551949

3: Judy Low



**SMRT Accident Vehicle Repair Estimates**


• To resurvey before/after spray painting  
• To display damaged part(s) during resurvey  
• Parts prices are subject to confirmation  
• Third party survey is on a "Without Prejudice" basis  
• No illegal modification(s) is allowed  
• Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer  
Signature:  
Date:

Not Authorized  
AKK means 90096608  
take photo before repair  
P17 # 6785091  
6 days

SMRT Auto  
60 Woodlan  
FAX Number  
Estimator T  
Accident Re  
Date Gener  
User ID

Section A - Accident Details	
Registration Number	SHB1158S
Case Reference Number	TAX/07/24/2037
Registration Date	9/9/2021
Company Type	Strides Premier Taxi Pte Ltd
Make	MORRISGARAGES
Model	MG5
Name of Driver	LIEW CHEE KONG
Type of Accident	Head to Rear
Accident Date and Time	11/7/2024 3:30 PM
Accident Reported Date and Time	12/7/2024 9:57 AM
Is Surveyor Required?	No
Survey by	
Vehicle is Towed Back?	No
Towed Back Date and Time	
Replacement Vehicle issued?	No
Job Card Number	24121815
Special Instruction to ARC, if any	TP/REAR PORTION
Prepared Date and Time	12/7/2024 10:32 AM
Chassis Number	
Mileage	
Work Shop	
Repair Completion Date and Time	

Section B - Summary of Repair Estimates		
Summary of Repair Estimates		
	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$1,800.00	\$0.00
Total Spray Cost	\$1,316.00	\$0.00
Total Spare Part Cost	\$8,268.24	\$0.00
Total Other Cost	\$1,750.00	\$0.00
<b>TOTAL COST</b>	<b>\$13,134.24</b>	<b>\$0.00</b>
Lump Sum Total	\$0.00	\$0.00
Number of Repair Days	8.0	
Prepared / Adjusted By	Boon Chew Tay	
ARC / Surveyor Sign Off Date	12/07/2024 11:08 AM	
Signature		x
Remarks		

Section C - Quotation and Accident Invoice Details			
Quotation Number		Invoice Number	
Quotation Date		Invoice Date	
Invoice Amount		Prepared Date	



## SMRT Accident Vehicle Repair Estimates

SMRT Autor  
60 Woodlanc  
Fax Number  
Estimator Te  
Accident Rep

Date Genera

User ID

### Section D - Details of Repair Estimates

#### Part 1 - Labour Works

Job Scope	Quotation from AR	Adjusted by Surveyor, if applicab
TO REPAIR REAR PORTION 40.	\$1,800.00	800 /
<b>Total Labour</b>	<b>\$1,800.00</b>	

#### Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicab
TO RESPRAY TAIL GATE	\$428.00	250 /
TO RESPRAY REAR SPARE TYRE PANEL rear fender LH	\$230.00	250 /
TO RESPRAY REAR BUMPER	\$428.00	250 /
TO RESPRAY REAR PANEL	\$230.00	100 /
<b>Total Spray Painting &amp; Panel Beating</b>	<b>\$1,316.00</b>	

#### Part 3 - Other Costs - Accident and Accident Repair Related Expense

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicab
TO WASH AND VACUUM	\$60.00	17X /
TO CHECK WIRING AND SYSTEM FUNCTION	\$120.00	20 /
TO APPLY RUST-PROOFING ON AFFECTED AREA	\$200.00	30 /
TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	\$350.00	11X /
TO TRANSFER REAR TAILGATE MECHANISM	\$120.00	60 /
TO TEST AND REFIX REVERSE SENSOR SYSTEM	\$120.00	30 /
TO REMOVE AND REFIX REAR WINDSCREEN	\$180.00	100 /
TO REPLACE SUNDRY PARTS	\$100.00	11X /
TO CHECK & RESET SYSTEM FUNCTION	\$350.00	150 /
ISOLATED OF (EV) (NET)	\$150.00	17X /
<b>Total Other Costs</b>	<b>\$1,750.00</b>	

#### Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Ap
		10328219-SEPP	TAIL GATE ASM-LIFT	1.00	\$1,928.26	10.00	\$1,735.43	Replace 1.00 /	
		10103179	HINGE ASM-L/GATE - LH	1.00	\$30.89	10.00	\$27.80	Replace x 11 /	X
		10103178	HINGE ASM-L/GATE - RH	1.00	\$30.89	10.00	\$27.80	Replace x 11 /	X
		10444797	STRUT ASM-L/GATE - LH	1.00	\$52.52	10.00	\$47.27	Replace x 11 /	X
		10444798	STRUT ASM-L/GATE - RH	1.00	\$52.52	10.00	\$47.27	Replace x 11 /	X
		10935050	EMBLEM ASM-RR LIC PLT ( MG )	1.00	\$62.92	10.00	\$56.63	Replace 1.00 /	
		10885560	EMBLEM ASM-L/GATE ( MG5 SW )	1.00	\$21.84	10.00	\$19.66	Replace 1.00 /	
		10896035	EMBLEM ASM-L/GATE (SW EV )	1.00	\$33.90	10.00	\$30.51	Replace 1.00 /	
		10321485	WEATHERSTRIP-L/GATE	1.00	\$73.53	10.00	\$66.18	Replace x 11 /	X
		10294677	STRIKER ASM-L/GATE LAT	1.00	\$17.16	10.00	\$15.44	Replace x 11 /	X
		10606578	COVER-L/GATE LAT	1.00	\$6.86	10.00	\$6.17	Replace x 11 /	X
		10314527	LATCH ASM-L/GATE	1.00	\$139.36	10.00	\$125.42	Replace x 11 /	X
		10022051	SWITCH-L/GATE OPEN	1.00	\$30.68	10.00	\$27.61	Replace x 11 /	X
		10521906	PANEL ASM-L/GATE LWR TR	1.00	\$167.34	10.00	\$150.61	Replace x 11 /	X
		10431554	PANEL-L/GATE UPR TR	1.00	\$10.30	10.00	\$9.27	Replace x 11 /	X
		10562676	PLATE ASM-RR LIC PLT	1.00	\$96.40	10.00	\$86.76	Replace 1.00 /	X



## SMRT Accident Vehicle Repair Estimates

SMRT Autor  
60 Woodlanc  
FAX Number  
Estimator Te  
Accident Rep

Date Genera

User ID

### Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Ap
			NUMBER PLATE FRAME	1.00	\$25.00	0.00	\$25.00 S/N	Replace	DM
			NUMBER PLATE	1.00	\$35.00	0.00	\$35.00 S/N	Replace	DM
			STRIDES LOGO	1.00	\$7.80	0.00	\$7.80 S/N	Replace	DM
			STICKER DECAL 65558888	1.00	\$21.60	0.00	\$21.60 S/N	Replace	DM
		10964627	WINDOW ASM-RR	1.00	\$323.44	10.00	\$291.10	Replace	DM
			SEALANT W/SCREEN	2.00	\$37.00	0.00	\$74.00 S/N	Replace	DM
		10728270	MODULE ASM-WSW SYS	1.00	\$359.11	10.00	\$323.20	Replace	DM
		10328380	MOTOR ASM-R/WDO WPR	1.00	\$208.52	10.00	\$187.67	Replace	DM
		10369261- SPRP	FASCIA-RR BPR	1.00	\$758.48	10.00	\$682.63	Replace	DM
		10751490	FASCIA-RR BPR LWR	1.00	\$230.68	10.00	\$207.61	Replace	DM
		10359003	FINISHER-RR BPR - RH	1.00	\$47.42	10.00	\$42.68	Replace	DM
		10359002	FINISHER-RR BPR - LH	1.00	\$47.42	10.00	\$42.68	Replace	DM
		10465727	BRACKET ASM-RR BPR FASCIA SI-RH	1.00	\$29.85	10.00	\$26.87	Replace	DM
		10465723	BRACKET ASM-RR BPR FASCIA SI-L	1.00	\$29.85	10.00	\$26.87	Replace	DM
		10326371	BRACKET-RR BPR FASCIA SI MTG - RH	1.00	\$46.08	10.00	\$41.47	Replace	DM
		10326369	BRACKET-RR BPR FASCIA SI MTG - LH	1.00	\$46.08	10.00	\$41.47	Replace	DM
		10371766	BRACKET-PARK DIST CONT SEN(BRACKET- PARK DIST CONT SEN) - LH	1.00	\$13.20	10.00	\$11.88	Replace	DM
		10371768	BRACKET-PARK DIST CONT SEN(BRACKET- PARK DIST CONT SEN) - CTE	1.00	\$12.90	10.00	\$11.61	Replace	DM
		10371790	BRACKET-PARK DIST CONT SEN(BRACKET- PARK DIST CONT SEN) - RH	1.00	\$12.90	10.00	\$11.61	Replace	DM
		10449056	BRACKET-RR BPR FASCIA LWR MTG - RH	1.00	\$12.80	10.00	\$11.52	Replace	DM
		10449047	BRACKET-RR BPR FASCIA LWR MTG - LH	1.00	\$12.80	10.00	\$11.52	Replace	DM
		90003417	SCRIVET-RR BPR FASCIA	10.00	\$0.84	10.00	\$7.56	Replace	DM
		10327894	BAR ASM-RR BPR IMP	1.00	\$339.77	10.00	\$305.79	Replace	DM
		10395721- SEPP	PANEL ASM-RR END	1.00	\$708.66	10.00	\$637.79	Replace	DM
		10376550-WSD	SENSOR-RR PARK DIST CONT	3.00	\$65.00	10.00	\$175.50	Replace	DM
		10732857	CAMERA ASM-RR VIEW	1.00	\$237.74	10.00	\$213.97	Replace	DM
		10587409	LAMP ASM-TAIL(BODY SI) - LH	1.00	\$764.09	10.00	\$687.68	Replace	DM
		10587410	LAMP ASM-TAIL(BODY SI) - RH	1.00	\$764.09	10.00	\$687.68	Replace	DM
		10587411	LAMP ASM-TAIL(LID SI) - LH	1.00	\$407.68	10.00	\$366.91	Replace	DM
		10587412	LAMP ASM-TAIL(LID SI) - RH	1.00	\$407.68	10.00	\$366.91	Replace	DM
		10726677	LAMP ASM-RR FOG - RH	1.00	\$189.07	10.00	\$170.16	Replace	DM
		10726676	LAMP ASM-RR FOG - LH	1.00	\$36.30	10.00	\$32.67	Replace	DM
Total					\$8,994.22		\$8,268.24		

### Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Cl
-------------	---------	--------------	-----------	----------	---------------	--------------	------------------	-----------	-------------

# REQUEST FOR SUPPLEMENTS PARTS

Contractor:	STRIDES AUTOMOTIVE		
Accident Case Number	TAX/07/24/2037	Date of Collection	/ /
Vehicle No	SHB1158S	Date of Request	17/7/2024
Vehicle Model	MG5	Number of Days to Extend (If any)	6 DAYS

S/N	Part Number	Part Description	Quantity	Total Price
1	10327894	BAR ASM-RR BPR IMP	1 <i>Replaced</i>	\$339.77 X
2	10395721-SEPP	PANEL ASM-RR END	1 <i>Replaced</i>	\$708.66 X
3	<i>refer part 2</i>	TO RESPRAY REAR PANEL	1 <i>Replaced</i>	\$230.00 X
4		TO REPLACE REAR END PANEL	1	<del>\$600.00</del> 400
5		TO APPLY RUST-PROOFING ON AFFECTED AREA <i>end panel</i>	1	<del>\$100.00</del> 30 ✓
6				
7				
8				
9				
10				

<<< Please submit photographs for damaged parts >>>

I, (Name) \_\_\_\_\_

(Position) \_\_\_\_\_

do solemnly and sincerely declare that:- Supplementary Parts are raised for replacement for the aforesaid vehicle.

Signature of person making this declaration  
(to be signed in front of an authorised witness)

I acknowledge that this declaration is true and correct, and I make it with the understanding and belief that a person who makes a false declaration is liable to the damages of perjury.

For SMRT Staff

Acknowledge By	ARC Executive / Supervisor / SA	
Approval By	Surveyor / In-house Staff	
Parts Ordering	SMRT Store / Contractor Supply / Form 22 / WOC	Form22 / PO / WOC/ Reservation / Number
Photo Submitted	YES / NO	D+A1:J31ate of submission

P 4613  
102  
P-4151-70  
S.N-163-40  
L-2470  
6785.10

*Not Allowed*  
*Rec*  
*received 17/7/24*



# REQUEST FOR SUPPLEMENTS PARTS

Contractor:	STRIDES AUTOMOTIVE		
Accident Case Number	TAX/07/24/2037	Date of Collection	/ /
Vehicle No	SHB1158S	Date of Request	17/7/2024
Vehicle Model	MG5	Number of Days to Extend (If any)	

S/N	Part Number	Part Description	Quantity	Total Price
1	10562676	PLATE ASM-RR LIC PLT	1	Replaced \$96.40 cre X
2	10012107	LAMP ASM-RR LIC PLT	2	\$64.48 cre 58.03
3				(102)
4				
5				
6				
7				
8				
9				
10				

<<< Please submit photographs for damaged parts >>>

I, (Name) \_\_\_\_\_

(Position) \_\_\_\_\_

do solemnly and sincerely declare that:- Supplementary Parts are raised for replacement for the aforesaid vehicle.

Signature of person making this declaration  
(to be signed in front of an authorised witness)

I acknowledge that this declaration is true and correct, and I make it with the understanding and belief that a person who makes a false declaration is liable to the damages of perjury.

For SMRT Staff


Acknowledge By	ARC Executive / Supervisor / SA	
Approval By	Surveyor / In-house Staff	
Parts Ordering	SMRT Store / Contractor Supply / Form 22 / WOC	Form22 / PO / WOC/ Reservation / Number
Photo Submitted	YES / NO	#NAME?

**Section A - Accident Details**

Registration Number	SHB1158S
Case Reference Number	TAX/07/24/2037
Registration Date	9/Sep/2021
Company Type	Strides Premier Taxi Pte Ltd
Make	MORRISGARAGES
Model	MG5
Name of Driver	LIEW CHEE KONG
Type of Accident	Head to Rear
Accident Date and Time	11/Jul/2024 3:30 PM
Accident Reported Date and Time	12/Jul/2024 9:57 AM
Is Surveyor Required?	Yes
Survey by	
Vehicle is Towed Back?	No
Towed Back Date and Time	
Replacement Vehicle issued?	No
Job Card Number	24121815
Special Instruction to ARC, if any	TP/REAR PORTION
Prepared Date and Time	12/Jul/2024 10:32 AM
Chassis Number	
Mileage	
Work Shop	
Repair Completion Date and Time	

**Section B - Summary of Repair Estimates**

**Summary of Repair Estimates**

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Cost	\$2,400.00	\$1,200.00
Total Spray Cost	\$1,744.00	\$850.00
Total Spare Part Cost	\$9,356.61	\$4,315.09
Total Other Cost	\$1,850.00	\$420.00
<b>TOTAL COST</b>	<b>\$15,350.61</b>	<b>\$6,785.09 (P/P)</b>
<b>Lump Sum Total</b>	<b>\$0.00</b>	<b>\$0.00</b>
Number of Repair Days	12.0	6.0
Prepared / Adjusted By	Boon Chew Tay	MARCUS CHUA (LKK) / Sompo
ARC / Surveyor Sign Off Date	17/07/2024 2:21 PM	17/07/2024 11:00 AM
Signature		Marcus Chua
Remarks	INITIAL = 8 DAYS WITH SUPP = 4 DAYS TOTAL = 12 DAYS	INITIAL = 4 DAYS / EXTEND = 2 DAYS SURVEYOR ONLY APPROVED \$35.00 FOR NUMBER PLATE AND FRAME P/P REPAIR / BEFORE PAINT PHOTO, FOR CHECK ITEM and REPLACE ITEM PLEASE CALL SURVEYOR MARCUS CHUA (LKK) / HP : 9009 6608 / Email : marcuschua@kkauto.com

8/8/24  
9/28 6785.09





**Section C - Quotation and Accident Invoice Details**

Quotation Number	QN-2407-0273	Invoice Number	
Quotation Date	24.07.2024	Invoice Date	
Invoice Amount		Prepared Date	

**Section D - Details of Repair Estimates**

**Part 1 - Labour Works**

Job Scope	Quotation from AR	Adjusted by Surveyor, if applicable
TO REPLACE REAR END PANEL	\$600.00	\$400.00 ✓
TO REPAIR REAR PORTION	\$1,800.00	\$800.00 ✓
<b>Total Labour</b>	<b>\$2,400.00</b>	<b>\$1,200.00</b>

**Part 2 - Spray Painting & Panel Beating Related Works**

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO RESPRAY REAR PANEL	\$230.00	\$100.00 ✓
TO RESPRAY TAIL GATE	\$428.00	\$250.00 ✓
TO RESPRAY REAR FENDER LH	\$428.00	\$250.00 ✓
TO RESPRAY REAR BUMPER	\$428.00	\$250.00 ✓
TO RESPRAY REAR PANEL	\$230.00	\$0.00
<b>Total Spray Painting &amp; Panel Beating</b>	<b>\$1,744.00</b>	<b>\$850.00</b>

**Part 3 - Other Costs - Accident and Accident Repair Related Expense**

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO APPLY RUST-PROOFING ON AFFECTED AREA	\$100.00	\$30.00
TO WASH AND VACUUM	\$60.00	\$0.00
TO CHECK WIRING AND SYSTEM FUNCTION	\$120.00	\$20.00
TO APPLY RUST-PROOFING ON AFFECTED AREA	\$200.00	\$30.00
TO PROVIDE LABOUR & MATERIAL FOR SOLAR FILM (NET)	\$350.00	\$0.00
TO TRANSFER REAR TAILGATE MECHANISM	\$120.00	\$60.00
TO TEST AND REFIX REVERSE SENSOR SYSTEM	\$120.00	\$30.00
TO REMOVE AND REFIX REAR WINDSCREEN	\$180.00	\$100.00
TO REPLACE SUNDRY PARTS	\$100.00	\$0.00
TO CHECK & RESET SYSTEM FUNCTION	\$350.00	\$150.00
ISOLATED OF (EV) (NET)	\$150.00	\$0.00
<b>Total Other Costs</b>	<b>\$1,850.00</b>	<b>\$420.00</b>

**Part 4 - Spare Parts / Material Usage**

Part Number	Portion	Stock Number	Part Name	Quantity	List Price (\$)	Discount (%)	Final Price (\$)	Estimator Approved	Surveyor Approved
		10726676	LAMP ASM-RR FOG - LH	1.00	\$36.30	10.00	\$32.67	Replace	Replace



Strides Premier Accident Vehicle Repair Estimates

Strides Premier Automotive Services Pte Ltd	
50 Woodlands Industrial Park E4, Singapore 757705	
FAX Number : 63685592	
Estimator Telephone Number : 68662623	
Accident Reporting Number : 68662672	

Date Generated : 24/07/2024

User ID : PohSuan

	10726677	LAMP ASM-RR FOG - RH	1.00	\$189.07	10.00	\$170.16	Replace	Replace	✓
	10587412	LAMP ASM-TAIL(LID SI) - RH	0.00	\$407.68	0.00	\$0.00	Replace	Not Given	X
	10587411	LAMP ASM-TAIL(LID SI) - LH	0.00	\$407.68	0.00	\$0.00	Replace	Not Given	X
	10587410	LAMP ASM-TAIL(BODY SI) - RH	0.00	\$764.09	0.00	\$0.00	Replace	Not Given	X
	10587409	LAMP ASM-TAIL(BODY SI) - LH	0.00	\$764.09	0.00	\$0.00	Replace	Not Given	X
	10732857	CAMERA ASM-RR VIEW	0.00	\$237.74	0.00	\$0.00	Replace	Check	X
	10376550-WSD	SENSOR-RR PARK DIST CONT	0.00	\$65.00	0.00	\$0.00	Replace	Check	X
	10395721-SEPP	PANEL ASM-RR END	0.00	\$708.66	0.00 <i>102</i>	\$0.00 <i>102</i>	Replace	Check	X <i>102</i>
	10327894	BAR ASM-RR BPR IMP	0.00	\$339.77	0.00 <i>101</i>	\$0.00	Replace	Check	X <i>101</i>
	90003417	SCRIVET-RR BPR FASCIA	10.00	\$0.84	10.00	\$7.56	Replace	Replace	✓
	10449047	BRACKET-RR BPR FASCIA LWR MTG - LH	0.00	\$12.80	0.00	\$0.00	Replace	Check	X
	10449056	BRACKET-RR BPR FASCIA LWR MTG - RH	0.00	\$12.80	0.00	\$0.00	Replace	Check	X
	10371790	BRACKET-PARK DIST CONT SEN(BRACKET-PARK DIST	1.00	\$12.90	10.00	\$11.61	Replace	Replace	✓
	10371768	BRACKET-PARK DIST CONT SEN(BRACKET-PARK DIST	1.00	\$12.90	10.00	\$11.61	Replace	Replace	✓
	10371766	BRACKET-PARK DIST CONT SEN(BRACKET-PARK DIST	1.00	\$13.20	10.00	\$11.88	Replace	Replace	✓
	10326369	BRACKET-RR BPR FASCIA SI MTG - LH	0.00	\$46.08	0.00	\$0.00	Replace	Check	X
	10326371	BRACKET-RR BPR FASCIA SI MTG - RH	0.00	\$46.08	0.00	\$0.00	Replace	Check	X
	10465723	BRACKET ASM-RR BPR FASCIA SI-L	0.00	\$29.85	0.00	\$0.00	Replace	Check	X
	10465727	BRACKET ASM-RR BPR FASCIA SI-RH	0.00	\$29.85	0.00	\$0.00	Replace	Check	X
	10359002	FINISHER-RR BPR - LH	1.00	\$47.42	10.00	\$42.68	Replace	Replace	✓
	10359003	FINISHER-RR BPR - RH	1.00	\$47.42	10.00	\$42.68	Replace	Replace	✓
	10751490	FASCIA-RR BPR LWR	1.00	\$230.68	10.00	\$207.61	Replace	Replace	✓
	10369261-SPRP	FASCIA-RR BPR	1.00	\$758.48	10.00	\$682.63	Replace	Replace	✓
	10328380	MOTOR ASM-R/WDO WPR	0.00	\$208.52	0.00	\$0.00	Replace	Check	X
	10728270	MODULE ASM-WSW SYS	0.00	\$359.11	0.00	\$0.00	Replace	Check	X
		SEALANT W/SCREEN	2.00	\$37.00	0.00	\$74.00	Replace	Replace	✓
	10964627	WINDOW ASM-RR	0.00	\$323.44	0.00	\$0.00	Replace	Check	X
		STICKER DECAL 65558888	1.00	\$21.60	0.00	\$21.60	Replace	Replace	✓
		STRIDES LOGO	1.00	\$7.80	0.00	\$7.80	Replace	Replace	✓
		NUMBER PLATE	1.00	\$35.00	0.00	\$35.00	Replace	Replace	✓ <i>102</i>
	10562676	PLATE ASM-RR LIC PLT	0.00	\$96.40	0.00	\$0.00	Replace	Check	X <i>102</i>
	10321485	WEATHERSTRIP-L/GATE	0.00	\$73.53	0.00	\$0.00	Replace	Check	X
	10896035	EMBLEM ASM-L/GATE (SW EV)	1.00	\$33.90	10.00	\$30.51	Replace	Replace	✓
	10885560	EMBLEM ASM-L/GATE (MG5 SW)	1.00	\$21.84	10.00	\$19.66	Replace	Replace	✓
	10935050	EMBLEM ASM-RR LIC PLT (MG)	1.00	\$62.92	10.00	\$56.63	Replace	Replace	✓
	10328219-SEPP	TAIL GATE ASM-LIFT	1.00	\$1,928.26	10.00	\$1,735.43	Replace	Replace	✓
	10103179	HINGE ASM-L/GATE - LH	0.00	\$30.89	0.00	\$0.00	Replace	Not Given	X
	10103178	HINGE ASM-L/GATE - RH	0.00	\$30.89	0.00	\$0.00	Replace	Not Given	X
	10444797	STRUT ASM-L/GATE - LH	0.00	\$52.52	0.00	\$0.00	Replace	Not Given	X
	10444798	STRUT ASM-L/GATE - RH	0.00	\$52.52	0.00	\$0.00	Replace	Not Given	X

**Strides Premier Accident Vehicle Repair Estimates**

Strides Premier Automotive Services Pte Ltd	
50 Woodlands Industrial Park E4, Singapore 757705	
FAX Number : 63685592	
Estimator Telephone Number : 68662623	
Accident Reporting Number : 68662672	

Date Generated : 24/07/2024

User ID : PohSuan

		10294677	STRIKER ASM-L/GATE LAT	0.00	\$17.16	0.00	\$0.00	Replace	Check	X
		10606578	COVER-L/GATE LAT	0.00	\$6.86	0.00	\$0.00	Replace	Check	X
		10314527	LATCH ASM-L/GATE	0.00	\$139.36	0.00	\$0.00	Replace	Check	X
		10022051	SWITCH-L/GATE OPEN	0.00	\$30.68	0.00	\$0.00	Replace	Check	X
		10521906	PANEL ASM-L/GATE LWR TR	0.00	\$167.34	0.00	\$0.00	Replace	Check	X
		10431554	PANEL-L/GATE UPR TR	0.00	\$10.30	0.00	\$0.00	Replace	Check	X
			NUMBER PLATE FRAME	1.00	\$25.00	0.00	\$25.00	Replace	Replace	✓
Total					\$8,994.22		\$3,226.72			

**Added Spare Parts / Material Usage After Surveyor Signed off**

Part Number	Portion	Stock Number	Part Name	Quantity	List Price \$	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	
		10562676	PLATE ASM-RR LIC PLT	1.00	\$96.40	10.00	\$86.76	Replace	Replace	✓
		10012107	LAMP ASM-RR LIC PLT	2.00	\$32.24	10.00	\$58.03	Replace	Replace	✓
		10327894	BAR ASM-RR BPR IMP	1.00	\$339.77	10.00	\$305.79	Replace	Replace	✓
		10395721 -SEPP	PANEL ASM-RR END	1.00	\$708.66	10.00	\$637.79	Replace	Replace	✓
Total					1,177.07		1,088.37			

4,315.09  
+ 1200.00  
+ 1270.00  
-----  
6,785.09