

(08/11/13) . wef

ASS. REC. BY: Marcus

REF:

CS/MSG 24070303/Ump3

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SMM 6063G

at Workshop m/s PE

of _____

Insured: SLQ268h

Policy No. _____

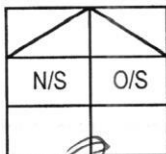
Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

Bal. or Market Value: 102k

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 4 days Res.: Yes or No

Lum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: LIA 36430

Veh No: SMM 6063G Yr Regn: 05/07/19

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or A /

Make: Toyota Noah Hybrid c.c 1797

Colour: S.hue A/C: Insured / Std / NI / NA

Sp. Reading: 189071 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: ZWR800342759

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 195/65-15

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Goodride

Front _____ Rear _____

R/Bal. 7 mm R/Bal. 7 mm

L/Bal. 7 mm L/Bal. 7 mm

D.O.A. 18/07/24 D.O.I. 22/7/24

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction Dep 18/18/18

3/8/24 Have video of Rotor
4/5 \$5300 4800 inland Alen
(Red. #13201.56, 7310)

Date/Time, File Pass to?

☐ : Preli. Report

1)

☐ : Final Report

Date/Time, File Return to?

2)

Days Of Repair: 4

Resurvey No. of Trip: _____

Report Format : _____

Lump Sum / I.B.I: (\$ _____)

Add Fee: ☐ : Site Insp (\$ _____)☐ : Interview (\$ _____)☐ : Tech. Invs (\$ _____)☐ : Weekend (\$ _____)

Survey Fee: _____

Transportation: _____

S + RS, SI

Photos

Others

TOTAL

FASTECH AUTO PTE LTD
1 Kaki Bukit Ave 6 #01-48 Autobay
Singapore 417883
Tel No: 67452063/ 67467158 Fax No: 67458520
Tax Reg No : 200006262D

Not Authorized
as
mount
22/7/24
1/5 \$4800
4/5 \$5300
Temporarily Attemp
4 days

VEHICLE No: SMM 6063G

1PC	REAR WINDSCREEN	11	\$1,655.10 X
1PC	REAR WINDSCREEN MOULDING	NS	\$185.50 X
1PC	TAILGATE	1985.90	20/300 \$2,994.45
1PC	TAILGATE OUTER CHROME GARNISH	11	\$688.10 X
1PC	TAILGATE EMBLEM 'Hybrid'	11	\$68.90
1PC	TAILGATE INNER LOCK	409.90	20/300 \$609.23
1PC	TAILGATE INNER TRIM BOARD	20/300	\$681.20
1PC	TAILGATE INNER PULL GARNISH	11	\$65.20 X
1PC	TAILGATE WEATHERSTRIP	20/300	\$399.45
1PC	TAILGATE KEYLESS SMART	80	\$185.30 X
1PC	REAR BUMPER	985.10	20/300 \$1,655.10
2PCS	REAR BUMPER REFLECTORS @\$145.00	11	\$290.00 X
2PCS	REAR BUMPER SIDE RETAINERS @\$105.10	11	\$210.20 X
1PC	REAR END PANEL	801.10	20/300 \$955.23
1PC	REAR END PANEL TOP GARNISH	285.40	20/300 \$366.10
2PCS	TAILLAMP LOWER APRON GARNISHS @\$385.10	11	\$770.20 X
1PC	REAR FLOOR PANEL	R	\$820.10 X
1PC	REAR FLOOR PANEL TOP BOARD	845.10	11/100 \$1,282.20 X
			\$13,881.56

S.NETT

1PC	REAR WINDSCREEN SEALANT	11	\$50.00 40
1PC	REAR WINDSCREEN INNER SEAL	11	\$50.00 20
1PC	REAR LICENCE PLATE	11	\$50.00 X
1SET	REAR BUMPER LOWER REFLECTIVE STICKER	11	\$180.00 X
1SET	REAR BUMPER CLIPS	11	\$50.00 30
1SET	TAILGATE INNER TRIM BOARD CLIPS	11	\$50.00 X
1PC	REAR END PANEL SEALANT	11	\$50.00 40
	TO CHECK WIRING		\$50.00 20
	TO DISMANTLE & REFIX REAR WINDSCREEN		\$150.00 20
	TO DISMANTLE & REFIX CUSHION UPHOLSTERY		\$120.00 60
	TO TRANSFER TAILGATE MECHANISM		\$100.00 60
	TO SPRAY RUST PROOFING		\$100.00 50
	TO RESET & REPROGRAMME SYSTEM		\$120.00 X

LABOUR FOR PANEL BEATING & REPLACED PARTS
TO PUTTY & SPRAY PAINTING

	\$1,500.00	600
	\$1,500.00	800
TOTAL	\$18,001.56	

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

P- 616.98	P- 6462.05
252	252
4812.71	4846.54
130	130
1710	1710
6052.71	6086.54
4840	208
	1249