

ASS. REC. BY:

REF:

CS / ^{ASA}AXA17023178 / Arbbsz

Special Instruction:

Surveyor:

Adrian

ASSIGNMENT (Office)

Smart claim

From (Person):

Jas Tan Kitty

of

AXA

Date/Time: 06/12/2017 10:54am

Estimated Cost:

Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SKQ 657K

Insured:

at Workshop m/s

SME motor

Tel:

6747 6106

of

Blk 1 Kaki Bukit Ave 6 #02-15

Policy No:

Claim No:

S7M0051V

Sum Insured:

Excess:

NIL

Make of Veh:

D.O.A. 02.12.2017

(Client's Record)

CA / REV / REP. / REV 24 HRS

H.O.D. Endorsement:

Date/Time:

06/12/2017 1:39pm

Person Contacted:

Pui Ying

Vehicle IN/OUT

Date/Time	Action/Instruction (✓) Estimate
	SKQ 657K - x
	Sent preli through smart claim
	Confirm \$12,446.00 @ 5 days
	Red: \$1734, 12%.

Smart Claim

ASSIGNMENT

From: Date: 06/12/2017

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: SKQ 657K
at Workshop m/s: SME motor
of: B1K1 Kaki Bukit Ave 6 #02-15

Insured:

Policy No:

Claims No:

Sum Insured:

Excess:

(Client's Record)

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

N/S	O/S

Bal. or Market Value: 70K.

IDAC Accident Report: Consistent? : Yes or No

GIA / PR Seen: Consistent? : Yes or No

Est. Repairs: days Res: Yes or No

Lum Sum: % 3 Val: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: Person Contacted:

Veh No: SKQ 657K. Yr Regn: 2014 OCT

Type: ☒ Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: Volkswagen Jetta. cc 1390

Colour: Gold. A/C Insured / Std / NI / NA

Sp. Reading: 109883 T-Radio: Insured / Std / NI / NA

Eng No:

C.No: WVWZ2216ZEM058706

Gen. Cond: ☒ Good / Fair / Poor / BurntSteering: ☒ Inorder / Jammed / Leaked / Burnt orBrake: ☒ Inorder / Jammed / Leaked / Burnt orModl: Nil / S/Rim / ☒ STD A/Rim or

Tyre Size: F: 205/55R16.

R: 205/55R16.

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Nexen.

Front

Rear

R/Bal. 06 mm R/Bal. 06 mm

L/Bal. 06 mm L/Bal. 06 mm

D.O.A. D.O.I. 06/12/17.

Survey held at SME.

Des. of Damages: ☒ Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

02 A19.

RECEIVED 31 JUL 2018

31/7/2018

Date/Time: File Pass to?

1) typist

Date/Time: File Return to?

2)

☐ : Preli. Report
☒ : Final Report

Days Of Repair: 5

Resurvey No. of Trip: 1

Survey Fee

Transportation

1 \$ - RS \$

Photos

Others

Add Fee: ☐ Site Insp \$☐ Interview \$☐ Tech. Ins \$☐ Weekend \$

Report Format: OD

Lump Sum / I.B.I. \$ 12446.00

250

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
AXA INSURANCE PTE LTD		Ref : CS/AXA17023178/Arb		
8 SHENTON WAY #24-01 AXA TOWERSINGAPORE 068811		Date : 06-12-2017		
		Code : AXA2		
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	Veh. Inspected		SKQ 657K	
Policy No.	Coverage (\$)		0.00	
Claim No. S7M0051V	Excess (\$)		0.00	
Assign From SMART CLAIM (JAS TAN)	Assign Date		06/12/2017	
2. Vehicle Particulars & Condition				
Make & Model	c.c		0	
Engine No. HIDDEN	Year of Reg.			
Chassis No.	Colour			
Odometer -	Steering			
Brakes	Modification			
General				
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre			mm	
L/H Front Tyre			mm	
R/H Rear Tyre			mm	
L/H Rear Tyre			mm	
4. Description of Damages				
5. General Information				
Accident Date 02/12/2017	Inspection Date		06/12/2017	
Survey held at SME MOTOR PTE LTD				
1 KAKI BUKIT AVE 6 #02-15 (AUTOBAY @KAKI BUKIT) SINGAPORE 417883				
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				



Service Request Details

Claim

S7M0051V

Reference

None 

Loss Date

December 2, 2017

Request Date

December 6, 2017

Due Date

December 13, 2017

Vendor Name

LKK AUTO CONSULTANTS PTE LTD (OD)

Type of Loss

Own Damage

Services

Accelerated survey and authorize

Actions

Next Step

Agree to perform service

Decline Work

Accept Work

Vehicle Information

Incident Vehicle Registration #

SKQ657K

Make

VOLKSWAGEN

Service Address

1 Kaki Bukit Ave 6 #02-15, , 417883

Primary Contact/Insured

LEONG HOONG SIEW
BLK 325 YISHUN CENTRAL, #02-351, 760325, Singapore, Singapore
91174151

Claim Handler

Jas TAN
6568804844
jas.tan@axa.com.sg

Additional Instructions
OD xs - nil workshop-SME

[Messages](#)[Invoices](#)[History](#)[Documents](#)[Assessment](#)[Metrics](#)[Notes](#)[New Message](#)



PRELIMINARY REVISED FOR SKQ 657K

Type

 Question

Message

Repairer's Estimate (Gross) : S\$ 14,055.00. Revised Estimate Amount : S\$ 11,641.00 "Check" Items (Estimated) : S\$ 1,905.00 . Total Repair cost : S\$ 13,546.00 . Pre-Accident Value : S\$ 70,000.00 . COE/PARF value : S\$ 51,573.00 . Nett Value : S\$ 18,427.00. Survey date and time: 06/12/2017 at 5.00pm. We have authorize repair. Janice

Reply

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore(GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	02/12/2017 15:00
Date Of Accident	02/12/2017 12:20
Exact Location Of Accident	CTE TO PIE CHANGI EXIT
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SKQ657K
Insured/Policyholder	
Name Of Registered Owner	SIEW LEONG HOONG
NRIC No	S7134934I
Email Address	NOEMAIL
Mobile Phone No	(LOCAL) +65-91174151
Alternative Phone No	OFFICE-91174151

Vehicle Particulars

Manufacturer	VOLKSWAGEN
Model	JETTA

Exact Purpose for which vehicle was being used at time of accident

Are you claiming under your own insurance policy for repair to your vehicle? YES

If No, Please state action to be taken

Vehicle Category	PRIVATE CAR
------------------	-------------

Insurance Company

Name of Insurance Company	AXA INSURANCE PTE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	P1741601
Cover Note Number	

Driver

Name of Driver	SIEW LEONG HOONG
NRIC No	S7134934I
Date Of Birth	03/10/1971
Occupation	INDOOR
Date Of Driving Pass	10/10/1994
Driving Experience	23 YEARS AND 1 MONTH
Gender	MALE
Mobile Number	(LOCAL) +65-91174151
Fax Number	
Contact Number	OFFICE-91174151
E-Mail Address	NOEMAIL

Details Of Properties

VEHICLE C

Name of Driver

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

Details of Witness

Name

Phone Number

Email Address

Sketch Plan #2 Pg. 1

SKETCH PLAN



DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

front veh suddenly stop, I cannot stop in time
I hit veh B from front

DECLARATION

I/We declare the foregoing particulars are true in every respect.


Policyholder's Signature
Date & Time

Driver's Signature
(If driver is not the policyholder)
Date & Time

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type	Singapore NRIC
Owner ID	4934I
Vehicle Details	
Vehicle No.	SKQ657K
Vehicle to be Exported	Yes
Intended De-registration Date	06 Dec 2017
Vehicle Make	VOLKSWAGEN
Vehicle Model	JETTA 1.4 TSI A/T ABS D/AIRBAG 2WD
Primary Colour	Silver
Manufacturing Year	2014
Engine No.	CAXE85006
Chassis No.	WVWZZZ16ZEM058706
Maximum Power Output	90.0 kW (120 bhp)
Open Market Value	\$19,154.00
Original Registration Date	30 Oct 2014
First Registration Date	30 Oct 2014
Transfer Count	2
Actual ARF Paid	\$9,154.00
Intended PARF Rebate Details	
PARF Eligibility	Yes
PARF Eligibility Expiry Date	29 Oct 2024
PARF Rebate Amount	\$6,865.00
Intended COE Rebate Details	
COE Expiry Date	29 Oct 2024
COE Category	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years)	10
QP Paid	\$64,841.00
COE Rebate Amount	\$44,708.00
Total Rebate Amount	\$51,573.00

The information contained herein is correct as at 06 Dec 2017

OK

VEHICLE NO.: SKQ657K

MAKE: VOLKSWAGEN

MODEL: JETTA

YEAR OF MAKE: 2014

CHASSIS NO.: WVVZZZ16ZEM058706

SUPPLIERS : HEXING

S/N	Items Description	QTY	Remarks
1	FRT WINDSCREEN <i>cracked</i>	1	\$490.00 ✓ /
2	FRT BONNET <i>Debed</i>	1	\$480.00 ✓ /
3	FRT BONNET RUBBER (WITH CLIP) <i>new</i>	2	\$44.00 ✓ /
4	FRT BONNET LOCK <i>new</i>	1	\$95.00 ✓ /
5	FRT GRILLE <i>cut</i>	1	\$220.00 ✓ /
6	GRILLE MOULDING (CHROME) <i>cut the new</i>	1	SAMPLE ✓ /
7	FRT BUMPER <i>Debed</i>	1	\$560.00 ✓ /
8	FRT BUMPER RETAINER <i>new</i>	2	\$56.00 ✓ /
9	FRT BUMPER CLIP <i>new</i>	10	\$15.00 ✓ /
10	NUMBER PLATE GARNISH <i>Debed</i>	1	\$70.00 ✓ /
11	FRT BUMPER INNER SPONGE <i>new</i>	1	\$25.00 ✓ /
12	FRT BUMPER REINFORCEMENT <i>Best</i>	1	\$280.00 ✓ /
13	HEADLAMP <i>Lit cracked RH (PHOTOS)</i>	2	\$580.00 290 ✓ /
14	HEADLAMP SUPPORT PANEL <i>Byis</i>	1	\$490.00 ✓ /
15	STEERING AIRBAG	1	\$1,720.00 ✓ /
16	FRT PASSENGER AIRBAG	1	\$1,870.00 ✓ /
17	FRT SAFETY BELT	2	\$900.00 ✓ /
18	AIRBAG CONTROL UNIT	1	\$980.00 ✓ /
19	CLOCK SENSOR	1	\$460.00 ✓ /
20	DASHBOARD <i>Point</i>	1	\$2,200.00 ✓ /
21	FRT Bumper CENTER BRACKET <i>cracked (A)</i>	1	\$125. ✓ /
22	TOTAL:		\$11,535.00
23			
24			
25	SPECIAL NETT:		
26	NUMBER PLATE <i>Best</i>		\$25.00 ✓ /
27	RADIATOR COOLANT <i>new</i>		\$20.00 ✓ /
28	FRT WINDSCREEN GUM <i>new</i>		\$60.00 ✓ /
29	ERP BRACKET <i>new</i>		\$25.00 ✓ /
30			
31	TOTAL:		\$130.00
32			
33			
34			
5			

Adrian Ling
06/12/17.
P/P Excess: NIL.
Authorised Repairs
Resurvey 12/12/17.
Adrian Ling
H.S.

VEHICLE NO.: SKQ657K

MAKE: VOLKSWAGEN

MODEL: JETTA

YEAR OF MAKE: 2014

CHASSIS NO.: VVVZZZ16ZEM058706

SUPPLIERS : HEXING


S/N	Items Description	QTY	Remarks
1	FRT WINDSCREEN <i>cracked</i>	1	\$490.00 ✓
2	FRT BONNET <i>Beut</i>	1	\$480.00 ✓
3	FRT BONNET RUBBER (WITH CLIP) <i>near</i>	2	\$44.00 ✓
4	FRT BONNET LOCK <i>near</i>	1	\$95.00 ✓
5	FRT GRILLE <i>cut</i>	1	\$220.00 ✓
6	GRILLE MOULDING (CHROME) <i>cut</i>	1	SAMPLE ✓
7	FRT BUMPER <i>Beut</i>	1	\$560.00 ✓
8	FRT BUMPER RETAINER <i>~</i>	2	\$56.00 ✓
9	FRT BUMPER CLIP <i>~</i>	10	\$15.00 ✓
10	NUMBER PLATE GARNISH <i>Beut</i>	1	\$70.00 ✓
11	FRT BUMPER INNER SPONGE <i>near</i>	1	\$25.00 ✓
12	FRT BUMPER REINFORCEMENT <i>Beut</i>	1	\$280.00 ✓
13	HEADLAMP <i>Lite cracked RH ? (PHOTOS)</i>	2	\$580.00 290
14	HEADLAMP SUPPORT PANEL <i>near</i>	1	\$490.00 ✓
15	STEERING AIRBAG	1	\$1,720.00 ✓
16	FRT PASSENGER AIRBAG	1	\$1,870.00 ✓
17	FRT SAFETY BELT	2	\$900.00 ✓
18	AIRBAG CONTROL UNIT	1	\$980.00 ✓
19	CLOCK SENSOR	1	\$460.00 ✓
20	DASHBOARD <i>Point</i>	1	\$2,200.00 ✓
21	FRT Bumper CENTER BRACKET	1	\$125. ✓
22	TOTAL: <i>cracked</i>		\$11,535.00
23			
24			
25	SPECIAL NETT:		
26	NUMBER PLATE <i>Beut</i>		\$25.00 ✓
27	RADIATOR COOLANT <i>near</i>	1	\$20.00 ✓
28	FRT WINDSCREEN GUM <i>near</i>		\$60.00 ✓
29	ERP BRACKET <i>near</i>		\$25.00 ✓
30			
31	TOTAL:		\$130.00
32			
33			
34			
35			
36			
37			
38			
39			
40			

41			
42			
43			
44	LABOUR:		
45	WIRE CHECKING	\$20.00	✓
46	REMOVE & REFIX AIRCON AND GAS	\$100.00	2
47	REMOVE & REFIX FRT WINDSCREEN	\$120.00	100
48	REMOVE & REFIX 2PCS SAFETY BELT AND AIRBAG SYSTEM	\$300.00	280
49	REPROGRAMME AIRBAG SYSTEM	\$250.00	220
50	REMOVE & REFIX DASHBOARD	\$200.00	✓
51	LABOUR CHARGE	\$700.00	400 ✓
52	SPRAY PAINTING	\$700.00	400
53			
54	TOTAL:	\$2,390.00	1600
55			
56			
57			
58			
59			
60	TOTAL:	\$14,055.00	
61	GST 7%	\$983.85	
62		\$15,038.85	
63			
64			
65			
66	parts 10,716		
67			
68	SN 110		
69			
70	LC 1600		
71			
72	12,446		
73			
74			
75			
76	19/01/2018		
77			
78			
79			
80			
81			
82			
83			

Adrian Lij
06/12/17

P/P Excess: NIL.
Authorised Repairs

Resurvey 12/12/17
Adrian Lij
H.S.

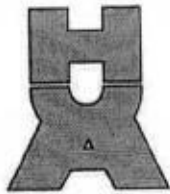

合興汽車零件私人有限公司

HE XING AUTO PARTS PTE LTD

MAIN OFFICE: No. 76 DUNLOP STREET, SINGAPORE 209403
TOYOTA / LEXUS / MITSUBISHI / FORD / WINDSCREEN / CHEVROLET /
DAIHATSU / KIA / SUZUKI / HONDA
TEL: 6291 2827 FAX: 6296 4390
A/C: 6291 1886 FAX: 6291 7717

Co. Reg. No: 200310923R GST Reg. No: 20-0310923-R

TAX INVOICE

M/S: SME MOTOR PTE LTD

1 KAKI BUKIT AVE.6
#02-15/16/17/18 AUTOBAY @KAKI BUKIT
SINGAPORE 417883
SKQ657K
HAN

NO: DL19197737
PAGE: 1
DATE: 29/12/2017
A/C CODE: LDSM446
TERMS: CR

Part No	Description	Location	Qty	Unit Price SIN	Amount SIN
Our D/O No: DDO9020884					
1 V5C6 823 031 D	BONNET	VC-8	1	480.00	480.00
2 V5C6 853 651 A ZLL	FRT GRILLE	VB-12	1	220.00	220.00
3 V5C6 807 217 H GRU	FR BUMPER	DDS	1	560.00	560.00
4 V5C6 807 287 9B9	LIC PLATE HOLDER	VB2-15	1	70.00	70.00
5 V5C8 941 005	HEADLAMP LH	VA-8	1	290.00	290.00
Our D/O No: DDO9020886					
1 V5C6 807 109 C	BKT	VA-21	1	280.00	280.00
2 V5C6 805 706 D	GUIDE SECTION	VB14-3	1	125.00	125.00
Our D/O No: DDO9020903					
1 V1KM 880 201 G 81U	STEERING AIRBAG	DDS	1	1,720.00	1,720.00
2 V5C6 880 204 H	PASSENGER AIR BAG	DDS	1	1,870.00	1,870.00
3 V5C6 857 705 A RAA	SAFETY BELT LH	DDS	1	450.00	450.00
4 V5C6 857 706 B RAA	SAFETY BELT RH	DDS	1	450.00	450.00
5 V5C8 857 002 D 6T6	DASHBOARD ASSY	DDS	1	2,200.00	2,200.00
6 V5C6 807 184	GUIDE PROFILE RH	DDS	1	28.00	28.00
7 V5C6 807 183	GUIDE PROFILE LH	DDS	1	28.00	28.00
8 VN 909 747 01	BUMPER CLIP	DDS	10	1.50	15.00
9 V5C0 959 655 C 02A	AIRBAG CTRL UNIT	DDS	1	980.00	980.00
10 V5K0 953 569 AK	CLOCK SPRING	DDS	1	460.00	460.00
11 V5C6 845 011 NVB	FR W/S GLASS	DDS	1	490.00	490.00

Print / MT / 29/12/2017 2:31:42 PM

...Cont'd





合興汽車零件私人有限公司

HE XING AUTO PARTS PTE LTD

MAIN OFFICE: No. 76 DUNLOP STREET, SINGAPORE 209403
TOYOTA / LEXUS / MITSUBISHI / FORD / WINDSCREEN / CHEVROLET /
DAIHATSU / KIA / SUZUKI / HONDA
TEL: 6291 2827 FAX: 6296 4390
A/C: 6291 1886 FAX: 6291 7717
Co. Reg. No: 200310923R GST Reg. No: 20-0310923-R

TAX INVOICE


M/S: SME MOTOR PTE LTD

NO: DLI9197737

PAGE: 2

TOTAL QUANTITY:	27	TOTAL	SIN 10,716.00
		ADD GST @ 7%	750.12
		GRAND TOTAL	SIN 11,466.12

#02-18

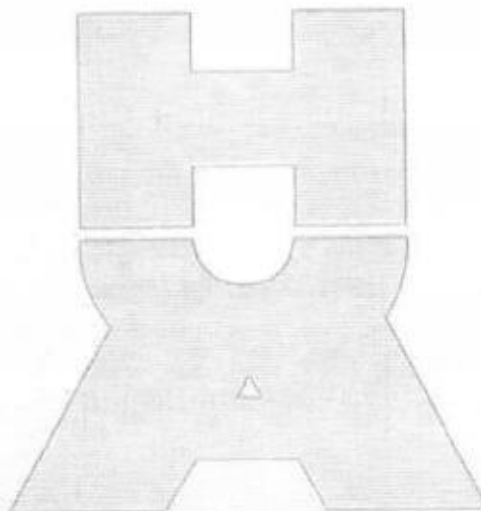

Print / MT / 29/12/2017 2:31:42 PM


SALESMAN: MT

This document is computer generated. No signature required.

GOODS SOLD ARE NOT RETURNABLE



E & O E
CHEVROLET
PARTS



GOODS RECEIVED BY



VEHICLE NO.: SKQ657K

MAKE: VOLKSWAGEN

MODEL: JETTA

YEAR OF MAKE: 2014

CHASSIS NO.: WVVZZZ16ZEM058706

SUPPLIERS : HEXING

S/N	Items Description	QTY	Remarks
1	FRT WINDSCREEN <i>Cracked</i>	1	\$490.00 ✓
2	FRT BONNET <i>Painted</i>	1	\$480.00 ✓
3	FRT BONNET RUBBER (WITH CLIP) <i>new</i>	2	\$44.00 ✓
4	FRT BONNET LOCK <i>new</i>	1	\$95.00 ✓
5	FRT GRILLE <i>cut</i>	1	\$220.00 ✓
6	GRILLE MOULDING (CHROME) <i>cut</i>	1	SAMPLE ✓
7	FRT BUMPER <i>Painted</i>	1	\$560.00 ✓
8	FRT BUMPER RETAINER <i>new</i>	2	\$56.00 ✓
9	FRT BUMPER CLIP <i>new</i>	10	\$15.00 ✓
10	NUMBER PLATE GARNISH <i>Painted</i>	1	\$70.00 ✓
11	FRT BUMPER INNER SPONGE ?	1	\$25.00 ?
12	FRT BUMPER REINFORCEMENT ?	1	\$280.00 ?
13	HEADLAMP <i>Left cracked</i> <i>RH ? (PHOTOS)</i>	2	\$580.00 <i>290</i>
14	HEADLAMP SUPPORT PANEL	1	\$490.00
15	STEERING AIRBAG	1	\$1,720.00 ✓
16	FRT PASSENGER AIRBAG	1	\$1,870.00 ✓
17	FRT SAFETY BELT	2	\$900.00 ✓
18	AIRBAG CONTROL UNIT	1	\$980.00 ✓
19	CLOCK SENSOR	1	\$460.00 ✓
20	DASHBOARD <i>Paint</i>	1	\$2,200.00 ✓
21			
22	TOTAL:		\$11,535.00
23			
24			
25	SPECIAL NETT:		
26	NUMBER PLATE <i>Best</i>		\$25.00 ✓
27	RADIATOR COOLANT ?		\$20.00 ?
28	FRT WINDSCREEN GUM <i>new</i>		\$60.00 ✓
29	ERP BRACKET <i>new</i>		\$25.00 ✓
30			
31	TOTAL:		\$130.00
32			
33			
34			
35			
36			
37			
38			
39			
40			

41			
42			
43			
44	LABOUR:		
45	WIRE CHECKING		\$20.00 ✓
46	REMOVE & REFIX AIRCON AND GAS		\$100.00 ?
47	REMOVE & REFIX FRT WINDSCREEN		\$120.00 100
48	REMOVE & REFIX 2PCS SAFETY BELT AND AIRBAG SYSTEM		\$300.00 280
49	REPROGRAMME AIRBAG SYSTEM		\$250.00 220
50	REMOVE & REFIX DASHBOARD		\$200.00 ✓
51	LABOUR CHARGE		\$700.00 ?
52	SPRAY PAINTING		\$700.00 400
53			
54	TOTAL:		\$2,390.00
55			
56			
57			
58			
59			
60	TOTAL:		\$14,055.00
61	GST 7%		\$983.85
62			\$15,038.85
63			
64			
65			
66			
67			
68			
69	LKK Auto Consultants hence notify the Repairer of the following: • To resurvey before/after spray painting • To display damaged part(s) during resurvey • Parts prices are subject to confirmation • Third party survey is on a "Without Prejudice" basis • No illegal modification(s) is allowed • Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company Acknowledged by Repairer Signature: Date: Adrian Lj 06/12/17 P/P Excess: NIL. Authorised Repair 05 days		
70			
71			
72			
73			
74			
75			
76			
77			
78			
79			
80			
81			
82			
83			

SERVICE REQUESTS

MESSAGES

CLAIMS

<< Service Request Details

Claim	S7M0051V	Vehicle Information	
Reference		Incident Vehicle	SKQ657K
CS/ASM17023178/Arts&ss Date		Registration #	Service Address
December 2, 2017	Request Date	VOLKSWAGEN 1	
July 12, 2018	Due Date	Model	JETTA 1.4 TSI A/T ABS
March 6, 2018	Vendor Name	Kaki Bukit Ave 6 #02-15, , , 417883	
LKK AUTO CONSULTANTS PTE Loss LTD (OD)	Type of	Primary Contact/Insured	
Own Damage	Services	SIEW LEONG HOONG BLK 325 YISHUN CENTRAL, 760325, Singapore 91174151	

Actions

Next Step

PAST DUE: Report that your block modify the Expected Completion Date.

Complete Work More

SERVICE REQUESTS MESSAGES CLAIMS

<< Service Request Details

Claim	S7M0051V
Reference	CS/ASM17023178/Arbitration Date
Request Date	December 2, 2017
Due Date	July 12, 2018
Vendor Name	March 6, 2018
Type of Loss	LKK AUTO CONSULTANTS PTE LOSS LTD (OD)
Own Damage	Services

Actions

Next Step

PAST DUE: Report that your block modify the Expected Completion Date.

Complete Work More

Vehicle Information			
Incident Vehicle	SKQ657K		
Registration #	Make	Service Address	
	VOLKSWAGEN	1	
Model	JETTA 1.4 TSI A/T ABS		
Kaki Bukit Ave 6 #02-15, , , 417883			
Primary Contact/Insured			

SIEW LEONG HOONG
BLK 325 YISHUN CENTRAL,
760325, Singapore
91174151



SERVICE REQUESTS

MESSAGES

CLAIMS



Assessment Details

General & Workshop Details

Vehicle & Driver Details

Vehicle Condition

Taxes & Ratio

Parts & Labour

Miscellaneous

Summary

General Details

Involving

1 2014 VOLKSWAGEN JETTA 1.4 TSI A/T ABS (SKQ657K)

Date of Loss

December 2, 2017

Time of Loss

12.20

Loss Description

SKQ657K (INSD)> SLA3192L (TP)> SLP6764M

Comment

Workshop Details

Total Rebate Amount

51573

Nett Loss Amount

\$18,427.00

Assigned Workshop

LKK AUTO CONSULTANTS PTE LTD (OD)

Target Date of Completion *

12/13/2017



Days of work completion *

7

Assessment Details

General & Workshop Details

Vehicle & Driver Details

Vehicle Condition

Taxes & Ratio

Parts & Labour

Miscellaneous

Summary

Vehicle & Driver Details

Vehicle Registration#

SKQ657K

Registration State

SINGAPORE

Mileage

109883

CATEGORY

Manufacturing Year

POLICY INFORMAT... 2014

ASSESSMENT INFO...

2014

Purchase Date

mm/dd/yyyy

Registration Date *

10/30/2014

Age of Vehicle

3

Driver Details

CATEGORY

Driver Name

FNOL INFORMATI...

SIEW LEONG HOONG

POST SURVEY INF...

ASSESSMENT INFO...

CATEGORY Engine No
POLICY INFORMAT... CAXE85006
ASSESSMENT INFO...

CATEGORY Engine Capacity
POLICY INFORMAT...
ASSESSMENT INFO...

CATEGORY Sum Insured
POLICY INFORMAT... 0
ASSESSMENT INFO...

CATEGORY Market Value
POLICY INFORMAT... 0
ASSESSMENT INFO...

FNOL INFORMATI... 22
POST SURVEY INF...
CATEGORY Driver License #
FNOL INFORMATI...
POST SURVEY INF...

CATEGORY License Type
FNOL INFORMATI...
POST SURVEY INF...

CATEGORY License Issue Date
FNOL INFORMATI...
POST SURVEY INF...

CATEGORY License Expiration Date
FNOL INFORMATI...
POST SURVEY INF...

CATEGORY Address

POST SURVEY INF...

-  SERVICE REQUESTS
- MESSAGES
- CLAIMS

<<

Assessment Details

- General & Workshop Details
- Vehicle & Driver Details
- Vehicle Condition
- Taxes & Ratio
- Parts & Labour
- Miscellaneous

Summary

Front left side

NEXEN 6mm

Rear left side

NEXEN 6mm

Front right side

NEXEN 6mm

Rear right side

NEXEN 6mm

SERVICE REQUESTSMESSAGESCLAIMS

Assessment Details

General & Workshop DetailsVehicle & Driver DetailsVehicle ConditionTaxes & RatioParts & LabourMiscellaneousSummaryParts

Add

Approve

Deny

Submit All

	EDIT	SR NO	QUAN TITY	MATERIAL	SIDE	PART NAME	PART NUMBER	REPAIR/REPLACE (PARTS)	CONDITION	LIST PRICE	DEPR/ BTTR %	DISC CUNT%	SALV AGE%	PART PRICE(NET)
		1	1			FRT WINDSCREEN			Cracked	490				490
		2	1			FRT BONNET			Dented	480				480
		3	2			FRT BONNET RUBBER (WITH CLIP)			Serviceable	0				0
		4	1			FRT BONNET LOCK			Serviceable	0				0
		5	1			FRT GRILLE			Cut	220				220
		6	1			GRILLE MOULDING (CHROME) (NPA)			Serviceable	0				0
		7	1			FRT BUMPER			Deformed	560				560
		8	2			FRT BUMPER RETAINER			Necessary	28				56
		9	10			FRT BUMPER CLIP			Necessary	1.5				15
		10	1			NUMBER PLATE GARNISH			Deformed	70				70

Claim Portal								
EDIT	SR NO	REPAIR/REPLACE (LABOUR)	PART NAME	LABOUR R&R	LABOUR REPAIR	PAINT	ACTION (LABOUR)	COMMENT
	2		REMOVE & REFIX AIRCON AND GAS.	0	0	0	Reviewing	
	3		REMOVE & REFIX FRT WINDSCREEN.	100	0	0	Reviewing	
	4		REMOVE & REFIX 2PCS SAFETY BELT AND AIRBAG SYSTEM.	280	0	0	Reviewing	
	5		REPROGRAMME AIRBAG SYSTEM.	220	0	0	Reviewing	
	6		REMOVE & REFIX DASHBOARD.	200	0	0	Reviewing	
	7		LABOUR CHARGE.	400	0	0	Reviewing	
	8		SPRAY PAINTING.	400	0	0	Reviewing	

SERVICE REQUESTS MESSAGES CLAIMS

<< Assessment Details

General & Workshop Details Vehicle & Driver Details Vehicle Condition Taxes & Ratio Parts & Labour Miscellaneous

Summary

EDIT		SR NO	NAME	ACTION	AMOUNT	COMMENT	REMOVE
☐		1	DAYS OF REPAIR	Reviewing	5		
☐		2	NUMBER PLATE	Reviewing	25	BENT	
☐		3	RADIATOR COOLANT	Reviewing	0	NOT NECESSARY	
☐		4	FRT WINDSCREEN GUM	Reviewing	60	NECESSARY	
☐		5	ERP BRACKET	Reviewing	25	NECESSARY	

SERVICE REQUESTS

MESSAGES

CLAIMS



Assessment Details

General & Workshop Details	Vehicle & Driver Details	Vehicle Condition	Taxes & Ratio	Parts & Labour	Miscellaneous
Summary	Claim Amount	\$12,446.00	Claim Amount	\$12,446.00	

CATEGORY	ESTIMATE	REVISED AMOUNT
----------	----------	----------------

Labour	\$1,620.00	\$1,620.00
--------	------------	------------

Miscellaneous	\$110.00	\$110.00
---------------	----------	----------

Spare Parts	\$10,716.00	\$10,716.00
-------------	-------------	-------------

Submit for Review