

Surveillance

REF:

NG/INC17023330 / 54602

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
 OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspect Vehicle No: _____
 at Workshop m/s _____
 of _____
 Insured: GBE 9185R
 Policy No. 50901879 60 30417 - 280418
 Claims No. MT/0972860-002
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
 repair at the time of inspection.

Bal. or Market Value: _____

IDAC Accident Report: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: SM 31415 Yr Regn: 2/14/2015
 Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or _____
 Make: MAN NL320 F c.c. 10518
 Colour: Multi Colour A/C: Insured / Std / NI / NA
 Sp. Reading: 142235 T/Radio: Insured / Std / NI / NA
 Eng/No: _____
 C/No: WMA112227 XE 9002889
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: In order / Jammed / Leaked / Burnt or
 Brake: In order / Jammed / Leaked / Burnt or
 Modi: Nil / S/Rim / STD A/Rim or
 Tyre Size: F: 275/70 R22.5
 R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or Five stars

Front	Rear
R/Bal. <u>6</u> mm	R/Bal. <u>6/6</u> mm
L/Bal. <u>5</u> mm	L/Bal. <u>6/6</u> mm
D.O.A. <u>4/12/2017</u>	D.O.I. <u>7/12/2017</u>

Survey held at 8MK
 Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time | Action / Instruction

SM 31415 - x

GBE 9185R - x

Part by Part \$6090.67 (Red: 459 / 7%)

REPAIRS 2018

Date/Time, File Pass to?



Preli. Report

1) 813 Typist



Final Report

Date/Time, File Return to?

2)

Days Of Repair: 3

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation: _____

Add Fee:



Site Insp (\$

) \$ + RS. SI



Interview (\$

) Photos



Tech. Invs (\$

) Others



Weekend (\$

)

Report Format : TP

Lump Sum / I.B.I. (\$) 6090.67

TOTAL

160
160



National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC17023330/Stb

73 BRAS BASAH ROAD

#05-01 NTUC TRADE UNION HOUSESINGAPORE Date: 08-12-2017

189556



Code: INC4

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	GBE 9185R	Veh. Inspected	SMB 3141S
Policy No.	5090187960	Coverage (\$)	0.00
Claim No.		Excess (\$)	0.00
Assign From		Assign Date	07/12/2017

2. Vehicle Particulars & Condition

Make & Model		c.c	0
Engine No.	HIDDEN	Year of Reg.	
Chassis No.		Colour	
Odometer	-	Steering	
Brakes		Modification	
General			

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

4. Description of Damages

--

5. General Information

Accident Date	04/12/2017	Inspection Date	07/12/2017
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705		

5a. Remarks

- A) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS.
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

TP Claims against NTUC Income: Follow-Through Survey

Date : 5/3/2018

S/No	Income Reference	Claimant (Owner / Taxi Company)	Claimant Vehicle No.	Income Vehicle No.	Date of Accident	Time of Accident	Estimate	Tentative repair cost
1	-	SMRT BUSES LTD	SMB 3529H	FV 3043U	11/12/2018	16:15	\$ 3,858.03	\$ 2,550.00
2	MT/0983770-002	COMFORT TRANSPORTATION PTE LTD	SHC 8339K	FY 5545J	25/2/2018	2:25	\$ 6,898.96	\$ 4,100.00
3	MT/0984758-001	COMFORT TRANSPORTATION PTE LTD	SHC 3155G	GBG 1237S	22/2/2018	14:40	\$ 2,549.36	\$ 1,400.00
4	MT/0980882-004	COMFORT TRANSPORTATION PTE LTD	SHD 3132S	GBC 3328X	3/2/2018	7:55	\$ 3,503.26	\$ 1,348.21
5	MT/0984276-002	COMFORT TRANSPORTATION PTE LTD	SHC 746X	SLR 7216L	28/2/2018	2:00	TOTAL LOSS	TOTAL LOSS
6	MT/0984762-001	SMRT BUSES LTD	SG 5452J	SKQ 3494T	5/1/2018	13:22	\$ 8,131.29	\$ 7,161.29
7	MT/0984765-001	SMRT BUSES LTD	SMB 336S	SHD 1237L	27/1/2018	18:30	\$ 2,990.00	\$ 700.00
8	MT/0979197-002	SMRT BUSES LTD	TIB 1116B	GBD 5665D	23/1/2018	10:05	\$ 3,964.77	\$ 3,000.00
9	MT/0983952-002	COMFORT TRANSPORTATION PTE LTD	SHB 6713G	SLA 46X	26/2/2018	6:05	\$ 6,740.80	\$ 4,950.00
10	NOT INSURED	COMFORT TRANSPORTATION PTE LTD	SHA 6973C	FBB 4102D	23/2/2018	17:15	\$ 1,250.48	\$ 600.00
11	MT/09833501-002	CITY CAB PTE LTD	SHA 9243G	PC 4246B	23/2/2018	18:05	\$ 2,681.58	\$ 2,400.00
12	MT/0984783-001	CITY CAB PTE LTD	SHB 4736D	FBL 7388Z	22/2/2018	12:30	\$ 2,487.18	\$ 950.48
13	MT/0982510-002	COMFORT TRANSPORTATION PTE LTD	SH 6763A	SJP 3496E	13/2/2018	22:00	\$ 2,324.08	\$ 1,295.76
14	MT/0984221-001	CITY CAB PTE LTD	SHC 926T	SDX 6942T	18/2/2018	16:50	\$ 3,181.90	\$ 1,400.00
15	MT/0984099-001	COMFORT TRANSPORTATION PTE LTD	SHA 4722Z	SJR 294E	16/2/2018	16:40	\$ 5,637.20	\$ 2,237.52
16	MT/0984101-001	COMFORT TRANSPORTATION PTE LTD	SHC 3372X	SLU 1543R	18/2/2018	5:35	\$ 4,132.08	\$ 560.00
17	MT/0984790-001	CITY CAB PTE LTD	SHC 7866L	SLP 4518X	18/2/2018	17:50	\$ 1,375.12	\$ 660.00
18	MT/0983617-002	COMFORT TRANSPORTATION PTE LTD	SH9111L	SHC 6770K	24/2/2018	22:50	\$ 2,605.10	\$ 975.48
19	MT/0983513-002	COMFORT TRANSPORTATION PTE LTD	SH A 3341X	SIL 7579U	24/2/2018	14:05	\$ 6,414.38	\$ 1,200.00
20	MT/0972860-002	COMFORT TRANSPORTATION PTE LTD	SMB 3141S	GBE 9185R	4/12/2017	14:25	\$ 6,153.67	\$ 6,090.67
21	MT/0983749-002	COMFORT TRANSPORTATION PTE LTD	SHA 7760T	SID 3446M	25/2/2018	22:15	\$ 6,759.82	\$ 1,850.00

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type	Company
Owner ID	2292D

Vehicle Details

Vehicle No.	SMB3141S
Vehicle to be Exported	No
Intended De-registration Date	08 Dec 2017
Vehicle Make	MAN
Vehicle Model	NL 320F (A22) 11L AUTO ABS TURBO
Primary Colour	Multi-Colour
Manufacturing Year	2014
Engine No.	50339912323991
Chassis No.	WMAA22ZZXF7002689
Maximum Power Output	-
Open Market Value	\$249,830.00
Original Registration Date	02 Nov 2015
First Registration Date	02 Nov 2015
Transfer Count	0
Actual ARF Paid	\$0.00

Intended PARF Rebate Details

PARF Eligibility	No
PARF Eligibility Expiry Date	-
PARF Rebate Amount	\$0.00

Intended COE Rebate Details

COE Rebate Amount	\$0.00
Total Rebate Amount	\$0.00

The information contained herein is correct as at 08 Dec 2017

OK



Please read through the Privacy Statement, Terms of Use, and Disclaimer.

Please do not use the Back or Forward buttons on your browser as this may alter the results of the transactions.

Best viewed with IE 10 and above, Chrome, Firefox, and Safari.

Copyright 2017 LTA [Privacy Statement](#) [Terms of Use](#) [Disclaimer](#) [Rate the Website](#) [Rate this e-Service](#)

Last updated on 19 Nov 2017 at 12:12 AM

eBaoTech

General Claim

Hello, NAC_PAYA_UBI_800601

[Change Language](#)[Change Password](#)[Log Out](#)[My Desktop](#)[Notice of Loss](#)

Policy Query

Policy No.	<input type="text"/>	Date of Accident	04/12/2017 11:18						
Vehicle No.(For Motor)	<input type="text" value="GBE9185R"/>								
<input type="button" value="Search"/>									
Select	Policy No.	Policyholder Name	Policyholder NRIC	Product	Cover Type	Vehicle No.	Insured Object	Commence Date	Expiry Date
	5090187960	CSP MAINTENANCE PTE LTD	199400236K	GCV	Comprehensive	GBE9185R	GBE9185R	29/04/2017	28/04/2018
<input type="button" value="Continue"/>									

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore(GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	05/12/2017 14:21
Date Of Accident	04/12/2017 14:25
Exact Location Of Accident	KALLANG BAHRU RD BEFORE BUS STOP(BS:60039)
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SMB3141S
Insured/Policyholder	
Name Of Registered Owner	SMRT BUSES LTD
Co Reg No	198202292D
Email Address	NOEMAIL
Mobile Phone No	
Alternative Phone No	OFFICE-64823888

Vehicle Particulars

Manufacturer	MERCEDES-BENZ
Model	BUS

Exact Purpose for which vehicle was being used at time of accident

Are you claiming under your own insurance policy for repair to your vehicle? NO

If No, Please state action to be taken THIRD PARTY

Vehicle Category BUS

Insurance Company

Name of Insurance Company	FIRST CAPITAL INSURANCE LTD
Type Of Coverage	THIRD PARTY
Fleet Policy	YES
Policy Number	D-17087563MFBP
Cover Note Number	

Driver

Name of Driver	PAW SENG YONG
Passport No/FIN	G7340431U
Date Of Birth	09/10/1984
Occupation	OUTDOOR
Date Of Driving Pass	08/12/2015
Driving Experience	1 YEAR AND 11 MONTHS
Gender	MALE
Mobile Number	
Fax Number	
Contact Number	
Email Address	NOEMAIL

Address

Postcode

Was driver an employee of the Insured's Company YES

If No, Relationship of the Driver with the Insured

Vehicle Registration Number of Driver's Own Vehicle -

Insurance Company of Driver's Own Vehicle -

General Information of the Accident

Type Of Accident SIDE SWIPE

Weather Conditions CLEAR

Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident? NO

Was any body injured in the Accident? NO

Was any other material or property damaged? YES

I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO

Number of Passengers (Including Driver) 3

Details of Police Action

Was the accident reported to the police? NO

If Yes, Please state which Police Station

Was notice of intended Prosecution given? NO

If Yes, against whom?

Circumstances of Accident

Bus while traveling along Kallang Bahru rd before bus stop(Bs:60039) opp Blk 66, a lorry (GBE9185R) that had turn left and stopped at the SP PowerGrip building entrance suddenly reversing his vehicle and side-swiped the left body of the bus. For the alleged accident nobody was injured.

Attachment(s)

Are accident photos available for attachment? NOT AVAILABLE DUE TO CIRCUMSTANCES OF ACCIDENT

Was there any video captured by Car Camera? NO

Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number GBE9185R

Vehicle Make/Model/Colour

Details Of Properties

Name of Driver UNKNOWN

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

Details of Witness

Name

Phone Number

Email Address

SKETCH PLAN


Bus 12/17/1004

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

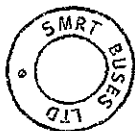

Policyholder's Signature
Date & Time:

[Signature]


Driver's Signature
(If driver is not the policyholder)
Date & Time:

[Signature]

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

SP power Grid
Building.

SKETCH PLAN

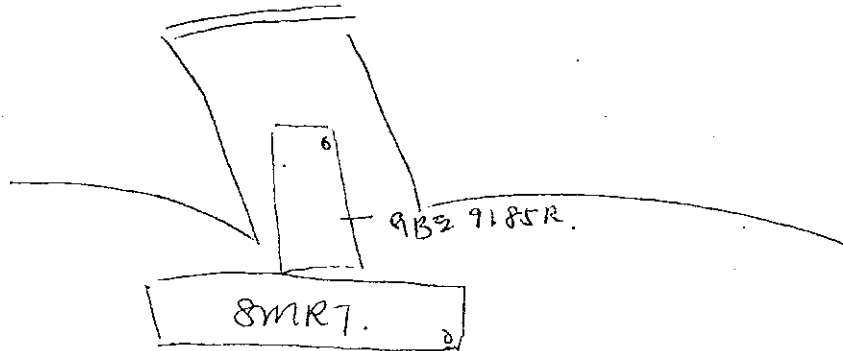

lullang Behn Rd

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

pls refer to first report.

DECLARATION

I/We declare the foregoing particulars are true in every respect.



Policyholder's Signature
Date & Time:

[Signature]

Driver's Signature
(If driver is not the policyholder)
Date & Time:


[Signature]

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

SMRT Accident Vehicle Repair Estimates

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SMB3141S
Ref. No : BUS/12/17/1004
Reg. Date : 02/11/2015
Vehicle Type : BUS -12M
Make : MAN
Model : MAN
Name of Driver : Paw Seng Yong
Type of Accident : SIDE SWIPE
Date / Time of Accident : 04/12/2017 02:27:00 PM
Accident Reported Date / Time : 05/12/2017 12:00:00 AM
Surveyor is Required? : Yes
Survey by : IDAC
Vehicle is Towed Back? : No
Towed Back Date/Time :
Replacement Vehicle issued? : No
Accident Repair Job Card No : 000024093510
Special Instruction to ARC,if any :
SMB3141S - LEFT CENTRE PORTION
GBE9185R (TP) - INSURED WITH NTUC
Prepared Date : 06/12/2017 02:13:57 PM

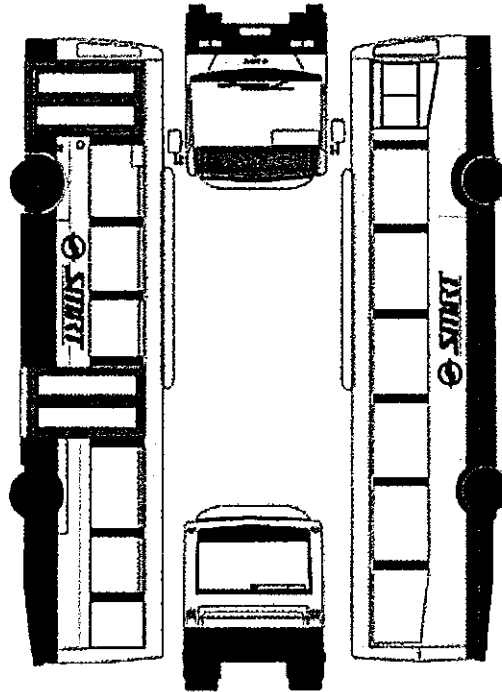

Section B - To be completed by Service Advisor, Accident Repair Centre

Chassis No : WMAA22ZZXF7002689

Mileage : 0

Work Shop :

Repair Completed Date / Time : 01/01/2000

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges	: 1,855.00	1,590.00
Total Spray Painting Charges	: 694.00	500.00
Total Material Charges	: 3,640.67	3,640.67
Other Charges	: 360.00	360.00
TOTAL	: 6,549.67	6,090.67
Lum Sum Total	: 0.00	0.00
No. of Repair Days	: 4.00	3.00 /
Prepared / Adjusted By	:	SEBASTIAN -LKK
Arc / Surveyor Sign Off Date	: 07/12/2017 01:02:10 PM	10/02/2018 04:59:27 PM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 07/12/2017 09:43:25 AM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No :	Invoice No :
Quotation Date :	Invoice Date :
Invoice Amount :	Prepared Date :

Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REMOVE & INSTALL ALL ABOVE ITEMS AND REPAIR OTHERS DAMAGED AFFECTED AREAS.	1,855.00	1,590.00 /
Total Labour	1,855.00	1,590.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
PROVIDE LABOUR AND MATERIAL TO PUTTY AND RESPRAY ABOVE REPAIR ITEMS	694.00	500.00 /
Total Spray Painting & Panel Beating	694.00	500.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
PIXEL STENCIL LHS FRT	60.00	60.00 /
PIXEL STENCIL LHS MID	150.00	150.00 /
PIXEL STENCIL LHS REAR	150.00	150.00 /
Total Other Costs	360.00	360.00

6257.30

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
A01001-CW555		6009999	LH SIDE PANEL L5	1	1,776.80	10.00	1,599.12	Replace	Replace	No / DT
		4006315	ACTIVATOR	1	80.00	0.00	80.00	Replace	Replace	No /
	COMMON	4006314	SEALANT SIKAFLEX	16	37.00	0.00	592.00	Replace	Replace	No /
GV124M03	LEFT	6010498	RUBBER,EXIT DOOR:FOR MAN A22 BUS	1	750.00	10.00	675.00	Replace	Replace	No /
	LEFT	6011891	COVER:4 WAY VALVE DOOR MAN	1	109.50	10.00	98.55	Replace	Replace	No /
	COMMON	4005299	SMRT STICKER(B)	1	200.00	0.00	200.00	Replace	Replace	No /
		6010568	FRAME,EXIT DOOR	1	440.00	10.00	396.00	Replace	Replace	No /
TOTAL MATERIALS							3,640.67	3,640.67		
TOTAL MATERIALS(Discounted)							3,640.67	3,640.67		

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
A01001-CW555		LH SIDE PANEL L5	1	1,776.80	10.00	1,599.12	Replace	Replace	No
		ACTIVATOR	1	80.00	0.00	80.00	Replace	Replace	No
	COMMON	SEALANT SIKAFLEX	16	37.00	0.00	592.00	Replace	Replace	No
GV124M03	LEFT	RUBBER,EXIT DOOR:FOR MAN A22 BUS	1	750.00	10.00	675.00	Replace	Replace	No
	LEFT	COVER:4 WAY VALVE DOOR MAN	1	109.50	10.00	98.55	Replace	Replace	No
	COMMON	SMRT STICKER(B)	1	200.00	0.00	200.00	Replace	Replace	No
		FRAME,EXIT DOOR	1	440.00	10.00	396.00	Replace	Replace	No
TOTAL SUPPLEMENTARY MATERIALS						3,640.67			

3640.67
 1590.00
 500.00
 360.00


 6090.67
 Subtotal 06/1/12



SMRT Accident Vehicle Repair Estimates

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SMB3141S
Ref. No : BUS/12/17/1004
Reg. Date : 06/12/2017
Vehicle Type : BUS -12M
Make : MAN
Model : MAN
Name of Driver : Paw Seng Yong
Type of Accident : SIDE SWIPE
Date / Time of Accident : 04/12/2017 02:27:00 PM
Accident Reported Date / Time : 05/12/2017 12:00:00 AM
Surveyor is Required? : Yes
Survey by : IDAC
Vehicle is Towed Back? : No
Towed Back Date/Time :
Replacement Vehicle issued? : No
Accident Repair Job Card No :
Special Instruction to ARC, if any :
SMB3141S - LEFT CENTRE PORTION
GBE9185R (TP) - INSURED WITH NTUC
Prepared Date : 06/12/2017 02:13:57 PM

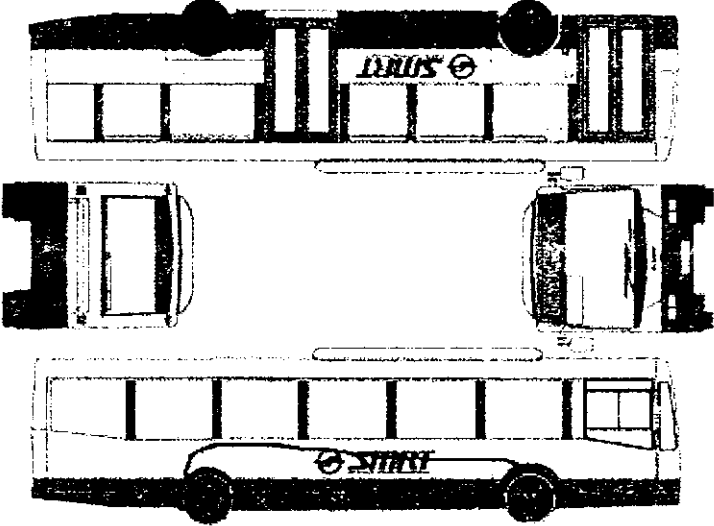

Chassis No : Mileage : 0
Work Shop : Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges	: 1,855.00	0.00
Total Spray Painting Charges	: 694.00	0.00
Total Material Charges	: 3,244.67	3,244.67
Other Charges	: 360.00	0.00
TOTAL	: 6,153.67	0.00
Lum Sum Total	: 0.00	0.00
No. of Repair Days	: 4.00	0.00 3 days
Prepared / Adjusted By	:	
Arc / Surveyor Sing Off Date	: 07/12/2017 01:02:10 PM	01/01/1900 12:00:00 AM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 07/12/2017 09:43:25 AM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No : Invoice No :
Quotation Date : Invoice Date :
Invoice Amount : Prepared Date :

Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REMOVE & INSTALL ALL ABOVE ITEMS AND REPAIR OTHERS DAMAGED AFFECTED AREAS.	1,855.00	0.00 1590
Total Labour	1,855.00	0.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
PROVIDE LABOUR AND MATERIAL TO PUTTY AND RESPRAY ABOVE REPAIR ITEMS	694.00	0.00 5 00
Total Spray Painting & Panel Beating	694.00	0.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
PIXEL STENCIL LHS FRT	60.00	0.00
PIXEL STENCIL LHS MID	150.00	0.00
PIXEL STENCIL LHS REAR	150.00	0.00
Total Other Costs	360.00	0.00

LKK Auto Consultants hence notify the Repainter of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repainter
Signature: _____
Date: _____

Sebastian.
7/12/2019.

- Part by part repair.
- Photo Before & After Paint

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommendation	Surveyor Approved	Photos Attached
A01001-CW555		6009999	LH SIDE PANEL L5	1	1,776.80	10.00	1,599.12	Replace	Replace	No <input checked="" type="checkbox"/>
		4006315	ACTIVATOR	1	80.00	0.00	80.00	Replace	Replace	No <input checked="" type="checkbox"/>
	COMMO	4006314	SEALANT SIKAFLEX	16	37.00	0.00	592.00	Replace	Replace	No <input checked="" type="checkbox"/>
	N									
GV124M03	LEFT	6010498	RUBBER,EXIT DOOR, FOR MAN A22 BUS	1	750.00	10.00	675.00	Replace	Replace	No <input checked="" type="checkbox"/>
	LEFT	6011891	COVER,4 WAY VALVE DOOR MAN	1	109.50	10.00	98.55	Replace	Replace	No <input checked="" type="checkbox"/>
	COMMO	4005299	SMRT STICKER(B)	1	200.00	0.00	200.00	Replace	Replace	No <input checked="" type="checkbox"/>
TOTAL MATERIALS										3,244.67
TOTAL MATERIALS(Discouted)										3,244.67

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
TOTAL SUPPLEMENTARY MATERIALS									




National Assessment Centre Services

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



NTUC INCOME INSURANCE CO-OPERATIVE LTD Ref: NS/INC17023330/Stbe2				
73 BRAS BASAH ROAD #05-01 NTUC TRADE UNION HOUSESINGAPORE 189556			Date: 12-03-2018	
Code: INC4				
1. Policy Particulars - THIRD PARTY CLAIM				
Insured Veh.	GBE 9185R	Veh. Inspected	SMB 3141S	
Policy No.	5090187960	Coverage (\$)	0.00	
Claim No.	MT/0972860-002	Excess (\$)	0.00	
Assign From		Assign Date	07/12/2017	
2. Vehicle Particulars & Condition				
Make & Model	MAN NL 320F	c.c	10518	
Engine No.	HIDDEN	Year of Reg.	2015	
Chassis No.	WMAA22ZZXF7002689	Colour	MULTI COLOUR	
Odometer	142255	Steering	IN ORDER	
Brakes	IN ORDER	Modification	NIL	
General	FAIR			
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre	275/70 R22.5	FIRENZA	6 mm	
L/H Front Tyre	275/70 R22.5	FIRENZA	6 mm	
R/H Rear Tyre	275/70 R22.5 (D)	FIRENZA	6/6 mm	
L/H Rear Tyre	275/70 R22.5 (D)	FIRENZA	6/6 mm	
4. Description of Damages				
THE VEHICLE SUSTAINED DAMAGES AT THE N/S BODY. DAMAGES SEE DETAILS.				
5. General Information				
Accident Date	04/12/2017	Inspection Date	07/12/2017	
Survey held at	SMRT AUTOMOTIVE SERVICES PTE LTD 60 WOODLANDS INDUSTRIAL PARK E4 SINGAPORE 757705			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				
5b. Estimate Days of Repair				
ESTIMATED NORMAL PERIOD FOR REPAIR:		3 Working Days		

**National Assessment Centre Services**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6841 0055 FAX: 6841 6315

Reg. No: 52983356E GST Reg. No. 20-0405911-H



Page No.:1 of 1

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SMB 3141S

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	LH SIDE PANEL L5	DENTED	1,776.80	1,776.80
1	RUBBER, EXIT DOOR : FOR MAN A22 BUS	TORN	750.00	750.00
1	COVER: 4 WAY VALVE DOOR MAN	MISSING	109.50	109.50
1	FRAME, EXIT DOOR	DAMAGED	440.00	440.00
	LESS 10% DISCOUNT		-	-307.63
			3,076.30	2,768.67
SPECIAL NETT ITEMS				
1	PIXEL STENCIL LHS FRT (SN)	NECESSARY	60.00	60.00
1	PIXEL STENCIL LHS MID (SN)	NECESSARY	150.00	150.00
1	PIXEL STENCIL LHS REAR (SN)	NECESSARY	150.00	150.00
1	ACTIVATOR (SN)	NECESSARY	80.00	80.00
16	SEALANT SIKAFLEX @\$37.00 (SN)	NECESSARY	592.00	592.00
1	SMRT STICKER (B) (SN)	NECESSARY	200.00	200.00
			1,232.00	1,232.00
LABOUR				
	TO REMOVE & INSTALL ALL ABOVE ITEMS AND REPAIR OTHERS DAMAGED AFFECTED AREAS.		1,855.00	1,590.00
	PROVIDE LABOUR AND MATERIAL TO PUTTY AND RESPRAY ABOVE REPAIR ITEMS.		694.00	500.00
			2,549.00	2,090.00
GRAND TOTAL			6,857.30	6,090.67

RECOMMENDED COST OF REPAIRS (CONFIRMED)	6,090.67
--	-----------------

Report Ref No. NS/INC17023330/Stbe2

YEANG WAI KEEN

Automotive Assessor

K.K.LAU CPT(RET)

BEng(Hons), B.Bus, MBA, PEng, PE,
MInstAEA, MASME, MIRTE

REGD Auto Consultant-SAE, Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.