

ASS. REC. BY:

REF:

CS/CTU7023483/Gqber

Special Instruction:

Surveyor
Maimun

GQ

ASSIGNMENT (Office)

From (Person):

Chong Soon Sen

of

CTL

Date/Time:

11-12-2017 3:09pm

Estimated Cost:

Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SG6 9672G

Insured:

at Workshop m/s

Car City Auto

Tel:

6781 0300

of

Blk 906 Tampines St 93 #01-158

Policy No:

DMP CSN 3013821606

Claim No:

SNMI7D07009 C01

Sum Insured:

Excess:

\$0

Make of Veh:

(Client's Record)

D.O.A.

09-12-2017

CA / REV / REP. / REV 24 HRS

12-12-2017

H.O.D. Endorsement:

Date/Time:

11-12-2017 3:24pm

Person Contacted:

Mr. Ng

Vehicle IN

Date/Time	Action/Instruction (✓) Estimate
	SG6 9672G 006 / ALH 14004053 / Kwa392
	REF: 240114
12/12/17 @ 4:16pm	Refer to Chong Soon Sen via Maimun.
13/12/17 @ 17:33	authorise repair by Alfred Tan
14/12 @ 9:27	inform Mr Ng authorise repaired excess \$0 (Lump Sum)
07/01/18 @ 4:21pm	confirmed with Mr Ho by 61600, 5 days. by email.
	(Ref \$473.87 21%).

CS/CN7023483 /Ggb

228



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD

Ref : CS/CTI17023483/Gqb

3 ANSON ROAD #16-00
SPRINGLEAF TOWERS SINGAPORE 079909

Date : 11-12-2017



Code : CTI

1. Policy Particulars - OWN DAMAGE

Insured Veh.		Veh. Inspected	SGG 9672G
Policy No.	DMPCSN3043821606	Coverage (\$)	0.00
Claim No.	SNM17D07009C01	Excess (\$)	0.00
Assign From	MERIMEN (CHONG BOON SEN)	Assign Date	11/12/2017

2. Vehicle Particulars & Condition

Make & Model		c.c	0
Engine No.	HIDDEN	Year of Reg.	
Chassis No.		Colour	
Odometer	-	Steering	
Brakes		Modification	
General			

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

4. Description of Damages

--	--

5. General Information

Engine No.	HIDDEN	Accident Date	07/12/2017	Inspection Date	
Survey held at	CAR CITY AUTO CENTRE PTE LTD BLK 9006 TAMPINES ST 93 #01-198 SINGAPORE 528840				

5a. Remarks

A) THE MARKET VALUE IS S\$----- (EST. AVERAGE)
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE AUTHORISED REPAIRS.

Reference No.: C9/C7117073483/996
Policy Type: OD / TP / TP RES / TL / EVA

566 96724

Policy Type: OD / TP / TP RES / TL / EVA

Case Handler

Typist

Admin (Cathy): Case handler to make sure all information created by the assignment team are **ACCURATE**.

(1) Office Assign Form

- | | |
|---|---------------------------------------|
| C | Reference No. |
| C | Customer Code |
| N | Assign From |
| C | Assign Date |
| C | Veh No (Inspected) |
| C | Veh No (Insured) |
| C | D.O.A |
| C | Policy No |
| C | Claim No |
| C | Insurance Authorisation (CA /REV/REP) |
| C | Report Type |
| C | Weekend Charges |
| N | Survey held at/Repairer |
| C | Excess |

[illegible]

Surveyor (*Guo Qiang*): Case handler to make sure the surveyor completed all required information.

(1) Assignment Form

- | | |
|---|------------------------|
| C | Vehicle No |
| C | Regn Month/Year |
| N | Vehicle Type |
| N | Make & Model |
| C | Engine Capacity. (C.C) |
| N | Colour |
| C | Odometer. (Sp.Reading) |
| C | Chassis No |
| N | General Condition |
| N | Steering |
| N | Brake |
| N | Modification (Modi) |
| C | Tyre Size |
| N | Tyre Make |
| C | Tyre Balance |
| C | Date of Inspection |
| N | Survey held |
| N | Des.of Damages |

[illegible]

(2) System - (Views/Merimen)

- ### C Damaged Vehicle Photographs Uploaded

--	--	--	--

(3) Workshop Estimate/Assignment Form

- N ALL Parts condition
- C Market Value for OD cases
- C Estimate Repair Cost for PRI (RSI, TMI, MSIG)
- C Days of repair
- C Finalised Amount
- C Re-inspection Cases to Finalize within 5 Days

✓	
✓	
✓	
✓	

(4) System - (Views/Merimen)

- C Resurvey photo ☒ Uploaded

<input checked="" type="checkbox"/>		
-------------------------------------	--	--

Check By:

Case Handler

Date _____

*C: Critical *N: Non-Critical

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Fst Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
	11 Dec 2017	11 Dec 2017	11 Dec 2017				
Main	Sendback Est	14:18	15:09				New Assignment
		S\$2,375.68	Assign				Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS									
Insured:	ONG KAR IMM, ID: S1710597C, Tel: +6596276829, Email: SALLYBINGO@GMAIL.COM								
Vehicle Reg. No.:	SGG9672G	Date of Loss:	07/12/2017 18:00 - :59						
Claim Type:	OD / SNM17D07009C01	Policy/Cover Note No.:	DMPCSN3043821606 (Comprehensive)						
		Excess:	\$0.00						
Repairer:	Car City Auto Centre Pte Ltd (HQ) Bk 9006 #01-198, Tampines Street 93, 528840 Tampines - Tel: 6781 0300								
Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Chong Boon Sen]								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Final Rpt due 20/12/2017]								
Driver/Custodian:	ONG KAR IMM (52 / Female), NRIC: S1710597C, Tel: +6596276829								
Adj Asg. Remarks:	SURVEY REVERT								
ASSOCIATED MAIL RECEIVED									
There are no mail for this case.			View All	Compose Case Mail					
ALL ASSOCIATED TASKS									
View All	Search Tasks	Create New Task	Complete						
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

View Received Message

This mail is associated with :

SGG9672G (SNM17D07009C01)

OD

Dec 7 2017 6:00PM

[ONG KAR IMM]

Car City Auto Centre Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From China Taiping Insurance (Singapore) Pte. Ltd. (HQ) (CHINA_TAIPING), sent on 13/12/2017 17:33 PM.
To LKK_HQ
Subject Alert - Adj Mandate Approved (S\$2237.08) - SGG9672G - Claim Handler: Chong Boon Sen

Approved:2237.08:Please proceed to authorize repairs at \$1,500.00 (lump sum basis) Excess WAIVED.

DOCUMENTS SUMMARY

There are no documents.

Shiau Chan (LKKAUTO)

From: CAR CITY AUTO CENTRE PTE LTD <ccacpl@singnet.com.sg>
Sent: Friday, 2 February 2018 4:21 PM
To: Shiau Chan (LKKAUTO)
Subject: Re: RE: RE: SGG9672G AFTER SPRAY PHOTOS AND MARKED AUDATEX REPORT

ok thank u

Ho

>-----Original Message-----

>From : siewsc@lkkauto.com
>Date : 02/02/2018 - 12:12 GMT+8
>To : ccacpl@singnet.com.sg
>Cc : sur@lkkauto.com
>Subject : RE: RE: SGG9672G AFTER SPRAY PHOTOS AND MARKED AUDATEX REPORT

>

>Dear Mr Ho,

>

>Offer Lump Sum \$1,600.00 before GST and 5 repair days.

>Kindly confirm.

>

>Best Regards,

>Shiau Chan (Ms) | Case Handler

>LKK Auto Consultants Pte Ltd

>Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315 Blk 51,

>Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

>

>-----Original Message-----

>From: CAR CITY AUTO CENTRE PTE LTD [mailto:ccacpl@singnet.com.sg]

>Sent: Thursday, 1 February 2018 10:07 AM

>To: Shiau Chan (LKKAUTO) <siewsc@lkkauto.com>

>Subject: Re: RE: SGG9672G AFTER SPRAY PHOTOS AND MARKED AUDATEX REPORT

>

>Dear Miss Shiau Chan,

>

>Please take note in your Audatex report item 742 and 842 missing (given during survey time).

>

>Please redo.

>

>Regards,

>

>Ho Too Boon

>CAR CITY AUTO CENTRE PTE LTD

>TEL: 67810300 FAX: 67820300

>EMAIL: ccacpl@singnet.com.sg

>

>>-----Original Message-----

>>From : siewsc@lkkauto.com

>>Date : 31/01/2018 - 17:47 GMT+8

>>To : ccacpl@singnet.com.sg, sur@lkkauto.com Subject : RE: SGG9672G

>>AFTER SPRAY PHOTOS AND MARKED AUDATEX REPORT

>>

Note: This document has not been finalised.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To: China Taiping Insurance (Singapore) Pte. Ltd.
3 Anson Road
#16-00 Springleaf Tower
Singapore 079909

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Chong Boon Sen

Date: 12 Dec 2017

Preliminary Advice

Vehicle No	: SGG9672G	Accident Date	: 07/12/2017
Make	: HONDA CIVIC	Policy No.	: DMPCSN3043821606
Assignment Date	: 11/12/2017	Excess	: S\$0.00
Date of Inspection	: 12/12/2017	Est. Duration of Repair	: 5.00
Inspection At	: CAR CITY AUTO CENTRE PTE LTD (HQ) BLK 9006 #01-198, TAMPINES STREET 93 SINGAPORE 528840		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages o/s portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	2,375.68
Revised Amount	:S\$	2,055.18
Check Items (Estimated)	:S\$	181.90
Total	:S\$	2,237.08
 Lump Sum Repair	 :S\$	 1,800.00 (ESTIMATE)

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	34,000.00
COE / PARF Rebate	:S\$	20,892.00
Salvage Value	:S\$	
Margin for Repair	:S\$	13,108.00

Remarks

- (X) The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- () The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- (X) Other comments : THE VEHICLE REPAIR ON LUMP SUM BASIS.

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type	Singapore NRIC
Owner ID	0597C

Vehicle Details

Vehicle No.	SGG9672G
Vehicle to be Exported	No
Intended De-registration Date	12 Dec 2017
Vehicle Make	HONDA
Vehicle Model	CIVIC 2.0L 5AT
Primary Colour	Black
Manufacturing Year	2008
Engine No.	K20Z24500910
Chassis No.	JHMF26409S200911
Maximum Power Output	114.0 kW (152 bhp)
Open Market Value	\$28,463.00
Original Registration Date	16 Dec 2009
First Registration Date	16 Dec 2009
Transfer Count	0
Actual ARF Paid	\$28,463.00

Intended PARF Rebate Details

PARF Eligibility	Yes
PARF Eligibility Expiry Date	15 Dec 2019
PARF Rebate Amount	\$17,077.00

Intended COE Rebate Details

COE Expiry Date	15 Dec 2019
COE Category	B - Car (1601cc & above)
COE Period(Years)	10
QP Paid	\$19,003.00
COE Rebate Amount	\$3,815.00
Total Rebate Amount	\$20,892.00

The information contained herein is correct as at 12 Dec 2017

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	08/12/2017 19:18
Date Of Accident	07/12/2017 18:30
Exact Location Of Accident	ALONG NORTH BRIDGE RD TOWARDS BUGIS JUNCTION
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SGG9672G
Insured/Policyholder	
Name Of Registered Owner	ONG KAR IMM
NRIC No	S1710597C
Email Address	SALLYBINGO@GMAIL.COM
Mobile Phone No	(LOCAL) +65-96276829
Alternative Phone No	OFFICE-96276829

Vehicle Particulars

Manufacturer	HONDA
Model	CIVIC-2.0 L (A)
Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE

Are you claiming under your own insurance policy for repair to your vehicle? YES

If No, Please state action to be taken

Vehicle Category	PRIVATE CAR
------------------	-------------

Insurance Company

Name of Insurance Company	CHINA TAIPING INSURANCE (SINGAPORE) PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	DMPCSN3043821606
Cover Note Number	

Driver

Name of Driver	ONG KAR IMM
NRIC No	S1710597C
Date Of Birth	03/01/1965
Occupation	INDOOR
Date Of Driving Pass	28/02/2003
Driving Experience	14 YEARS AND 9 MONTHS
Gender	FEMALE
Mobile Number	(LOCAL) +65-96276829
Fax Number	
Contact Number	OFFICE-96276829
EMail Address	SALLYBINGO@GMAIL.COM

Address
 Postcode
 Was driver an employee of the Insured's Company NO
 If No, Relationship of the Driver with the Insured OWNER
 Vehicle Registration Number of Driver's Own Vehicle -
 -
 -
 Insurance Company of Driver's Own Vehicle -
 -
 -

General Information of the Accident

Type Of Accident SIDE SWIPE
 Weather Conditions CLEAR
 Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident? NO
 Was any body injured in the Accident? NO
 Was any other material or property damaged? YES
 I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO
 Number of Passengers (Including Driver) 1

Details of Police Action

Was the accident reported to the police? NO
 If Yes, Please state which Police Station
 Was notice of intended Prosecution given? NO
 If Yes, against whom?

Circumstances of Accident

AS PER ATTACHED SKETCH PLAN

Attachment(s)

Are accident photos available for attachment? YES
 Was there any video captured by Car Camera? NO
 Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number SHA4471Y
 Vehicle Make/Model/Colour HYUNDAI BLUE COLOUR TAXI
 Details Of Properties
 Name of Driver
 NRIC/Passport Number
 Contact Number
 Address
 Postcode
 Insurance Company Name
 Nature Of Damage
 No. Of Passenger (Including Driver) 3

Details of Witness

Name
 Phone Number
 Email Address

SKETCH PLAN

IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This Form must be **completed by the Policyholder and/or the Authorised Driver**.
3. Information provided must be as **truthful and accurate as possible**. Any wilful misrepresentation or withholding of material facts may allow insurance companies to **repudiate policy liability**.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents(including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.



Policyholder's Signature

Date & Time: 8/12/17
1 pm

Driver's Signature

(If driver is not the policyholder)


Date & Time:

Reporting Centre Personnel's Signature

Name:

NRIC/FIN No.:

SKETCH PLAN

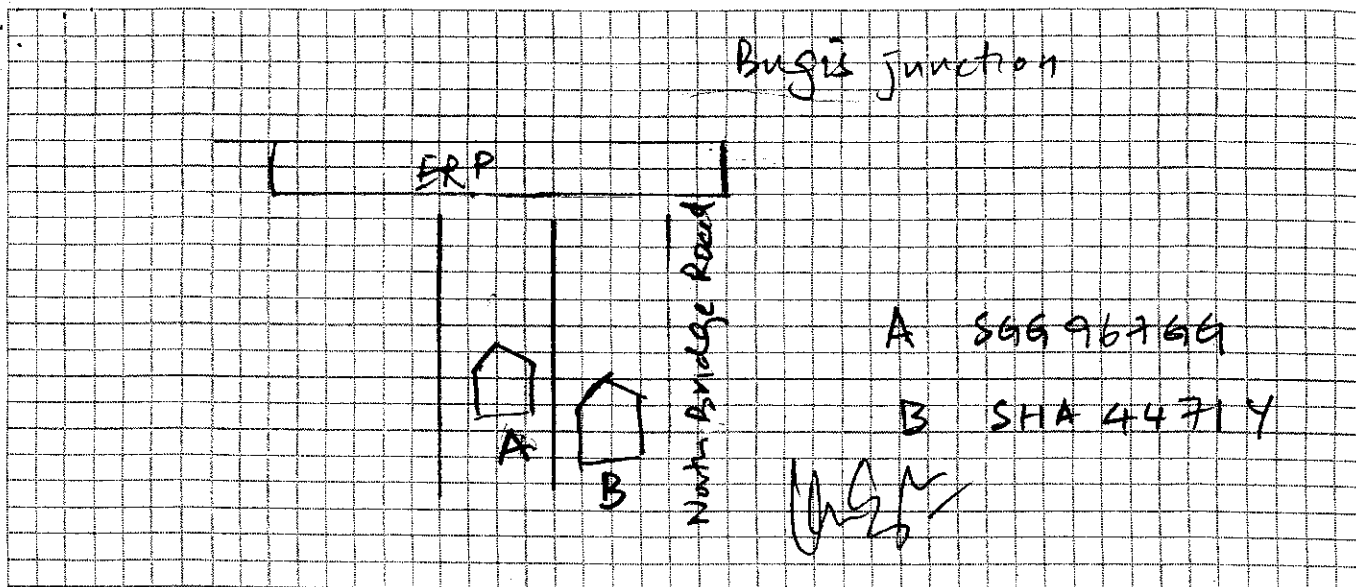

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

On 7 Dec about 6:30 pm I was driving along North Bridge Road towards Bugis junction. When I ~~was~~ filter right, car B ~~came~~ was driving on my right side and the ~~two~~ car A hit car B. As a result, right side mirror of car A and bumper was scratched. For car B, left side mirror was affected plus some minor scratches at the left front.

[Signature]

DECLARATION

I/We declare the foregoing particulars are true in every respect.

[Signature]

Policyholder's Signature

Date & Time: 8/12/17
1 pm

Driver's Signature

(If driver is not the policyholder)

Date & Time:

Reporting Centre Personnel's Signature

Name:

NRIC/FIN No.:

**CAR CITY AUTO CENTRE
PTE LTD
BLK 9006 TAMPINES
STREE 93**

**#01-198
SINGAPORE 528840**

**Claim Reference: CCA00323
Assessment Number: CCA00323
Version: CAR CITY/2
Date Calculated: 11/12/2017 03:02**

**Full Report - V1
Registration: SGG9672G
Printed: 11/12/2017 11:02**

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	HO TOO BOON	Date of Incident:	07/12/2017
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	Liberty Insurance Pte Ltd	Repairs Authorised:	TBA
Claim Reference:	CCA00323	Estimated Repair Time:	
Policy Number:	DMPCSN3043821606	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	HONDA
Model:	Civic
Sub Model:	BASE MODEL
Model Sheet Number:	H48 01
Registration:	SGG9672G
Registration Month:	December
Registration Year:	2009
VIN Number:	JHMFD26409S200911
Manufacture Year:	2008
Odometer:	Not Known
Colour:	Black
Engine Number:	K20Z24500910
Fuel Level:	%

Model Specs

FROM MODEL 2009	AUTO AIR CON
ELECT FOLDING MIRROR	RADIATOR DENSO
XENON HEADLAMPS	FOG LAMPS
CHROME DOOR HANDLES	PAINTED DOOR MIRRORS
MLDGS/CHROME INSERTS	S-BELT TENSIONER SYS
ANTI THEFT ALARM	TOW BAR
RR PARK DIST CONTROL	2.0 LTR 114 KW
5 SPEED GEARBOX	HYDRAULIC SERVO
FRONT BRAKE DISC 15"	TYRES 205/55 VR 16
WHEELS 6J X 15 ALLOY	WHEELS 4T X 15
HEAD AIRBAG	MUDFLAP
TWO COAT METALLIC	PAINTING OFF VEHICLE

Vehicle Condition


Vehicle Status

Pre-Accident Condition:	Fair	Severity of Impact:	Heavy Panel
Steering:	Satisfactory	Vehicle Status on	Roadworthy
		Inspection:	
Brakes Pedal Travel:	Satisfactory	Date of Inspection:	08/12/2017
Place of Inspection:			
Pre-Accident Damage:			
Tyres Condition:	Fair		
Tread Depth LHF:		Tread Depth RHF:	
Tread Depth LHR:		Tread Depth RHR:	
Damage Areas:		Direction of Impact:	

CAR CITY AUTO CENTRE PTE LTD

Claim Reference: CCA00323
 Assessment Number: CCA00323
 Version: CAR CITY/2
 Date Calculated: 11/12/2017 03:02

Full Report - V1
 Registration: SGG9672G
 Printed: 11/12/2017 11:02

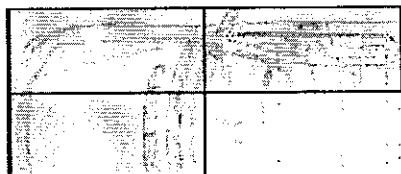

Addresses

Cost Summary

Total Labour	\$749.80
Total Paint/Material	\$187.13
Total Parts	\$1,396.75
Total of Additional Costs	\$42.00
Excess:	TBA
Grand Total Exc GST:	\$2,375.68
7 % GST:	\$166.30
Grand Total Inc GST:	\$2,541.98

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR
 Price/Dent = \$0.00/HR

Repair /

Guide Number Repair Details

		WU	Cost Price (\$)
NO NUMBER	R + R BOTH FOG LAMPS	2.0	9.20
71101-SNB	RENEW COMPLETE FRONT BUMPER	8.0	36.80
	INCLUDES: FRONT BUMPER CPL AND		
	R + R RADIATOR GRILLE.		
60211-SNB	R + R R/F WING	12.0	55.20
	INCLUDES: R + R FRONT BUMPER, HEADLAMP		
	AND WHEELHOUSE COVER		
83503-SNA	R + R RIGHT FRONT DOOR TRIM	4.0	18.40
72410-SNA	R + R R/F DOOR CHANNEL MOULDING	2.0	9.20
76250-SNB)	R + R RIGHT DOOR MIRROR	1.0	4.60
	(RIGHT DOOR TRIM REMOVED)		
75302-SNA)	R + R RIGHT FRONT DOOR MOULDING	2.0	9.20
	(DOOR TRIM REMOVED)		
1009	REPAIR FRONT PANEL CPL	10 23.0*	105.80
1482	REPAIR RIGHT FRONT DOOR	10 18.0*	82.80

LABOUR COST

Total Work Units	72.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	7.2HRS	\$331.20
Paint Labour	9.1HRS	\$418.60
Total Labour	16.3HRS	\$749.80

PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$46.00/HR

Guide Number Description

WU Cost Price (\$)

CAR CITY AUTO CENTRE PTE LTD

Claim Reference: CCA00323
 Assessment Number: CCA00323
 Version: CAR CITY/2
 Date Calculated: 11/12/2017 03:02

Full Report - V1
 Registration: SGG9672G
 Printed: 11/12/2017 11:02

	- TWO COAT METALLIC	
	- PAINTING OFF VEHICLE	
340	FRONT BUMPER SUPPORTSURFACE PAINT	4.0
742	R/F WING NEW PART PAINTING	11.0
283	FRONT BUMPER NEW PART PAINT K1R	12.0
1566	R/F DOOR OUT HANDLE NEW PART PAINT K1R	3.0
1682	R/F DOOR MOULDING NEW PART PAINT K1R	3.0
1738	R/DOOR MIRROR NEW PART PAINT K1R	4.0
1482	RIGHT FRONT DOOR REPAIR PAINTING >50%	24.0
471	BONNET SURFACE PAINT	8.0
1009	FRONT PANEL CPL SURFACE PAINT	6.0
LABOUR COST - PAINT		
	TIME(PAINT)	75.0
	Preparation Main Work Metal	11.0
	Preparation Comp. Work Plastic	5.0
	Preparation Work Multi Layer Paint	0.0
	Total Work Units (10WU/HR)	91.0
	Total Paintwork Labour	9.1HRS

MATERIAL COST - PAINT		Cost Price
	New Part Painting	\$23.22
	New Part Painting - Plastic K1R	\$65.42
	Surface-/Blend Paint	\$38.60
	Repair Painting	\$32.79
	Material-Const Main Work Metal	\$18.10
	Material-Const Comp. Work Plastic	\$9.00
	Total Excluding Pearlescent Uplift	\$187.13
	Pearlescent Uplift @ 0.0%	\$0.00
	Total Paint Material Cost	\$187.13

PARTS

Price Valid: 01/06/2015

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
283	1	FRONT BUMPER / CEA	71101SNLQ90ZZ		0%	210.00*
318	1	R/F OUT BUMPER BRKT / AL	71193SNB003		0%	17.00*
319	1	L/F UPP BUMPER BRKT X NN	71190SNB000		0%	23.00*
320	1	R/F UPP BUMPER BRKT X NN	71140SNB000		0%	23.00*
562	1	R/F HEADLAMP CPL / SER	33101SNBT51		0%	280.00*
742	1	R/F WING / BUC	60211SNB000ZZ		0%	180.00*
746	1	R/F WING BRACKET X NN	60212SNBE00ZZ		0%	17.00*
842	1	R/WHEELHOUSE SHELL / AL	74101SNAA10		0%	55.00*
1662	1	R/F WINDOW MOULDING X NN	72410SNAA01		0%	55.00*
1682	1	R/F DOOR MOULDING / AL	75302SNBT01ZB		0%	55.00*
1738	1	R/DOOR MIRROR / BR	76200SNAU01ZA		0%	320.00*
f: OEM Parts			Sub Total			\$1,235.00
g: Original			Mark Up From Cost	(5 %)		\$61.75
h: Secondhand			Sundry Parts	(Fixed)		\$100.00
p: Parallel			Total Parts			\$1,396.75
x: Exchange						

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
AUDATEX FEES SPECIALIST	0%	\$42.00
Total Extras		\$42.00

CAR CITY AUTO CENTRE PTE LTD

Claim Reference: CCA00323
Assessment Number: CCA00323
Version: CAR CITY/2
Date Calculated: 11/12/2017 03:02

Full Report - V1
Registration: SGG9672G
Printed: 11/12/2017 11:02

Final Calculation

Total Parts		\$1,396.75
Labour		
Total Panel/Mechanical	\$331.20	
Total Paintwork	\$418.60	
Total Labour		\$749.80
Additional Costs		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$42.00	
Total of Additional Costs		\$42.00
Total Paint/Material Costs		\$187.13
Grand Total Excludes GST		\$2,375.68
GST @ 7 %		\$166.30
Grand Total Includes GST		\$2,541.98

Assessment Notes

5 Days.
Unpsum repair.
After repair photos.
Excess 0
Not Authorised.
12/12/17

LINK Auto Consultants hence notify the Repairer of the following: <ul style="list-style-type: none">• To resurvey before/after spray painting• To display damaged part(s) during resurvey• Parts prices are subject to confirmation• Third party survey is on a "Without Prejudice" basis• No illegal modification(s) is allowed• Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company
Acknowledged by Repairer
Signature:
Date:

**CAR CITY AUTO CENTRE
PTE LTD
BLK 9006 TAMPINES
STREE 93**

**#01-198
SINGAPORE 528840**

**Claim Reference: CCA00323
Assessment Number: CCA00323
Version: CAR CITY/2
Date Calculated: 11/12/2017 03:02**

**Full Report - V1
Registration: SGG9672G
Printed: 11/12/2017 11:02**

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	HO TOO BOON	Date of Incident:	07/12/2017
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	Liberty Insurance Pte Ltd	Repairs Authorised:	TBA
Claim Reference:	CCA00323	Estimated Repair Time:	
Policy Number:	DMPCSN3043821606	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	HONDA
Model:	Civic
Sub Model:	BASE MODEL
Model Sheet Number:	H48 01
Registration:	SGG9672G
Registration Month:	December
Registration Year:	2009
VIN Number:	JHMF26409S200911
Manufacture Year:	2008
Odometer:	Not Known
Colour:	Black
Engine Number:	K20Z24500910
Fuel Level:	%

Model Specs

FROM MODEL 2009	AUTO AIR CON
ELECT FOLDING MIRROR	RADIATOR DENSO
XENON HEADLAMPS	FOG LAMPS
CHROME DOOR HANDLES	PAINTED DOOR MIRRORS
MLDGS/CHROME INSERTS	S-BELT TENSIONER SYS
ANTI THEFT ALARM	TOW BAR
RR PARK DIST CONTROL	2.0 LTR 114 KW
5 SPEED GEARBOX	HYDRAULIC SERVO
FRONT BRAKE DISC 15"	TYRES 205/55 VR 16
WHEELS 6J X 15 ALLOY	WHEELS 4T X 15
HEAD AIRBAG	MUDFLAP
TWO COAT METALLIC	PAINTING OFF VEHICLE

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Fair	Severity of Impact:	Heavy Panel
Steering:	Satisfactory	Vehicle Status on Inspection:	Roadworthy
Brakes Pedal Travel:	Satisfactory	Date of Inspection:	08/12/2017
Place of Inspection:			
Pre-Accident Damage:			
Tyres Condition:	Fair		
Tread Depth LHF:		Tread Depth RHF:	
Tread Depth LHR:		Tread Depth RHR:	
Damage Areas:		Direction of Impact:	

CAR CITY AUTO CENTRE PTE LTD

Claim Reference: CCA00323

Full Report - V1



Assessment Number: CCA00323

Registration: SGG9672G

Version: CAR CITY/2

Printed: 11/12/2017 11:02

Date Calculated: 11/12/2017 03:02

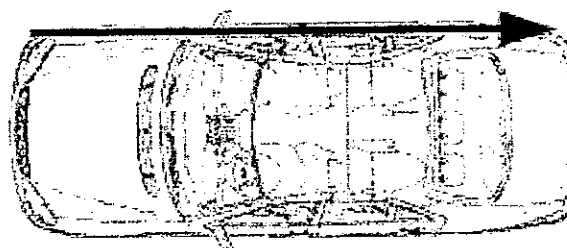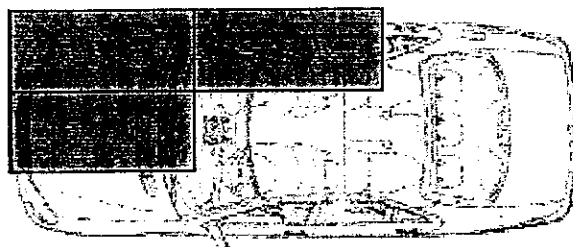**Addresses****Cost Summary**

Total Labour	\$749.80
Total Paint/Material	\$187.13
Total Parts	\$1,396.75
Total of Additional Costs	\$42.00
Excess:	TBA
Grand Total Exc GST:	\$2,375.68
7 % GST:	\$166.30
Grand Total Inc GST:	\$2,541.98

Repair Information

LABOUR		Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR Price/Dent = \$0.00/HR	
Repair / Guide Number	Repair Details	WU	Cost Price (\$)
NO NUMBER	R + R BOTH FOG LAMPS	2.0	9.20
71101-SNB	RENEW COMPLETE FRONT BUMPER INCLUDES: FRONT BUMPER CPL AND R + R RADIATOR GRILLE.	8.0	36.80
60211-SNB	R + R R/F WING INCLUDES: R + R FRONT BUMPER, HEADLAMP AND WHEELHOUSE COVER	12.0	55.20
83503-SNA	R + R RIGHT FRONT DOOR TRIM	4.0	18.40
72410-SNA	R + R R/F DOOR CHANNEL MOULDING	2.0	9.20
76250-SNB)	R + R RIGHT DOOR MIRROR (RIGHT DOOR TRIM REMOVED)	1.0	4.60
75302-SNA)	R + R RIGHT FRONT DOOR MOULDING (DOOR TRIM REMOVED)	2.0	9.20
1009	REPAIR FRONT PANEL CPL	10 23.0*	105.80
1482	REPAIR RIGHT FRONT DOOR	10 18.0*	82.80
LABOUR COST			
Total Work Units		72.0	
Corrosion Protection External Labour		0.0HRS	0.00
Corrosion Protection Internal Labour		0.0HRS	0.00
Sub Total		7.2HRS	\$331.20
Paint Labour		9.1HRS	\$418.60
Total Labour		16.3HRS	\$749.80

PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$46.00/HR

Guide Number Description WU Cost Price (\$)

CAR CITY AUTO CENTRE PTE LTD

Claim Reference: CCA00323

Assessment Number: CCA00323

Version: CAR CITY/2

Date Calculated: 11/12/2017 03:02

Full Report - V1

Registration: SGG9672G

Printed: 11/12/2017 11:02

	- TWO COAT METALLIC		
	- PAINTING OFF VEHICLE		
340	FRONT BUMPER SUPPORTSURFACE PAINT	4.0	
742	R/F WING NEW PART PAINTING	11.0	
283	FRONT BUMPER NEW PART PAINT K1R	12.0	
1566	R/F DOOR OUT HANDLE NEW PART PAINT K1R	3.0	
1682	R/F DOOR MOULDING NEW PART PAINT K1R	3.0	
1738	R/DOOR MIRROR NEW PART PAINT K1R	4.0	
1482	RIGHT FRONT DOOR REPAIR PAINTING >50%	24.0	
471	BONNET SURFACE PAINT	8.0	
1009	FRONT PANEL CPL SURFACE PAINT	6.0	
LABOUR COST - PAINT			
	TIME(PAINT)	75.0	
	Preparation Main Work Metal	11.0	
	Preparation Comp. Work Plastic	5.0	
	Preparation Work Multi Layer Paint	0.0	
	Total Work Units (10WU/HR)	91.0	
	Total Paintwork Labour	9.1HRS	\$418.60
MATERIAL COST - PAINT			Cost Price
	New Part Painting		\$23.22
	New Part Painting - Plastic K1R		\$65.42
	Surface-/Blend Paint		\$38.60
	Repair Painting		\$32.79
	Material-Const Main Work Metal		\$18.10
	Material-Const Comp. Work Plastic		\$9.00
	Total Excluding Pearlescent Uplift		\$187.13
	Pearlescent Uplift @ 0.0%		\$0.00
	Total Paint Material Cost		\$187.13

PARTS

Price Valid: 01/06/2015

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
283	1	FRONT BUMPER / <i>CLA</i>	71101SNLQ90ZZ		0%	210.00*
318	1	R/F OUT BUMPER BRKT / <i>AL</i>	71193SNB003		0%	17.00*
319	1	L/F UPP BUMPER BRKT X	71190SNB000		0%	22.00*
320	1	R/F UPP BUMPER BRKT ? X	71140SNB000		0%	22.00*
562	1	R/F HEADLAMP CPL / <i>SIC</i>	33101SNBT51		0%	280.00*
742	1	R/F WING / <i>Buc</i>	60211SNB000ZZ		0%	180.00*
746	1	R/F WING BRACKET X	60212SNBE00ZZ		0%	17.00*
842	1	R/WHEELHOUSE SHELL / <i>AL</i>	74101SNAA10		0%	55.00*
1662	1	R/F WINDOW MOULDING ? X	72410SNAA01		0%	55.00*
1682	1	R/F DOOR MOULDING / <i>AL</i>	75302SNBT01ZB		0%	55.00*
1738	1	R/DOOR MIRROR / <i>BR</i>	76200SNAU01ZA		0%	320.00*
f: OEM Parts			Sub Total			1117.00 \$1,235.00
g: Original			Mark Up From Cost	(5 %)		\$61.75
h: Secondhand			Sundry Parts	(Fixed)		\$100.00
p: Parallel			Total Parts			\$1,396.75
x: Exchange						

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
AUDATEX FEES	0%	\$42.00
SPECIALIST		
Total Extras		\$42.00

CAR CITY AUTO CENTRE PTE LTD

Claim Reference: CCA00323

Full Report - V1

Assessment Number: CCA00323

Registration: SGG9672G

Version: CAR CITY/2

Printed: 11/12/2017 11:02

Date Calculated: 11/12/2017 03:02

Final Calculation

Total Parts		\$1,396.75
Labour		
Total Panel/Mechanical	\$331.20	
Total Paintwork	\$418.60	
Total Labour		\$749.80
Additional Costs		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$42.00	
Total of Additional Costs		\$42.00
Total Paint/Material Costs		\$187.13
Grand Total Excludes GST		\$2,375.68
GST @ 7 %		\$166.30
Grand Total Includes GST		\$2,541.98

Assessment Notes

5 Days.

Unpssm repair.

After repair photos.

14/12/17
Andrew
T-50

Excess 0

Not Authorised.

12/12/17

(Quoted)

Car City Auto Centre Pte Ltd (Co.Reg.No:200719980C)

Blk 9006 #01-198, Tampines Street 93

Singapore 528840

Tel: 6781 0300 Fax: 6782 0300 Email: ccacpl@singnet.com.sg;carcity@singnet.com.sg

INSURER: China Taiping Insurance (Singapore) Pte. Ltd. (HQ)**PARTICULARS OF CLAIM**

Claim Type:	OD (OWN DAMAGE)	Ref. No:	OD/18028
Policy No:	DMPCSN3043821606	Date of Loss:	07/12/2017
Vehicle Reg. No.:	SGG9672G	Driveable?	
Driver Age/Info:	52 / FEMALE	Party At Fault:	UNKNOWN
TP Injury Involved?	NO	Third Party Involved?	YES
Insured/Claimant:	ONG KAR IMM	Contact No:	+6596276829
Driver:	ONG KAR IMM		

Make/Model:	HONDA CIVIC, 2.0 L (A)	Vehicle Reg. Date:	16/12/2009
Vehicle Colour:	BLACK		
Engine No:	K20Z2450090	Chassis No:	JHMFD26409S200911
Odometer:	9999 KM		

Paint Type:	
Total Loss?	NO
Est. Duration of Repair (day)	6

Description of Accident/Loss	AS PER ATTACHED SKETCH PLAN
Present Location:	CAR CITY AUTO CENTRE PTE LTD (HQ)

COST OF CLAIMS

	Amount
Parts	1,296.75
Miscellaneous Items	142.00
Labour	936.93
Paintwork Labour	0.00
Towing	0.00
Gross Total (S\$)	2,375.68
+ GST 7.00% (S\$)	166.30
Nett Amount (S\$)	2,541.98

This claim is handled by: HO TOO BOON

Generated using Merimen e-Claims Internet Estimation & Adjusting System

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 11 Dec 2017)
Parts: 143 HONDA CIVIC 2.0 L (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's (Price-denominated Standard List)
Print Code: Car City Auto Centre Pte Ltd/SGG9672G/11/12/2017 14:18
Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1	NA	*FRONT BUMPER (wlp)	0.00	0.00 ✓	*210.00 F CFA
2	1	NA	*L/F UPP BUMPER BRKT	0.00	0.00	*23.00 F XAN
3	1	NA	*R/DOOR MIRROR	0.00	0.00 ✓	*320.00 F BR
4	1	NA	*R/F DOOR MOULDING	0.00	0.00	*55.00 F XAN
5	1	NA	*R/F HEADLAMP CPL	0.00	0.00 ✓	*280.00 F SCR
6	1	NA	*R/F OUT BUMPER BRKT	0.00	0.00 ✓	*17.00 F MC
7	1	NA	*R/F UPP BUMPER BRKT	0.00	0.00	*23.00 F XAN
8	1	NA	*R/F WINDOW MOULDING	0.00	0.00	*55.00 F XAN
9	1	NA	*R/F WING	0.00	0.00 ✓	*180.00 F BUC
10	1	NA	*R/F WING BRACKET	0.00	0.00	*17.00 F XAN
11	1	NA	*R/WHEELHOUSE SHELL	0.00	0.00 ✓	*55.00 F DE
Sub Total (\$\$)						1,235.00
+ Margin on L,N Items 5.00% (\$\$)						61.75
Total Parts (\$\$)						1,296.75

F=Franchise part.

Car City Auto Centre Pte Ltd/SGG9672G/11/12/2017 14:18. Not valid without Reference section.
 Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

No Qty Particulars

Amount

Miscellaneous Items

1	1	AUDATEX FEES	42.00 ✓
2	1	SUNDRY PARTS	100.00 ✓
Sub Total (S\$)			142.00

Estimates on Labour

No Particulars

Lab.Type

Amount

Labour Items

1	Total Paint Labour	New	423.20	418.60
2	Total Paint Materials	New	173.37	187.13
3	Total Panel/Mechanical Labour	New	170.20	331.20
Gross Labour Cost (S\$)				936.93

Car City Auto Centre Pte Ltd/SGG9672G/11/12/2017 14:18. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

51 Ubi Avenue 1, #01-25
Paya Ubi Industrial Park
Singapore
408933

Claim Reference: SNM17D07009C01
Assessment Number: CCA00323
Version: LKKAUTOC/3
Date Calculated: 02/02/2018 04:05

Full Report - V1
Registration: SGG9672G
Printed: 02/02/2018 12:05

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	MR LAU	Date of Incident:	07/12/2017
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	Liberty Insurance Pte Ltd	Repairs Authorised:	TBA
Claim Reference:	SNM17D07009C01	Estimated Repair Time:	
Policy Number:	DMPCSN3043821606	Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	HONDA
Model:	Civic
Sub Model:	BASE MODEL
Model Sheet Number:	H48 01
Registration:	SGG9672G
Registration Month:	December
Registration Year:	2009
VIN Number:	JHMF26409S200911
Manufacture Year:	2008
Odometer:	Not Known
Colour:	Black
Engine Number:	K20Z24500910
Fuel Level:	%

Model Specs

FROM MODEL 2009	AUTO AIR CON
ELECT FOLDING MIRROR	RADIATOR DENSO
XENON HEADLAMPS	FOG LAMPS
CHROME DOOR HANDLES	PAINTED DOOR MIRRORS
MLDGS/CHROME INSERTS	S-BELT TENSIONER SYS
ANTI THEFT ALARM	TOW BAR
RR PARK DIST CONTROL	2.0 LTR 114 KW
5 SPEED GEARBOX	HYDRAULIC SERVO
FRONT BRAKE DISC 15"	TYRES 205/55 VR 16
WHEELS 6J X 15 ALLOY	WHEELS 4T X 15
HEAD AIRBAG	MUDFLAP
TWO COAT METALLIC	PAINTING OFF VEHICLE

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Fair	Severity of Impact:	Heavy Panel
Steering:	Satisfactory	Vehicle Status on Inspection:	Roadworthy
Brakes Pedal Travel:	Satisfactory	Date of Inspection:	08/12/2017
Place of Inspection:			
Pre-Accident Damage:			
Tyres Condition:	Fair		
Tread Depth LHF:		Tread Depth RHF:	
Tread Depth LHR:		Tread Depth RHR:	
Damage Areas:		Direction of Impact:	

51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference: SNM17D07009C01

Full Report - V1


Assessment Number: CCA00323

Registration: SGG9672G

Version: LKKAUTOC/3

Printed: 02/02/2018 12:05

Date Calculated: 02/02/2018 04:05

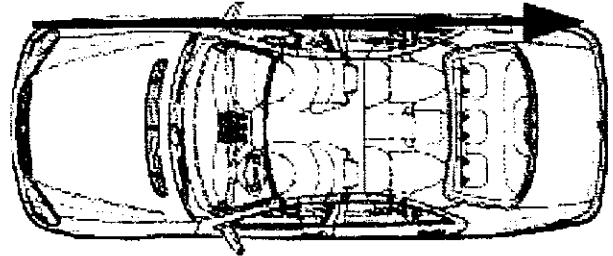

Addresses

Cost Summary

Total Labour	\$593.40
Total Paint/Material	\$173.37
Total Parts	\$1,215.10
Total of Additional Costs	\$42.00
Excess:	- \$0.00
Grand Total Exc GST:	\$2,023.87
7 % GST:	\$141.67
Grand Total Inc GST:	\$2,165.54

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR
Price/Dent = \$0.00/HR

Repair /

Guide Number Repair Details

		WU	Cost Price (\$)
NO NUMBER	R + R BOTH FOG LAMPS	2.0	9.20
71101-SNB	RENEW COMPLETE FRONT BUMPER INCLUDES: FRONT BUMPER CPL AND R + R RADIATOR GRILLE.	8.0	36.80
60211-SNB	R + R R/F WING INCLUDES: R + R FRONT BUMPER, HEADLAMP AND WHEELHOUSE COVER	12.0	55.20
83503-SNA	R + R RIGHT FRONT DOOR TRIM	4.0	18.40
76250-SNB)	R + R RIGHT DOOR MIRROR (RIGHT DOOR TRIM REMOVED)	1.0	4.60
1482	REPAIR RIGHT FRONT DOOR	10.0*	46.00

LABOUR COST

Total Work Units

37.0

Corrosion Protection External Labour

0.0HRS

0.00

Corrosion Protection Internal Labour

0.0HRS

0.00

Sub Total

3.7HRS

\$170.20

Paint Labour

9.2HRS

\$423.20

Total Labour

12.9HRS

\$593.40

PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$46.00/HR

Guide Number Description

		WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PAINTING OFF VEHICLE		
340	FRONT BUMPER SUPPORTSURFACE PAINT	4.0	
742	R/F WING NEW PART PAINTING	11.0	
283	FRONT BUMPER NEW PART PAINT K1R	12.0	
1738	R/DOOR MIRROR NEW PART PAINT K1R	4.0	

1566	R/F DOOR OUT HANDLE REPAIR PAINT PLASTIC	9.0	
1482	RIGHT FRONT DOOR REPAIR PAINTING >50%	24.0	
471	BONNET SURFACE PAINT	8.0	
LABOUR COST - PAINT			
	TIME(PAINT)	72.0	
	Preparation Main Work Plastic	12.0	
	Preparation Comp. Work Metal	8.0	
	Preparation Work Multi Layer Paint	0.0	
	Total Work Units (10WU/HR)	92.0	
	Total Paintwork Labour	9.2HRS	\$423.20
MATERIAL COST - PAINT			Cost Price
	New Part Painting		\$23.22
	New Part Painting - Plastic K1R		\$61.00
	Surface-/Blend Paint		\$26.65
	Repair Painting		\$32.79
	Repair Painting Plastic		\$0.81
	Material-Const Main Work Plastic		\$16.20
	Material-Const Comp. Work Metal		\$12.70
	Total Excluding Pearlescent Uplift		\$173.37
	Pearlescent Uplift @ 0.0%		\$0.00
	Total Paint Material Cost		\$173.37

PARTS

				Price Valid: 01/06/2015	
Guide No.	Qty	Description	Part Number	Supplier	Price (\$)
283	1	FRONT BUMPER	71101SNLQ90ZZ		0% 210.00*
318	1	R/F OUT BUMPER BRKT	71193SNB003		0% 17.00*
562	1	R/F HEADLAMP CPL	33101SNBT51		0% 280.00*
742	1	R/F WING	60211SNB000ZZ		0% 180.00*
842	1	R/WHEELHOUSE SHELL	74101SNAA10		0% 55.00*
1738	1	R/DOOR MIRROR	76200SNAU01ZA		0% 320.00*
f: OEM Parts		Sub Total			\$1,062.00
g: Original		Mark Up From Cost		(5 %)	\$53.10
h: Secondhand		Sundry Parts		(Fixed)	\$100.00
p: Parallel		Total Parts			\$1,215.10
x: Exchange					

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
AUDATEX FEES	0%	\$42.00
SPECIALIST		
Total Extras		\$42.00

Final Calculation

Total Parts		\$1,215.10
Labour		
Total Panel/Mechanical	\$170.20	
Total Paintwork	\$423.20	
Total Labour		\$593.40
Additional Costs		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$42.00	
Total of Additional Costs		\$42.00

51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore
Claim Reference: SNM17D07009C01
Assessment Number: CCA00323
Version: LKKAUTOC/3
Date Calculated: 02/02/2018 04:05

Full Report - V1
Registration: SGG9672G
Printed: 02/02/2018 12:05

Total Paint/Material Costs	\$173.37
Grand Total Excludes GST	\$2,023.87
GST @ 7 %	\$141.67
Grand Total Includes GST	\$2,165.54

Assessment Notes

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	11 Dec 2017 Sendback Est	11 Dec 2017 14:18 S\$2,375.68	11 Dec 2017 15:09 Edit Adj Rpt	S\$1,600.00 Edit Estimates	S\$1,600.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All
------	-----------	---------------	-----------	----------

CLAIM SUBFOLDER DETAILS

Insured:	ONG KAR IMM, ID: S1710597C, Tel: +6596276829, Email: SALLYBINGO@GMAIL.COM		
Vehicle Reg. No.:	SGG9672G	Date of Loss:	07/12/2017 18:00 - :59
Claim Type:	OD / SNM17D07009C01	Policy/Cover Note No.:	DMPCSN3043821606 (Comprehensive)
		Excess:	S\$0.00
Repairer:	Car City Auto Centre Pte Ltd (HQ) Blk 9006 #01-198, Tampines Street 93, 528840 Tampines - Tel: 6781 0300		
Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Chong Boon Sen]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by XING GUO QIANG] ... [Final Rpt due 20/12/2017]		
Driver/Custodian:	ONG KAR IMM (52 / Female), NRIC: S1710597C, Tel: +6596276829		
Adj Asg. Remarks:	SURVEY REVERT		

ASSOCIATED MAIL RECEIVED

[View All](#) [Compose Case Mail](#)

- CHINA_TAIPING (13/12/2017): Alert - Adj Mandate Approved (S\$2237.08) - SGG9672G - Claim Handler: Chong Boon ...

ALL ASSOCIATED TASKS

[View All](#) [Search Tasks](#) [Create New Task](#) [Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents




























SGG9672G (SNM17D07009C01)

OD

Dec 7 2017 6:00PM






















[ONG KAR IMM]

Car City Auto Centre Pte Ltd

Upload Documents		Upload Photos	Compose New Letter	View View in Browser <input type="button" value="v"/>	
Assessment Reports				1 per page <input type="button" value="v"/>	<input checked="" type="checkbox"/>
No	Finalized On	Car City Auto Centre Pte Ltd (HQ)		Thumbnail	Print
1	08/12/17 19:28	Accident Statement		Load HTM	
2	11/12/17 14:18	Repairer Estimates		Load HTM	
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	12/12/17 16:14	Adjuster Immediate Advice		Load HTM	
Photos/Images				3 per page <input type="button" value="v"/>	<input checked="" type="checkbox"/>
No	Finalized On	Car City Auto Centre Pte Ltd (HQ)		Thumbnail	Print
1	08/12/17 19:26	3RD PARTY TAXI [Linked Accident Report Documents]		Load JPG	<input checked="" type="checkbox"/>
2	08/12/17 19:26	3RD PARTY TAXI [Linked Accident Report Documents]		Load JPG	<input checked="" type="checkbox"/>
3	08/12/17 19:26	3RD PARTY TAXI [Linked Accident Report Documents]		Load JPG	<input checked="" type="checkbox"/>
4	08/12/17 19:26	3RD PARTY TAXI [Linked Accident Report Documents]		Load JPG	<input checked="" type="checkbox"/>
5	08/12/17 19:26	3RD PARTY TAXI [Linked Accident Report Documents]		Load JPG	<input checked="" type="checkbox"/>
6	08/12/17 19:26	3RD PARTY TAXI [Linked Accident Report Documents]		Load JPG	<input checked="" type="checkbox"/>
7	08/12/17 19:26	INSURED CAR [Linked Accident Report Documents]		Load JPG	<input checked="" type="checkbox"/>
8	08/12/17 19:26	INSURED CAR CHASSIS NUMBER [Linked Accident Report Documents]		Load JPG	<input checked="" type="checkbox"/>
9	08/12/17 19:26	INSURED CAR [Linked Accident Report Documents]		Load JPG	<input checked="" type="checkbox"/>
10	08/12/17 19:26	INSURED CAR [Linked Accident Report Documents]		Load JPG	<input checked="" type="checkbox"/>
11	08/12/17 19:26	INSURED CAR [Linked Accident Report Documents]		Load JPG	<input checked="" type="checkbox"/>
12	08/12/17 19:26	INSURED CAR [Linked Accident Report Documents]		Load JPG	<input checked="" type="checkbox"/>
13	08/12/17 19:26	INSURED CAR [Linked Accident Report Documents]		Load JPG	<input checked="" type="checkbox"/>
14	08/12/17 19:26	INSURED CAR [Linked Accident Report Documents]		Load JPG	<input checked="" type="checkbox"/>
15	08/12/17 19:26	INSURED CAR [Linked Accident Report Documents]		Load JPG	<input checked="" type="checkbox"/>
16	08/12/17 19:26	INSURED CAR [Linked Accident Report Documents]		Load JPG	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	18/12/17 09:34	General View		Load JPG	<input checked="" type="checkbox"/>
2	18/12/17 09:34	General View		Load JPG	<input checked="" type="checkbox"/>
3	18/12/17 09:34	General View		Load JPG	<input checked="" type="checkbox"/>
4	18/12/17 09:34	General View		Load JPG	<input checked="" type="checkbox"/>
5	18/12/17 09:34	General View		Load JPG	<input checked="" type="checkbox"/>
6	18/12/17 09:34	General View		Load JPG	<input checked="" type="checkbox"/>
7	18/12/17 09:34	General View		Load JPG	<input checked="" type="checkbox"/>
8	18/12/17 09:34	General View		Load JPG	<input checked="" type="checkbox"/>
9	18/12/17 09:34	General View		Load JPG	

			1		<input checked="" type="checkbox"/>
10	18/12/17 09:34	General View	1	Load JPG	<input checked="" type="checkbox"/>
11	18/12/17 09:34	General View	1	Load JPG	<input checked="" type="checkbox"/>
12	18/12/17 09:34	General View	1	Load JPG	<input checked="" type="checkbox"/>
13	18/12/17 09:34	General View	1	Load JPG	<input checked="" type="checkbox"/>
14	18/12/17 09:34	General View	1	Load JPG	<input checked="" type="checkbox"/>
15	18/12/17 09:34	General View	1	Load JPG	<input checked="" type="checkbox"/>
16	18/12/17 09:34	General View	1	Load JPG	<input checked="" type="checkbox"/>
17	18/12/17 09:34	General View	1	Load JPG	<input checked="" type="checkbox"/>
18	18/12/17 09:34	General View	1	Load JPG	<input checked="" type="checkbox"/>
19	18/12/17 09:34	General View	1	Load JPG	<input checked="" type="checkbox"/>
20	18/12/17 09:34	General View	1	Load JPG	<input checked="" type="checkbox"/>
21	18/12/17 09:34	General View	1	Load JPG	<input checked="" type="checkbox"/>
22	18/12/17 09:34	General View	1	Load JPG	<input checked="" type="checkbox"/>
23	18/12/17 09:34	General View	1	Load JPG	<input checked="" type="checkbox"/>
24	18/12/17 09:34	General View	1	Load JPG	<input checked="" type="checkbox"/>
25	18/12/17 09:34	General View	1	Load JPG	<input checked="" type="checkbox"/>
26	18/12/17 09:34	General View	1	Load JPG	<input checked="" type="checkbox"/>
27	18/12/17 09:34	General View	1	Load JPG	<input checked="" type="checkbox"/>
28	18/12/17 09:34	General View	1	Load JPG	<input checked="" type="checkbox"/>
29	18/12/17 09:34	General View	1	Load JPG	<input checked="" type="checkbox"/>
30	18/12/17 09:34	General View	1	Load JPG	<input checked="" type="checkbox"/>
31	18/12/17 09:34	General View	1	Load JPG	<input checked="" type="checkbox"/>
32	18/12/17 09:34	General View	1	Load JPG	<input checked="" type="checkbox"/>
33	18/12/17 09:34	General View	1	Load JPG	<input checked="" type="checkbox"/>
34	18/12/17 09:34	General View	1	Load JPG	<input checked="" type="checkbox"/>
35	18/12/17 09:34	General View	1	Load JPG	<input checked="" type="checkbox"/>
36	18/12/17 09:34	General View	1	Load JPG	<input checked="" type="checkbox"/>
37	18/12/17 09:35	Odometer Reading	1	Load JPG	<input checked="" type="checkbox"/>
38	18/12/17 09:35	Chassis Number	1	Load JPG	<input checked="" type="checkbox"/>
39	18/12/17 09:35	Reinspection Photo	1	Load JPG	<input checked="" type="checkbox"/>
40	18/12/17 09:35	Reinspection Photo	1	Load JPG	<input checked="" type="checkbox"/>
41	18/12/17 09:35	Reinspection Photo	1	Load JPG	<input checked="" type="checkbox"/>
42	18/12/17 09:35	Reinspection Photo	1	Load JPG	<input checked="" type="checkbox"/>
43	18/12/17 09:35	Reinspection Photo	1	Load JPG	<input checked="" type="checkbox"/>
44	18/12/17 09:35	Reinspection Photo	1	Load JPG	<input checked="" type="checkbox"/>
45	18/12/17 09:35	Reinspection Photo	1	Load JPG	<input checked="" type="checkbox"/>
Documentation					1 per page <input type="button" value="v"/> <input checked="" type="checkbox"/>
No	Finalized On	Car City Auto Centre Pte Ltd (HQ)		Thumbnail	Print
1	08/12/17 19:23	Sketch Plan [Linked Accident Report Documents]	1	Load TIF	
2	08/12/17 19:23	Sketch Plan #2 [Linked Accident Report Documents]	1	Load TIF	
3	08/12/17 19:24	OWNER / DRIVER DL [Linked Accident Report Documents]	1	Load TIF	
4	08/12/17 19:24	OWNER / DRIVER IC [Linked Accident Report Documents]	1	Load TIF	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	12/12/17 16:17	WORKSHOP ESTIMATE	1	Load PDF	
2	12/12/17 16:17	REVISED AUDATEX	1	Load PDF	

Linked Accident Report Documents

			View View in Browser	
Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Car City Auto Centre Pte Ltd (HQ)	Thumbnail	Print
1	08/12/17 19:28	Accident Statement	 Load HTM	<input type="checkbox"/>
Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Finalized On	Car City Auto Centre Pte Ltd (HQ)	Thumbnail	Print
1	08/12/17 19:26	3RD PARTY TAXI	 Load JPG	<input checked="" type="checkbox"/>
2	08/12/17 19:26	3RD PARTY TAXI	 Load JPG	<input checked="" type="checkbox"/>
3	08/12/17 19:26	3RD PARTY TAXI	 Load JPG	<input checked="" type="checkbox"/>
4	08/12/17 19:26	3RD PARTY TAXI	 Load JPG	<input checked="" type="checkbox"/>
5	08/12/17 19:26	3RD PARTY TAXI	 Load JPG	<input checked="" type="checkbox"/>
6	08/12/17 19:26	3RD PARTY TAXI	 Load JPG	<input checked="" type="checkbox"/>
7	08/12/17 19:26	INSURED CAR	 Load JPG	<input checked="" type="checkbox"/>
8	08/12/17 19:26	INSURED CAR CHASSIS NUMBER	 Load JPG	<input checked="" type="checkbox"/>
9	08/12/17 19:26	INSURED CAR	 Load JPG	<input checked="" type="checkbox"/>
10	08/12/17 19:26	INSURED CAR	 Load JPG	<input checked="" type="checkbox"/>
11	08/12/17 19:26	INSURED CAR	 Load JPG	<input checked="" type="checkbox"/>
12	08/12/17 19:26	INSURED CAR	 Load JPG	<input checked="" type="checkbox"/>
13	08/12/17 19:26	INSURED CAR	 Load JPG	<input checked="" type="checkbox"/>
14	08/12/17 19:26	INSURED CAR	 Load JPG	<input checked="" type="checkbox"/>
15	08/12/17 19:26	INSURED CAR	 Load JPG	<input checked="" type="checkbox"/>
16	08/12/17 19:26	INSURED CAR	 Load JPG	<input checked="" type="checkbox"/>
Documentation			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Car City Auto Centre Pte Ltd (HQ)	Thumbnail	Print
1	08/12/17 19:23	Sketch Plan	 Load TIF	<input type="checkbox"/>
2	08/12/17 19:23	Sketch Plan #2	 Load TIF	<input type="checkbox"/>
3	08/12/17 19:24	OWNER / DRIVER DL	 Load TIF	<input type="checkbox"/>
4	08/12/17 19:24	OWNER / DRIVER IC	 Load TIF	<input type="checkbox"/>

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
<div style="border: 1px solid black; padding: 5px; margin-bottom: 10px;"> Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ) <div style="border: 1px solid black; height: 40px; margin-top: 5px;"></div> <div style="text-align: right; margin-top: 5px;"> ^ v </div> </div> <p>Show Remarks To: <input type="checkbox"/> Repairer <input type="checkbox"/> Handling Insurer</p> <p><small>Note: Remarks are private unless you show it to other parties.</small></p>			

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

China Taiping Insurance (Singapore) Pte. Ltd.
3 Anson Road, #16-00 Springleaf Tower
Singapore 079909

Our File No: CS/CT117023483/GQBE2

Date: 09/02/2018

REFERENCE

Insured/Claimant: ONG KAR IMM Policy No: DMPCSN3043821606
Date of Loss: 07/12/2017 Nature of Claim: OD Claim No: SNM17D07009C01

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SGG9672G**
Make & Model: HONDA CIVIC, 2.0 L (A) Engine No: K20Z24500910
Reg. Date: 16/12/2009 (Man. Year: 2008) Chassis No: JHMFD26409S200911
Colour: Black Odometer: 154389 km
Engine Capacity: 1998 cc
Market Value/New Car Price: S\$34,000.00
Sum Insured (S\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 205/55 R16 Rear Tyre Size: 205/55 R16
Front Left Side: Dunlop 6 mm Rear Left Side: Dunlop 6 mm
Front Right Side: Dunlop 6 mm Rear Right Side: Dunlop 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	1,296.75	1,115.10	181.65	14.01
Miscellaneous Items	142.00	142.00	0.00	0.00
Labour	936.93	766.77	170.16	18.16
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	2,375.68	2,023.87	351.81	14.81
Approved Total (Overridden) (S\$)		1,600.00		
(S\$)	2,375.68	1,600.00	775.68	32.65
+ GST 7.00/7.00% (S\$)	166.30	112.00	54.30	32.65
Nett Amount (S\$)	2,541.98	1,712.00	829.98	32.65

INSPECTION

Date of Assignment: 11/12/2017 Present Location: Car City Auto Centre Pte Ltd (HQ)
Date Inspected: 12/12/2017 Inspected At: Blk 9006 #01-198, Tampines Street 93
Singapore 528840
Estimated Period of Repair: 5.0 days

Adjuster: XING GUO QIANG

Manager: SHIAU CHAN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 09 Feb 2018)
Parts: 143 HONDA CIVIC 2.0 L (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's (Price-denominated Standard List)
Print Code: (Unsubmitted, no print-code for SGG9672G)
Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1	NA	*FRONT BUMPER (WCP)	Cracked	210.00 F	*210.00 F
2	1	NA	*L/F UPP BUMPER BRKT (WCP)	Not Necessary	23.00 F	*- F
3	1	NA	*R/DOOR MIRROR (WCP)	Broken	320.00 F	*320.00 F
4	1	NA	*R/F DOOR MOULDING (WCP)	Not Necessary	55.00 F	*- F
5	1	NA	*R/F HEADLAMP CPL (WCP)	Scratched	280.00 F	*280.00 F
6	1	NA	*R/F OUT BUMPER BRKT (WCP)	Necessary	17.00 F	*17.00 F
7	1	NA	*R/F UPP BUMPER BRKT (WCP)	Not Necessary	23.00 F	*- F
8	1	NA	*R/F WINDOW MOULDING (WCP)	Not Necessary	55.00 F	*- F
9	1	NA	*R/F WING (WCP)	Buckled	180.00 F	*180.00 F
10	1	NA	*R/F WING BRACKET (WCP)	Not Necessary	17.00 F	*- F
11	1	NA	*R/WHEELHOUSE SHELL (WCP)	Deformed	55.00 F	*55.00 F

F=Franchise part.

Sub Total (S\$)	1,235.00	1,062.00
+ Margin on L,N Items 5.00/5.00% (S\$)	61.75	53.10
Total Parts (S\$)	1,296.75	1,115.10

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

No	Qty	Particulars	Repairer's	Amount
Miscellaneous Items				
1	1	AUDATEX FEES	42.00	42.00
2	1	SUNDRY PARTS (NECESSARY)	100.00	100.00
Sub Total (S\$)			142.00	142.00

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	Total Paint Labour	New	418.60	423.20
2	Total Paint Materials	New	187.13	173.37
3	Total Panel/Mechanical Labour	New	331.20	170.20
Gross Labour Cost (S\$)			936.93	766.77

Report was unsubmitted during this print-out.

< END OF ESTIMATES >