

12/01/2017

ASS. REC. BY:

REF:

CC3/MG17015195

EVB-1

Special Instruction:

Submitted by: Richard

ASSIGNMENT (Office)

From (Person):

monica chung

of

MSIG

Date/Time: 26.12.2017

Estimated Cost:

Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

BBB 1199R

Insured:

SCY9108Y

at Workshop m/s

Revol Carz

Tel:

97406855 Gavin

of 10 BMW #03-18

Policy No:

28808660QMX

Claim No:

500461

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A.

09/07/2017

CA / REV / REP. / REV 24 HRS 'wp'

H.O.D. Endorsement:

Date/Time:

7/8

Person Contacted:

Gavin

Vehicle IN/OUT

Date/Time	Action/Instruction (X) Estimate	Do Not finalize
	PRS	
	BBB 1199R - X	
	SCY9108Y - CVI VAL17014655	UV MV as at July 2017 \$99K - \$100K (Est)
	Dismantle Part: 10.08.2017	
	After repair: 28.08.2017	
18/01/18 7:16pm	Email to monica chung thru mesmen	

15/1/18 Submit LS \$ 9600 (Red 6000, 389), 5 days

RECEIVED 15 JAN 2018

RICHARD

REF:

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD/TP/WS/TP RES/OD RES/EVA/INV/MV

To Inspect Vehicle No: _____

at Workshop m/s _____

of _____

Insured _____

Policy No _____

Claims No _____

Sum Insured: _____ Excess _____

(Client's Record)

Make of Veh _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value _____

DAC Accident Report _____ Consistent? : Yes or No

GIA / PR Seen _____ Consistent? : Yes or No

Est. Repairs _____ days Res: Yes or No

Lum Burn _____ % 3 Val: Yes or No

CA / REV / REP. / 24 HRS

Date _____ Person Contacted: _____

Vehicle: IN / OUT

N/S	O/S

Veh No: **SBQ 1199R** Yr Regn: **30/04/2008**

Type: ☒ M.Co / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or _____

Make: **BMW 325i conv.** CC **2497**

Colour: **Silver** A/C Insured / Std / NI / NA

Sp Reading: **105545** T.Radio Insured / Std / NI / NA

Eng No _____

C No: **WBAWL12050PD75841**

Gen. Cond: ☒ Good / Fair / Poor / Burnt

Steering: ☒ in order / Jammed / Leaked / Burnt or

Brake: ☒ in order / Jammed / Leaked / Burnt or

Modi: Nil / ☒ S/Rim / STD A/Rim or

Tyre Size: F: **225/45 R17** CONTI
R: **255/40 R17** BS

☒ BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or _____

Front _____ Rear _____

R/Bal: **5** mm R/Bal: **6** mm

L/Bal: **5** mm L/Bal: **6** mm

D.O.A: **09/07 22:35** D.O.I: **7/8 1:05pm**

Survey held at: **REVOL**

Des. of Damages: ☒ Fr / Rear / ☒ O/S N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision

Date: Time _____ Action / Instruction _____

\$710 - \$9K

4/10/2017

Date/Time: File Pass to? ☐ : Preli. Report

04/10/2017 ☐ : Final Report

Date/Time: File Return to? _____

Report Format: **PRS**

Lump Sum / I.B.I: (\$)

Days Of Repair: _____

Resurvey No. of Trip: _____

Add Fee: ☐ Site Insp (\$)

☐ Interview (\$)

☐ Tech Invs (\$)

☐ Weekend (\$)

Survey Fee _____

Transportation _____

_____ + RS _____



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MSIG INSURANCE (SINGAPORE) PTE LTD

Ref : CS3/MSG17015198/vb-1

16 RAFFLES QUAY
#24-01 HONG LEONG BLDG SINGAPORE 048581

Date : 28-12-2017



Code : MSG

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	SCY 9108Y	Veh. Inspected	SBQ 1199R
Policy No.	28808660QMX	Coverage (\$)	0.00
Claim No.	522461	Excess (\$)	0.00
Assign From	MERIMEN (MONICA CHUNG)	Assign Date	26/12/2017

2. Vehicle Particulars & Condition

Make & Model	c.c	0
Engine No.	HIDDEN	Year of Reg.
Chassis No.		Colour
Odometer	-	Steering
Brakes		Modification
General		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

4. Description of Damages

--

5. General Information

Accident Date	09/07/2017	Inspection Date	28/12/2017
Survey held at	REVOL CARZ GARAGE PTE LTD BLOCK 10, ANG MO KIO IND PARK 2A #02-18, AMK AUTOPOINT SINGAPORE 568047		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

...CLAIM SUBFOLDER...(Pending for Survey Report)

Paper Survey

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	11 Jul 2017		07 Aug 2017 16:26 Edit Adj Rpt	S\$0.00 Edit Estimates	S\$0.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All
CLAIM SUBFOLDER DETAILS [Created by insurer]				
Insured:	CHEW WEE KAI, ID: S0104207F			
Main Claimant:	IQBAL MARICAN, ID: S0031412I			
Vehicle Reg. No.:	SBQ1199R	Date of Loss:	09/07/2017 22:00 - :59	
Claim Type:	TP / 522461	Policy/Cover Note No.:	28808660QMX (Comprehensive) Coverage: 15/09/2016 - 14/09/2017	
Vehicle Reg. No. (Insured):	SCY9108Y	Policy No. (Claimant):		
		Excess:	S\$500.00	
Repairer:	Revol Carz Garage Pte Ltd (HQ) Block 10, Ang Mo Kio Ind Park 2A, #02-18, AMK Auto Point, 568047 Ang Mo Kio - Tel:			
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Monica Chung Pei Zhen - 6594 2552]			
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by Richard Harjanto] ... [Final Rpt due 28/12/2017]			
Driver/Custodian (Insured):	WONG NGIAP HUA (/ Female), NRIC: S0054880D			
ASSOCIATED MAIL RECEIVED View All Compose Case Mail				
• MSIG_SG (26/12/2017): Report Send Back Alerts - SBQ1199R (TP)				
<div> <div> <div>ALL ASSOCIATED TASKS</div> <div> <div>Due Date</div> <div>Priority</div> <div>Type</div> <div>Task Group</div> <div>Subject</div> <div>Handler</div> <div>Assigned By</div> <div>Completed On</div> <div>Created On</div> <div>Done?</div> </div> </div> <div> <div>View All</div> <div>Search Tasks</div> <div>Create New Task</div> <div>Complete</div> </div> </div>				
No results.				



Advocates & Solicitors | Commissioner for Oaths | Notary Public

Our Ref: EM.lk.5758.2017.Revol
Your Ref: SCY9108Y

13 DEC 2017

TO: **WONG NGIAP HUA**
36 Greenridge Crescent
Singapore 598924

cc: **CHEW WEE KAI**
36 Greenridge Crescent
Singapore 598924

cc: **MSIG Insurance (Singapore) Pte Ltd**
(Motor Claims Dept)
16 Raffles Quay
#24-01 Hong Leong Building
Singapore 048581

BY CERTIFICATE OF
POSTING

WITHOUT PREJUDICE

BY CERTIFICATE OF
POSTING

BY PDX

WITHOUT PREJUDICE



MAIN OFFICE
133 NEW BRIDGE ROAD
#23-03/04/05
CHINATOWN POINT
SINGAPORE 059413
TEL: 6438 1323
FAX: 6438 2313

BRANCH OFFICE
1 JALAN BERSEH
#03-12 NEW WORLD CENTRE
SINGAPORE 209037

PLEASE SEND ALL
CORRESPONDENCES TO
THE MAIN OFFICE

WE DO NOT ACCEPT
SERVICE BY FAX

Dear Sirs

IQBAL MARICAN
376 Laurel Wood Avenue
Singapore 275971

We are instructed by the abovenamed to claim damages against you in connection with an accident on 09 July 2017 at about 22:35 hours along South Buona Vista Road before Slip Road to Tuas involving our client's vehicle no. SBQ1199R and vehicle registration number SCY9108Y driven by you at the material time.

We are instructed that the accident was caused by the negligence of you in the driving, management and control of vehicle registration number SCY9108Y.

As a result of the accident, our client's vehicle registration number SBQ1199R was damaged and our client has been put to loss and expense, particulars of which are as follows:-

A	Damages		
a.	Cost of Repairs	\$	15,600.00
b.	Loss of Use (10 days x \$120.00 per day) (inclusive of Sunday and 2 days Pre-Repair Inspection Notice)	\$	1,200.00
B	Disbursements		
a.	LTA Search	\$	5.35
b.	GIA Report	\$	29.00
c.	Survey Report	\$	1,100.00
C	LEGAL COSTS (AT THIS STAGE)	\$	963.00
		\$	18,897.35

CONFIDENTIALITY CAUTION

THIS DOCUMENT IS FOR THE ADDRESSEE(S) ONLY AND MAY CONTAIN CONFIDENTIAL INFORMATION AND/OR MAY BE SUBJECT TO LEGAL PRIVILEGE. IF YOU HAVE RECEIVED THIS IN ERROR, PLEASE CONTACT US IMMEDIATELY.

CrossBorders LLC

A LIMITED LIABILITY CORPORATION. REGISTRATION NUMBER 201305284K
GST REGISTRATION NUMBER 201305284K

can't find file

EG, upload to (M)

- pass LOV
back to me

me
18/12/17

We enclose herewith copies of the following documents in support of our client's claim:-

- a) GIA Report lodged by the driver of our client's vehicle no. SBQ1199R with sketch plan;
- b) GIA Report and Traffic Accident Report lodged by you (SCY9108Y) with sketch plan together with photographs of your motor vehicle no. SCY9108Y;
- c) Result of LTA search on your vehicle registration no. SCY9108Y;
- d) Repair Bill from Revol Carz Garage Pte Ltd;
- e) Vehicle Assessment Report & Invoice from PAL's Appraiser Pte Ltd;
- f) Two Hundred (200) copies of colour photographs depicting the damages to our client's motor Vehicle no. SBQ1199R.

Please note that if you are insured and you wish to claim under your insurance policy, you should immediately pass this letter and all the enclosed documents to your insurer.

Please note that you or your insurer should send to us an acknowledgement of receipt of this letter **within 14 days** of your receipt of this letter, failing which our clients will have no alternative but to commence proceedings against you without further notice to you or your insurer.

Please also note that if you have a counterclaim against our client arising out of the accident, you are required to send to us a letter giving full particulars of the counterclaim together with all relevant supporting documents **within 8 weeks** of your receipt of this letter.

Yours faithfully


Amerjeet Singh
Email: corene@crossbordersllc.com (secretary)

encs

cc: SBQ1199R

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	10/07/2017 17:51
Date Of Accident	09/07/2017 22:35
Exact Location Of Accident	SOUTH BUONA VISTA RD BEFORE SLIP RD TO TUAS
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SBQ1199R
Insured/Policyholder	
Name Of Registered Owner	IQBAL MARICAN
NRIC No	S0031412I
Email Address	IQBALMARICAN@HOTMAIL.COM
Mobile Phone No	(LOCAL) +65-96701219
Alternative Phone No	OFFICE-96701219
Vehicle Particulars	
Manufacturer	BMW
Model	325
Exact Purpose for which vehicle was being used at time of accident	NORMAL USAGE
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE CAR
Insurance Company	
Name of Insurance Company	MSIG INSURANCE (SINGAPORE) PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	B80084853 SMP
Cover Note Number	
Driver	
Name of Driver	YEO JIN-NI
NRIC No	S9446320C
Date Of Birth	22/11/1994
Occupation	INDOOR
Date Of Driving Pass	11/02/2017
Driving Experience	0 YEAR AND 4 MONTH
Gender	FEMALE
Mobile Number	
Fax Number	
Contact Number	
Email Address	JINNI.YEO2@GAMIL.COM

Address	376 LAUREL WOOD AVE
Postcode	275971
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - FAMILY FRIEND/GOD FATHER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	SIDE SWIPE
Weather Conditions	CLEAR
Road Surface	DRY
Other Information	

Was any foreign vehicle involved in this accident?	NO
Was any body injured in the Accident?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	YES
If Yes, Please state which Police Station	
Police Station Name	BUKIT TIMAH NEIGHBOURHOOD POLICE CENTRE
Police Station Address	ROAD: 1 DUKE ROAD , POSTCODE: 268914 , COUNTRY: SINGAPORE
Police Station Contact	TEL NO: 1800-4629999 - FAX NO: 64628933
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

REFER TO ATTACH.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SCY9108Y
Vehicle Make/Model/Colour	MERCEDES BENZ 200/BLUE
Details Of Properties	
Name of Driver	WONG NGIAP HUA
NRIC/Passport Number	S0054880D
Contact Number	96713018
Address	
Postcode	
Insurance Company Name	MSIG INSURANCE (SINGAPORE) PTE. LTD.
Nature Of Damage	FRONT LEFT
No. Of Passenger (Including Driver)	
Details of Witness	
Name	
Phone Number	
Email Address	

SKETCH PLAN

IMPORTANT NOTICE


1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)
I understand, acknowledge, agree and consent that:
(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
(ii) investigating the accident and/or my claims;
(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
(iv) administering my claims (including the making of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of an envelope/postal packages); and/or
(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
(collectively the "Purposes")
(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

[Signature]
10/7/17 2:40pm
Policyholder's Signature / Date & Time

[Signature] 10/7/17 12:26 PM.
Driver's Signature (if driver is not the policyholder) / Date & Time

[Signature]
Witnessed by Reporting Centre Personnel

Sketch Plan

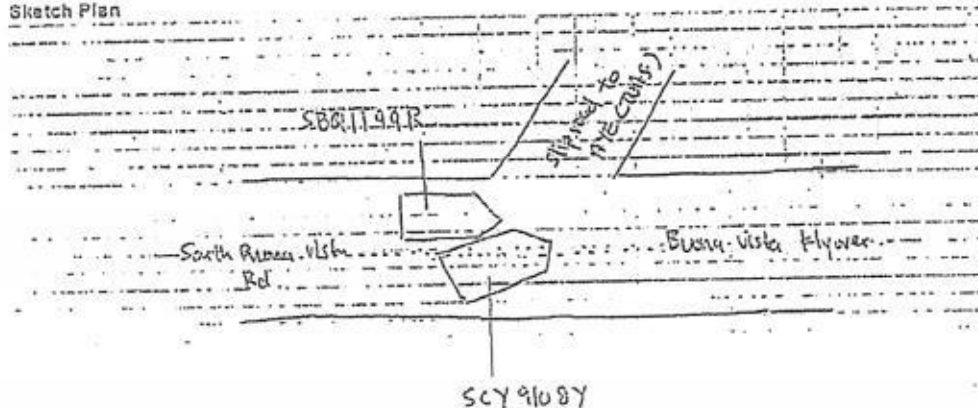

Describe Circumstances of the Accident

On 09/07/2017 at about 1035 PM, I was driving along South Buona Vista Rd towards Buona Vista Flyover on the left lane of a 4 lane road. The weather was clear, roads completely dry, and traffic volume was light. I was driving at approximately 50 km/h.

Whilst I was driving past the slip road, the driver of car (5C9108Y) who was driving on the 3rd lane slowly closed up me abruptly changed lanes without even signaling to enter the slip road to BYE (TURNS). I tried to jam brake but could not do so in time. The left side of the other party's car hit into the front right side of my car. ~~The other party's car hit into the front right side of my car. The other party's car hit into the front right side of my car. The other party's car hit into the front right side of my car.~~

Due to the heavy impact, my car was also dragged onto the slip road. The other party's car ~~was~~ mounted a curb and struck a lamp post near to the right side of the slip road.


The driver went out of the car and immediately apologized to me. She informed that she had not seen my car. She also informed me that she had been visiting a relative at the St. Ann's Intensive Care Unit and was therefore not in the right state of mind.

I do not have any in-vehicle camera installed inside my car. ~~Neither myself nor the other party were suffered any physical injuries. There were also no additional passengers since both myself and the other party were driving alone.~~

Declaration

We declare the foregoing particulars are true in every respect.


10/7/17 2:00pm
Policyholder's Signature / Date & Time


10/7/17 1:58 PM
Driver's Signature (if driver is not the policyholder) / Date & Time


Witnessed by Reporting Centre Personnel

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	1412I
Vehicle Details	
Vehicle No.:	SBQ1199R
Vehicle to be Exported:	No
Intended De-registration Date:	15 Jan 2018
Vehicle Make:	B.M.W.
Vehicle Model:	325I CONVERTIBLE
Primary Colour:	Grey
Manufacturing Year:	2008
Engine No.:	76034229N52B25AF
Chassis No.:	WBAWL12060PD75841
Maximum Power Output:	160.0 kW (214 bhp)
Open Market Value:	\$71,420.00
Original Registration Date:	30 Apr 2008
First Registration Date:	30 Apr 2008
Transfer Count:	0
Actual ARF Paid:	\$71,420.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	29 Apr 2018
PARF Rebate Amount:	\$35,710.00
Intended COE Rebate Details	
COE Expiry Date:	31 Aug 2027
COE Category:	E - Open Category

COE Period(Years):	10
PQP Paid:	\$50,972.00
COE Rebate Amount:	\$49,067.00
Total Rebate Amount:	\$84,777.00

The information contained herein is correct as at 15 Jan 2018

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report 11/07/2017 15:54
Date Of Accident 09/07/2017 22:30
Exact Location Of Accident ALONG RD 1 SOUTH BUONA VISTA RD SLIP RD INTO AYE
Country/State of Loss SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number SCY9108Y
Insured/Policyholder
Name Of Registered Owner CHEW WEE KAI
Email Address NOEMAIL
Mobile Phone No (LOCAL) +65-96713018
Alternative Phone No OFFICE-96713018

Vehicle Particulars

Manufacturer MERCEDES-BENZ
Model E250
Vehicle Category PRIVATE CAR

Insurance Company

Name of Insurance Company MSIG INSURANCE (SINGAPORE) PTE. LTD.
Type Of Coverage COMPREHENSIVE
Fleet Policy NO
Policy Number 28808660 QMX

Cover Note Number

Driver

Name of Driver WONG NGIAP HUA
NRIC No S0054880D
Address

General Information of the Accident

Type Of Accident COLLISION - HEAD TO REAR
Weather Conditions CLEAR

Other Information

Was any foreign vehicle involved in this accident? NO
Was any body injured in the Accident? NO
Was any other material or property damaged? YES
Number of Passengers (Including Driver) 1

Circumstances of Accident

REFER ATTACHED POLICE REPORT.

Attachment(s)

Are accident photos available for attachment? YES
Was there any video captured by Car Camera? NO

Was there any audio recorded?

NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number

SBQ1199R

Vehicle Make/Model/Colour

Name of Driver

Insurance Company Name

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

(a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:

(i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;

(ii) investigating the accident and/or my claims;

(iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;


(iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or

(v) complying with applicable law in administering, processing, handling and/or dealing with my claims.


(collectively the "Purposes")

(b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and


(c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

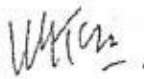

Policyholder's Signature / Date &
Time



Driver's Signature (If driver is not the policyholder) / Date
& Time




Witnessed by Reporting Centre
Personnel

Sketch Plan

Refer to the attached sketch plan



A → SCY 9108 Y
B → SBQ 1199 R

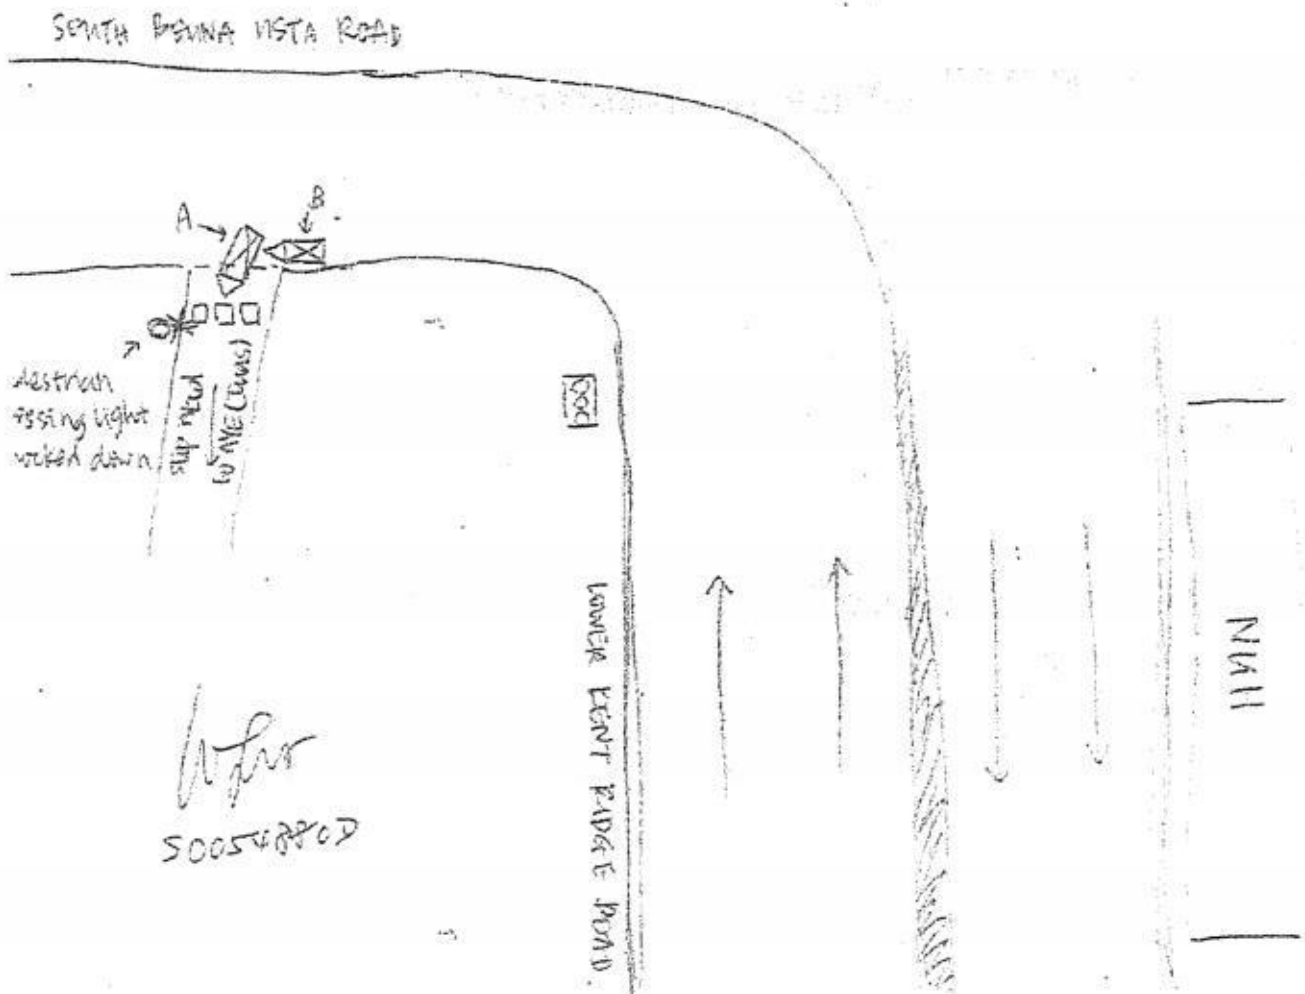

Describe Circumstances of the Accident

Refer to the attached Police Report

Declaration

We declare the foregoing particulars are true in every respect.

Policyholder's Signature / Date & Time
11/7/2017 2pm

Driver's Signature (If driver is not the policyholder) / Date & Time 11/7/2017 2pm

Witnessed by Reporting Centre
Personnel



**SINGAPORE
POLICE FORCE**



T/20170710/2115

1 of 4

Police Station Of Origin:
Thomson NPP
25 Sin Ming Road #01-180 SINGAPORE
570025
Tel No: 1800-4529999

Report No. T/20170710/2115

REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 10/07/2017 16:23		Vide Report No.:		Station Diary No.: 44	
Informant's Particulars					
Name of Informant: WONG NGIAP HUA			Address: 36 GREENRIDGE CRESCENT SINGAPORE 598924		
ID Type / ID No.: NRIC NO / S0054880D			Contact No.: Home/Office:		Mobile: 96713018
Nationality: SINGAPORE CITIZEN			Email:		
Sex: Female	Age: 65	Date of Birth: 03/09/1951	Type of Informant: Driver		
Race: Chinese			Language: English		Institution / School Name:
Occupation: Company director			Driving Licence Information: Class: 3		Date of Expiry:

General Information of the Accident

Type of Accident:	Non-Injury Government Property	Drink Drive: No	Date/Time of Accident: 09/07/2017 22:30	Type of Location: Y-Junction
Location: Along Road 1 SOUTH BUONA VISTA ROAD South Buona Vista Road Slip Road into AYE (Tuas) Lamp Post Number: 6				
Weather: Clear		Road Surface: Dry	Road Speed Limit:	
Traffic Flow: One Way		Traffic Control: Pedestrian Crossing	Traffic Volume: No Traffic	
Type of Collision: Moving Vehicle Against - Lamp Post			Anyone conveyed by ambulance: No	

Details of Vehicle Involved


Vehicle No.	Type	Make	Model	Color	Condition	No of Passenger
SBQ1199R	Car					0
SCY9108Y	Car				Seriously Damaged	0

Details of Person Involved

Any Pedestrian Involved: No	
No. of Pedestrians Injured: NIL	Use of Pedestrian Crossing: NA



**SINGAPORE
POLICE FORCE**



T/20170710/2115

2 of 4

Police Station Of Origin:

Thomson NPP

25 Sin Ming Road #01-180 SINGAPORE

570025

Tel No: 1800-4529999

Report No. T/20170710/2115

CONTINUATION OF REPORT

Driver		ID No.		S9446320C	
Name	YEO JIN-NI		Contact No.	92336249	
Related Vehicle	SBQ1199R (Car)		Class of Driving Licence & Expiry Date	Class: NIL Date of Expiry: NIL	
Hospital/Clinic	NIL		Date Treatment	NIL	
			Date Discharge	NIL	
			Degree of Injury	NIL	
No. of Days granted Medical Leave	NIL				
Driver		ID No.		S0054880D	
Name	WONG NGIAP HUA		Contact No.	96713018	
Related Vehicle	SCY9108Y (Car)		Class of Driving Licence & Expiry Date	Class: 3 Date of Expiry: NIL	
Hospital/Clinic	NIL		Date Treatment	NIL	
			Date Discharge	NIL	
			Degree of Injury	NIL	
No. of Days granted Medical Leave	NIL				

Brief Details.

On 9 July 2017, at about 10.28pm, I was driving along South Buona Vista Road in my vehicle (SCY9108Y) on the most right lane of a 2-lane road. As I know I am intending to turn to AYE(Tuas) on the left lane, I checked my mirrors and blind spot which was clear and filtered into the most left lane on South Buona Vista Road and turned into the slip road into AYE(Tuas).

As I was turning into AYE(Tuas), I felt an impact on the left side of the vehicle. The impact cause my vehicle to swerved to the right which resulted in my vehicle collided into the pedestrian crossing lamp at the slip road to AYE (Tuas). I immediately applied my brakes and managed to stop my vehicle. I then alighted my vehicle and observed that another vehicle (SBQ1199R) right front bumper had collided onto my left side of the vehicle. The accident resulted in the pedestrian crossing lamp to be uprooted and my vehicle left side to suffer with dents and scratches as well as my right front portion to be damaged.

Thereafter, I exchange particulars with the other party and my vehicle was then towed to my workshop. Subsequently, there was a police vehicle which came across and render assistance and advised for both parties to lodge a Traffic Accident Report as it involves a government property. I wish to state I do not have any in vehicle camera.

I am lodging this police report as informed by the police officer that I am required to do so as the accident involved with government property and for insurance claim purposes.

DEF



**SINGAPORE
POLICE FORCE**



T/20170710/2115

3 of 4

Report No. T/20170710/2115

Police Station Of Origin:
Thomson NPP
25 Sin Ming Road #01-180 SINGAPORE
570025
Tel No: 1800-4529999

CONTINUATION OF REPORT



**SINGAPORE
POLICE FORCE**

Police Station Of Origin:
Thomson NPP
25 Sin Ming Road #01-180 SINGAPORE
570025
Tel No: 1800-4529999



T/20170710/2115

4 of 4

Report No. T/20170710/2115

CONTINUATION OF REPORT

Sketch Plan

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference.

Signature Of Officer Recording The Report:

E /

Cpl CHENG XINLIANG

Signature Of Interpreter:

Not applicable

Officer In Charge Of Case:

TP / AEIT /

Sr Staff Sgt ANG YI TING, STEPHANIE

Contact No.: 65476414

Authentication Stamp

NP168

Signature Of Informant:

Date/Time:

10/07/2017 16:23

Classification Of Case:



Singapore Police Force

Enquire Vehicle & Owner Information (Vehicle No. SCY9108Y As At 09 Jul 2017 / 22:35:00)**Law Firm Search Details**

Search Reason: Insurance claim in relation to traffic accident

Law Firm Case No.: EM.REVOL

Current Owner Details

Owner ID Type: Singapore NRIC

Owner ID: S0104207F

Owner Name: CHEW WEE KAI

Registered Address Type: Private Residential (non-Condo Apt / non-House)

Registered Block/House No.: 36

Registered Street Name: GREENRIDGE CRESCENT

Registered Unit No.: -

Registered Building Name: -

Registered Postal Code: 598924

Current Vehicle Details

Vehicle No.: SCY9108Y

Make Description/Model: MERCEDES BENZ / E 250

Insurance Company Name: MSIG INSURANCE (SINGAPORE) PTE LTD

Land Transport  Authority

Please read through the Privacy Statement, Terms of Use and Disclaimer.

Please do not use the Back or Forward buttons on your browser as this may alter the results of the transactions.

Best viewed with IE 6.0 SP3 and above, 1024 X 768 resolution

Copyright © 2017 LTA | [Privacy Statement](#) | [Terms of Use](#) | [Disclaimer](#) | [Rate the Website](#)

Last updated on 30 Jul 2017 at 12:58 AM

Revol Carz Garage Pte Ltd

Blk 10 Ang Mo Kio Industrial Park 2a, Ang Mo Kio Autopoint #02-18
Singapore 568047
Tel: 65551171 Fax: 62679317

Name : Iqbal Marican

Date : 16-Oct-17

Address : c/o Blk 10 Ang Mo Kio Industrial Park 2A
#02-18 Ang Mo Kio Autopoint
Singapore 568047

Final repair bill for BMW 325i SBQ 1199 R

To supply and replace parts, labour charges for
repairing, knocking, welding and to respray painting
(Lump Sum Repair)

\$ 15,600.00

Dollars : Fifteen Thousand Six Hundred Only

PAL'S

APPRAISER PTE LTD

No. 1 Kaki Bukit Avenue 6 #01-53 AutoDay @ Kaki Bukit Singapore 417583 Tel: 8181 8802 Fax: 6747 1017
Registration No : 2010002681D

Invoice No 08-17011/AY

Billing Name & Address

Iqbal Marican
c/o Blk 10 Ang Mo Kio Industrial Park 2A
#02-18 Ang Mo Kio Autopoint
Singapore 568047

Date 16 Oct 2017

Vehicle No : SBQ 1199 R

Model : BMW 325i

Item	Descriptions	Amount S\$
1	Date of inspection : <u>4 Aug 2017</u> A copy of the inspection / survey report Correspondence, postages and etc.	
2	Photography Services - Purchase of films, develop negatives - Storage of negatives - Submission of photographs <u>200</u> copies	
3	Transportation Charges	
4	2nd Inspection & Final Inspection	
	Total	<u>\$ 1100.00</u>
	SDLS : ONE THOUSAND ONE HUNDRED ONLY	

Notes :

1. All cheque payment should be "Crossed" and made payable to "Pal's Appraiser Pte. Ltd."
2. All cheque should have our "Invoice No." written on the reverse side of the cheque
3. For further enquiries on this invoice, please feel free to contact us



Official Stamp

E & O. E

PAL'S

APPRAISER PTE LTD

No. 1 Kaki Bukit Avenue 6 #01-53 AutoBay @ Kaki Bukit Singapore 417883 Tel: 8181 8802 Fax: 6747 1017
Registration No: 201000268D

Report Reference : TP / 08-17011/AY / 2017
Date of Report : 16 Oct 2017

Iqbal Marican
c/o Blk 10 Ang Mo Kio Industrial Park 2A
#02-18 Ang Mo Kio Autopoint
Singapore 568047

THIRD PARTY SURVEY ACCIDENT HAPPENED ON 9 Jul 2017

As per your instruction dated 4 Aug 2017 with regard to the above matter. We have carried out a physical inspection on the said vehicle SBQ 1199 R. We enclosed herewith our report and findings as follows:

1. VEHICLE PARTICULARS

Registration No : SBQ 1199 R
Model : BMW 325i
Year / Capacity : 2008/2497
Chassis No : WBAWL12060PD75841
Engine No : 76034229N52B25AF
Mileage : 105545
Colour : Grey

2. TYRES CONDITION

		<u>Size</u>	<u>Made</u>	<u>Balance</u>		<u>Rim</u>
FRONT	O/S	: 225/45 R17	Continental	5.00	mm	Sport
REAR	O/S	: 255/40 R17	Bridgestone	7.00	mm	Sport
FRONT	N/S	: 225/45 R17	Continental	5.00	mm	Sport
REAR	N/S	: 255/40 R17	Bridgestone	7.00	mm	Sport

PAL'S

APPRAISER PTE LTD

No. 1 Kaki Bukit Avenue 6 #01-53 Autotray @ Kaki Bukit Singapore 417883 Tel: 8181 8502 Fax: 6747 1017
Registration No.: 20100026819

3. DESCRIPTION OF DAMAGES

At the time of inspection, we noted that the vehicle has sustained an impact damages on the front o/s portion(s). For more detail of the damages, please see photograph attached.

4. Workshop Address : Revol Carz Garage Pte Ltd
Blk 10 Ang Mo Kio Industrial Park 2A
#02-18 Ang Mo Kio Autopoint
Singapore 568047
5. Estimated normal period of repair : 7 working days to complete.
6. Enclosed number of photograph : 200 copies.
7. In accordance to your instruction, we have Not Authorised repair to the vehicle and the survey was done on a "Without Prejudice" basis. We hope that this report will be of assistance to you in dealing with the matter.
8. Should you discover any discrepancy in the report, please kindly notify us within 2 weeks, or the report will be treated as correct.

Disclaimer

The rates and assessment of damages as stated in this report is to be used solely for legal proceedings in relation to the surveyed vehicle and the accident in which the surveyed vehicle was involved in. The rates and assessment of damages must not be used in any circumstances for comparison with other vehicles and/or other accidents in other legal proceedings.

Vehicle No: SBQ 1199 R
Report No: TP/ 08-17011/AY / 2017

SPARE PARTS

Qty	Parts Description	Condition	Workshop's Estimation	Our Revised Estimation
<u>List Items</u>				
1	Bonnet	Damage	\$ 1290.00	\$ 1290.00
1	Bonnet lock	Intact	\$ 45.00	\$
1	Bonnet rubber	Necessary	\$ 35.30	\$ 35.30
2	Front headlamps 05-CRA, 115-111	Damage	\$ 3996.00	\$ 3996.00 1998
1	Front o/s spray nozzle pen	Damage	\$ 175.00	\$ 175.00
1	Front bumper	Damage	\$ 1235.00	\$ 1235.00
1	Front bumper fog lamp	Damage	\$ 286.00	\$ 286.00
1	Front bumper fog lamp cover	Damage	\$ 47.55	\$ 47.55
1	Front bumper reinforcement	Damage	\$ 536.85	\$ 536.85 XNN
1	Front bumper side retainer	Damage	\$ 68.00	\$ 68.00
1	Front o/s fender	Damage	\$ 785.00	\$ 785.00
1	Front o/s fender inner shield	Damage	\$ 95.00	\$ 95.00
1	Front o/s fender inner shield clip (1 set)	Necessary	\$ 37.50	\$ 37.50
1	Front support panel	Damage	\$ 645.00	\$ 645.00 XR
2	Front under support bars	Damage	\$ 450.00	\$ 450.00 XR
1	Front o/s wheel hub c/w bearing	Damage	\$ 465.75	\$ 465.75
2	Front shock absorbers	Damage	\$ 917.10	\$ 917.10
2	Front shock absorber mountings	Necessary	\$ 389.20	\$ 389.20
1	Front o/s knuckle arm	Damage	\$ 394.10	\$ 394.10
1	Front o/s lower arm	Damage	\$ 225.20	\$ 225.20
1	Front o/s stay arm	Damage	\$ 230.85	\$ 230.85
1	Front steering rack	Damage	\$ 2497.55	\$ 2497.55 YNN
1	Front stabilizer bar	Damage	\$ 351.60	\$ 351.60 XNN
1	Front n/s stabilizer bar link	Damage	\$ 90.25	\$ 90.25
1	Front o/s brake disc	Damage	\$ 245.20	\$ 245.20 XNN
1	Front o/s brake disc cover	Damage	\$ 78.00	\$ 78.00 XNN
1	O/s side skirt	Damage	\$ 297.75	\$ 297.75
1	Front engine undercover	Damage	\$ 325.00	\$ 325.00
			\$ 16234.75	\$ 16189.75
Discount 5.0%			\$ 811.74	\$ 809.49
			\$ 15423.01	\$ 15380.26
<u>Special Nett Items</u>				
1	Front o/s tyre (Depreciation)	Damage	\$ 400.00	\$ 200.00
1	Front o/s sport rim	Damage	\$ 700.00	\$ 700.00
1	Paint protection (Ze Tough Foundation)	Necessary	\$ 788.00	\$ 788.00 500
			\$ 1888.00	\$ 1688.00

Spare Parts Total \$ 17311.01 \$ 17068.26

Vehicle No: SBQ 1199 R
Report No: TP/ 08-17011/AY / 2017

LABOUR COST

S/No	Job Descriptions	Workshop's Estimation	Our Revised Estimation
	Spare Parts Total c/f	\$ 17311.01	\$ 17068.26
1	To remove and refit damage parts, test for proper functioning and focus of headlamps.	\$ 50.00	\$ 40.00 30
2	To remove and refit front undercarriage.	\$ 400.00	\$ 200.00 100
3	To check and re-adjust (Computerized) all wheel alignment.	\$ 200.00	\$ 120.00 80
4	To remove and replace the above damaged parts, straighten, knock out, realign and repair including cut and weld body panels. To re-adjust to the original position using power tools.	\$ 1500.00	\$ 1000.00 600
5	To spray paint on the replaced and repaired parts, prepare spray such as masking tape the unaffected areas with paper, cleaning and sanding of surfaces, final polishing and waxing are also available.	\$ 1500.00	\$ 1000.00 800
6	To apply undercoating on the repaired and replaced panels for rust protection.	\$ 150.00	\$ 30.00
Total		\$ 21111.01	\$ 19458.26

The repairer has agreed to undertake the repair under a Lump Sum Basis. We have further adjusted the amount to a Lump Sum Repair Contract of:

\$ 15600.00

5 days

SDLS: FIFTEEN THOUSAND SIX HUNDRED ONLY


Qualified Appraiser

...CLAIM SUBFOLDER...(Pending for Survey Report)

Paper Survey

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	11 Jul 2017		07 Aug 2017 16:26 Edit Adj Rpt	\$9,600.00 Edit Estimates	\$9,600.00 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All
------	-----------	---------------	-----------	--------------------------

CLAIM SUBFOLDER DETAILS [Created by insurer]

Insured:	CHEW WEE KAI, ID: S0104207F		
Main Claimant:	IQBAL MARICAN, ID: S0031412I		
Vehicle Reg. No.:	SBQ1199R	Date of Loss:	09/07/2017 22:00 - :59
Claim Type:	TP / 522461	Policy/Cover Note No.:	28808660QMX (Comprehensive) Coverage: 15/09/2016 - 14/09/2017
Vehicle Reg. No. (Insured):	SCY9108Y	Policy No. (Claimant):	
		Excess:	S\$500.00
Repairer:	Revol Carz Garage Pte Ltd (HQ) Block 10, Ang Mo Kio Ind Park 2A, #02-18, AMK Auto Point, 568047 Ang Mo Kio - Tel:		
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Monica Chung Pei Zhen - 6594 2552]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by Richard Harjanto] ... [Final Rpt due 28/12/2017]		
Driver/Custodian (Insured):	WONG NGIAP HUA (/ Female), NRIC: S0054880D		

[View All](#) [Compose Case Mail](#)

ASSOCIATED MAIL RECEIVED

- MSIG_SG (26/12/2017): Report Send Back Alerts - SBQ1199R (TP)

ALL ASSOCIATED TASKS
[View All](#) [Search Tasks](#) [Create New Task](#) [Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

*SBQ1199R (522461)
[SCY9108Y]
TP
IQBAL MARICAN
Jul 9 2017 10:00PM
[CHEW WEE KAI]
Revol Carz Garage Pte Ltd

Upload Documents		Upload Photos		Compose New Letter		View		View in Browser	
Assessment Reports						1 per page		<input checked="" type="checkbox"/>	
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)				Thumbnail		Print	
1	07/08/17 14:35	Accident Statement From:OD - Reg. No: SCY9108Y, Claimant: CHEW WEE KAI				1 Load HTM			
Photos/Images						3 per page		<input checked="" type="checkbox"/>	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)				Thumbnail		Print	
1	18/09/17 19:14	General View				1 Load JPG		<input checked="" type="checkbox"/>	
2	18/09/17 19:14	General View				1 Load JPG		<input checked="" type="checkbox"/>	
3	18/09/17 19:14	General View				1 Load JPG		<input checked="" type="checkbox"/>	
4	18/09/17 19:14	General View				1 Load JPG		<input checked="" type="checkbox"/>	
5	18/09/17 19:14	General View				1 Load JPG		<input checked="" type="checkbox"/>	
6	18/09/17 19:14	General View				1 Load JPG		<input checked="" type="checkbox"/>	
7	18/09/17 19:14	General View				1 Load JPG		<input checked="" type="checkbox"/>	
8	18/09/17 19:14	General View				1 Load JPG		<input checked="" type="checkbox"/>	
9	18/09/17 19:14	General View				1 Load JPG		<input checked="" type="checkbox"/>	
10	18/09/17 19:14	General View				1 Load JPG		<input checked="" type="checkbox"/>	
11	18/09/17 19:14	General View				1 Load JPG		<input checked="" type="checkbox"/>	
12	18/09/17 19:14	General View				1 Load JPG		<input checked="" type="checkbox"/>	
13	18/09/17 19:14	General View				1 Load JPG		<input checked="" type="checkbox"/>	
14	18/09/17 19:14	Odometer Reading				1 Load JPG		<input checked="" type="checkbox"/>	
15	18/09/17 19:14	General View				1 Load JPG		<input checked="" type="checkbox"/>	
16	18/09/17 19:14	General View				1 Load JPG		<input checked="" type="checkbox"/>	
17	18/09/17 19:14	General View				1 Load JPG		<input checked="" type="checkbox"/>	
18	18/09/17 19:14	General View				1 Load JPG		<input checked="" type="checkbox"/>	
19	18/09/17 19:14	General View				1 Load JPG		<input checked="" type="checkbox"/>	
20	18/09/17 19:14	General View				1 Load JPG		<input checked="" type="checkbox"/>	
21	18/09/17 19:14	General View				1 Load JPG		<input checked="" type="checkbox"/>	
22	18/09/17 19:14	General View				1 Load JPG		<input checked="" type="checkbox"/>	
23	18/09/17 19:14	General View				1 Load JPG		<input checked="" type="checkbox"/>	
24	18/09/17 19:14	General View				1 Load JPG		<input checked="" type="checkbox"/>	
25	18/09/17 19:14	General View				1 Load JPG		<input checked="" type="checkbox"/>	
26	18/09/17 19:14	General View				1 Load JPG		<input checked="" type="checkbox"/>	
27	18/09/17 19:14	General View				1 Load JPG		<input checked="" type="checkbox"/>	
28	18/09/17 19:14	General View				1 Load JPG		<input checked="" type="checkbox"/>	
29	18/09/17 19:14	Photographs of Damaged Parts				1 Load JPG		<input checked="" type="checkbox"/>	
30	18/09/17 19:14	Photographs of Damaged Parts				1 Load JPG		<input checked="" type="checkbox"/>	
31	18/09/17 19:14	Photographs of Damaged Parts				1 Load JPG		<input checked="" type="checkbox"/>	

32	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
33	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
34	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
35	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
36	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
37	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
38	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
39	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
40	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
41	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
42	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
43	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
44	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
45	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
46	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
47	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
48	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
49	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
50	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
51	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
52	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
53	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
54	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
55	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
56	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
57	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
58	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
59	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
60	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
61	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
62	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
63	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
64	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
65	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
66	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
67	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
68	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
69	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
70	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
71	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
72	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
73	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
74	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
75	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
76	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
77	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
78	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
79	18/09/17 19:14	Photographs of Damaged Parts	1	Load JPG	<input checked="" type="checkbox"/>
80	18/09/17 19:15	Photo After Spray	1	Load JPG	<input checked="" type="checkbox"/>
81	18/09/17 19:15	Photo After Spray	1	Load JPG	<input checked="" type="checkbox"/>

82	18/09/17 19:15	Photo After Spray	1	Load JPG	<input checked="" type="checkbox"/>
83	18/09/17 19:15	Photo After Spray	1	Load JPG	<input checked="" type="checkbox"/>
84	18/09/17 19:15	Photo After Spray	1	Load JPG	<input checked="" type="checkbox"/>
85	18/09/17 19:15	Photo After Spray	1	Load JPG	<input checked="" type="checkbox"/>
86	18/09/17 19:15	Photo After Spray	1	Load JPG	<input checked="" type="checkbox"/>
87	18/09/17 19:15	Photo After Spray	1	Load JPG	<input checked="" type="checkbox"/>
				1 per page	<input checked="" type="checkbox"/>
Documentation					
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)		Thumbnail	Print
1	07/08/17 14:35	TP E-FILE REPORT From: OD - Reg. No: SCY9108Y, Claimant: CHEW WEE KAI	1	Load PDF	
2	07/08/17 14:38	PRI	1	Load PDF	
3	07/08/17 16:26	EMAIL to TP reject their list of surveyor	1	Load PDF	
4	21/12/17 20:39	LOD, TP E-FILE REPORT, OI E-FILE REPORT, LTA ENQUIRE VEHICLE, REPAIR BILL, SURVEY BILL, SURVEY REPORT	1	Load PDF	
5	21/12/17 20:44	TP PHOTO - SBQ1199R	1	Load PDF	
6	21/12/17 20:44	TP PHOTO 2 - SBQ1199R.	1	Load PDF	
7	21/12/17 20:44	TP PHOTO 4 - SBQ1199R.	1	Load PDF	
8	21/12/17 20:44	TP PHOTO 5 - SBQ1199R.	1	Load PDF	
9	21/12/17 20:50	TP PHOTO 3 - SBQ1199R PART	1	Load PDF	
10	21/12/17 20:50	TP PHOTO 3 - SBQ1199R PART 2.	1	Load PDF	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	16/01/18 13:15	PRS INVOICE	1	Load PDF	

Documents Checklist

DOCUMENTS CHECKLIST		Reset	Save	Print
There are no document checklists configured.				
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ) <div style="border: 1px solid black; height: 40px; margin: 5px 0;"></div>				
Show Remarks To: <input type="checkbox"/> Handling Insurer <small>Note: Remarks are private unless you show it to other parties.</small>				

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/MSG17015198/CVBS2-1
 Date: 16/01/2018

REFERENCE

Handling Insurer: MSIG Insurance (Singapore) Pte. Ltd.

Policy No: 28808660QMX

Claimant Vehicle No: SBQ1199R

Insured Vehicle No: SCY9108Y

Date of Loss: 09/07/2017

Nature of Claim: TP

Claim No: 522461

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SBQ1199R**
 Make & Model: BMW 325i, 2.5 CONVERTIBLE (A)
 Reg. Date: 30/04/2008 (Man. Year: 2008)
 Colour: Silver
 Engine Capacity: 2497 cc
 Market Value/New Car Price: N/A
 Sum Insured (S\$): **Market Value/New Car Price**

Engine No: 76034229N52B25AF
 Chassis No: WBAWL12060PD75841
 Odometer: 105545 km

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Good Steering (Serviceable): Yes Footbrake (Serviceable): Yes
 Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size: 225/45R17 Rear Tyre Size: 255/40R17
 Front Left Side: Continental 5 mm Rear Left Side: Bridgestone 6 mm
 Front Right Side: Continental 5 mm Rear Right Side: Bridgestone 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	17,311.01	10,318.17	6,992.84	40.40
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,800.00	1,720.00	2,080.00	54.74
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	21,111.01	12,038.17	9,072.84	42.98
Approved Total (Overridden) (S\$)		9,600.00		
Nett Amount (S\$)	21,111.01	9,600.00	11,511.01	54.53

INSPECTION

Date of Assignment: 07/08/2017
 Date Inspected: 07/08/2017 Inspected At:

Revol Carz Garage Pte Ltd (HQ)
 Block 10, Ang Mo Kio Ind Park 2A, #02-18,
 AMK Auto Point
 Singapore 568047

Estimated Period of Repair: 5.0 days

Adjuster: Richard Harjanto

Manager: CATHERINE CHONG KAI LING

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source:	(Last Synchronised: 16 Jan 2018)
Parts:	N/A BMW 325i 2.5 CONVERTIBLE (A) (Model not available in database)
Labour:	Repairer's (Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SBQ1199R)
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*BONNET	Damaged	1,290.00 FL	*1,290.00 FL
2	1		*BONNET LOCK	Intact	45.00 FL	*- FL
3	1		*BONNET RUBBER	Necessary	35.30 FL	*35.30 FL
4	1		*FRONT HEADLAMPS	O/s Cracked/N/s Not Necessary	3,996.00 FL	*1,998.00 FL
5	1		*FRONT O/S SPRAY NOZZLE PEN	Damaged	175.00 FL	*175.00 FL
6	1		*FRONT BUMPER	Damaged	1,235.00 FL	*1,235.00 FL
7	1		*FRONT BUMPER FOG LAMP	Damaged	286.00 FL	*286.00 FL
8	1		*FRONT BUMPER FOG LAMP COVER	Damaged	47.55 FL	*47.55 FL
9	1		*FRONT BUMPER REINFORCEMENT	Not Necessary	536.85 FL	*- FL
10	1		*FRONT BUMPER SIDE RETAINER	Damaged	68.00 FL	*68.00 FL
11	1		*FRONT O/S FENDER	Damaged	785.00 FL	*785.00 FL
12	1		*FRONT O/S FENDER INNER SHIELD	Damaged	95.00 FL	*95.00 FL
13	1		*SET FRONT O/S FENDER INNER SHIELD CLIP	Necessary	37.50 FL	*37.50 FL
14	1		*FRONT SUPPORT PANEL	Repair	645.00 FL	*- FL
15	1		*FRONT UNDER SUPPORT BARS	Repair	450.00 FL	*- FL
16	1		*FRONT O/S WHEEL HUB C/W BEARING	Damaged	465.75 FL	*465.75 FL
17	2		*FRONT SHOCK ABSORBERS	Damaged	917.10 FL	*917.10 FL
18	2		*FRONT SHOCK ABSORBER MOUNTINGS	Necessary	389.20 FL	*389.20 FL
19	1		*FRONT O/S KNUCKLE ARM	Damaged	394.10 FL	*394.10 FL
20	1		*FRONT O/S LOWER ARM	Damaged	225.20 FL	*225.20 FL
21	1		*FRONT O/S STAY ARM	Damaged	230.85 FL	*230.85 FL
22	1		*FRONT STEERING RACK	Not Necessary	2,497.55 FL	*- FL
23	1		*FRONT STABILIZER BAR	Not Necessary	351.60 FL	*- FL
24	1		*FRONT N/S STABILIZER BAR LINK	Damaged	90.25 FL	*90.25 FL
25	1		*FRONT O/S BRAKE DISC	Not Necessary	245.20 FL	*- FL
26	1		*FRONT O/S BRAKE DISC COVER	Not Necessary	78.00 FL	*- FL
27	1		*O/S SIDE SKIRT	Damaged	297.75 FL	*297.75 FL
28	1		*FRONT ENGINE UNDERCOVER	Damaged	325.00 FL	*325.00 FL
29	1		*FRONT O/S TYRE (DEPRECIATION)	Damaged	400.00 FS	*200.00 FS
30	1		*FRONT O/S SPORT RIM	Damaged	700.00 FS	*700.00 FS
31	1		*PAINT PROTECTION (ZE TOUGH FOUNDATION)	Necessary	788.00 FS	*500.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$) 18,122.75 10,787.55

- List Item Discount on L Items 5.00/5.00% (\$\$) 811.74 469.38

Total Parts (\$\$) 17,311.01 10,318.17

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
-----	-----	-------------	-------------	-----------	------------	--------

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO REMOVE AND REFIT DAMAGE PARTS, TEST FOR PROPER FUNCTIONING AND FOCUS OF HEADLAMPS.	New	50.00	30.00
2	TO REMOVE AND REFIT FRONT UNDERCARRIAGE.	New	400.00	180.00
3	TO CHECK AND RE-ADJUST (COMPUTERIZED) ALL WHEEL ALIGNMENT.	New	200.00	80.00
4	TO REMOVE AND REPLACE THE ABOVE DAMAGED PARTS, STRAIGHTEN, KNOCK OUT, REALIGN AND REPAIR INCLUDING CUT AND WELD BODY PANELS. TO RE-ADJUST TO THE ORIGINAL POSITION USING POWER TOOLS.	New	1,500.00	600.00
5	TO SPRAY PAINT ON THE REPLACED AND REPAIRED PARTS, PREPARE SPRAY SUCH AS MASKING TAPE THE UNAFFECTED AREAS WITH PAPER, CLEANING AND SANDING OF SURFACES, FINAL POLISHING AND WAXING ARE ALSO AVAILABLE.	New	1,500.00	800.00
6	TO APPLY UNDERCOATING ON THE REPAIRED AND REPLACED PANELS FOR RUST PROTECTION.	New	150.00	30.00
Gross Labour Cost (\$\$)			3,800.00	1,720.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >