

ASS. REC. BY:

REF: CS/ASM18001043/Rlgber

Special Instruction:

Surveyor: RasulASSIGNMENT (Officer)

Smart claim

From (Person):

Yvonne Ang

of

ASM

Date/Time:

17/01/2018 2:12pm

Estimated Cost:

Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SGE 2693C

Insured:

at Workshop m/s

Mova

Tel:

6172 3892.

of

15 Tanjong Road

Policy No:

Claim No:

SSM0077Y

Sum Insured:

Excess:

\$ 700.00

Make of Veh:

D.O.A.

15-01-2018

(Client's Record)

CA / REV / REP. / REV 24 HRS18-01-2018 @ morning

H.O.D. Endorsement:

Date/Time:

17/01/2018 2:45pm

Person Contacted:

AvrilVehicle IN / OUT

Date/Time	Action/Instruction (✓) Estimate
	<u>SGE 2693C - X</u>
<u>19/1/18 @ 2:05pm</u>	<u>visit to Yvonne Ang via Smart Claims.</u>
<u>23/1/18 @ 11:10am</u>	<u>Yvonne Ang informed C/A if consistent -</u>
<u>23/1/18 @ 11:20am</u>	<u>informed Avril C/A & Ex: \$700.</u>
<u>24/1/18 @ 5:27pm</u>	<u>confirmed with Avril final Bq \$6770, 8 days by email.</u>
	<u>(Paid \$985, 14%)</u>
	<u>no lump sum.</u>

✓ n/a

Rasu

ASM (AXA)

68196

COE XPIRY: 2021/MAR

18/01/2018

SGE 2693C

2006

MMR

Estimated Date

①

TOYOTA LEXUS GS 300

TOYOTA LEXUS

① ① WS/TP RES CO RES/REVA/IN/IN

Estimated Date

SGE 2693C

Estimated Date

Mova Automotive

①

15 Fan Yong Road

Insured

Eng No

Policy No

①

STH BG 96S60 5034589

Claims No

Gen. Cng. Gede

① Poor Burnt

Sum Insured

Excess

700

Steering

① ① Jammed Leaked Burnt

Claims Record

Brake

① ① Jammed Leaked Burnt

Make of car

Morning

Wet


① STD A/R

Tyre Size

R

225/50R17

Policy Condition

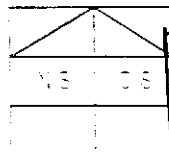

Remark: The car had commenced its

repair at the time of inspection.

①

ES DUN EXNOVA GY FS LIZA MIO C-TSL PR SUM

Salvage/Market Value

43K

Front

Rear

DAC Accident Report

Consistent? Yes or No

R/Ba

6

R/Ba

6

GA - RF Seen

Consistent? Yes or No

L/Ba

6

L/Ba

6

Est. Repairs

8

days

Rest: Yes or No

DCA

15/01/18

DCA

18/01/18

Acc. Sum

8

Excess: Yes or No

Survey report

Mova (PY)

① REP. 24 HRS 'w/p

Des. of Damages

Front

Rear

①

NS L/D Roof top

Date

Person Contacted

Vehicle IN/OUT

The U/C in Chassis frame

Body Structure altered due to collision

Date/Time

Action/Inspection

RECEIVED 18/01/2018

Inspection Report

①

Final Report

Days Of Repair

8

Inspection Report

①

Final Report

Reserve, No. of Tru

1

Sum. Rep.

200

Inspection Report

①

Final Report

Add. Rep.

①

Sum. Rep.

Repair Status

Smart Claim

①

6270

Sum. Rep.

Sum. Rep.

200



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile			
AXA INSURANCE PTE LTD		Ref : CS/ASM18001043/R1qb	
8 SHENTON WAY #24-01 AXA TOWERSINGAPORE 068811		Date : 17-01-2018	
		Code : ASM	
1. Policy Particulars :- OWN DAMAGE			
Insured Veh.		Veh. Inspected	SGE 2693C
Policy No.		Coverage (\$)	0.00
Claim No.	S8M0077Y	Excess (\$)	700.00
Assign From	SMART CLAIM (YVONNE ANG)	Assign Date	17/01/2018
2. Vehicle Particulars & Condition			
Make & Model		c.c	0
Engine No.	HIDDEN	Year of Reg.	
Chassis No.		Colour	
Odometer	-	Steering	
Brakes		Modification	
General			
3. Conditions of Tyres			
	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm
4. Description of Damages			
5. General Information			
Accident Date	15/01/2018	Inspection Date	18/01/2018
Survey held at	MOVA AUTOMOTIVE PTE LTD 15 FAN YONG ROAD SINGAPORE 629792		
5a. Remarks			
A) THE MARKET VALUE IS S\$----- (EST. AVERAGE) B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE AUTHORISED REPAIRS.			



Service Request Details

17 of 17 @ 2:06 pm
April 16th 10:15 PM

Claim
S8M0077Y

Reference
None

Loss Date
January 15, 2018

Request Date
January 17, 2018

Due Date
January 24, 2018

Vendor Name
LKK AUTO CONSULTANTS PTE LTD (OD)

Type of Loss
Incident Only

Services
Accelerated workshop survey

Actions

Next Step
Agree to perform service

Decline Work

Accept Work

Vehicle Information

Incident Vehicle Registration #
SGE2693C

Make
LEXUS

Service Address

Blk 1008, , , 159722

Primary Contact/Insured

RUPA NATARAJAN
14A, SWISS CLUB ROAD, 288108, Singapore, Singapore
81133531
MITA_NATARAJAN@YAHOO.COM

Claim Handler

Default Owner

Additional Instructions

EXCESS 700

MessagesInvoicesHistoryDocumentsAssessmentMetricsNotes

New Message

Shiau Chan (LKKAUTO)

From: Shiau Chan (LKKAUTO)
Sent: Thursday, 26 April 2018 5:27 PM
To: Alan Chng; Rasul (LKKAUTO)
Cc: Admin A; SUR
Subject: RE: finalization for vhe no:SGE2693C ***LKK REF:CS/ASM18001043/R1qb

Dear Alan,

Confirm final fig \$6,270.00 before excess \$700.00 & GST and 8 repair days.

Best Regards,
Shiau Chan (Ms) | Case Handler
LKK Auto Consultants Pte Ltd
Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315 Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

-----Original Message-----

From: Shu Pei (LKKAUTO)
Sent: Monday, 29 January 2018 2:09 PM
To: Alan Chng <tuckmeng@nova.com.sg>; Rasul (LKKAUTO) <Rasul@lkkauto.com>; Shiau Chan (LKKAUTO) <siewsc@lkkauto.com>
Cc: Admin A <admin-a@lkkauto.com>; SUR <sur@lkkauto.com>
Subject: RE: finalization for vhe no:SGE2693C ***LKK REF:CS/ASM18001043/R1qb

Dear Alan,

Thank you for your email.

Our respective case handler will look into the matter and revert to you in due course.

Dear Rasul / Shiau Chan,

For your information and necessary action please.

Thank you.

To check availability of the case handler, you may contact the undersigned.

Best Regards,
Shu Pei | Admin
LKK Auto Consultants Pte Ltd
Phone: 6366-0055 | email: shupeil@lkkauto.com | fax: 6741-4108 Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

-----Original Message-----

From: Alan Chng [<mailto:tuckmeng@nova.com.sg>]
Sent: Monday, 29 January 2018 11:54 AM
To: Rasul (LKKAUTO) <Rasul@lkkauto.com>
Cc: Admin A <admin-a@lkkauto.com>
Subject: finalization for vhe no:SGE2693C

Dear Rasul,

Shiau Chan (LKKAUTO)

From: Shiau Chan (LKKAUTO)
Sent: Tuesday, 23 January 2018 11:18 AM
To: avril@movva.com.sg
Cc: SUR
Subject: VEHICLE SGE 2693C (DOA: 15/01/2018)

Dear Avril,

As spoken with you.

As instructed by our client, please proceed to repair the insured vehicle **SGE 2693C (Excess \$700/-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right not to pay if there is no valid approval obtained before repair.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)



Auto
Consultants
Pte Ltd

51 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Your Ref: S8M0077Y

Date: 19th January 2018

Our Ref: CS/ASM18001043/R1qb

The Motor Claims Department
AXA Insurance Singapore Pte Ltd

Attn: Yvonne

Dear Sirs/Mdm

PRELIMINARY ADVICE OF VEHICLE NO. SGE 2693C


We thank you for the instruction on 17/01/2018.

Please be informed that we had conducted the inspection of the abovementioned vehicle on 18/01/2018 (6pm) at the premises of M/s MOVA and have the following to report:-

Workshop Estimate Amount	: S\$ <u>7,255.00</u>
Revised Estimate Amount	: S\$ <u>6,005.00</u>
"Check" Items Amount	: S\$ <u>470.00</u>
Total	: S\$ <u>6,475.00</u>
Market Value	: S\$ <u>43,000.00</u>
LTA Reimbursement Value	: S\$ <u>16,018.00</u>
Nett Value	: S\$ <u>26,982.00</u>

Description of Damage:

The vehicle sustained damages at the o/s portion.

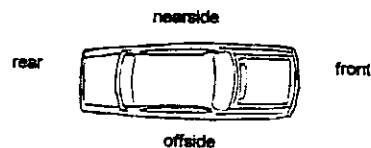

Comments/ Present Status:

Damages consistent.

Repair cost economical.

Estimated normal period for repairs: 08 working days.

We have not authorised the repairs.

Yours faithfully

Rasul
Automobile Assessor

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Singapore NRIC
Owner ID: 6819G

Vehicle Details

Vehicle No.: SGE2693C
Vehicle to be Exported: No
Intended De-registration Date: 19 Jan 2018
Vehicle Make: TOYOTA
Vehicle Model: LEXUS GS300
Primary Colour: Purple
Manufacturing Year: 2006
Engine No.: 3GR0157489
Chassis No.: JTHBG96S605034589
Maximum Power Output: 170.0 kW (227 bhp)
Open Market Value: \$49,476.00
Original Registration Date: 14 Mar 2006
First Registration Date: 14 Mar 2006
Transfer Count: 0
Actual ARF Paid: \$54,424.00

Intended PARF Rebate Details

PARF Eligibility: Forfeited
PARF Eligibility Expiry Date: -
PARF Rebate Amount: \$0.00

Intended COE Rebate Details

COE Expiry Date: 13 Mar 2021
COE Category: B - Car (1601cc & above)
COE Period(Years): 5
PQP Paid: \$25,466.00
COE Rebate Amount: \$16,018.00
Total Rebate Amount: \$16,018.00

Message

Please note that the 5-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 19 Jan 2018

OK

OD AXA

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Singapore NRIC

Owner ID: 6819G

Vehicle Details

Vehicle No.: SGE2693C

Vehicle to be Exported: Yes

Intended De-registration Date: 15 Jan 2018

Vehicle Make: TOYOTA

Vehicle Model: LEXUS GS300

Primary Colour: Purple

Manufacturing Year: 2006

Engine No.: 3GR0157489

Chassis No.: JTHBG96S605034589

Maximum Power Output: 170.0 kW (227 bhp)

Open Market Value: \$49,476.00

Original Registration Date: 14 Mar 2006

First Registration Date: 14 Mar 2006

Transfer Count: 0

Actual ARF Paid: \$54,424.00

Intended PARF Rebate Details

PARF Eligibility: Forfeited

PARF Eligibility Expiry Date: -

PARF Rebate Amount: \$0.00

Intended COE Rebate Details

COE Expiry Date: 13 Mar 2021

COE Category: B - Car (1601cc & above)

COE Period(Years): 5

PQP Paid: \$25,466.00

COE Rebate Amount: \$16,079.00

Total Rebate Amount: \$16,079.00

Message

Please note that the 5-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 15 Jan 2018

OK

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	15/01/2018 16:01
Date Of Accident	15/01/2018 12:45
Exact Location Of Accident	STEVENS RD TURNING TO BALMORAL DR
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SGE2693C
Insured/Policyholder	
Name Of Registered Owner	RUPA NATARAJAN
NRIC No	S2566819G
Email Address	MITA_NATARAJAN@YAHOO.COM
Mobile Phone No	(LOCAL) +65-81133531
Alternative Phone No	OFFICE-81133531

Vehicle Particulars

Manufacturer	LEXUS
Model	GS300-3.0 (A)

Exact Purpose for which vehicle was being used at time of accident

Are you claiming under your own insurance policy for repair to your vehicle? YES

If No, Please state action to be taken

Vehicle Category	PRIVATE CAR
------------------	-------------

Insurance Company

Name of Insurance Company	AXA INSURANCE PTE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	GA092629
Cover Note Number	

Driver

Name of Driver	RUPA NATARAJAN
NRIC No	S2566819G
Date Of Birth	07/10/1942
Occupation	INDOOR
Date Of Driving Pass	04/03/1989
Driving Experience	28 YEARS AND 10 MONTHS
Gender	FEMALE
Mobile Number	(LOCAL) +65-81133531
Fax Number	
Contact Number	OFFICE-81133531
EMail Address	MITA_NATARAJAN@YAHOO.COM

Address	14A SWISS CLUB RD S 288108
Postcode	
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	SIDE SWIPE
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

REFER TO SKETCH PLAN

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SHD4413A
Vehicle Make/Model/Colour	
Details Of Properties	
Vehicle Category	TAXI
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

Sketch Plan Pg. 1


SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims. (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

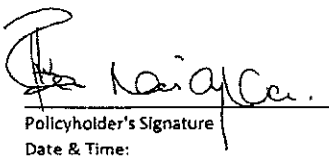
Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:


Sketch Plan Pg. 2

A : SGE2693C

B : SHD4413A

SKETCH PLAN

DRAYCOTT DRIVE

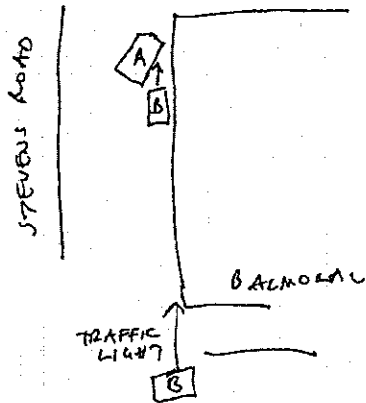



DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

LICENSE PLATE: SGE2693C	ACCIDENT DATE & TIME: JAN 15, 2018. 12:45PM
CONTACT NUMBER: 81133531	E-MAIL ADDRESS: mita_natarajan@yahoo.com
LOCATION: STEVENS ROAD TURNING TO BALMORAL DRIVE (DRAYCOTT)	
I WAS DRIVING ON STEVENS ROAD AND TURNING INTO DRAYCOTT DRIVE. I WAS ALREADY IN THE THIRD LANE ABOUT TO TURN INTO DRAYCOTT WHEN THE TAXI (SHD4413A) HIT ME IN THE CENTER OF MY CAR, DESTROYING DRIVERS SIDE DOOR. FROM THE DAMAGE ON HIS CAR ON LEFT HAND SIDE FRONT OF HIS CAR HE MUST HAVE DRIVEN TOO FAST AND HIT ME AS I WAS ALREADY ABOUT TO TURN TO DRAYCOTT. I THINK HE TRIED TO BEAT TRAFFIC LIGHT AND THAT IS WHY HE WAS GOING SO FAST AND DID NOT STOP DESPITE ME BEING IN THE LANE AND INDICATING.	
NOTE: PLEASE NOTE THAT YOUR INSURER MAY HAVE 14 DAYS TIME FRAME FOR YOU TO SUBMIT AN OWN DAMAGE CLAIM UNDER YOUR OWN POLICY. PLEASE CHECK YOUR POLICY FOR MORE INFORMATION	
Please state:	
☒ Claim Own Policy ☐ Claim Third Party ☐ Claim OD/TP at other workshop ☐ Reporting Only	

DECLARATION

I/We declare the foregoing particulars are true in every respect.


 Policyholder's Signature
 Date & Time:


 Driver's Signature
 (if driver is not the policyholder)
 Date & Time:

Reporting Centre Personnel's Signature
 Name:
 NRIC/FIN No.:

HOME SERVICE REQUESTS MESSAGES CLAIMS

total \$7785
S8100077Y
CK130526

Assessment Details

General & Workshop Details		Vehicle & Driver Details	Vehicle Condition	Taxes & Ratio	Parts & Labour	Miscellaneous	Summary
----------------------------	--	--------------------------	-------------------	---------------	----------------	---------------	---------

General Details

Workshop Details

Involving	1 2006 LEXUS GS300 (SGE2693C)							Total Rebate Amount	0
Date of Loss	January 15, 2018							Nett Loss Amount	\$0.00
Time of Loss	12.45							Assigned Workshop	MOVA AUTOMOTIVE PTE LTD
Loss Description	SGE2693C (INSD) C/W SGE2693C							Target Date of Completion *	01/27/2018
Comment								Days of work completion *	10



SERVICE REQUESTSMESSAGESCLAIMS

Assessment Details

General & Workshop DetailsVehicle & Driver DetailsVehicle ConditionTaxes & RatioParts & LabourMiscellaneousSummary

Parts

Add

EDIT	SR NO	QUAN TITY	MATERIAL	SIDE	PART NAME	PART NUMBER	REPAIR/REPLACE (PARTS)	CONDITION	LIST PRICE	DISC QUANTITY	PART PRICE(NET)	ACTION (PARTS)	REMOVE
	1	1			RH FRONT DOOR				750	750	750	Reviewing	
	2	1			RH FRONT DOOR SIDE RUBBER				130	130	130	Reviewing	
	3	1			RH FRONT DOOR OUTER MOULDING				110	110	110	Reviewing	
	4	1			RH FRONT DOOR LOWER MOULDING				150	150	150	Reviewing	
	5	1			RH FRONT DOOR HANDLE				230	230	230	Reviewing	

EDIT	SR NO	QUAN TTY	MATERIAL	SIDE	PART NAME	PART NUMBER	REPAIR/REPLACE (PARTS)	CONDITION	LIST PRICE	DISC COUNT%	PART PRICE(NET)	ACTION (PARTS)	REMOVE
	6	1			RH FRONT DOOR HANDLE TRIM				30	new ✓	30	Reviewing	
	7	1			RH FRONT DOOR HANDLE INNER BRACKET				230	new ✓	230	Reviewing	
	8	1			RH FRONT DOOR LOCK				350	PT ✓	350	Reviewing	
	9	1			RH FRONT DOOR RUBBER				150	new ✓	150	Reviewing	
	10	1			RH FRONT DOOR UPPER HINGE				70	PT ✓	70	Reviewing	
	11	1			RH FRONT DOOR LOWER HINGE				70	PT ✓	70	Reviewing	
	12	1			RH FRONT DOOR CHECKER				150	PT ✓	150	Reviewing	
	13	1			RH FRONT DOOR WINDOW REGULATOR				180	PT ✓	180	Reviewing	

EDIT	SR NO	QUANTITY	MATERIAL	SIDE	PART NAME	PART NUMBER	REPAIR/REPLACE (PARTS)	CONDITION	LIST PRICE	DISC QUANTITY	PART PRICE(NET)	ACTION (PARTS)	REMOVE
	14	1			RH FRONT DOOR MOTOR				320 <i>new</i>		320	Reviewing	
	15	1			RH FRONT DOOR REAR TRIM				250 <i>mis</i> <i>X800</i>		250	Reviewing	
	16	1			RH FRONT DOOR INNER TRIM - TBA				0 <i>0</i> <i>500</i>		0	Reviewing	
	17	1			RH FRONT DOOR FRAME MOULDING				110 <i>new</i>		110	Reviewing	
	18	10			RH FRONT DOOR FRAME RIVET				5 <i>new</i>		50	Reviewing	
	19	1			RH FRONT DOOR WIRE HARNESS - TBA				<i>500</i> <i>0</i> <i>7</i>		0	Reviewing	
	20	1			RH REAR DOOR				580 <i>PA</i>		580	Reviewing	
	21	1			RH REAR DOOR SIDE SEAL				130 <i>new</i>		130	Reviewing	

EDIT	SR NO	QUAN TITY	MATERIAL	SIDE	PART NAME	PART NUMBER	REPAIR/REPLACE (PARTS)	CONDITION	LIST PRICE	DISC COUNTX	PART PRICE(NET)	ACTION (PARTS)	REMOVE
	22	1			RH REAR LOWER MOULDING				150	<i>new</i>	150	Reviewing	
	23	1			RH REAR DOOR RUBBER				150	<i>new</i>	150	Reviewing	
	24	1			RH REAR DOOR FRAME MOULDING				160	<i>new</i>	160	Reviewing	
	25	10			RH REAR DOOR FRAME RIVET				5	<i>new</i>	50	Reviewing	
	26	1			RH REAR DOOR OUTER MOULDING				130	<i>new</i>	130	Reviewing	
	27	1			RH FRONT FENDER				330	<i>R</i>	330	Reviewing	
	28	1			RH FRONT FENDER WHEEL ARCH MOULDING				75	<i>800 X-AT</i>	75	Reviewing	
	29	1			RH FRONT FENDER INSULATOR				80	<i>800 X-AT</i>	80	Reviewing	

Labour

EDIT SR NO REPAIR/REPLACE (LABOUR) PART NAME LABOUR R&R LABOUR REPAIR PAINT ACTION (LABOUR) COMMENT REMOVE

TO REMOVE & TRANSFER
ITEMS TO RH SIDE BOTH
NEW DOOR

1

0

~~200~~ 160

0

Reviewing

REVIEWING

TO REMOVE & INSTALL
CARPET, GARNISH, TRIM
IN ORDER TO
STRAIGHTEN RH SIDE
FRONT AND CTR DOOR
PILLAR

2

0

~~200~~ 100

0

Reviewing

REVIEWING

TO STRAIGHTEN RH
FRONT DOOR PILLAR, CTR
PILLAR AND RENEW
DAMAGES PARTS

3

0

~~800~~ 600

0

Reviewing

REVIEWING

TO SPRAY PAINT ON
REPLACED, REPAIRED
AREAS

4

0

~~800~~ 800

1200

Reviewing

REVIEWING

TO REPROGRAMMING
ALL CONTROL UNITS
AFTER REPAIR

5

0

~~220~~ 180

0

Reviewing

REVIEWING

Rafael
Hp 900 1000000
8 days
P/P
18/01/18 2-1800
EXCESS: 700
Reev 6x paint

LKK Auto Consultants hence notify
the Repairer of the following:
• To resurvey before/after spray painting
• To display damaged part(s) during resurvey
• Parts prices are subject to confirmation
• Third party survey is on a "Without Prejudice" basis
• No illegal modification(s) is allowed
• Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company
Acknowledged by Repairer
Signature:
Date:



SERVICE REQUESTS

MESSAGES

CLAIMS



Assessment Details

General & Workshop Details	Vehicle & Driver Details	Vehicle Condition	Taxes & Ratio	Parts & Labour	Miscellaneous	Summary
----------------------------	--------------------------	-------------------	---------------	----------------	---------------	---------

Claim Amount \$7,785.00

CATEGORY

ESTIMATE

REVISED AMOUNT

Spare Parts

\$5,165.00

\$5,165.00

Labour

\$1,420.00

\$1,420.00

Paint

\$1,200.00

\$1,200.00



English (default) ▾

MOVA AUTOMOTIVE PTE LTD ▾



SERVICE REQUESTS

MESSAGES

CLAIMS

SS800077Y
CK130526

total \$7785

\$6270



Assessment Details

General & Workshop Details

Vehicle & Driver Details

Vehicle Condition

Taxes & Ratio

Parts & Labour

Miscellaneous

Summary

General Details

Workshop Details

Involving

1 2006 LEXUS GS300 (SGE2693C)

Total Rebate Amount

0

Date of Loss

January 15, 2018

Nett Loss Amount

\$0.00

Time of Loss

12.45

Assigned Workshop

MOVA AUTOMOTIVE PTE LTD

Loss Description

SGE2693C (INSD) C/W SGE2693C

Target Date of
Completion *

01/27/2018



Comment

Days of work
completion *

10



Service Requests Messages Claims

Assessment Details

General & Workshop Details Vehicle & Driver Details Vehicle Condition Taxes & Ratio Parts & Labour Miscellaneous Summary

Parts

Add

EDIT	SR NO	QUANTITY	MATERIAL	SIDE	PART NAME	PART NUMBER	REPAIR/REPLACE (PARTS)	CONDITION	LIST PRICE	DISC QUANTITY	PART PRICE(NET)	ACTION (PARTS)	REMOVE
☐	1	1			RH FRONT DOOR				750	1	750	Reviewing	☐
☐	2	1			RH FRONT DOOR SIDE RUBBER				130	1	130	Reviewing	☐
☐	3	1			RH FRONT DOOR OUTER MOULDING				110	1	110	Reviewing	☐
☐	4	1			RH FRONT DOOR LOWER MOULDING				150	1	150	Reviewing	☐
☐	5	1			RH FRONT DOOR HANDLE				230	1	230	Reviewing	☐

1370

1/17/2018

#

Claim Portal

EDIT	SR NO	QUAN TITY	MATERIAL	SIDE	PART NAME	PART NUMBER	REPAIR/REPLACE (PARTS)	CONDITION	LIST PRICE	DISC CUNTYX	PART PRICE(NET)	ACTION (PARTS)	REMOVE
	6	1			RH FRONT DOOR HANDLE TRIM				30	new /	30	Reviewing	
	7	1			RH FRONT DOOR HANDLE INNER BRACKET				230	new /	230	Reviewing	
	8	1			RH FRONT DOOR LOCK				350	pt /	350	Reviewing	
	9	1			RH FRONT DOOR RUBBER				150	new /	150	Reviewing	
	10	1			RH FRONT DOOR UPPER HINGE				70	pt /	70	Reviewing	
	11	1			RH FRONT DOOR LOWER HINGE				70	pt /	70	Reviewing	
	12	1			RH FRONT DOOR CHECKER				150	7 /	150	Reviewing	
	13	1			RH FRONT DOOR WINDOW REGULATOR				180	pt /	180	Reviewing	

1230

1/17/2018

4 7

Claim Portal

EDIT	SR NO	QUAN TTY	MATERIAL	SIDE	PART NAME	PART NUMBER	REPAIR/REPLACE (PARTS)	CONDITION	LIST PRICE	DISC CUNTX	PART PRICE(NET)	ACTION (PARTS)	REMOVE
☐	/	14	1		RH FRONT DOOR MOTOR	JAM/tue			320	7	320	Reviewing	☐
☐	/	15	1		RH FRONT DOOR REAR TRIM				250	MS	250	Reviewing	☐
☐	/	16	1		RH FRONT DOOR INNER TRIM				0	NE	0	Reviewing	☐
☐	/	17	1		RH FRONT DOOR FRAME MOULDING				110	new	110	Reviewing	☐
☐	/	18	10		RH FRONT DOOR FRAME RIVET				5	new	50	Reviewing	☐
☐	/	19	1		RH FRONT DOOR WIRE HARNESS				0	7	0	Reviewing	☐
☐	/	20	1		RH REAR DOOR				580	Ph	580	Reviewing	☐
☐	/	21	1		RH REAR DOOR SIDE SEAL				130	new	130	Reviewing	☐

1190

1/17/2018

7
10
#

FAN YOUNG

17-01-18:16:12

Claim Portal

EDIT	SR NO	QUAN TITY	MATERIAL	SIDE	PART NAME	PART NUMBER	REPAIR/REPLACE (PARTS)	CONDITION	LIST PRICE	DISC CUNTYX	PART PRICENET)	ACTION (PARTS)	REMOVE
☐	22	1			RH REAR LOWER MOULDING				150	new	150	Reviewing	☒
☐	23	1			RH REAR DOOR RUBBER				150	new	150	Reviewing	☒
☐	24	1			RH REAR DOOR FRAME MOULDING				160	new	160	Reviewing	☒
☐	25	10			RH REAR DOOR FRAME RIVET				5	new	50	Reviewing	☒
☐	26	1			RH REAR DOOR OUTER MOULDING				130	new	130	Reviewing	☒
☐	27	1			RH FRONT FENDER				230	R	230	Reviewing	☒
☐	28	1			RH FRONT FENDER WHEEL ARCH MOULDING				75	X	75	Reviewing	☒
☐	29	1			RH FRONT FENDER INSULATOR				80	X	80	Reviewing	☒

660

Labour

EDIT	SR NO	REPAIR/REPLACE (LABOUR)	PART NAME	LABOUR RER	LABOUR REPAIR	PAINT	ACTION (LABOUR)	COMMENT	REMOVE
	1		TO REMOVE & TRANSFER ITEMS TO RH SIDE BOTH NEW DOOR	0	200 160	0	Reviewing		
	2		TO REMOVE & INSTALL CARPET, GARNISH, TRIM IN ORDER TO STRAIGHTEN RH SIDE FRONT AND CTR DOOR PILLAR	0	200 100	0	Reviewing		
	3		TO STRAIGHTEN RH FRONT DOOR PILLAR CTR PILLAR AND RENEW DAMAGES PARTS	0	800 600	0	Reviewing		
	4		TO SPRAY PAINT ON REPLACED, REPAIRED AREAS	0	0 800	1200	Reviewing		
	5		TO REPROGRAMMING ALL CONTROL UNITS AFTER REPAIR	0	220 180	0	Reviewing		

KC-1840

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Rahul
Hp 900 10068

8 days

P/P

18/01/18 @ 1800

EXC 883:700

Reser b k paint



SERVICE REQUESTS

MESSAGES

CLAIMS



Assessment Details

General & Workshop Details	Vehicle & Driver Details	Vehicle Condition	Taxes & Ratio	Parts & Labour	Miscellaneous	Summary
----------------------------	--------------------------	-------------------	---------------	----------------	---------------	---------

Claim Amount \$7,785.00

CATEGORY

ESTIMATE

REVISED AMOUNT

Spare Parts

\$5,165.00

~~\$5,165.00~~ 4430

Labour

\$1,420.00

~~\$1,420.00~~ 1060

Paint

\$1,200.00

~~\$1,200.00~~ 800

6270

CD AXA

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Singapore NRIC
Owner ID: 6819G

Vehicle Details

Vehicle No.: SGE2693C
Vehicle to be Exported: Yes
Intended De-registration Date: 15 Jan 2018
Vehicle Make: TOYOTA
Vehicle Model: LEXUS GS300
Primary Colour: Purple
Manufacturing Year: 2006
Engine No.: 3GR0157489
Chassis No.: JTHBG96S605034589
Maximum Power Output: 170.0 kW (227 bhp)
Open Market Value: \$49,476.00
Original Registration Date: 14 Mar 2006
First Registration Date: 14 Mar 2006
Transfer Count: 0
Actual ARF Paid: \$54,424.00

Intended PARF Rebate Details

PARF Eligibility: Forfeited
PARF Eligibility Expiry Date: -
PARF Rebate Amount: \$0.00

Intended COE Rebate Details

COE Expiry Date: 13 Mar 2021
COE Category: B - Car (1601cc & above)
COE Period(Years): 5
PQP Paid: \$25,466.00
COE Rebate Amount: \$16,079.00
Total Rebate Amount: \$16,079.00

Message

Please note that the 5-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 15 Jan 2018

OK



合興汽車零件私人有限公司

HE XING AUTO PARTS PTE LTD

MAIN OFFICE: No. 76 DUNLOP STREET, SINGAPORE 209403

TEL: 6291 2827 FAX: 6296 4390

A/C: 6291 1886 FAX: 6291 7717

Co. Reg. No: 200310923R GST Reg. No: 20-0310923-R

TAX INVOICE

M/S: MOVA AUTOMOTIVE PTE LTD

BLK 1008 #01-04

BUKIT MERAH LANE 3

SINGAPORE 159722

SGE2693C

ALAN

NO: DLD198903

PAGE: 1

DATE: 24/01/2018

A/C CODE: LDMV315

TERMS: CR



	Part No	Description	Location	Qty	Unit Price	Amount
					SIN	SIN
1	T67895-30020	WEATHERSTRIP LEX	DDS	1	130.00	130.00 ✓
2	T67865-30040	DOOR W/STRIP FR LWR RH	DDS	1	130.00	130.00 ✓
3	T68610-30180	DOOR CHECK FR RH	DU1B107	1	150.00	150.00 ✓
4	T69030-30A10	FR DOOR LOCK RH	DDS	1	350.00	350.00 ✓
5	T75071-30080	OUTER MLG FR RH	DU1H21-12	1	150.00	150.00 ✓
6	T69210-30300-B4	OUTER HANDLE FR RH	DDS	1	230.00	230.00 ✓
7	T67861-30280	DOOR W/STRIP FR RH	DU1H14-9	1	150.00	150.00 ✓
8	T69217-28010-A0	COVER, OUTER HANDLE FR LH	DU1P35	1	30.00	30.00 ✓
9	T69201-30040	FR RH HANDLE BASE	DU1B163	1	230.00	230.00 ✓
10	T75710-30480	OUTER MLG FR RH	DU1F23-11	1	110.00	110.00 ✓
11	T75871-30370	WHEEL ARCH MLG FR RH	DU1G18-1	1	75.00	75.00
12	T85710-58010	MOTOR FRT RH	DDS	1	320.00	320.00 ✓
13	T69801-30260	REGULATOR FR RH	DU1C75-1	1	180.00	180.00 ✓
14	T53801-30A10	FENDER FR RH	DB1B40	1	330.00	330.00
15	T68730-30180	DOOR HINGE FR LWR RH	DDS	1	70.00	70.00 ✓
16	T67003-30620	DOOR RR RH	DB1G51	1	580.00	580.00 ✓
17	T75075-30080	OUTER MLG RR RH	DU1H17-1	1	150.00	150.00 ✓
18	T67871-30290	DOOR W/STRIP RR RH	DU1H15-11	1	150.00	150.00 ✓
19	T75730-30360	OUTER MLG RR RH	DDS	1	130.00	130.00 ✓
20	T75707-30080	MOULDING RH	DU1H9	1	160.00	160.00 ✓
21	T75753-30070	DOOR TOP MOULDING RH	DU1H17-8	1	110.00	110.00 ✓
22	T68710-30190	DOOR HINGE FR TOP RH	DU1AD17-11	1	70.00	70.00 ✓

Print / MT / 24/01/2018 10:36:51 AM

Cont'd


Simon
24/1/18

H430



CHEVROLET
PARTS



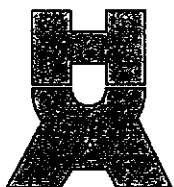

合興汽車零件私人有限公司

HE XING AUTO PARTS PTE LTD

MAIN OFFICE: No. 76 DUNLOP STREET, SINGAPORE 209403

TEL: 6291 2827 FAX: 6296 4390

A/C: 6291 1886 FAX: 6291 7717

Co. Reg. No: 200310923R GST Reg. No: 20-0310923-R

TAX INVOICE

M/S: MOVA AUTOMOTIVE PTE LTD

NO: DL19198903

PAGE

2

Part No	Description	Location	Qty	Unit Price	Amount
				SIN	SIN
23 T53827-30050	PROTECTOR RH	DUIAD33-5	1	80.00	80.00
24 T67001-30840	DOOR FR RH	DB1F3	1	750.00	750.00
25 T90269-04051	RIVET	DUIB11	20	5.00	100.00
TOTAL QUANTITY			41	TOTAL	SIN 4,915.00
				ADD GST @ 7%	344.05
				GRAND TOTAL	<u>SIN 5,259.05</u>

15 FAN YOONG RD

Print / MT 24/01/2018 10:36:51 AM

SALESMAN: MT

This document is computer generated. No signature required.

GOODS SOLD ARE NOT RETURNABLE

