

11/05/2005

ASS. REC. BY:

REF: cs/QBE1800203/T19d3<sup>82</sup>

Special Instruction:

Surveyor:

Turbien

ASSIGNMENT (Office)

From (Person):

Joyce Foo

of

QBE

Date/Time:

1/2/18 @ 2:04pm

Estimated Cost:

Bill to:

☒ OD ☐ IP ☐ WS ☐ TP RES ☐ OD RES ☐ EVA ☐ INV ☐ MV ☐ CS

To Inspect Vehicle No:

XD7032G

Insured:

at Workshop m/s:

Ban Choon Motor

Tel:

6264 1191

of

3 Pioneer Rd North #01-14/15

Policy No:

Claim No:

VC010951

Excess:

\$1,500.00

2000 USD

Sum Insured:

D.O.A.

05/12/2017

Make of Veh:

02/02/2018

(Client's Record)

H.O.D. Endorsement:

CA / ☒ REV /

REP. / REV 24 HRS

wp?

Date/Time:

2:15pm @ 1/2/18

Person Contacted:

Perlin

Vehicle ☒ IN ☐ OUT

Date/Time

Action/Instruction

☒

Estimate

XD7032G-X

05/2/18 @ 3:05pm revert to Joyce Foo by email.

09/3/18 @ 11:12am Jenny Toh informed CA &amp; EX: \$2000 by email.

09/3/18 @ 11:37am Informed Perlin C/A &amp; EX: \$2000 by email.

21/6/18 @ 3:28pm confirmed with Perlin US \$27200 (Red \$16977.15, 38%).

REF: QBE

## ASSIGNMENT

Event: 2/2/18

Estimated Cost: TP / WS / TP RES / OD RES / EVA / INV / MV

To inspect Vehicle No: XD7032G

at Workshop No: Ban Choon Motor

at 3 Pioneer Rd North # 01-14/15

Insured: Policy No:

Claims No: Sum Insured: Excess: \$1,500.00

Make of Vehicle: Client's Record:

Policy Condition: 

<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>
NIS	OIS

Remark: The veh had commenced its repair at the time of inspection.

Bel. or Market Value: 120k

QAC Accident Report: Consistent? Yes or No

GIA: PR Seen: Consistent? Yes or No

Est. Repairs: 75 days Res: Yes or No

Lum. Surv: 3 Val: Yes or No

CA: FEV REP: 24 HRS

Date: Person Contacted: Vehicle: IN / OUT

Event: XD7032G Date: 2015 March

Type: M Car / M Cycle / Bus / Van / Lorry / Taxi / Prime Mover

Truck / Trailer: Tipper Truck.

Make: Volvo FMX420 No: 12777.

Colour: White Insured / Std / Nil / NA

So Reading: — Reps Insured / Std / Nil / NA

Eng No: yv2Jh1062DA740237

CIN: Gen Cond: Good / Fair / Poor / Burnt

Steering: Indoor / Jammed / Leaked / Burnt or

Brake: Indoor / Jammed / Leaked / Burnt or

Mod: NO / S Rim / STD A/Rim or

Tyre Size: 315/80R22.5

BS / DUN / EXNOVA / GY / PS / LIZA / MIC / OHTSU / PIR / SUM /

TOYO / YOKO or: Technique

Front: 9 Rear: 9/7

R. Bal: 9 L. Bal: 9/5

D.O.A: 2/2/18

Survey held at: Ban Choon Motor.

Des. of Damages: Front / Rear / OIS / NIS / UIC / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision

Date Time Action Instruction \* battery weaker

RECEIVED 21 JUN 2018

Date Time File Passed: 2/6 August

Date Time File Returned: 27/08

Days Of Repair: 75

Resurvey No. of Trip: 1

Add Fee: ☐ Stained 3

☐ High 3

☐ Tear 3

☐ Peeling 3

Survey Fee: 300

Participation: —

Other: —

Total: —

Report Format: 00

Lump Sum / 27/08



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
QBE INSURANCE (SINGAPORE) PTE LTD			Ref : CS/QBE18002037/T1qd3	
1 RAFFLES QUAY #29-10 SOUTH TOWERS SINGAPORE 048583			Date : 01-02-2018	
			Code : QBE	
<b>1. Policy Particulars :- OWN DAMAGE</b>				
Insured Veh.		Veh. Inspected		XD 7032G
Policy No.		Coverage (\$)		0.00
Claim No.	VC010951	Excess (\$)		1,500.00
Assign From	JOYCE FOO	Assign Date		01/02/2018
<b>2. Vehicle Particulars &amp; Condition</b>				
Make & Model		c.c		0
Engine No.	HIDDEN	Year of Reg.		
Chassis No.		Colour		
Odometer		Steering		
Brakes		Modification		
General				
<b>3. Conditions of Tyres</b>				
	Size	Make	Balance	
R/H Front Tyre			mm	
L/H Front Tyre			mm	
R/H Rear Tyre			mm	
L/H Rear Tyre			mm	
<b>4. Description of Damages</b>				
<b>5. General Information</b>				
Accident Date		05/12/2017	Inspection Date	
Survey held at		BAN CHOON MOTOR WORKS 3 PIONEER ROAD NORTH #01-14/15 SINGAPORE 628457		
<b>5a. Remarks</b>				
A) THE MARKET VALUE IS S\$----- (EST. AVERAGE) B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE AUTHORISED REPAIRS.				

## Nivitha (LKK Auto)

---

**From:** Shu Pei (LKKAuto) <shupeilkkauto.com>  
**Sent:** Thursday, 1 February 2018 2:04 PM  
**To:** assignments  
**Subject:** FW: Request for OD survey - XD 7032 G - OUR REF. VC010951  
**Attachments:** XD 7032 G.pdf; 01022018125823.pdf

Best Regards,  
Shu Pei | Admin  
LKK Auto Consultants Pte Ltd  
Phone: 6366-0055 | email: shupeilkkauto.com | fax: 6741-4108 Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1,  
#02-25 | S(408933)

-----Original Message-----

From: Joyce Foo [mailto:joyce.foo@qbe.com]  
Sent: Thursday, 1 February 2018 1:52 PM  
To: Admin A <admin-a@lkkauto.com>  
Cc: Jenny Toh <jenny.toh@qbe.com>  
Subject: FW: Request for OD survey - XD 7032 G - OUR REF. VC010951

Our Ref. VC010951

Hi

Please assist to arrange OD survey. Policy excess : \$1500/-.

Please survey and revert.

Thank You & Best Regards

---

Joyce Foo  
Senior Assistant - Claims  
QBE Asia Pacific – Singapore

QBE Insurance (Singapore) Pte Ltd  
Phone: +65 6477 1184  
Email: joyce.foo@qbe.com  
Visit us on the web at [www.qbe.com.sg](http://www.qbe.com.sg)

-----Original Message-----

From: perlin [mailto:banchoon@singnet.com.sg]  
Sent: Thursday, 1 February, 2018 1:08 PM

To: Jenny Toh <jenny.toh@qbe.com>; Joyce Foo <joyce.foo@qbe.com>  
Subject: Request for OD survey - XD 7032 G

Hi

Attached herewith are vehicle no. XD 7032 G GIA Report and quotation  
for your reference.

Vehicle is already in the workshop. Please arrange to survey this vehicle asap.

Thanks & Regards.

Perlin

-----  
IMPORTANT NOTICE : The information in this email is confidential and may also be privileged. If you are not the intended recipient, any use or dissemination of the information and any disclosure or copying of this email is unauthorised and strictly prohibited. If you have received this email in error, please promptly inform us by reply email or telephone. You should also delete this email and destroy any hard copies produced.

## Shiau Chan (LKKAUTO)

---

**From:** Shiau Chan (LKKAUTO)  
**Sent:** Tuesday, 5 June 2018 5:42 PM  
**To:** Jenny Toh  
**Cc:** SUR  
**Subject:** RE: Request for OD survey - XD 7032 G - OUR REF. VC010951

Dear Jenny,

Noted with thanks.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: [siewsc@lkkauto.com](mailto:siewsc@lkkauto.com) | fax: 6256-4315 Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

-----Original Message-----

From: Jenny Toh [<mailto:jenny.toh@qbe.com>]

Sent: Tuesday, 5 June 2018 5:32 PM

To: Shiau Chan (LKKAUTO) <[siewsc@lkkauto.com](mailto:siewsc@lkkauto.com)>

Cc: SUR <[sur@lkkauto.com](mailto:sur@lkkauto.com)>

Subject: RE: Request for OD survey - XD 7032 G - OUR REF. VC010951

Hi Shiau Chan

Confirmed excess \$1,500.00 apply.

regards

---

Jenny Toh  
Senior Assistant, Claims  
QBE Emerging Markets – Singapore

QBE Insurance (Singapore) Pte Ltd  
Phone: +65 6477 1225  
Email: [jenny.toh@qbe.com](mailto:jenny.toh@qbe.com)  
Visit us on the web at [www.qbe.com.sg](http://www.qbe.com.sg)

-----Original Message-----

From: Shiau Chan (LKKAUTO) [<mailto:siewsc@lkkauto.com>]

Sent: Friday, 1 June, 2018 9:40 AM

To: Jenny Toh <[jenny.toh@qbe.com](mailto:jenny.toh@qbe.com)>

Cc: SUR <[sur@lkkauto.com](mailto:sur@lkkauto.com)>

Subject: RE: Request for OD survey - XD 7032 G - OUR REF. VC010951

Dear Jenny,

Kindly confirm the excess of above vehicle is \$1,500.00 or \$2,000.00.

## Shiau Chan (LKKAuto)

---

**From:** Shiau Chan (LKKAuto)  
**Sent:** Friday, 9 March 2018 11:37 AM  
**To:** banchoon@singnet.com.sg  
**Cc:** SUR  
**Subject:** VEHICLE XD 7032G (DOA: 05/12/2017)

Dear Perlin,

As spoken with you.

As instructed by our client QBE Insurance, please proceed to repair the insured vehicle **XD 7032G (excess \$2,000/-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

\*Our client reserve their right **not to pay** if there is no valid approval obtained before repair.

Best Regards,

**Shiau Chan (Ms)** | Case Handler

**LKK Auto Consultants Pte Ltd**

Phone: 6256-3561 | email: [siewsc@lkkauto.com](mailto:siewsc@lkkauto.com) | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

## Shiau Chan (LKKAUTO)

---

**From:** Jenny Toh <jenny.toh@qbe.com>  
**Sent:** Friday, 9 March 2018 11:12 AM  
**To:** Shiau Chan (LKKAUTO)  
**Cc:** SUR; Jenny Toh  
**Subject:** RE: Request for OD survey - XD 7032 G - OUR REF. VC010951

Dear Shiau Chan

Kindly authorised repair. Excess should be \$2,000.00 instead of \$1,500.00.

regards

---

Jenny Toh  
Senior Assistant, Claims  
QBE Emerging Markets – Singapore

QBE Insurance (Singapore) Pte Ltd  
Phone: +65 6477 1225  
Email: jenny.toh@qbe.com  
Visit us on the web at [www.qbe.com.sg](http://www.qbe.com.sg)

-----Original Message-----

From: Shiau Chan (LKKAUTO) [mailto:[siewsc@lkkauto.com](mailto:siewsc@lkkauto.com)]  
Sent: Friday, 9 March, 2018 10:58 AM  
To: Jenny Toh <jenny.toh@qbe.com>  
Cc: SUR <[sur@lkkauto.com](mailto:sur@lkkauto.com)>  
Subject: RE: Request for OD survey - XD 7032 G - OUR REF. VC010951

Dear Jenny,

Kindly advise on authorisation.

Best Regards,  
Shiau Chan (Ms) | Case Handler  
LKK Auto Consultants Pte Ltd  
Phone: 6256-3561 | email: [siewsc@lkkauto.com](mailto:siewsc@lkkauto.com) | fax: 6256-4315 Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1,  
#02-25 | S(408933)

-----Original Message-----

From: Shiau Chan (LKKAUTO)  
Sent: Tuesday, 27 February 2018 8:56 AM  
To: Jenny Toh <jenny.toh@qbe.com>  
Cc: SUR <[sur@lkkauto.com](mailto:sur@lkkauto.com)>  
Subject: FW: Request for OD survey - XD 7032 G - OUR REF. VC010951

Dear Jenny,

As per your requested.



**Shiau Chan (LKKAUTO)**

---

**From:** Shiau Chan (LKKAUTO)  
**Sent:** Monday, 5 February 2018 3:05 PM  
**To:** 'Joyce Foo'; assignments  
**Cc:** SUR  
**Subject:** RE: Request for OD survey - XD 7032 G - OUR REF. VC010951  
**Attachments:** CSQBE1800203T1qb.pdf

Dear Joyce,

Enclosed herewith preliminary advice of XD 7032G.  
We have not authorised repair.

Kindly advise on authorisation.

Best Regards,  
Shiau Chan (Ms) | Case Handler  
LKK Auto Consultants Pte Ltd  
Phone: 6256-3561 | email: [siewsc@lkkauto.com](mailto:siewsc@lkkauto.com) | fax: 6256-4315 Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1,  
#02-25 | S(408933)

-----Original Message-----

**From:** Admin-D (LKKAUTO)  
**Sent:** Thursday, 1 February 2018 2:17 PM  
**To:** 'Joyce Foo' <[joyce.foo@qbe.com](mailto:joyce.foo@qbe.com)>; assignments <[assignments@lkkauto.com](mailto:assignments@lkkauto.com)>  
**Cc:** SUR <[sur@lkkauto.com](mailto:sur@lkkauto.com)>  
**Subject:** RE: Request for OD survey - XD 7032 G - OUR REF. VC010951

Dear Sir/Mdm,

Thank you for the assignment.

BEST REGARDS,  
G.Nivitha | Admin  
LKK Auto Consultants Pte Ltd  
Phone: 6841-1972 | email: [assignments@lkkauto.com](mailto:assignments@lkkauto.com) | fax: 6256-4315 Blk 51, Paya Ubi Industrial Park, Ubi Avenue  
1, #02-25 | S(408933)

-----Original Message-----

**From:** Joyce Foo [<mailto:joyce.foo@qbe.com>]  
**Sent:** Thursday, 1 February 2018 1:52 PM  
**To:** Admin A <[admin-a@lkkauto.com](mailto:admin-a@lkkauto.com)>  
**Cc:** Jenny Toh <[jenny.toh@qbe.com](mailto:jenny.toh@qbe.com)>  
**Subject:** FW: Request for OD survey - XD 7032 G - OUR REF. VC010951

Our Ref. VC010951

Hi

Please assist to arrange OD survey. Policy excess : \$1500/-.



Auto  
Consultants  
Pte Ltd

51 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Your Ref: VC010951

Date: 05<sup>th</sup> February 2018

Our Ref: CS/QBE1800203/T1qd3

Without Prejudice

The Motor Claims Department  
QBE Insurance

Attn: Joyce

Dear Sirs/Mdm

**PRELIMINARY ADVICE OF VEHICLE NO. XD 7032G.**


We thank you for the instruction on 01/02/2018.

Please be informed that we had conducted the inspection of the abovementioned vehicle on 02/02/2018 at the premises of M/s BAN CHOO MOTOR and have the following to report:-

Workshop Estimate Amount	: S\$ <u>44,177.15</u>
Revised Estimate Amount	: S\$ <u>23,565.85</u>
"Check" Items Amount	: S\$ <u>19,061.30</u>
Market Value	: S\$ <u>120,000.00</u>
LTA Reimbursement Value	: S\$ <u>28,056.00</u>
Nett Value	: S\$ <u>91,944.00</u>

Description of Damage:

The vehicle sustained damages at the front portion.

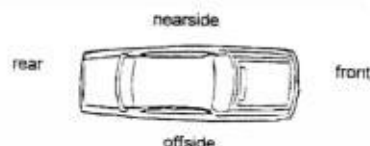

Comments/ Present Status:

Damages consistent.

Repair cost economical

Days of repair: 25 days.

We have not authorized repair.

Yours faithfully

Taufikh  
Automobile Assessor

## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

Date Of Report	06/12/2017 14:54
Date Of Accident	05/12/2017 12:30
Exact Location Of Accident	TPE TWDS SLE AFTER EXIT 6
Country/State of Loss	SINGAPORE

### DETAILS OF OWN VEHICLE

Vehicle Registration Number	XD7032G
<b>Insured/Policyholder</b>	
Name Of Registered Owner	KOK TONG TRANSPORT & ENGINEERING WORKS PTE LTD
Co Reg No	199904117E
Email Address	KINH0E.NG@KTCGROUP.COM
Mobile Phone No	
Alternative Phone No	OFFICE-64874646

### Vehicle Particulars

Manufacturer	VOLVO
Model	FMX420

Exact Purpose for which vehicle was being used at time of accident

Are you claiming under your own insurance policy for repair to your vehicle? YES

If No, Please state action to be taken

Vehicle Category	COMMERCIAL VEHICLE
------------------	--------------------

### Insurance Company

Name of Insurance Company	QBE INSURANCE (SINGAPORE) PTE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	8-V0009810-MVA-R002
Cover Note Number	

### Driver

Name of Driver	GOTHANDAM ARUN
NRIC No	S7867774J
Date Of Birth	20/03/1978
Occupation	INDOOR
Date Of Driving Pass	12/10/2009
Driving Experience	8 YEARS AND 1 MONTH
Gender	MALE
Mobile Number	(LOCAL) +65-92721053
Fax Number	
Contact Number	
Email Address	NOEMAIL

Address	BLK 522 WOODLANDS DRIVE 14 #04-373
Postcode	730522
Was driver an employee of the Insured's Company	YES
If No, Relationship of the Driver with the Insured	
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

#### General Information of the Accident

Type Of Accident	COLLISION - HEAD TO REAR
Weather Conditions	CLEAR
Road Surface	DRY

#### Other Information

Was any foreign vehicle involved in this accident?	NO
Was any body injured in the Accident?	YES
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

#### Details of Police Action

Was the accident reported to the police?	YES
If Yes, Please state which Police Station	
Police Station Name	SENGKANG NPC
Police Station Address	ROAD: 2 SENGKANG SQUARE #01-02 , POSTCODE: 545025 , COUNTRY: SINGAPORE
Police Station Contact	TEL NO: - FAX NO:
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

#### Circumstances of Accident

REFER TO POLICE REPORT: T/20171205/2120.

#### Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

#### DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	XB7908R
Vehicle Make/Model/Colour	
Details Of Properties	VEHICLE B
Name of Driver	
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

#### Details of Witness

Name	
Phone Number	

Email Address

#### DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number YM7560P  
Vehicle Make/Model/Colour  
Details Of Properties VEHICLE C  
Name of Driver  
NRIC/Passport Number  
Contact Number  
Address  
Postcode  
Insurance Company Name  
Nature Of Damage  
No. Of Passenger (Including Driver)

#### Details of Witness

Name  
Phone Number  
Email Address

#### DETAILS OF INJURED PERSON 1

Name VEH B DRIVER  
Approximate Age  
Injuries Sustain  
Injured person in which vehicle? XB7908R  
Were seat belts worn?  
Was injured conveyed to hospital by ambulance?  
Address  
Postcode

#### DETAILS OF INJURED PERSON 2

Name VEH C DRIVER  
Approximate Age  
Injuries Sustain  
Injured person in which vehicle? YM7560P  
Were seat belts worn?  
Was injured conveyed to hospital by ambulance?  
Address  
Postcode

#### DETAILS OF INJURED PERSON 3

Name PASSENGER  
Approximate Age  
Injuries Sustain  
Injured person in which vehicle? YM7560P  
Were seat belts worn?  
Was injured conveyed to hospital by ambulance?  
Address  
Postcode

## Sketch Plan Pg. 1

### SKETCH PLAN

#### IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This Form must be **completed by the Policyholder and/or the Authorised Driver**.
3. Information provided must be as **truthful and accurate as possible**. Any wilful misrepresentation or withholding of material facts may allow insurance companies to **repudiate policy liability**.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. The report will be forwarded by the Insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the Insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
  - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
  - (ii) investigating the accident and/or my claims;
  - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
  - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
  - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
  - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
  - (ii) for complying with requirements under any regulations, laws or court orders.



Policyholder's Signature  
Date & Time:

Driver's Signature  
(If driver is not the policyholder)  
Date & Time:

Reporting Centre Personnel's Signature  
Name:  
NRIC/FIN No.:


## Sketch Plan #2 Pg. 1

### SKETCH PLAN

A) XD 7032 G

3) XB 7908R

c) YM 7560 P

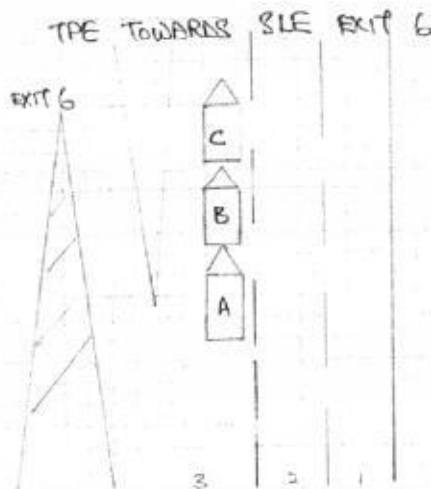

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

As per Police Report NO 7	20FF 1205	2120
---------------------------	-----------	------

## DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature

Date &amp; Time:

Driver's Signature

(If driver is not the policyholder)

Date &amp; Time:

Reporting Centre Personnel's Signature

Name:

NRIC/FIN No.:

## Sketch Plan #3 Pg. 1



**SINGAPORE  
POLICE FORCE**



T/20171205/2120

1 of 3

Police Station Of Origin:  
Sengkang N.P.C  
2 Sengkang Square #01-02 SINGAPORE  
545025  
Tel No: 1800-343 8999

Report No. T/20171205/2120

## REPORT OF A TRAFFIC ACCIDENT

Date/Time Report Made: 05/12/2017 17:08	Vide Report No.: G/20171205/0105	Station Diary No.: 115
--	-------------------------------------	---------------------------

## Informant's Particulars

Name of Informant: GOTHANDAM ARUN			Address: APT BLK 522 WOODLANDS DRIVE 14 #04-373 SINGAPORE 730522	
ID Type / ID No.: NRIC NO / S7867774J			Contact No.: Home/Office: Mobile: 92721053	
Nationality: INDIAN			Email:	
Sex: Male	Age: 39	Date of Birth: 20/03/1978	Type of Informant: Driver	
Race: Indian			Language: English	Institution / School Name:
Occupation: DRIVER			Driving Licence Information: Class: 3,4 Date of Expiry:	

## General Information of the Accident

General Information of Accident				
Type of Accident:	Injury Conveyed By Ambulance	Drink Drive: No	Date/Time of Accident: 05/12/2017 12:30	Type of Location: Straight Road
Location: Along Road 1 TAMPINES EXPRESSWAY				
AT ALONG TPE TOWARDS SLE, AFTER EXIT 6				
Weather: Clear		Road Surface: Wet		Road Speed Limit:
Traffic Flow: Two Way		Traffic Control: Not Controlled		Traffic Volume: Moderate
Type of Collision: Between Moving Vehicles - Head To Rear				Anyone conveyed by ambulance: Yes

## Details of Vehicle Involved

Vehicle No.	Type	Make	Model	Color	Condition	No of Passenger
XB7908R	Lorry					0
XD7032G	Lorry	VOLVO	FMX420 84RT SC	White	Seriously Damaged	0
YM7560P	Lorry					1





**SINGAPORE  
POLICE FORCE**



T/20171205/2120

2 of 3

Police Station Of Origin:  
Sengkang N.P.C  
2 Sengkang Square #01-02 SINGAPORE  
545025  
Tel No: 1800-343 8999

Report No. T/20171205/2120

## CONTINUATION OF REPORT

<b>Details of Person Involved</b>			
Any Pedestrian Involved: No			
No. of Pedestrians Injured: NIL		Use of Pedestrian Crossing: NA	
<b>Driver</b>			
Name	GOTHANDAM ARUN	ID No.	S7867774J
Related Vehicle	NIL	Contact No.	92721053
Hospital/Clinic	NIL	Class of Driving Licence & Expiry Date	Class: 3,4 Date of Expiry: NIL
Date Treatment	NIL	Date Discharge	NIL
No. of Days granted Medical Leave	NIL	Degree of Injury	NIL

**Brief Details.**

On 05/12/2017 at about 1230hrs, I (XD7032G) was driving at along TPE towards SLE after the exit 6. I was driving at the most outer left lane out of the three lane roads. There were constructions going on at the express way.

A vehicle ahead of me bearing registration number XB7908R suddenly jammed brake as such I could not react in time, I was not able to stop the vehicle in time. The front portion of the vehicle collided onto the rear portion of the vehicle. Due to the collision from my vehicle, the vehicle in front of me collided onto the vehicle in front of it (YM7560P)

Traffic police attended. Driver of XB7908R and both driver and passenger of YM7560P was conveyed by the ambulance.  
vide Incident G/20171205/0105 in charge case: Ivan c/n: 65476170

I do not have any in built camera in my lorry.

This is not the first time such incident happened.



**SINGAPORE  
POLICE FORCE**



T/20171205/2120

3 of 3

Report No. T/20171205/2120

Police Station Of Origin:  
Sengkang N.P.C  
2 Sengkang Square #01-02 SINGAPORE  
545025  
Tel No: 1800-343 8999

CONTINUATION OF REPORT

**Sketch Plan**

Informant is not able to provide sketch plan

IMPORTANT: Please attach a copy of your vehicle's Insurance Certificate to this report. If you don't have the certificate with you now, please fax a copy to 65474885 stating the report number as reference.

Signature Of Officer Recording The Report:

F /

Staff Sgt TEY LI TING, FION

Signature Of Informant:

Signature Of Interpreter:

Not applicable

Date/Time:

05/12/2017 17:08

Officer In Charge Of Case:

TP / GIT /

Classification Of Case:

Contact No.:

Authentication Stamp

NP168

## Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Company
Owner ID:	4117E
Vehicle Details	
Vehicle No.:	XD7032G
Vehicle to be Exported:	No
Intended De-registration Date:	05 Feb 2018
Vehicle Make:	VOLVO
Vehicle Model:	FMX420 84RT SC
Primary Colour:	White
Manufacturing Year:	2012
Engine No.:	D13379052
Chassis No.:	YV2JG10G2DA740237
Maximum Power Output:	-
Open Market Value:	\$136,767.00
Original Registration Date:	13 Mar 2013
First Registration Date:	13 Mar 2013
Transfer Count:	0
Actual ARF Paid:	\$6,839.00
Intended PARF Rebate Details	
PARF Eligibility:	No
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00
Intended COE Rebate Details	
COE Expiry Date:	12 Mar 2023
COE Category:	C - Goods Vehicle & Bus
COE Period(Years):	10

QP Paid:	\$54,989.00
COE Rebate Amount:	\$28,056.00
<b>Total Rebate Amount:</b>	<b>\$28,056.00</b>

The information contained herein is correct as at 05 Feb 2018

OK



# 萬 春 摩 哆 BAN CHOON MOTOR WORKS

Blk 3, Pioneer Road North #01-14/15 Singapore 628457

Tel: 6264 1191 Fax: 6261 1324

E-mail: banchoon@singnet.com.sg

Business Reg./GST Reg. No. 351915/00A

**GST Regn No. 35191500A**

01/02/2018

QBE Insurance (Singapore) Pte Ltd  
1 Raffles Quay  
#29-10 South Tower  
Singapore 048583

Attn: Motor Claims Dept.

Dear Sirs

QUOTATION FOR REPAIRS OF VEHICLE NO. XD 7032 G

MODEL: VOLVO FMX420

DATE OF ACCIDENT: 05/12/2017

POLICY NO. 8-V0009810-MVA-R002

LKK Auto Consultants hence notify  
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

	Code No		\$	
1 pc	1	Front windscreen	518.00	ana ✓
1 pc	2	Front windscreen rubber	285.00	ana ✓
1 pc	3	Wiper panel	1,424.00	bt ✓
1 pc	4	Wiper panel top garnish	570.00	ana ✓
1 pc	5	Wiper panel top garnish seal	33.00	ana ✓
1 pc	6	Front panel	1,293.00	ana ✓
2 pcs	7	Front panel hinges @ \$93.00 each	186.00	bt ✓
1 pc	8	Front panel air scoop garnish bracket	38.00	dis ✓
2 pcs	9	Front panel hinge covers @ \$45.00 each	90.00	ana ✓
2 pcs	10	Front panel shock absorbers @ \$100.00 each	200.00	bt ✓
2 pcs	11	Front panel locks @ \$86.00 each	172.00	bt ✓
1 pc	12	Front panel cross member <i>bumper</i>	2,542.00	bt ✓
2 pcs	13	Front panel inner brackets @ \$611.00 each	1,222.00	X nn ✓
2 pcs	14	Front panel anchorage @ \$563.00 each	1,126.00	X nn ✓
1 pc	15	Front grille	825.00	ana ✓
1 pc	16	LH control panel	250.00	dis ✓
1 pc	17	LH control panel bracket	132.00	dis ✓
1 pc	18	Front bumper carrier rail	526.00	bt ✓
1 pc	19	Front bumper bottom guard	277.00	bt ✓
1 pc	20	Front grille top panel	61.00	ana ✓
2 pcs	21	Front grille top side lower panels @ \$54.00 each	108.00	dis ✓
1 pc	22	Front bumper grille	252.00	ana ✓
2 pcs	24	Front bumper grille hinges @ \$93.00 each	186.00	bt ✓
2 pcs	25	Front bumper side retainers @ \$27.00 each	54.00	ana ✓
2 pcs	26	Front bumper side @ \$196.00 each	392.00	dis ✓
2 pcs	27	Front bumper side cover screws @ \$10.00 each	20.00	ana ✓
2 pcs	28	Front bumper side garnishes @ \$26.00 each	52.00	dis ✓
1 pc	29	Front bumper guard plate	187.00	dis ✓

1 pc	31	Front bumper guard plate
1 pc	30	Front bumper guard plate bracket
2 pcs	32	Headlamp housings @ \$135.00 each
2 pcs	33	Headlamp cover plates @ \$173.00 each
2 pcs	34	Headlamp housing inner brackets @ \$249.00 each
1 pc	35	LH top headlamp
1 pc	36	LH lower headlamp
1 pc	37	LH indicator lamp
1 pc	38	Hand pump
1 pc	39	Cylinder
1 pc	40	Wiper motor
1 pc	41	Wiper motor bracket
1 pc	42	Radiator
2 pcs	43	Radiator brackets @ \$314.00 each
1 pc	44	Dashboard
1 pc	51	Dashboard bracket
1 pc	45	Console box
1 pc	46	Cooling coil
1 pc	47	Air con condenser
2 pcs	48	Cabin shock absorbers @ \$250.00 each
1 pc	52	LH fuse box
1 pc	49	Anti roll bar
2 pcs	50	Anti roll bar stoppers @ \$82.00 each

Add: 15% profit on parts cost

1 pc	ERP bracket
1 pc	Front number plate
10 lit	Coolant

328.00	bt ✓
244.00	dis ✓
270.00	are ✓
346.00	dis ✓
498.00	Xnn ✓
228.00	ms ✓
110.00	ms ✓
69.00	ms ✓
736.00	bt ✓
1,263.00	Xnn ✓
418.00	Xnn ✓
574.00	bt ✓
2,010.00	bt ✓
628.00	bt ✓
2,004.00	photo Xnn ✓
324.00	Xnn ✓
885.00	ide ✓
3,089.00	bt ✓
1,895.00	bt ✓ 1300
500.00	bt ✓
120.00	as ✓
2,917.00	bt ✓
164.00	bt ✓
<hr/>	
\$ 32,641.00	
4,896.15	
<hr/>	
\$ 37,537.15	
15.00	SN me ✓
35.00	SN bt ✓
80.00	SN me ✓

#### LABOUR CHARGES:

To dismantle and reassemble of front windscreen
To dismantle and reassemble of air con unit and refill of air con gas
Check wiring
To dismantle and refix of dashboard.
To dismantle and refix of cushion upholstery
To knocking and straightening of all necessary damaged parts, 3rd day
To changing of the above part.
To putty and spray painting on accident damaged parts.

80.00	✓
100.00	✓
150.00	100.
280.00	200
100.00	80.
4,000.00	3000
1,800.00	1400.
<hr/>	
\$ 44,177.15	

Yours faithfully,

*Peelindoxe*

*[Signature]*  
19/2/18

Tanpin 97495749

-wp

2/2/18 @ 1645.

Ex \$1500


Revent.

Resurvey after paint.

Unipsum.

25 days.

①

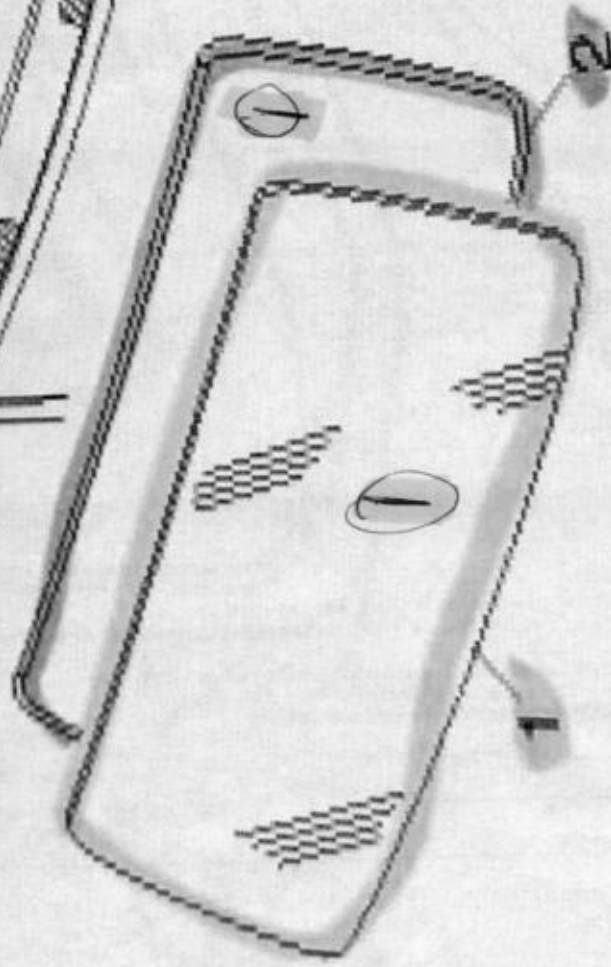


\$518.00

(WINDOW SCREEN)



\$281.00

(SEAL)

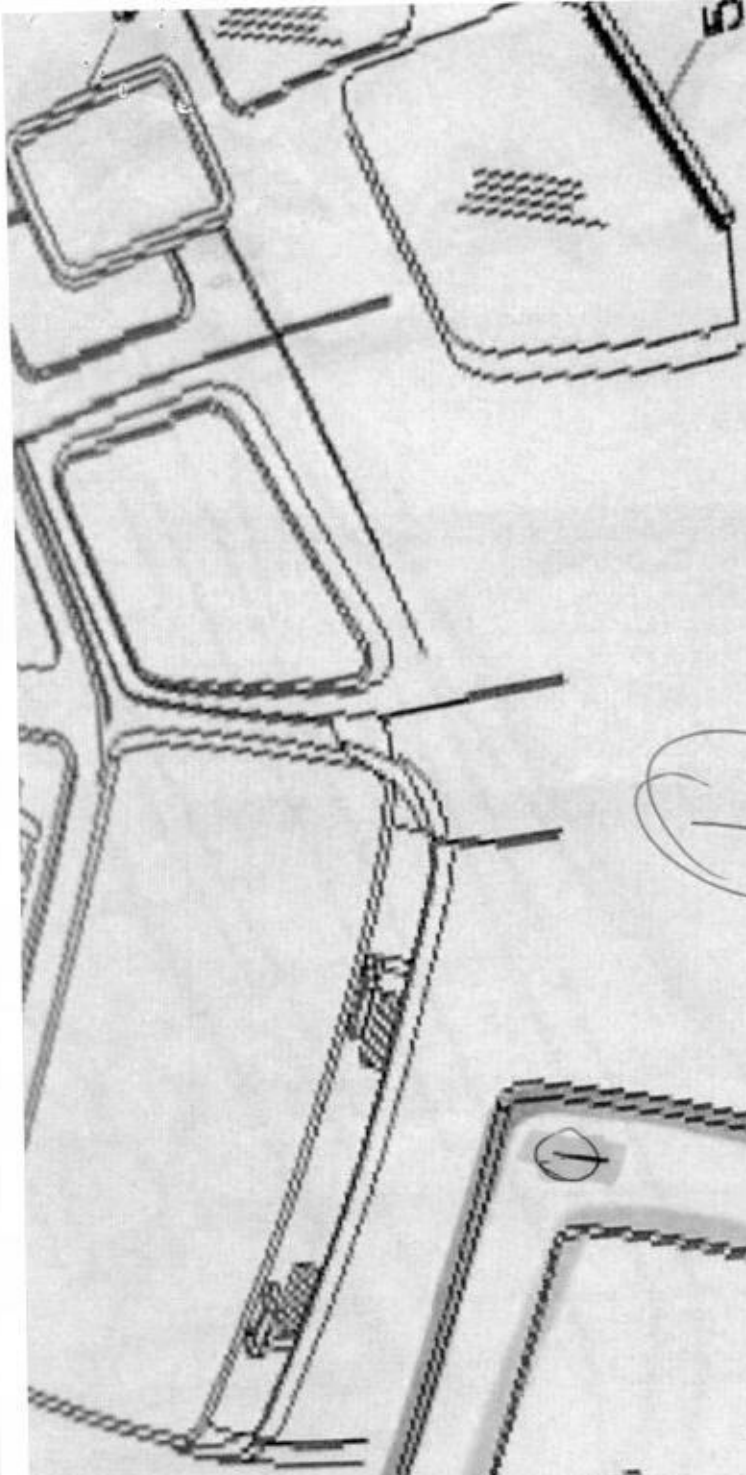





Grille (cab) (Identity: TB-74925632-17)

NO 14: \$53.00 (HANDLE)

NO 15: \$39.00 (COVER)

NO 32 A: \$33.00 (SEAL)

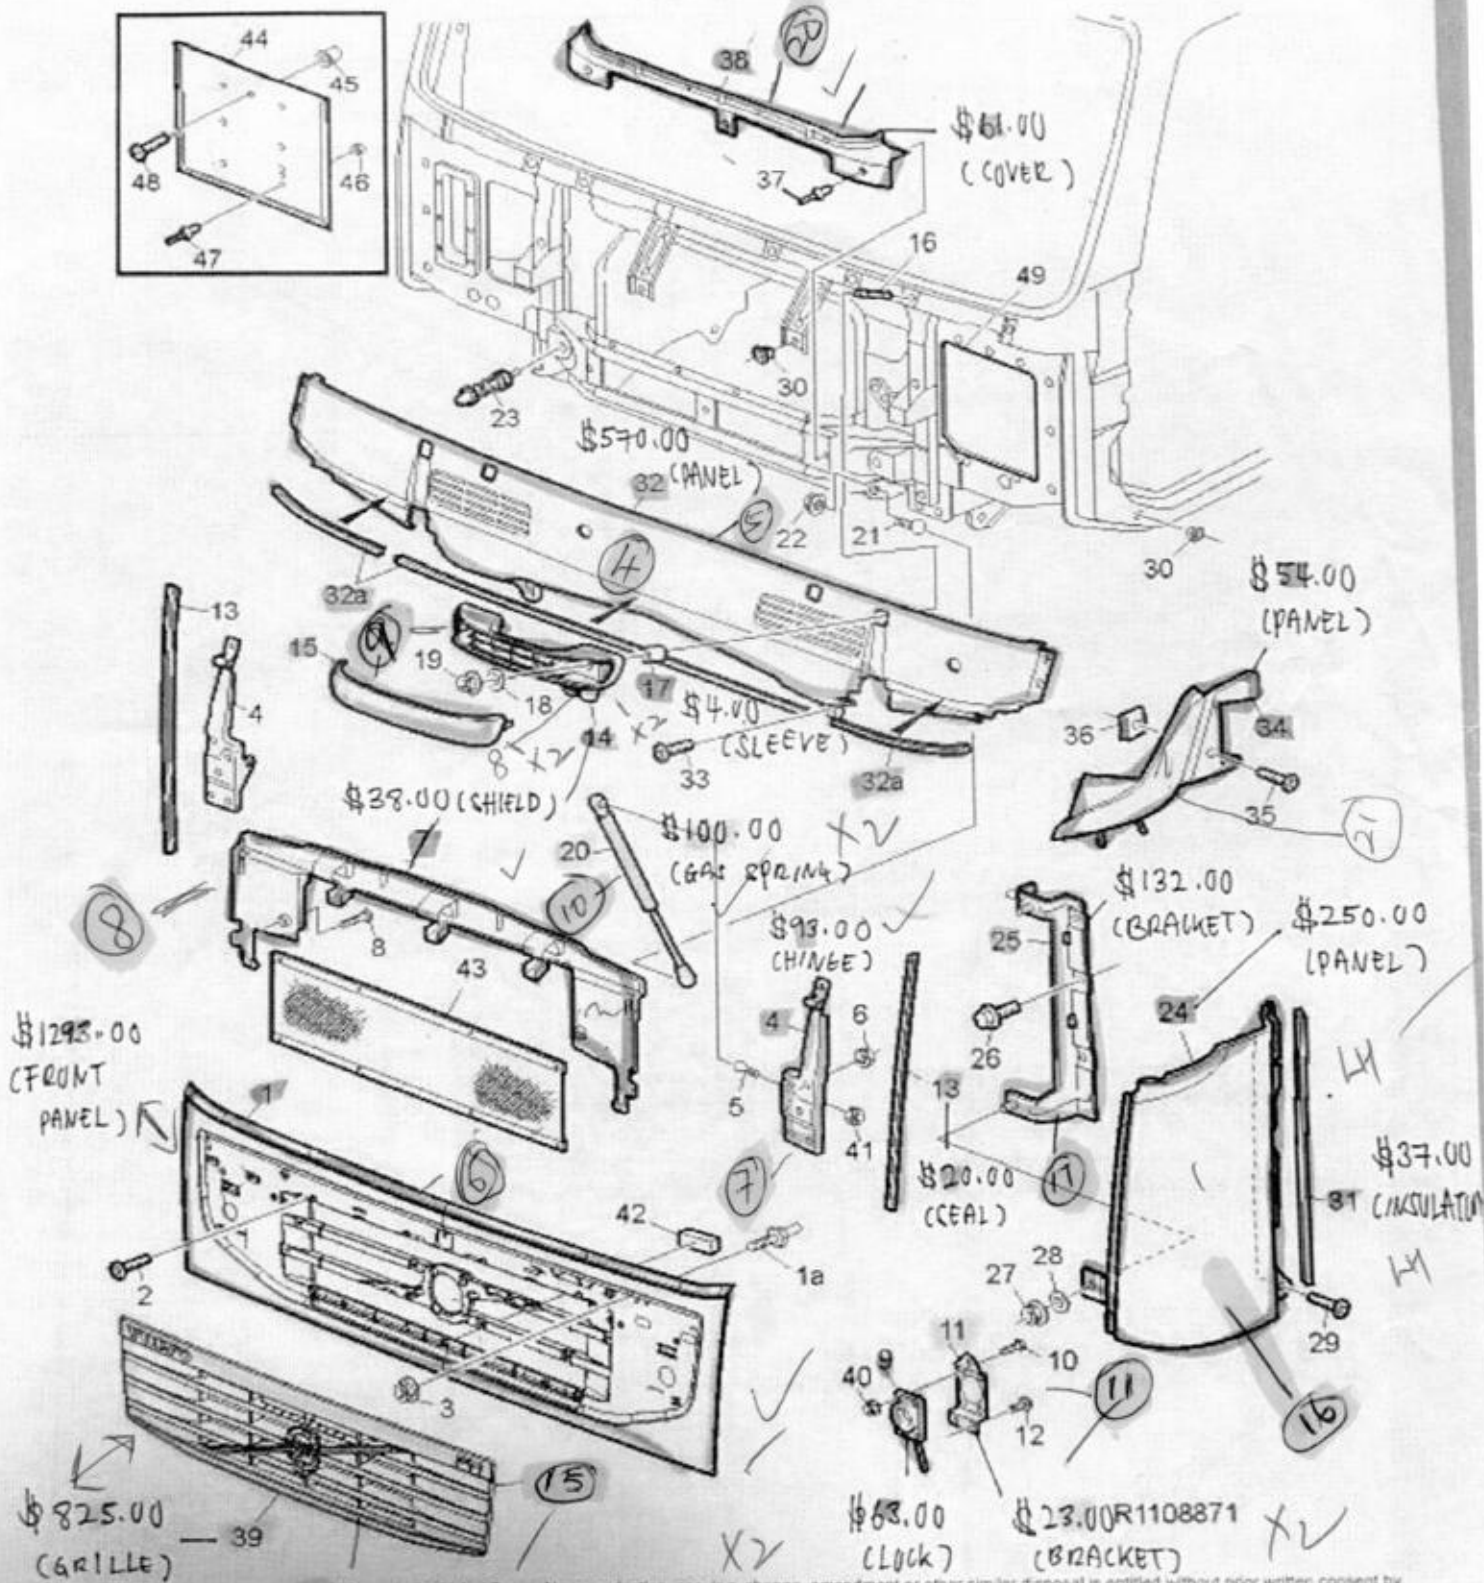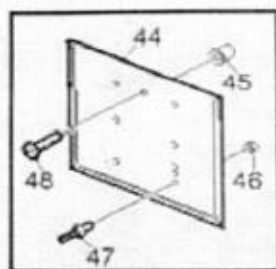


Copyright to this documentation belongs to the Volvo Group. No reproduction, copying, change, amendment or other similar disposal is entitled without prior written consent by the Volvo Group.


The information contained herein is current at the time of its original distribution, but is subject to change. The reader is advised that printed copies are uncontrolled.



CCW  
\$30.00

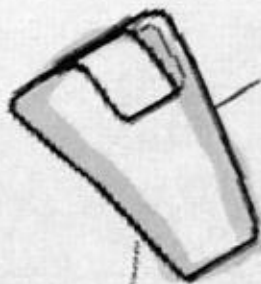


100

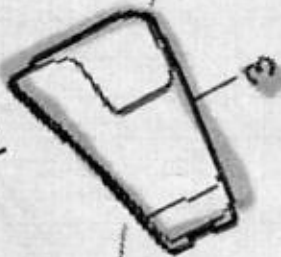


\$81.00  
C DIRECTION  
INDICATOR


147

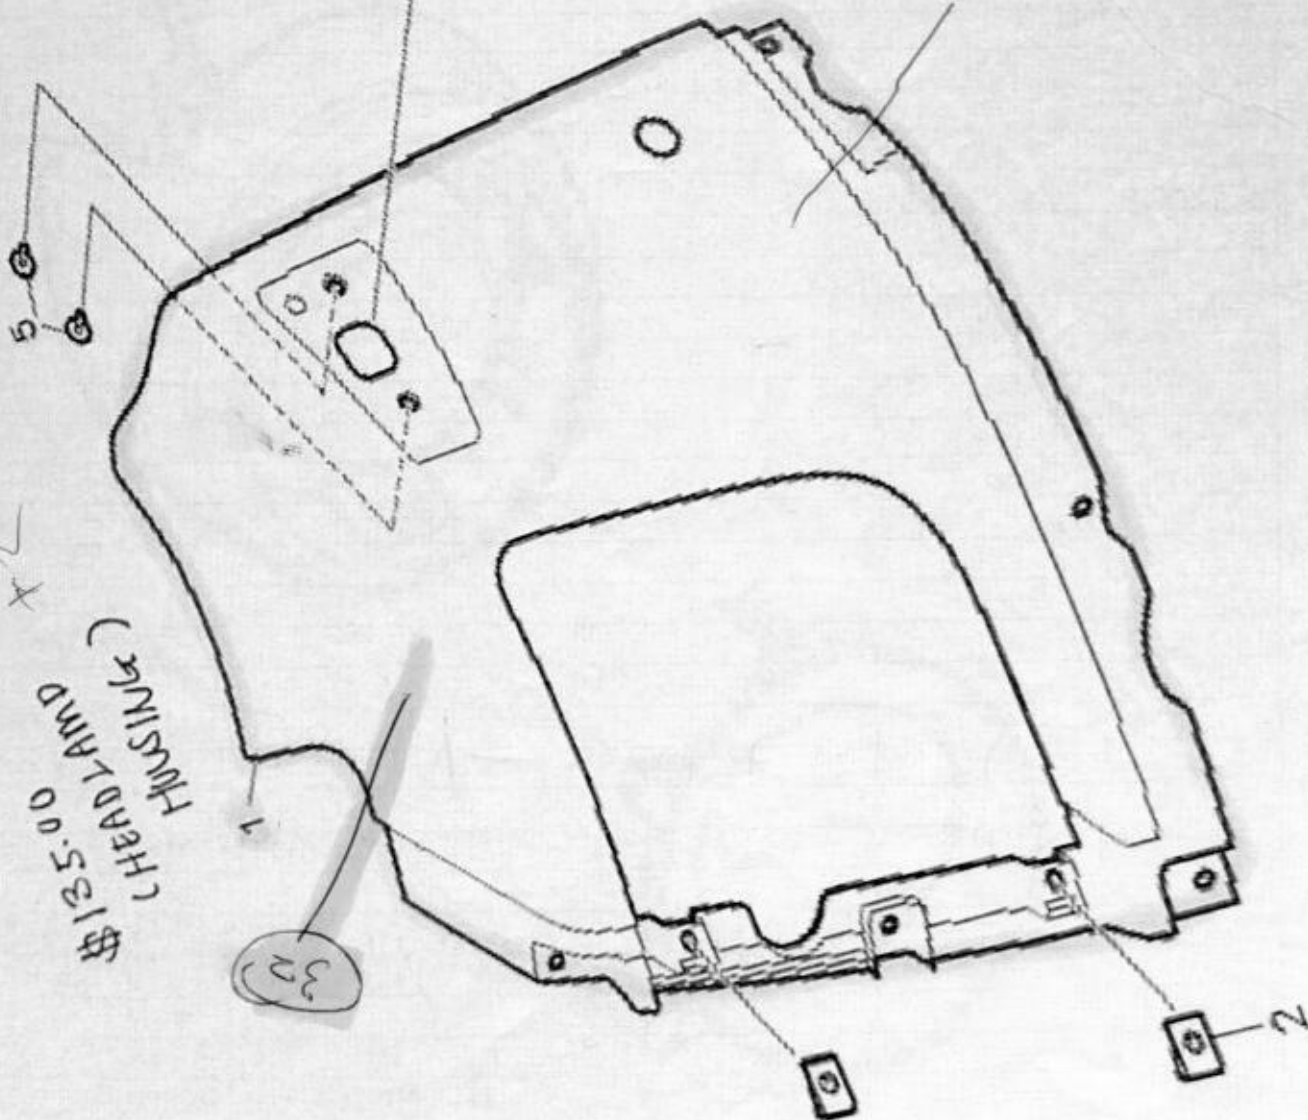

\$135.00  
(HEAD LAMP  
HUSKIN)

3

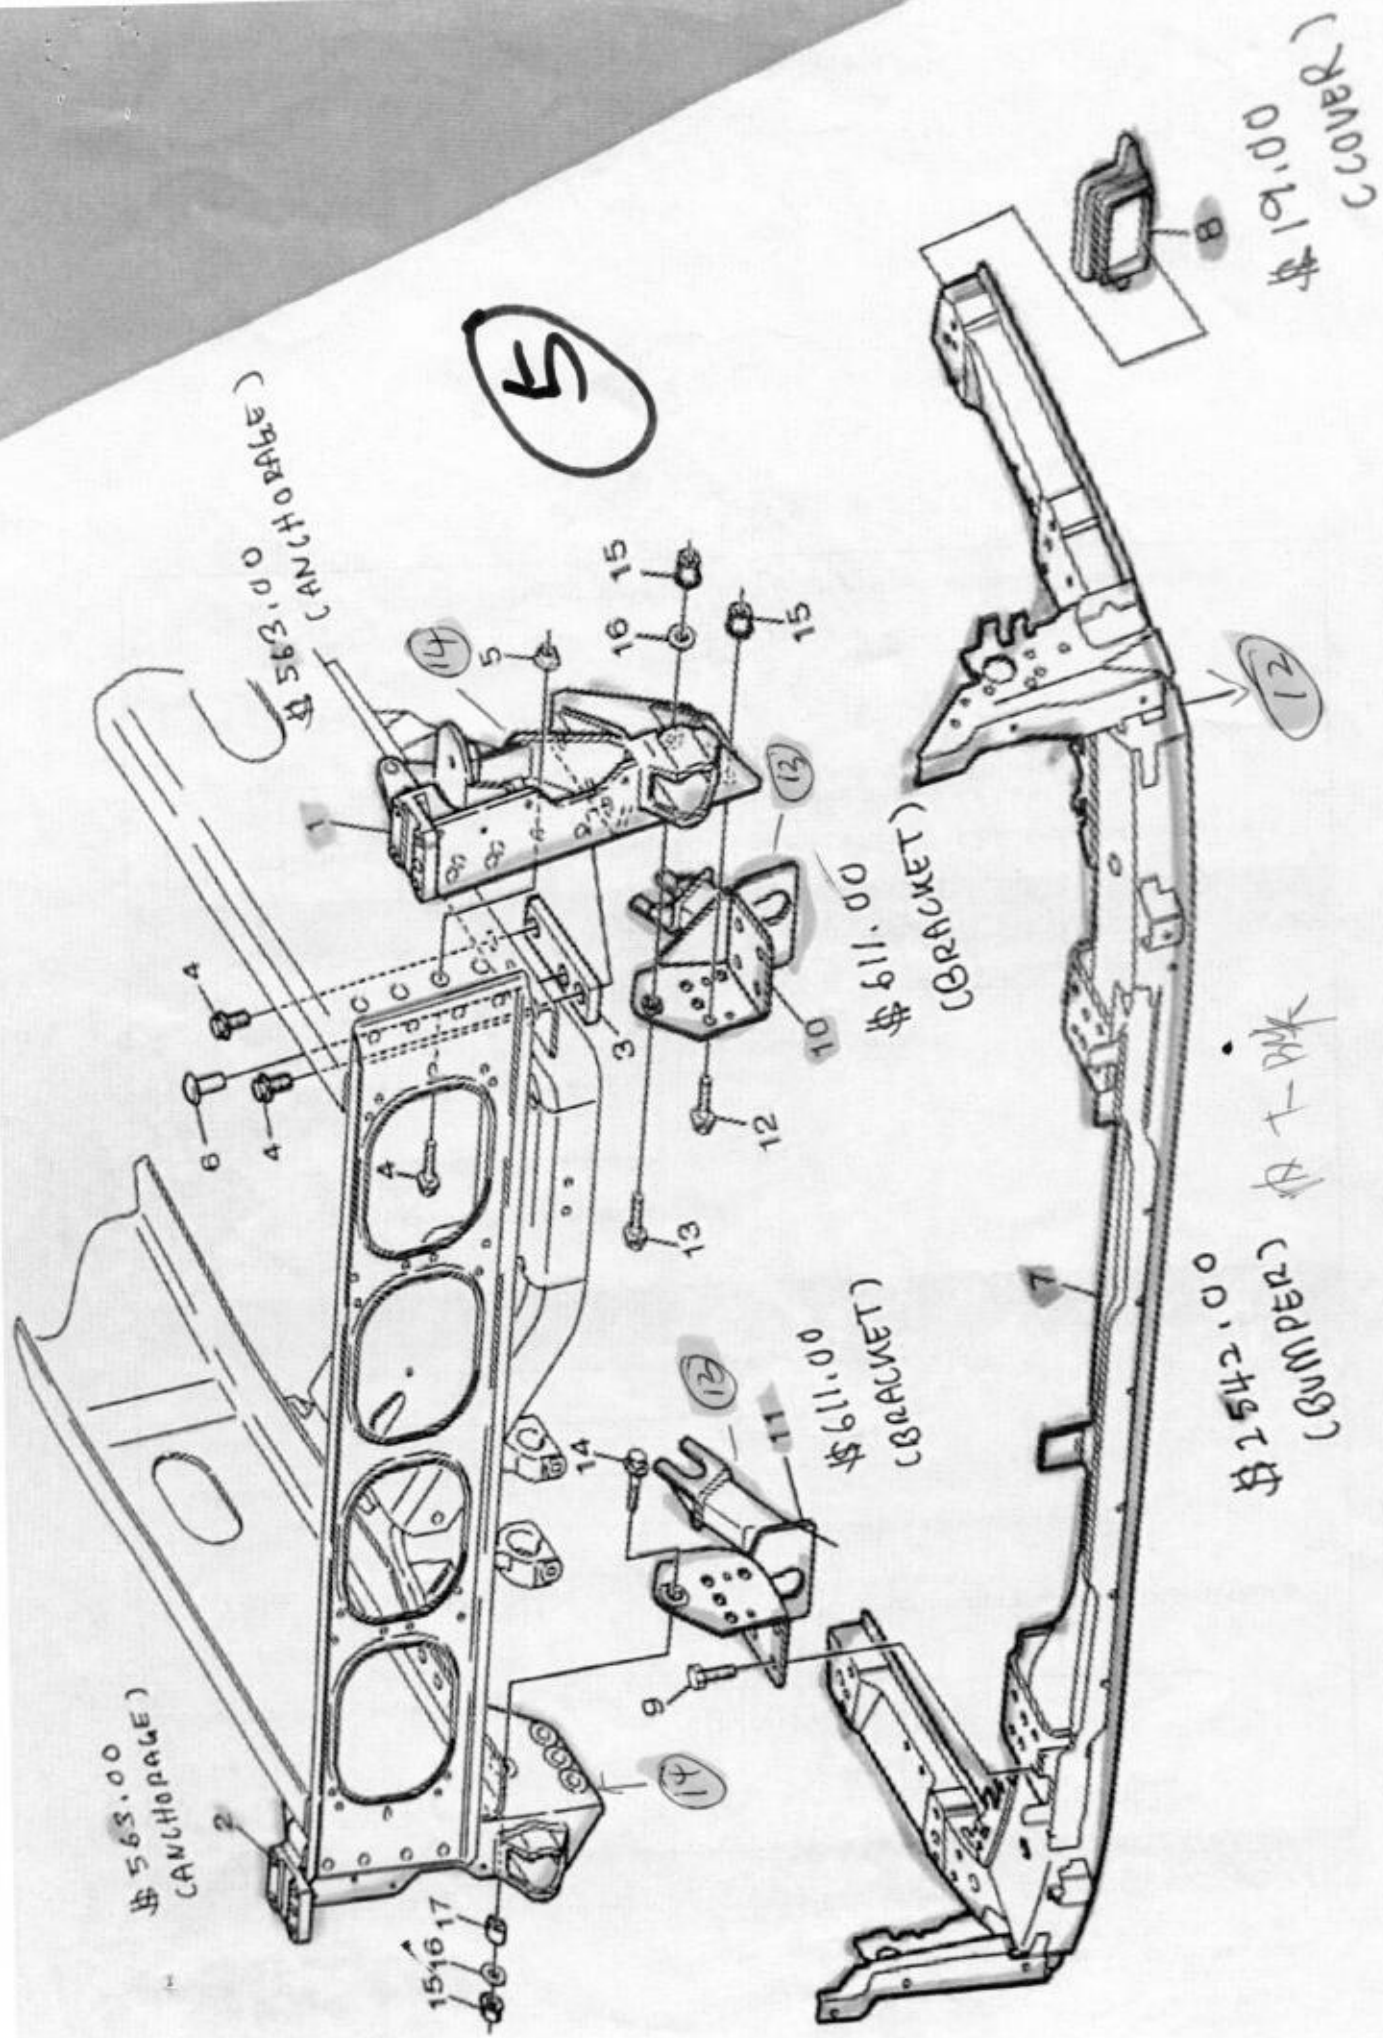

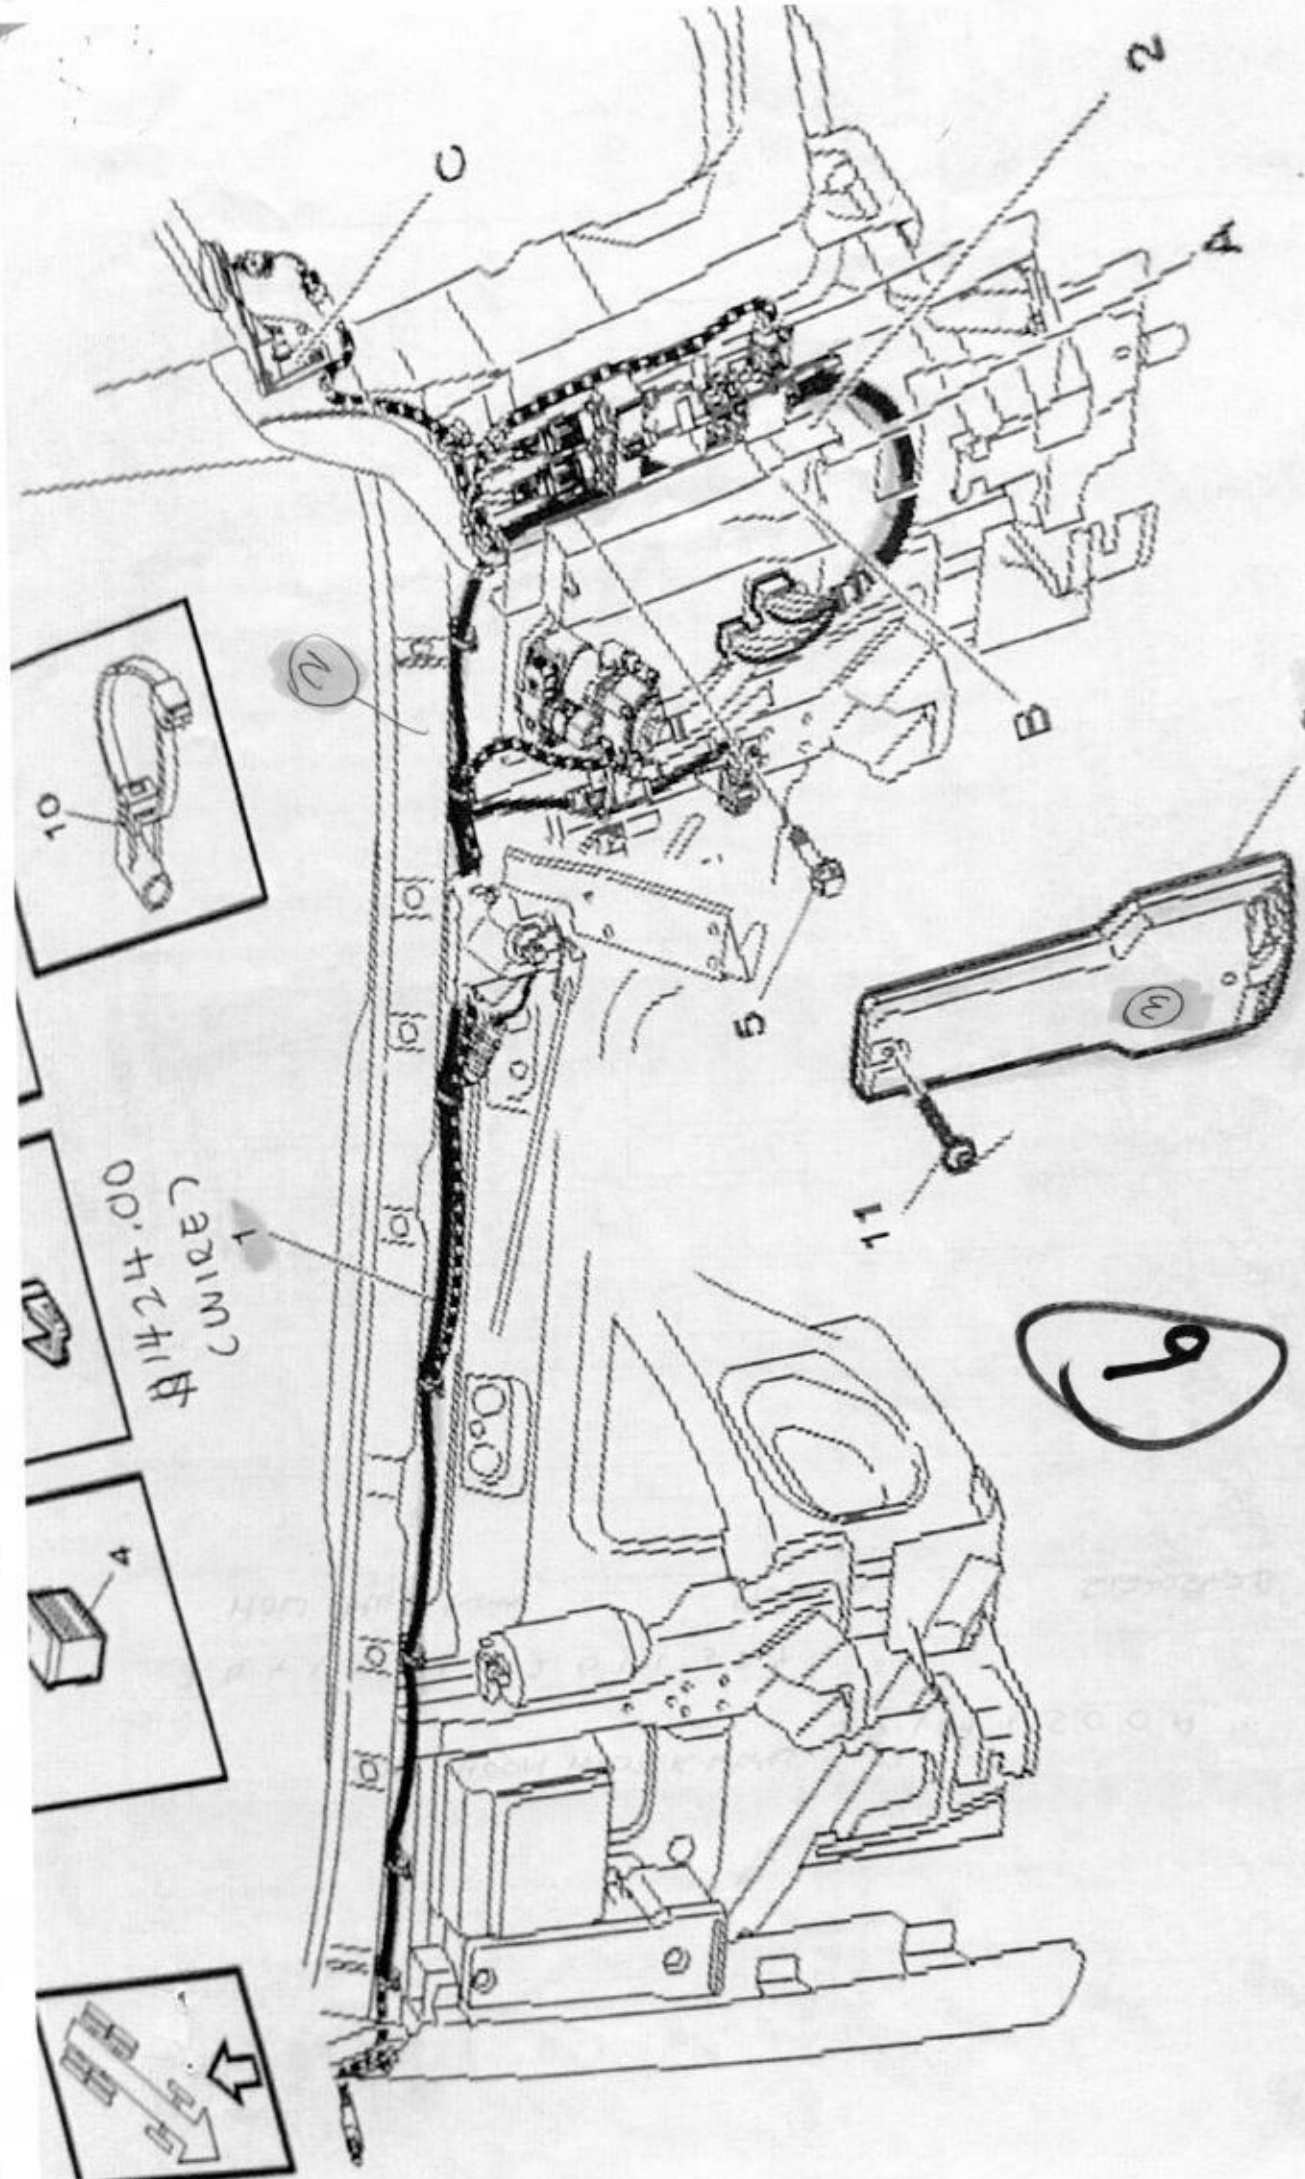

(C) 1964  
#10-00

#1424-00  
(wire)

9



A/C unit (cab) (Identity: TB-103260142-6)

\$86.00 (FRAME)

\$24.00

(DRAIN TUBE)

\$43.00  
(FILTER)

\$56.00  
(FILTER)

\$3089.00  
CLIMATE UNIT

\$227.00

(COOLANT PIPE)


\$97.00  
(HOSE)


R1041164  
© Volvo Parts Corp

Copyright to this documentation belongs to the Volvo Group. No reproduction, copying, change, amendment or other similar disposal is entitled without prior written permission from the Volvo Group.  
The information contained herein is current at the time of its original distribution, but is subject to change. The reader is advised that printed copies are uncontrolled.

\$736.00  
CHAND PUR

\$1263.00  
C CYLINDER

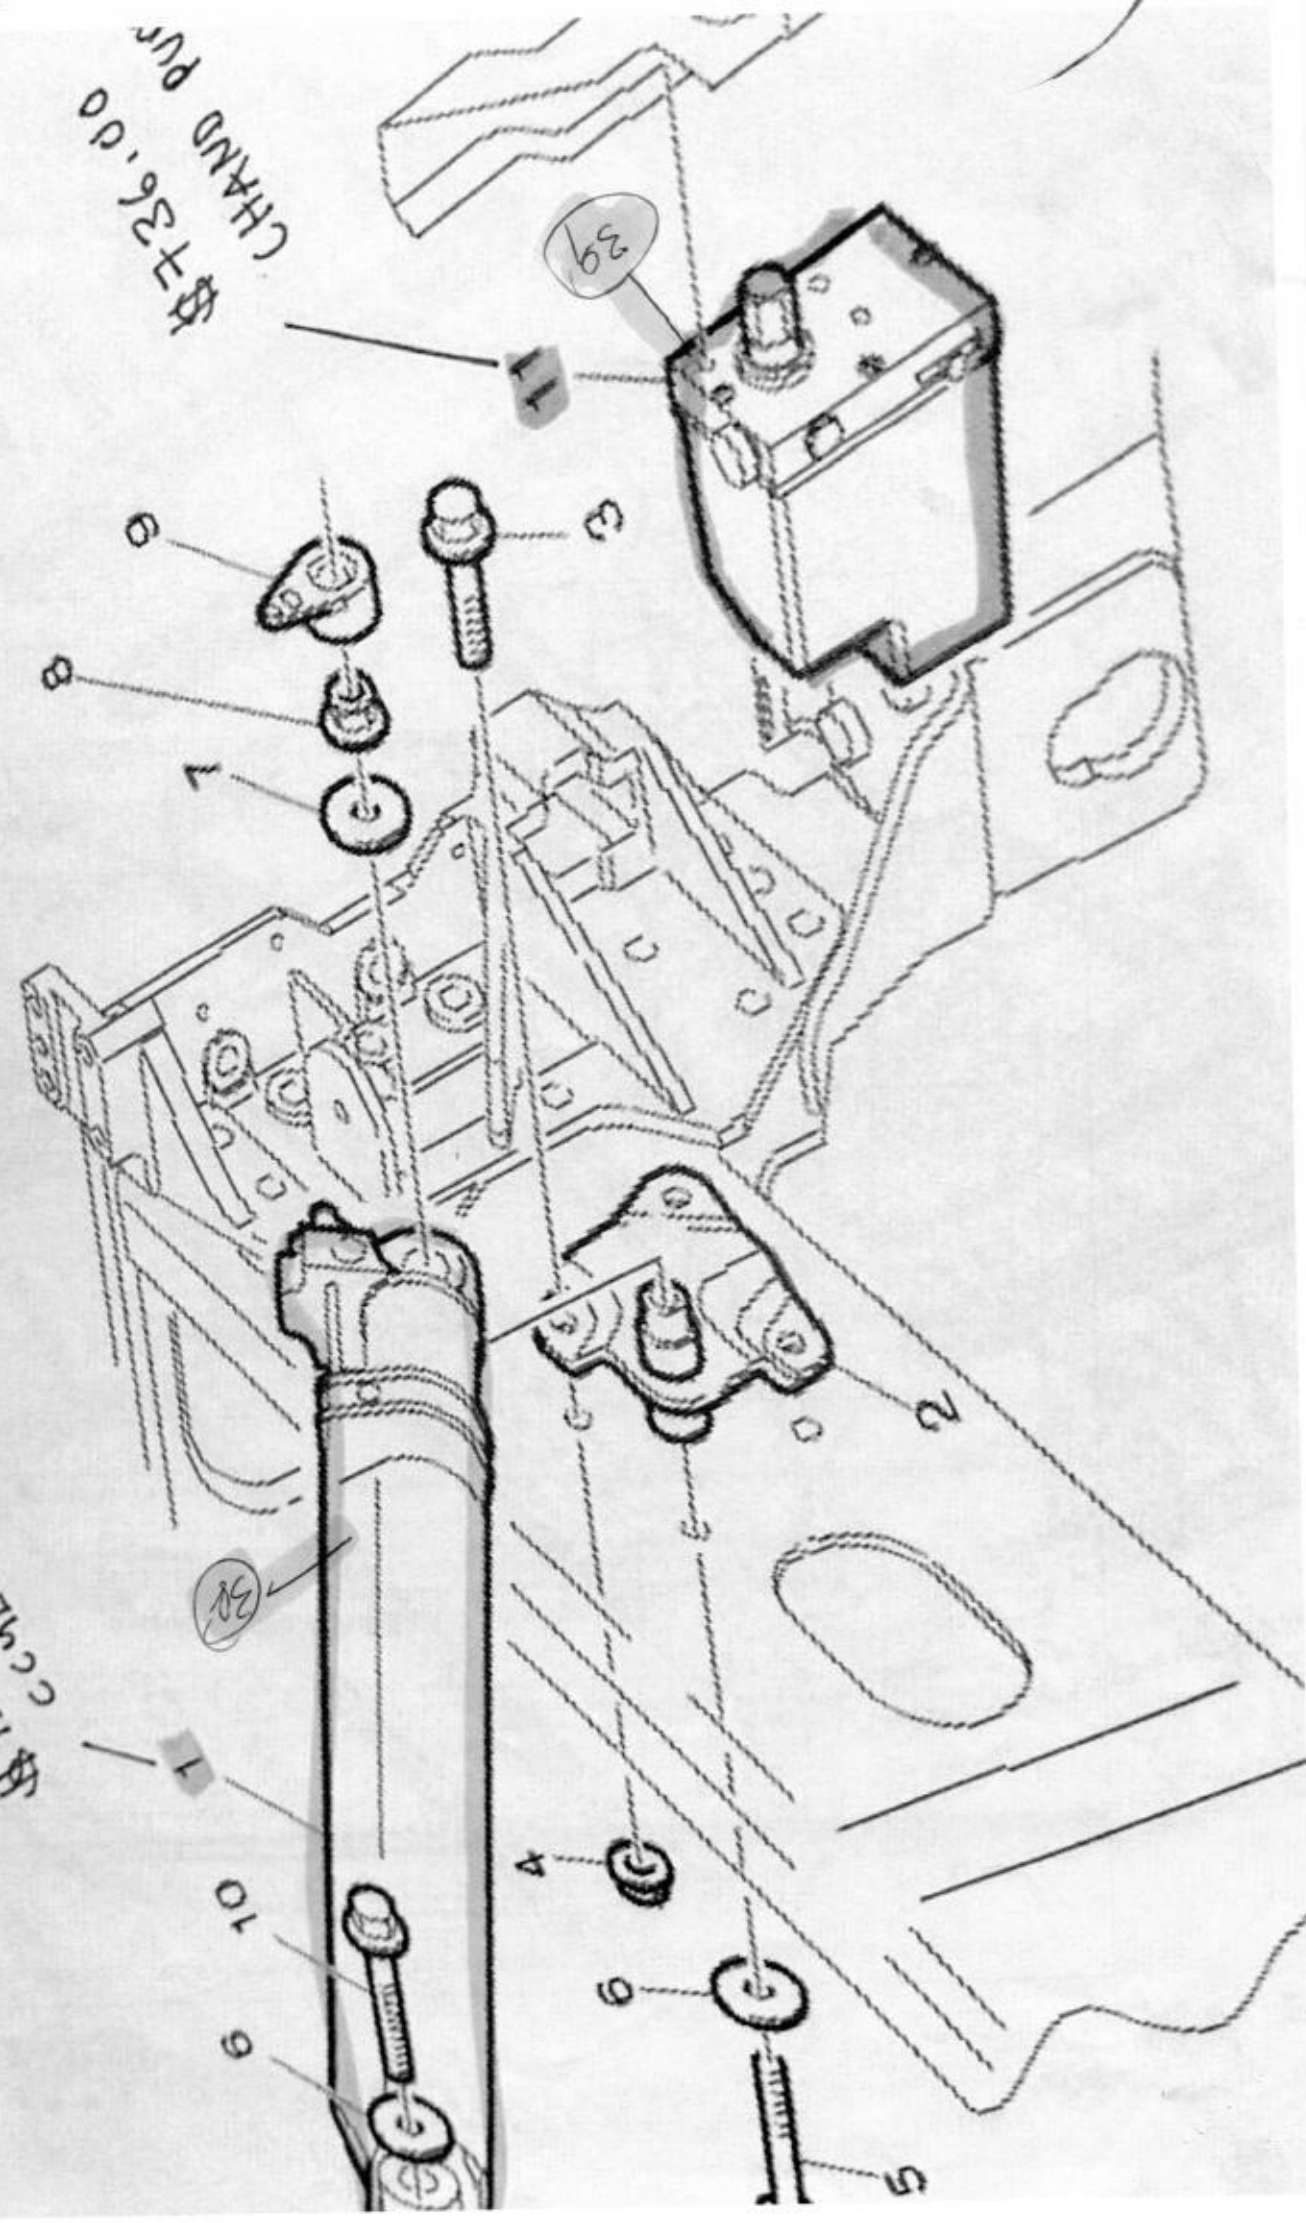

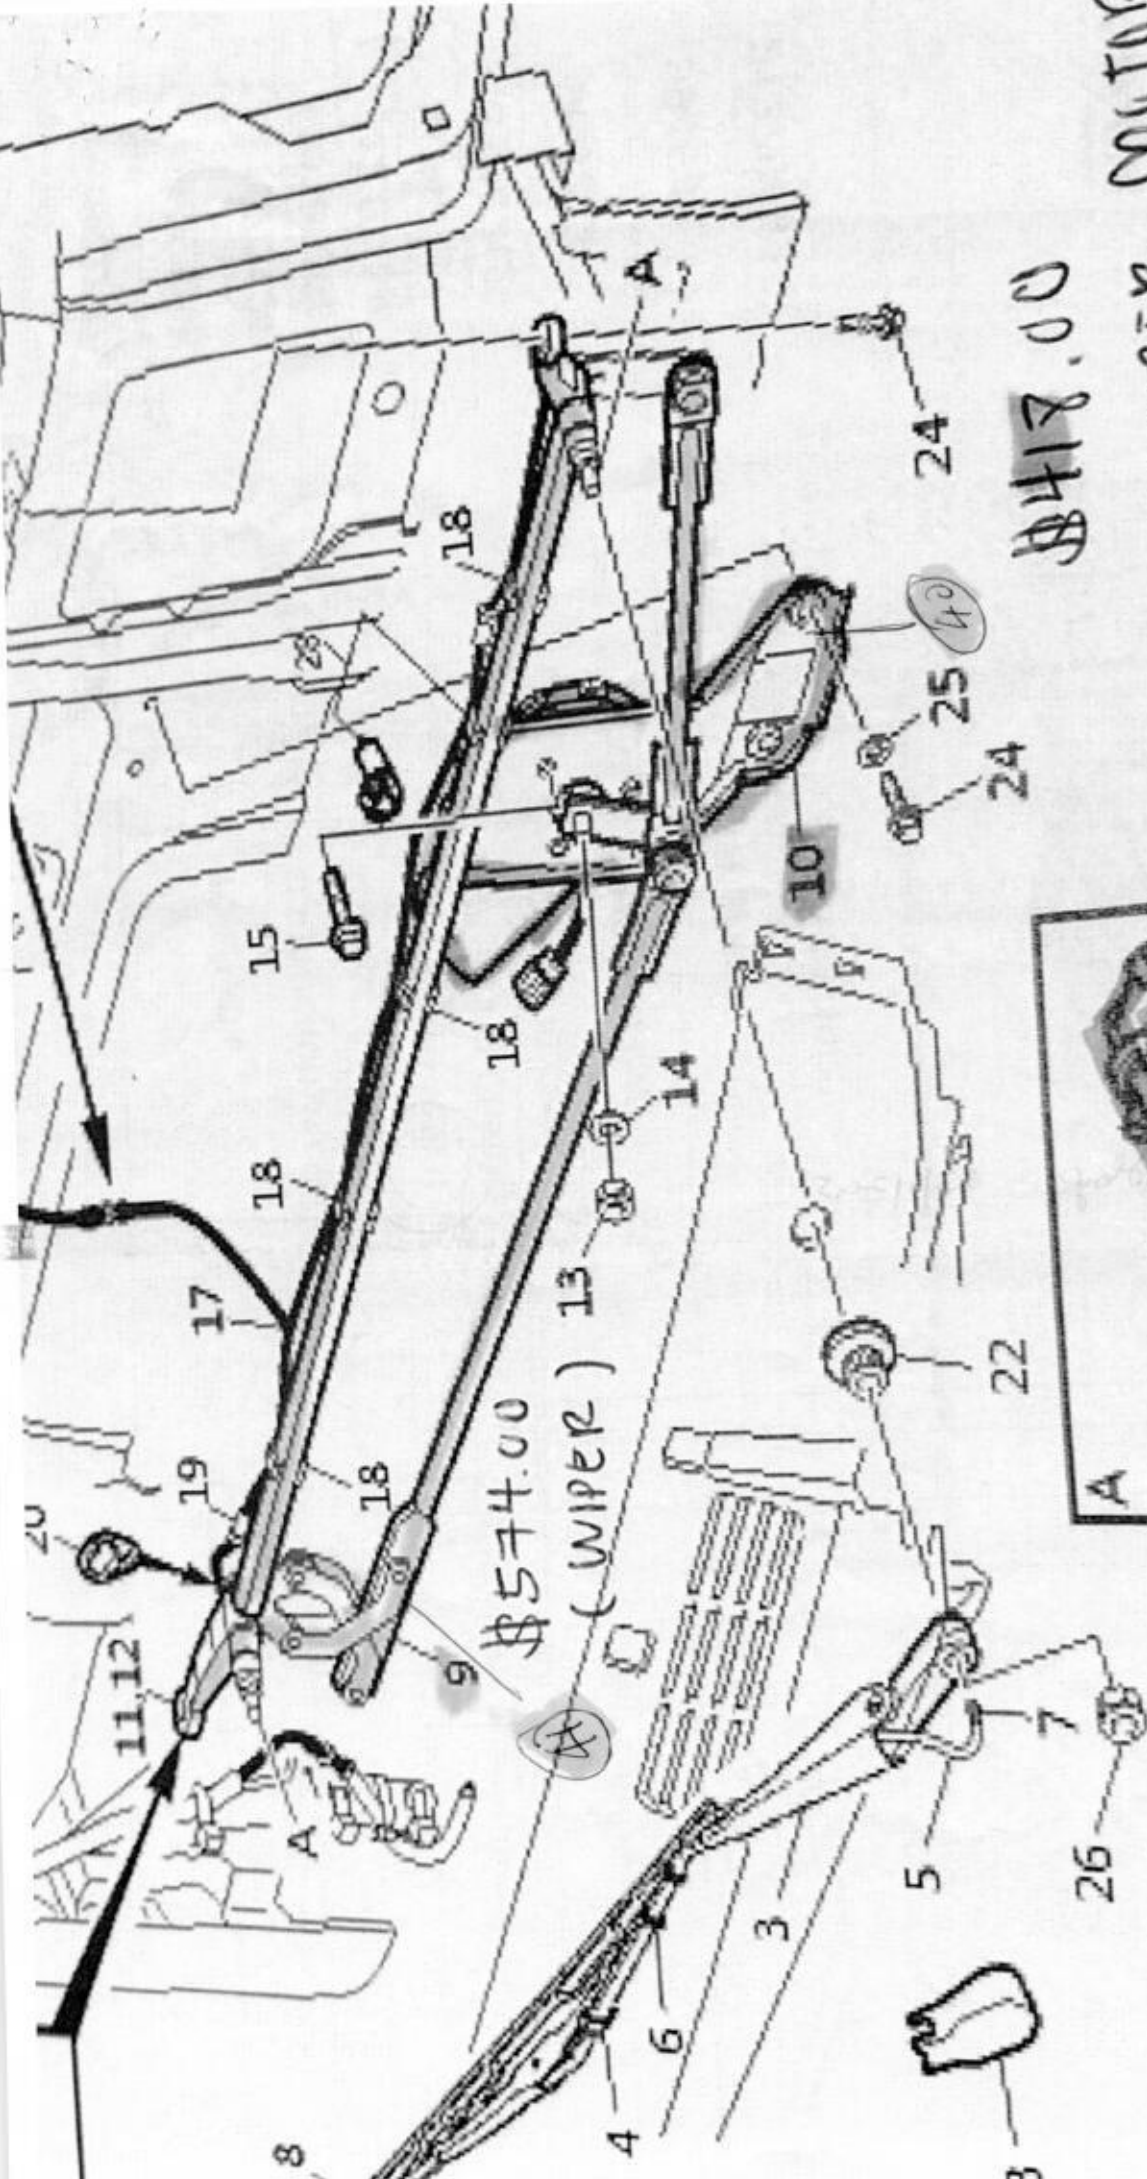


\$574.00  
(WIPER)

\$418.00

WIPER MOTOR


R1244652

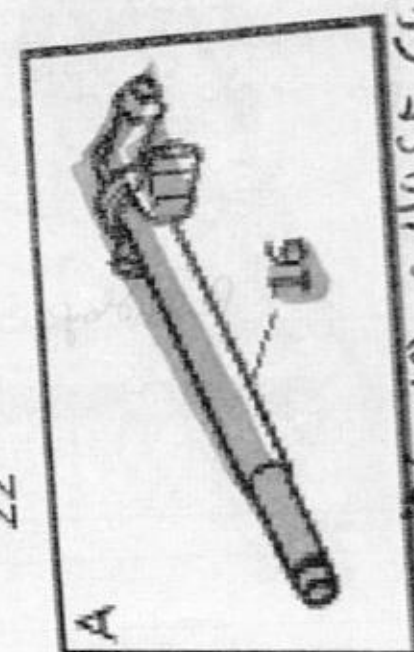

\$6.00 (HOSE CONNECTION)


Patent belongs to the Volvo Group. No reproduction, copying, change, amendment or other similar disposal is entitled without prior written permission from the Volvo Group.



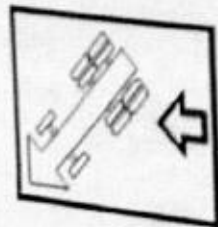

\$2004.00  
(CRASH PAD)

44

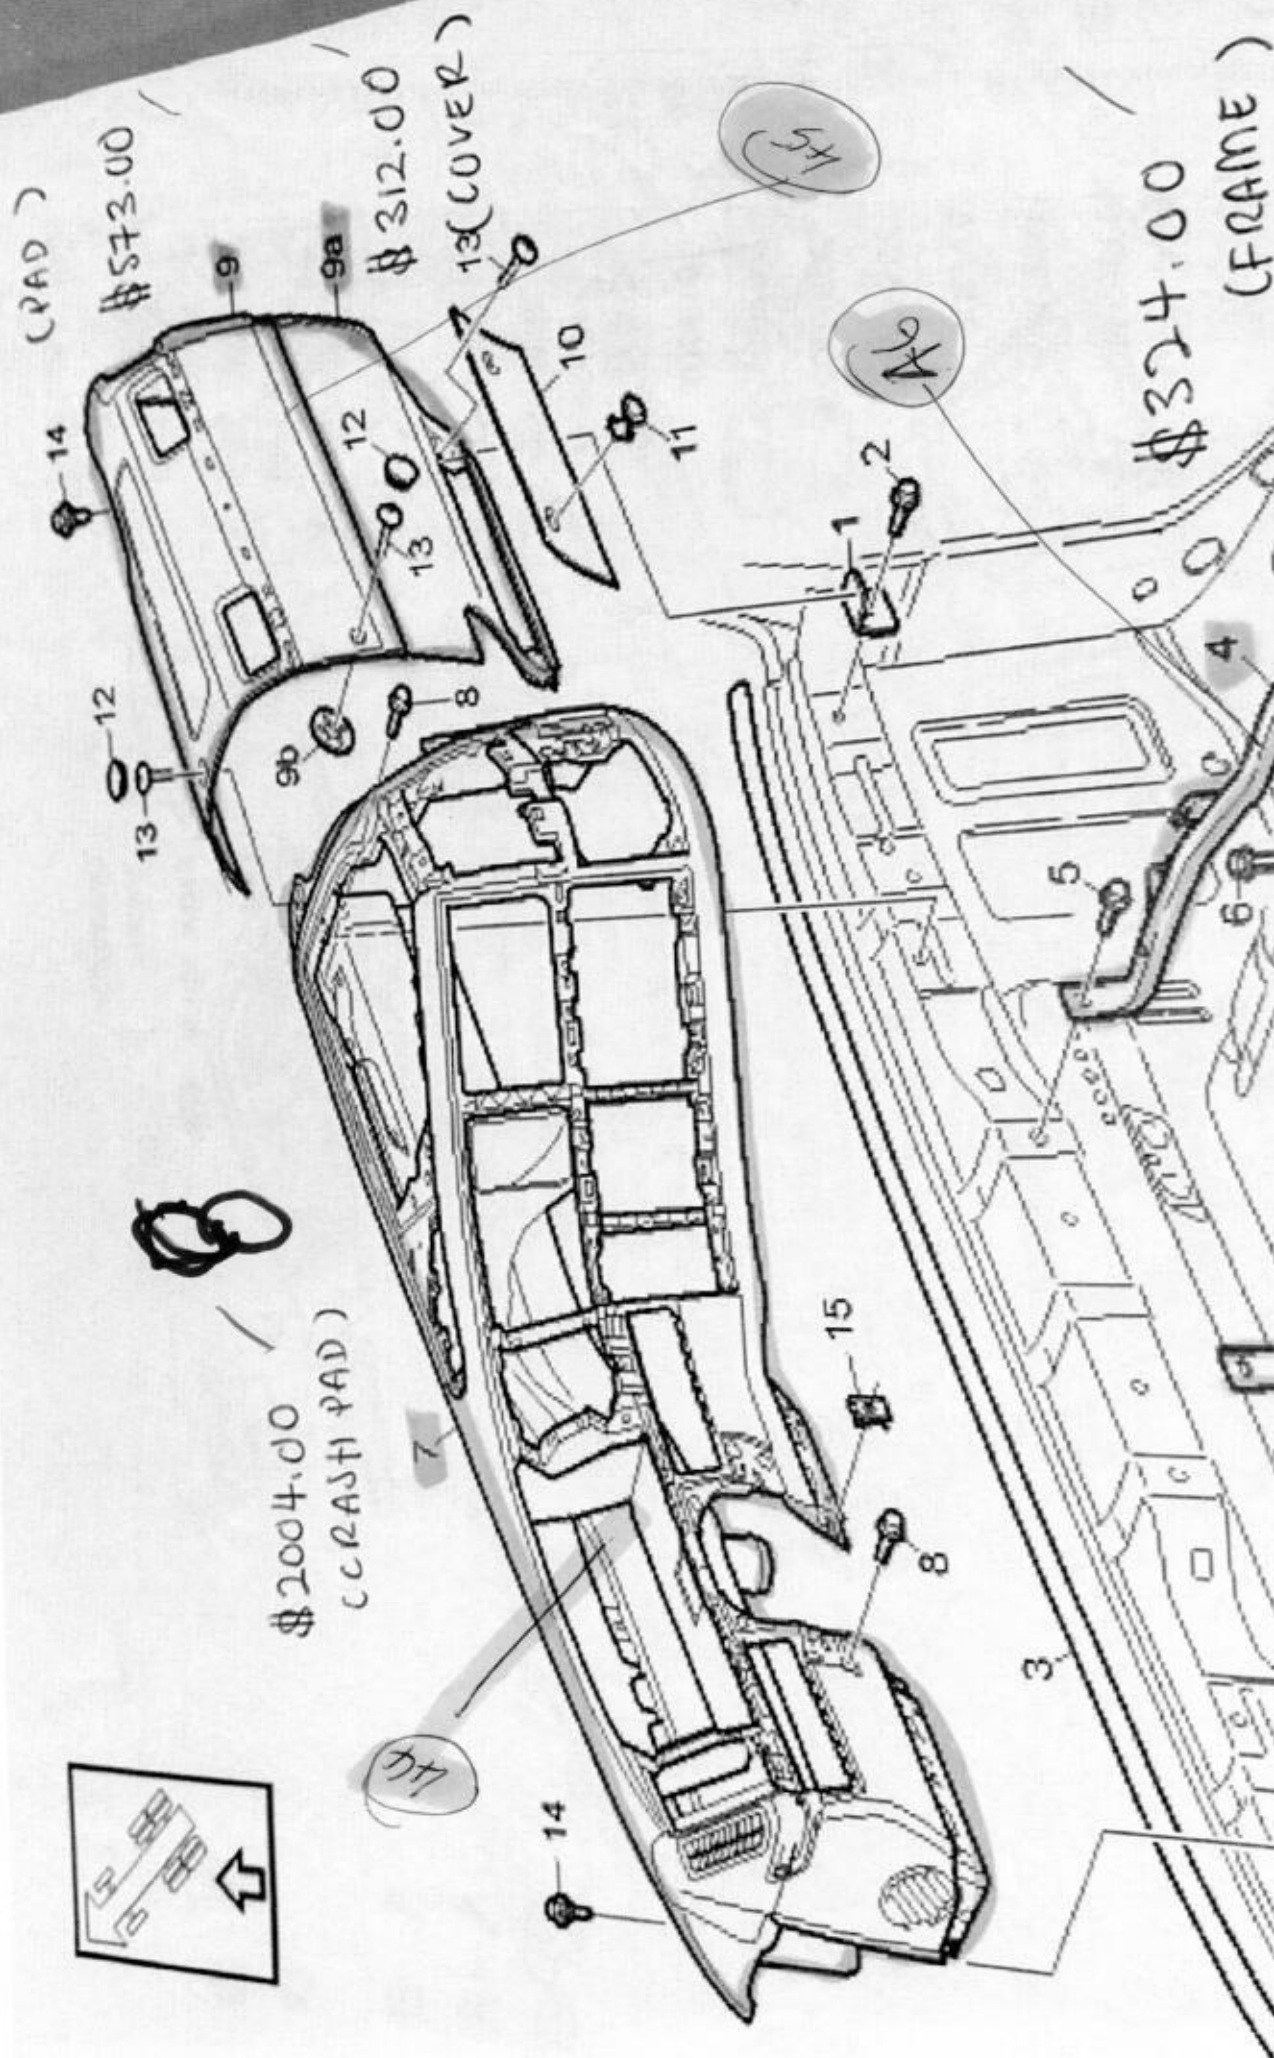

(RAD)

\$573.00

\$312.00

13(COVER)

\$324.00  
(FRAME)

44

44

15

14

2

1

6

5

4

2

1

11

10

12

9

9a

12

13

9b


7

3

2


1

9



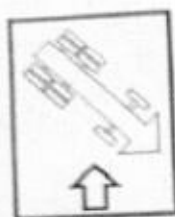


\$2010.00  
(RADIATOR)

NO 5: \$21.00  
(RUBBER  
CUSHION)

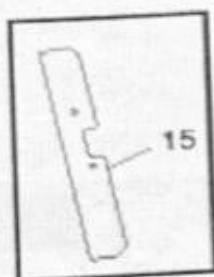


\$31.00  
(RUBBER  
WHIM)

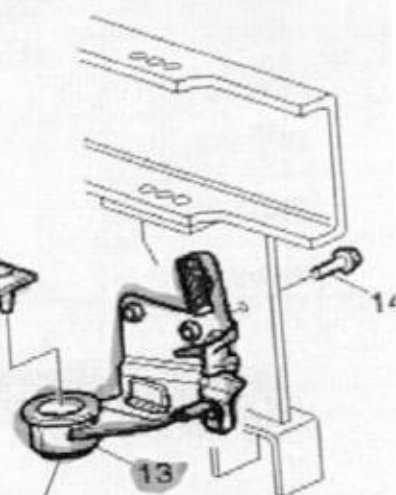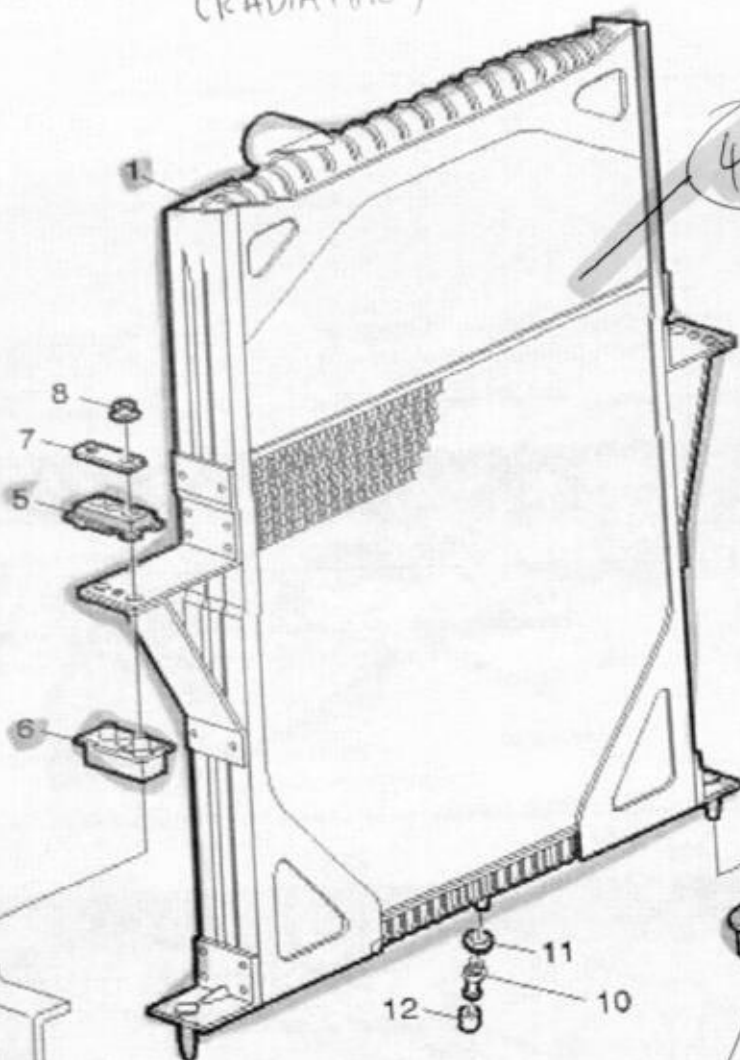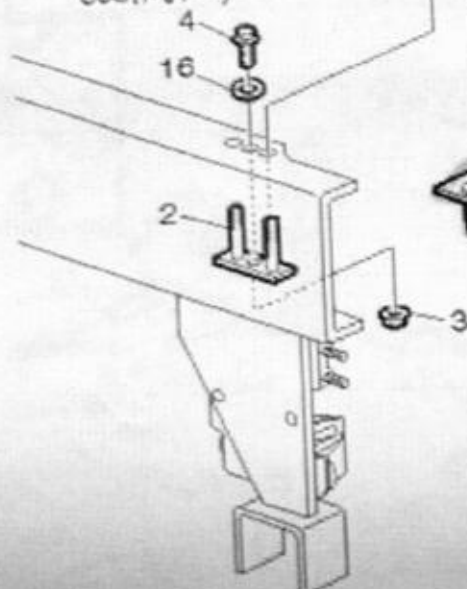

\$314.00  
(BRACKET)

43

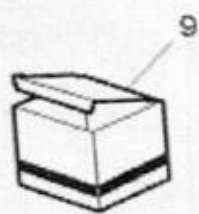


R1159762





11

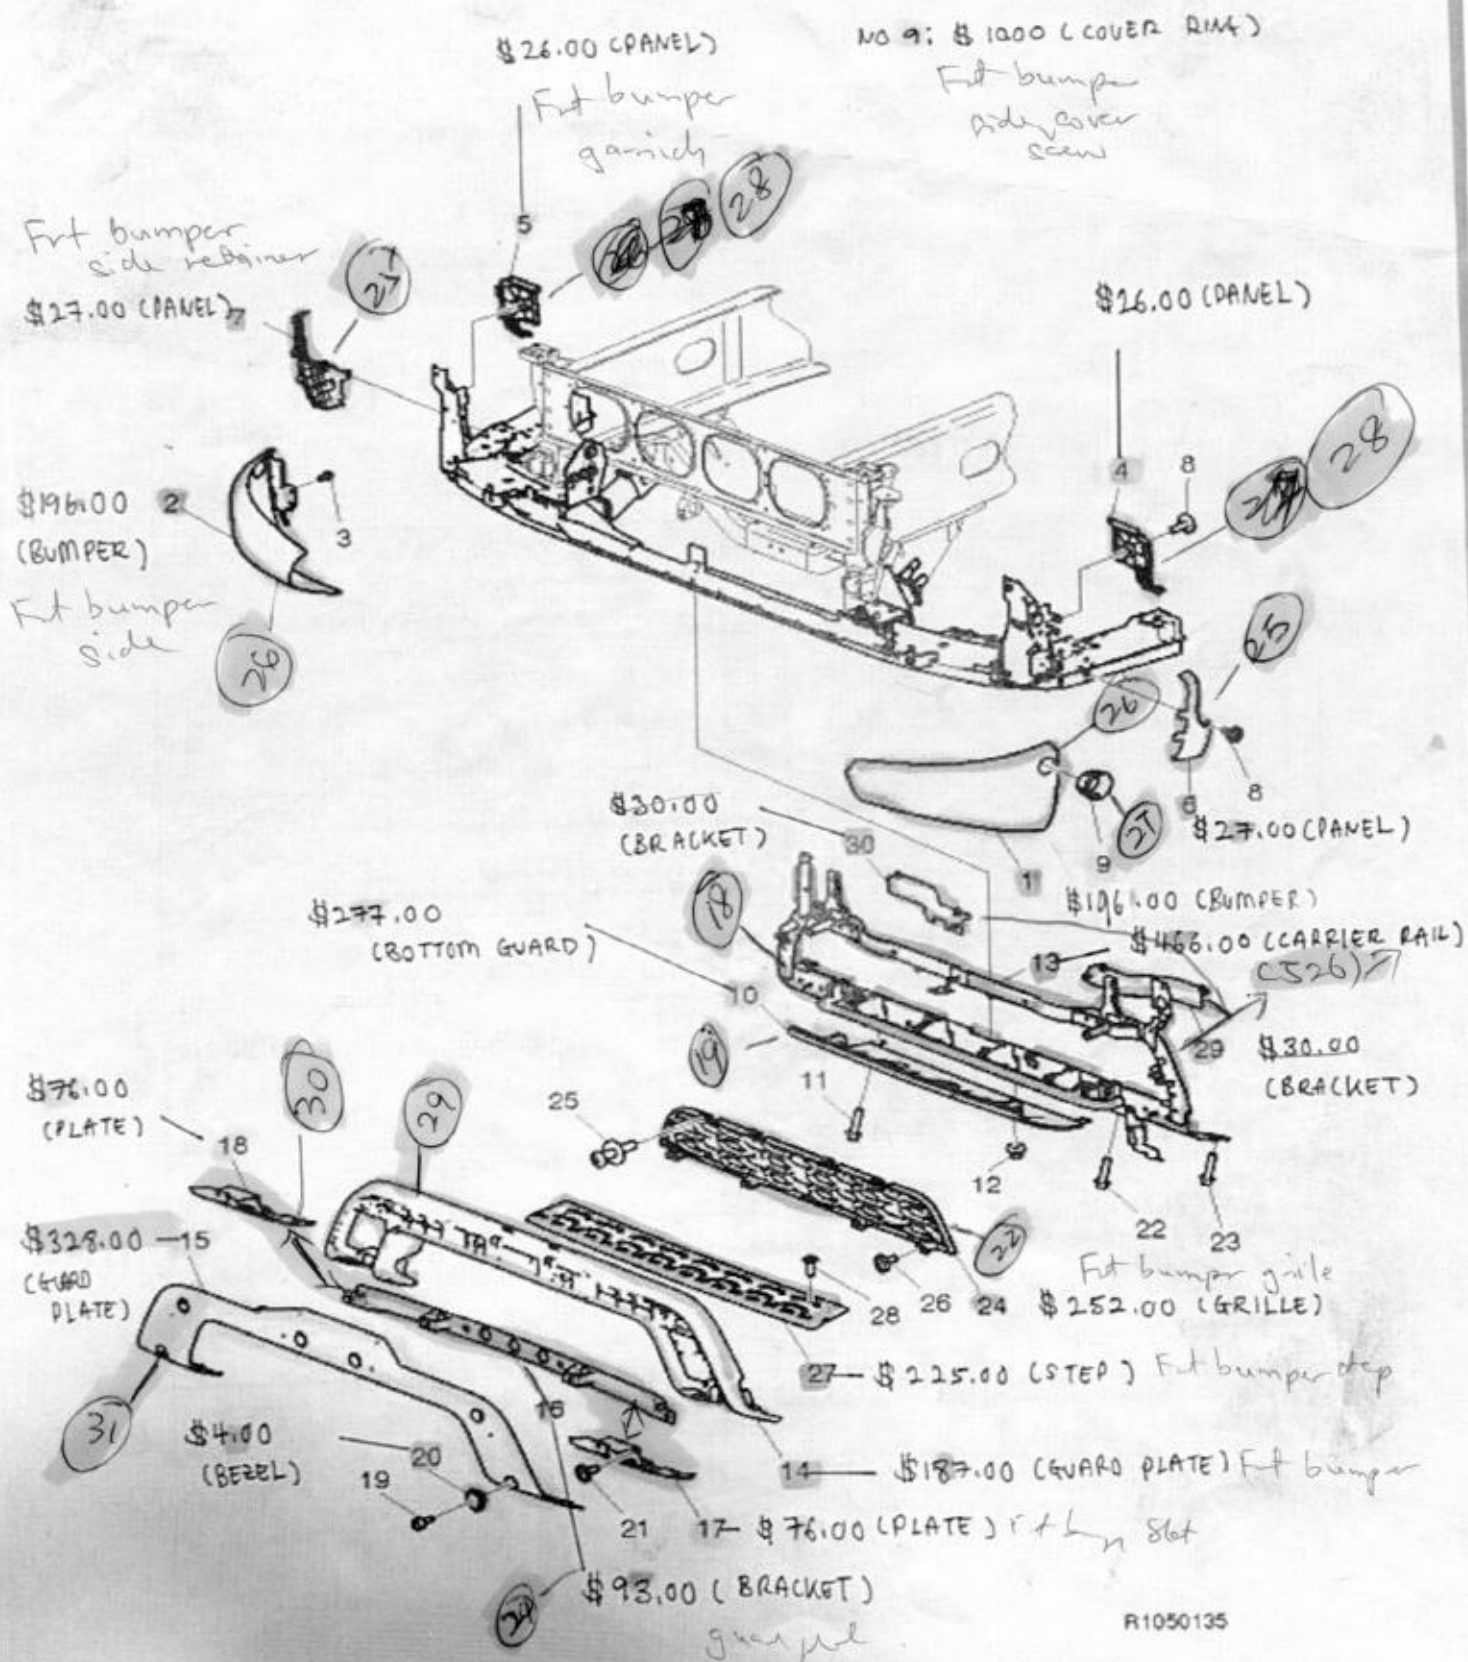


R1050135

Copyright to this documentation belongs to the Volvo Group. No reproduction, copying, change, amendment or other similar disposal is entitled without prior written consent by the Volvo Group.

The information contained herein is current at the time of its original distribution, but is subject to change. The reader is advised that printed copies are uncontrolled.

Assembly (Identity: TB-129471656-1)

12

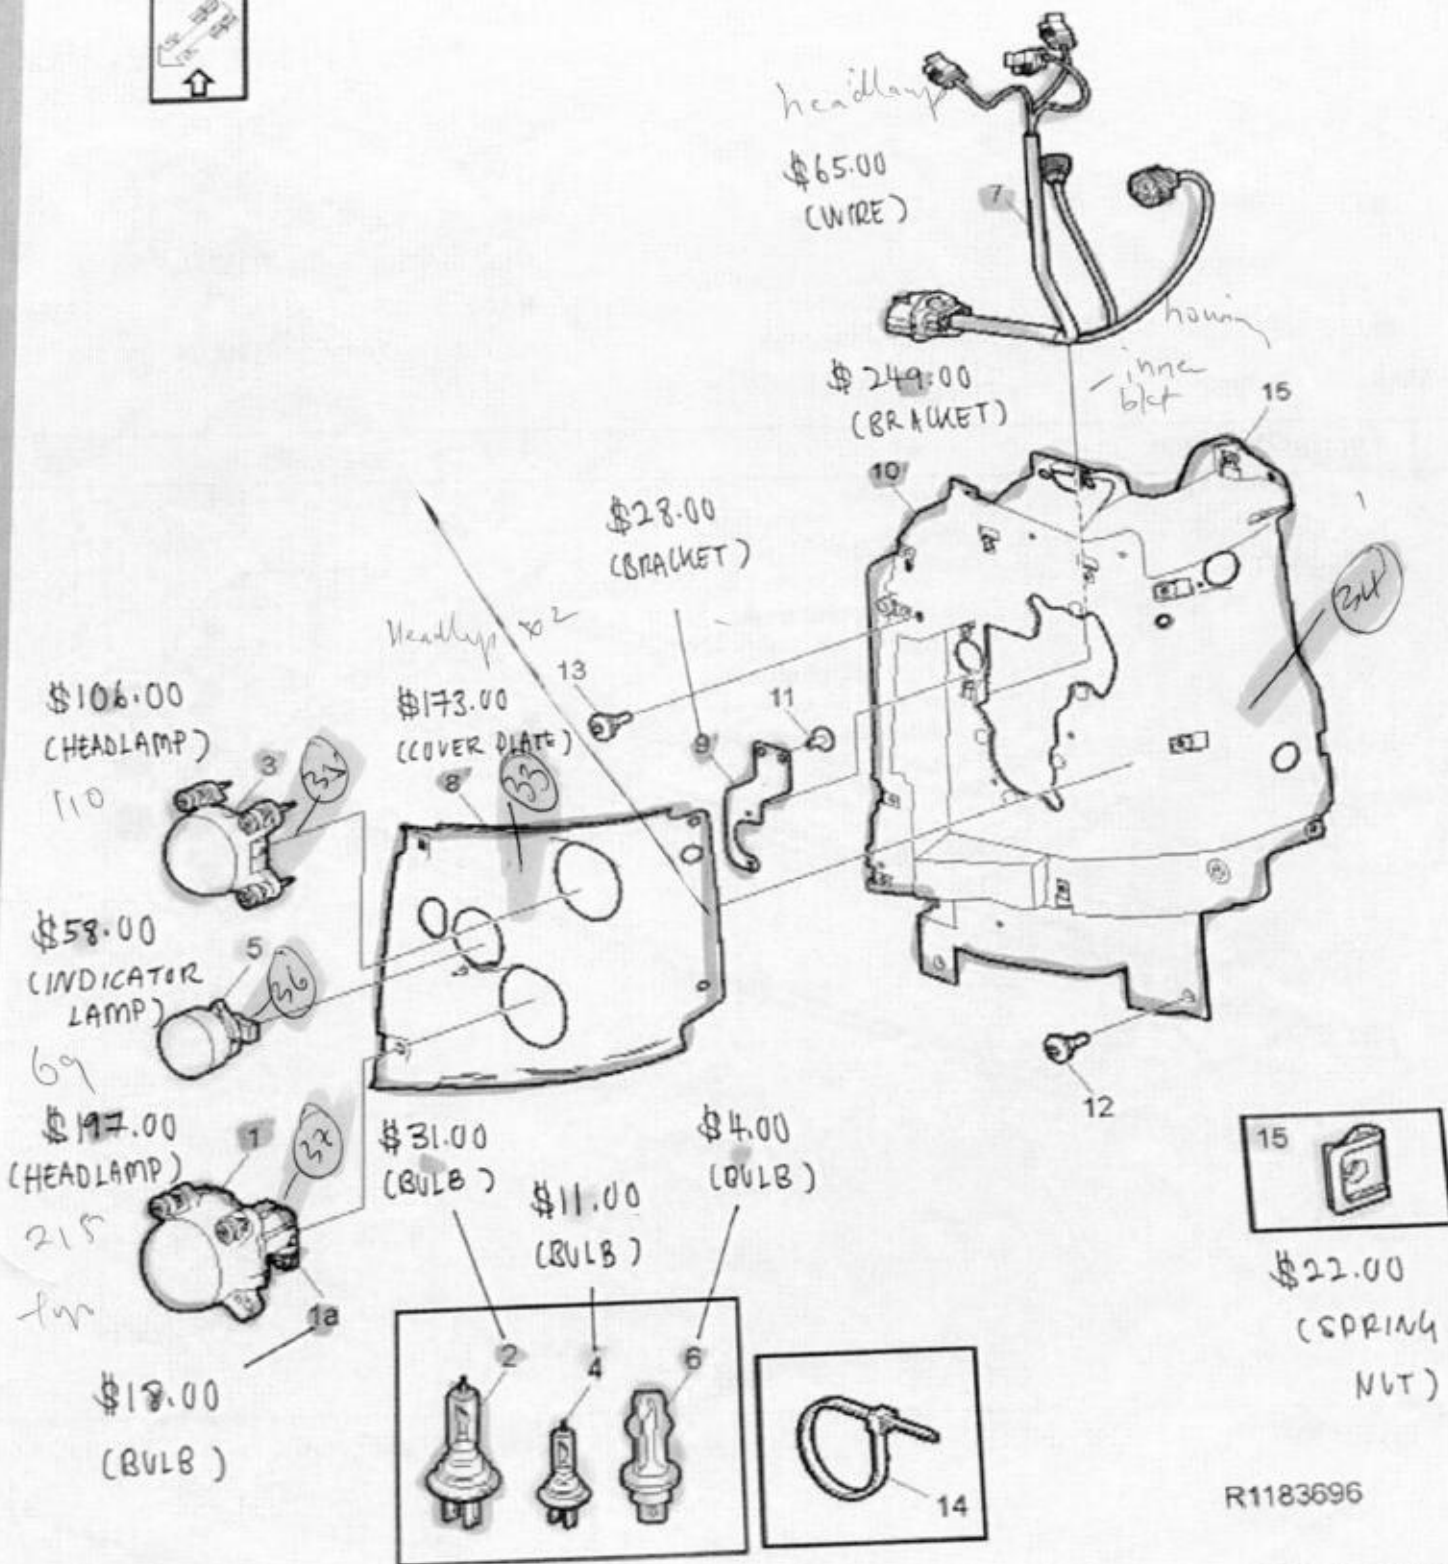

R1183696

Copyright to this documentation belongs to the Volvo Group. No reproduction, copying, change, amendment or other similar disposal is entitled without prior written consent of the Volvo Group.

The information contained herein is current at the time of its original distribution, but is subject to change. The reader is advised that printed copies are uncontrolled.



## LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

### Affiliated to Federation Internationale Des Experts En Automobile

QBE INSURANCE (SINGAPORE) PTE LTD

Ref : CS/QBE18002037/T1qd3s2

1 RAFFLES QUAY #29-10 SOUTH  
TOWERSINGAPORE 048583

Date : 05-07-2018



Code : QBE

#### 1. Policy Particulars :- OWN DAMAGE

Insured Veh.		Veh. Inspected	XD 7032G
Policy No.	8-V0009810-MVA-R002	Coverage (\$)	0.00
Claim No.	VC010951	Excess (\$)	1,500.00
Assign From	JOYCE FOO	Assign Date	01/02/2018

#### 2. Vehicle Particulars & Condition

Make & Model	VOLVO FMX420	c.c	12777
Engine No.	HIDDEN	Year of Reg.	2013
Chassis No.	YV2JG10G2DA740237	Colour	WHITE
Odometer	-	Steering	IN ORDER
Brakes	IN ORDER	Modification	NIL
General	GOOD		

#### 3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	315/80 R22.5	TECHKING	9 mm
L/H Front Tyre	315/80 R22.5	TECHKING	9 mm
R/H Rear Tyre	315/80 R22.5 (D)	TECHKING	9/9 mm
L/H Rear Tyre	315/80 R22.5 (D)	TECHKING	9/9 mm

#### 4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE FRONT PORTION. DAMAGES SEE DETAILS.
---

#### 5. General Information

Accident Date	05/12/2017	Inspection Date	02/02/2018
Survey held at	BAN CHOON MOTOR WORKS 3 PIONEER ROAD NORTH #01-14/15 SINGAPORE 628457		

#### 5a. Remarks

A)THE MARKET VALUE IS S\$120,000(EST. AVERAGE) B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE AUTHORISED REPAIRS.
---

#### 5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	25 Working Days
-------------------------------------	-----------------





# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 3

## ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. XD 7032G

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<b>REPLACEMENT OF PARTS</b>			
1	FRONT WINDSCREEN (WCP)	CRACKED	518.00	518.00
1	FRONT WINDSCREEN RUBBER (WCP)	NECESSARY	285.00	285.00
1	WIPER PANEL (WCP)	BENT	1,424.00	1,424.00
1	WIPER PANEL TOP GARNISH (WCP)	CRACKED	570.00	570.00
1	WIPER PANEL TOP GARNISH SEAL (WCP)	NECESSARY	33.00	33.00
1	FRONT PANEL (WCP)	CRACKED	1,293.00	1,293.00
2	FRONT PANEL HINGES @ \$93.00 (WCP)	BENT	186.00	186.00
1	FRONT PANEL AIR SCOOP GARNISH BRACKET (WCP)	DISTORTED	38.00	38.00
2	FRONT PANEL HINGE COVERS @ \$45.00 (WCP)	MISSING	90.00	90.00
2	FRONT PANEL SHOCK ABSORBERS @ \$100.00 (WCP)	BENT	200.00	200.00
2	FRONT PANEL LOCKS @ \$86.00 (WCP)	BENT	172.00	172.00
1	FRONT PANEL CROSS MEMBER BUMPER (WCP)	BENT	2,542.00	2,542.00
2	FRONT PANEL INNER BRACKETS @ \$611.00 (WCP)	NOT NECESSARY	1,222.00	-
2	FRONT PANEL ANCHORAGE @ \$563.00 (WCP)	NOT NECESSARY	1,126.00	-
1	FRONT GRILLE (WCP)	CRACKED	825.00	825.00
1	LH CONTROL PANEL (WCP)	DISTORTED	250.00	250.00
1	LH CONTROL PANEL BRACKET (WCP)	DISTORTED	132.00	132.00
1	FRONT BUMPER CARRIER RAIL (WCP)	BENT	526.00	526.00
1	FRONT BUMPER BOTTOM GUARD (WCP)	BENT	277.00	277.00
1	FRONT GRILLE TOP PANEL (WCP)	CRACKED	61.00	61.00
2	FRONT GRILLE TOP SIDE LOWER PANELS @ \$54.00 (WCP)	DISTORTED	108.00	108.00
1	FRONT BUMPER GRILLE (WCP)	CRACKED	252.00	252.00
2	FRONT BUMPER GRILLE HINGES @ \$93.00 (WCP)	BENT	186.00	186.00
2	FRONT BUMPER SIDE RETAINERS @ \$27.00 (WCP)	NECESSARY	54.00	54.00
2	FRONT BUMPER SIDE @ \$196.00 (WCP)	DISTORTED	392.00	392.00
2	FRONT BUMPER SIDE COVER SCREWS @ \$10.00 (WCP)	NECESSARY	20.00	20.00
2	FRONT BUMPER SIDE GARNISHS @ \$26.00 (WCP)	DEFORMED	52.00	52.00
1	FRONT BUMPER GUARD PLATE (WCP)	DISTORTED	187.00	187.00
1	FRONT BUMPER GUARD PLATE (WCP)	BENT	328.00	328.00
1	FRONT BUMPER GUARD PLATE BRACKET (WCP)	DISTORTED	244.00	244.00

Report Ref No. CS/QBE18002037/T1qd3s2



# LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
2	HEADLAMP HOUSING @ \$135.00 (WCP)	CRACKED	270.00	270.00
2	HEADLAMP COVER PLATES @ \$173.00 (WCP)	DISTORTED	346.00	346.00
2	HEADLAMP HOUSING INNER BRACKETS @ \$249.00 (WCP)	NOT NECESSARY	498.00	-
1	LH TOP HEADLAMP (WCP)	MISSING	228.00	228.00
1	LH LOWER HEADLAMP (WCP)	MISSING	110.00	110.00
1	LH INDICATOR LAMP (WCP)	MISSING	69.00	69.00
1	HAND PUMP (WCP)	BENT	736.00	736.00
1	CYLINDER (WCP)	NOT NECESSARY	1,263.00	-
1	WIPER MOTOR (WCP)	NOT NECESSARY	418.00	-
1	WIPER MOTOR BRACKET (WCP)	BENT	574.00	574.00
1	RADIATOR (WCP)	BENT	2,010.00	2,010.00
2	RADIATOR BRACKETS @ \$314.00 (WCP)	BENT	628.00	628.00
1	DASHBOARD (WCP)	NOT NECESSARY	2,004.00	-
1	DASHBOARD BRACKET (WCP)	NOT NECESSARY	324.00	-
1	CONSOLE BOX (WCP)	DEFORMED	885.00	885.00
1	COOLING OIL (WCP)	BENT	3,089.00	3,089.00
1	AIR CON CONDENSER (WCP)	BENT	1,895.00	1,300.00
2	CABIN SHOCK ABSORBER @ \$250.00 (WCP)	BENT	500.00	500.00
1	LH FUSE BOX (WCP)	CRACKED	120.00	120.00
1	ANTI ROLL BAR (WCP)	BENT	2,917.00	2,917.00
2	ANTI ROLL BAT STOPPERS @ \$82.00 (WCP)	BENT	164.00	164.00
	COST PLUS 15%		4,896.15	3,778.65
			37,537.15	28,969.65
	<b><u>SPECIAL NETT ITEMS</u></b>			
1	ERP BRACKET (SN)	NECESSARY	15.00	15.00
1	FRONT NUMBER PLATE (SN)	BENT	35.00	35.00
10	LIT COOLANT (SN)	NECESSARY	80.00	80.00
			130.00	130.00
	<b><u>LABOUR</u></b>			
	TO DISMANTLE AND REASSEMBLE OF FRONT WINDSCREEN.		80.00	80.00

Report Ref No. CS/QBE18002037/T1qd3s2

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:3 of 3

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO DISMANTLE AND REASSEMBLE OF AIR CON UNIT AND REFILL OF AIR CON GAS.		100.00	100.00
	CHECK WIRING.		150.00	100.00
	TO DISMANTLE AND REFIX OF DASHBOARD.		280.00	200.00
	TO DISMANTLE AND REFIX OF CUSHION UPHOLSTERY.		100.00	80.00
	TO KNOCKING AND STRAIGHTENING OF ALL NECESSARY DAMAGED PARTS, TO CHANGING OF THE ABOVE PART.		4,000.00	3,000.00
	TO PUTTY AND SPRAY PAINTING ON ACCIDENT DAMAGED PARTS.		1,800.00	1,400.00
			6,510.00	4,960.00
<b>GRAND TOTAL</b>			<b>44,177.15</b>	<b>34,059.65</b>
<b>RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)</b>				<b>27,200.00</b>
<b>LESS EXCESS</b>				<b>-1,500.00</b>
<b>NETT LIABILITY</b>				<b>25,700.00</b>

Report Ref No. CS/QBE18002037/T1qd3s2

**MOHAMAD TAUFIKH****M.MATAI, AMSAE-A****Automotive Assessor****ADRIAN LING WAI PING****B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI****Licensed Appraiser**

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.