

ASS. REC. BY:

REF:

CS/AV18002494/Dvb57

Special Instruction:

SURVEYOR

Brylan

ASSIGNMENT (Office)

From (Person):

Celyn Lim

of

Aviva

Date/Time: 07/07/2018 11:11am

Estimated Cost:

Bill to:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SH67 2789A

Insured:

at Workshop m/s

Comfort Delgro

Tel:

of

330 Ubi Rd 3

Policy No:

10744311

Claim No:

G00146683

Sum Insured:

Excess:

TBA

Make of Veh:

(Client's Record)

D.O.A.

02.02.2018

CA / REV / REP. / REV 24 HRS

H.O.D. Endorsement:

Date/Time:

07.02.2018 3:20pm

Person Contacted:

Vehicle IN/OUT

Date/Time	Action/Instruction (✓) Estimate
	SH67 2789A - X
8/2/18	Revert vehicle T/L by merimen
13/2/18	Submit uneconomical T/L

ASSIGNMENT

CDE May 2021

2006 May

From: _____ Date: _____
 Estimated Cost: _____
 OD / TP / WS / TP RES / CD RES / EVA / INV / MV
 To inspect Vehicle No: _____
 at Workshop No: _____
 of: _____
 Insured: _____
 Policy No: _____
 Claims No: _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Vehicle: _____



(Policy Condition)
 Remark: The veh had commenced its repair at the time of inspection.

Bel. or Market Value: _____
 IDAC Accident Report: _____ Consistent? : Yes or No
 GIA / PR Seen: _____ Consistent? : Yes or No
 Est. Repairs: _____ days Repair: Yes or No
 Lump Sum: _____ % 3 Val: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Ref No: **8GG 2789 A**
 Type: **6** (M Cycle / Bus / Van / Lorry / Taxi / Prime Mover / Truck / Trailer or)
 Make: **Hissen Sunny** No: **1597**
 Colour: **Silver** A.D. Insured / Std / NI / NA
 So. Reading: **H.A.** TP Res: Insured / Std / NI / NA
 Eng No: **CG 16410439**
 C/N: **JHICFAN1620101135**
 Gen. Cond: **3** (Good / Fair / Poor / Bad)
 Steering: **6** (Inter / Jammed / Leaked / Bent or)
 Brake: **6** (Inter / Jammed / Leaked / Bent or)
 Mod: **NB** (N / S / R / M / STD A/R / M or)
 Tyre Size: **R: 185/65 R15**
 BS / DUN / EXNOVA / GY / RS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or **Yokohama**
 Front: _____ Rear: _____
 R. Bal: **8** mm L. Bal: **8** mm
 D.O.A: **02/02/2018** D.O.I: **07/02/2018**
 Survey held at: **EDGE Ubi**

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or
The vehicle caught fire at engine
 The U/C / Chassis frame / Body Structure affected due to collision

Date / Time	Action / Instruction
Ariva 07	Total loss.
MV 19.51C	
BTA 14.81C	
NL 4.71C	

compartament. Cause of fire likely due to electrical nature

RECEIVED 14 FEB 2019

Date/Time File Pass to: ☐ Prel. Report
☐ Final Report

Days Of Repair: _____
 Resurvey No. of Trip: _____

Survey Fee: **620**
 Transcon: **50**
 Food: **8**
 Total: **678+10**

Date/Time File Return to: **13/2 - typist**

Add Fee: ☐ Stained \$
☐ Intellig \$
☐ Typing \$
☐ Weaving \$

500/-

Report Format: _____
 Lump Sum (L.B.I): _____

30x15=450
 450+170=620

Survey Department Check List (Case Handler)

Reference No.: CS/AVI/8002494 Dvb
Policy Type: OD / TP / TP RES / TL / EVA

Case Handler

Typist

Admin (

): Case handler to make sure all Information created by the assignment team are ACCURATE.

(1) Office Assign Form

		Y-Date	N-Date	Y-Date	N-Date
C	Reference No.	✓			
C	Customer Code				
N	Assign From				
C	Assign Date	✓			
C	Veh No (Inspected)	✓			
C	Veh No (Insured)				
C	D.O.A	✓			
C	Policy No	✓			
C	Claim No	✓			
C	Insurance Authorisation (CA /REV/REP)	✓			
C	Report Type	✓			
C	Weekend Charges	✓			
N	Survey held at/Repairer	✓			
C	Excess				

Surveyor (

): Case handler to make sure the surveyor completed all required information.

(1) Assignment Form

C	Vehicle No	✓			
C	Regn Month/Year	✓			
N	Vehicle Type	✓			
N	Make & Model	✓			
C	Engine Capacity. (C.C)	✓			
N	Colour	✓			
C	Odometer. (Sp.Reading)	✓			
C	Chassis No	✓			
N	General Condition	✓			
N	Steering	✓			
N	Brake	✓			
N	Modification (Modi)	✓			
C	Tyre Size	✓			
N	Tyre Make	✓			
C	Tyre Balance	✓			
C	Date of Inspection	✓			
N	Survey held	✓			
N	Des.of Damages	✓			

(2) System - (Views/Merimen)

C	Damaged Vehicle Photographs Uploaded	✓			
---	--------------------------------------	---	--	--	--

(3) Workshop Estimate/Assignment Form

N	ALL Parts condition	✓			
C	Market Value for OD cases	✓			
C	Estimate Repair Cost for PRI (RSI, TMI, MSIG)				
C	Days of repair				
C	Finalised Amount				
C	Re-inspection Cases to Finalize within 5 Days				

(4) System - (Views/Merimen)

C	Resurvey photo Uploaded				
---	-------------------------	--	--	--	--

Check By: VERON 13/5/18
Case Handler Date

*C: Critical *N: Non-Critical

21/05/20



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
AVIVA LTD		Ref : CS/AVI18002494/Dvb		
4 SHENTON WAY #26-00 SGX CENTRESINGAPORE 068807		Date : 07-02-2018		
		Code : AVI		
1. Policy Particulars :- OWN DAMAGE				
Insured Veh.		Veh. Inspected	SGG 2789A	
Policy No.	10744311	Coverage (\$)	0.00	
Claim No.	G0046683	Excess (\$)	0.00	
Assign From	MERIMEN (CELYN LIM)	Assign Date	07/02/2018	
2. Vehicle Particulars & Condition				
Make & Model		c.c	0	
Engine No.	HIDDEN	Year of Reg.		
Chassis No.		Colour		
Odometer	-	Steering		
Brakes		Modification		
General				
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre			mm	
L/H Front Tyre			mm	
R/H Rear Tyre			mm	
L/H Rear Tyre			mm	
4. Description of Damages				
5. General Information				
Accident Date	02/02/2018	Inspection Date	07/02/2018	
Survey held at	COMFORTDELGRO ENGINEERING PTE LTD NO : 320 UBI ROAD 3 SINGAPORE 408649			
5a. Remarks				
A)THE MARKET VALUE IS S\$------(EST. AVERAGE) B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE AUTHORISED REPAIRS.				

...CLAIM SUBFOLDER...(New Assignment)

Investigation

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	05 Feb 2018 Sendback Est	06 Feb 2018 14:58 S\$40,359.51	07 Feb 2018 11:11 Assign				New Assignment Cancel Case

Main	Reference	Claim Details	Documents	Show All
------	-----------	---------------	-----------	----------

CLAIM SUBFOLDER DETAILS

Insured:	LEO CHOA HOO, ID: S7043587Z, Tel: +6593865075, Email: choahoo70@yahoo.com.sg		
Vehicle Reg. No.:	SGG2789A	Date of Loss:	02/02/2018 13:00 - :59
Claim Type:	OD TFR / G0046683	Policy/Cover Note No.:	10744311 (Comprehensive)
		Excess:	
Repairer:	ComfortDelGro Engineering Pte Ltd (Ubi) 320 UBI ROAD 3, 408649 Ubi - Tel:		
Handling Insurer:	Aviva Ltd (HQ) - Tel: (65) 6827 9966 ... [Handled by Celyn Lim Shiau Hwee - 68277495]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Final Rpt due 19/02/2018]		
Driver/Custodian:	LEO CHOA HOO (47 / Male), NRIC: S7043587Z, Tel: +6593865075		

ASSOCIATED MAIL RECEIVED

There are no mail for this case.

[View All](#)[Compose Case Mail](#)

ALL ASSOCIATED TASKS

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

[View All](#)[Search Tasks](#)[Create New Task](#)[Complete](#)

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

To:	Aviva Ltd 4 Shenton Way #01-01 SGX Centre 2 Singapore 068807	From:	LKK Auto Consultants Pte Ltd 51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park Singapore 408933
Attn:	Celyn Lim Shiau Hwee	Date:	08 Feb 2018
<u>Preliminary Advice</u>			

Vehicle No	: SGG2789A	Accident Date	: 02/02/2018
Make	: NISSAN SUNNY	Policy No.	: 10744311
Assignment Date	: 07/02/2018	Excess	: S\$0.00
Date of Inspection	: 07/02/2018	Est. Duration of Repair	: 0.00
Inspection At	: COMFORTDELGRO ENGINEERING PTE LTD (UBI) 320 UBI ROAD 3 SINGAPORE 408649		

Point of Impact / General Description of Damages

The vehicle caught fire at engine compartment. Cause of fire likely due to electrical nature.

Repairer's Estimate (Gross)	:S\$	40,359.51
Revised Amount	:S\$	30,256.70
Check Items (Estimated)	:S\$	0.00
Total	:S\$	30,256.70

Lump Sum Repair :S\$

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	19,500.00
COE / PARF Rebate	:S\$	14,797.30
Salvage Value	:S\$	
Margin for Repair	:S\$	4,703.00

Remarks

- () The vehicle is repairable at our adjusted amount. We have also confirmed excess and policy coverage. Kindly let us have your authorisation.
- (X) The vehicle is uneconomical to be repaired, you are advised to invite tender for the wreck.
- (X) Other comments : Pending investigation

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	03/02/2018 11:10
Date Of Accident	02/02/2018 13:30
Exact Location Of Accident	734 PASIR RIS STREET 72 WEST PLAZA (MSCP/LVL 3)
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SGG2789A
Insured/Policyholder	
Name Of Registered Owner	LEO CHOA HOO
NRIC No	S7043587Z
Email Address	CHOAHOO70@YAHOO.COM.SG
Mobile Phone No	(LOCAL) +65-93865075
Alternative Phone No	OFFICE-93865075

Vehicle Particulars

Manufacturer	NISSAN
Model	SUNNY 1.6EXM
Exact Purpose for which vehicle was being used at time of accident	PRIVATE
Are you claiming under your own insurance policy for repair to your vehicle?	YES
If No, Please state action to be taken	
Vehicle Category	PRIVATE CAR

Buyer new in 2006
No problem.
Main driver.
Last servicing in 22/01/2018
at regular workshop.

Insurance Company

Name of Insurance Company	AVIVA LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	10744311
Cover Note Number	

Driver

Name of Driver	LEO CHOA HOO
NRIC No	S7043587Z
Date Of Birth	15/12/1970
Occupation	INDOOR
Date Of Driving Pass	01/04/1992
Driving Experience	25 YEARS AND 10 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-93865075
Fax Number	
Contact Number	OFFICE-93865075
Email Address	CHOAHOO70@YAHOO.COM.SG

Address	BLK 765 PASIR RIS STREET 71 #05-102 SINGAPORE 510765
Postcode	
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	FIRE, EXPLOSION OR LIGHTNING
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	NO
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	0

Details of Police Action

Was the accident reported to the police?	YES
If Yes, Please state which Police Station	
POLICE STATION NAME [OTHER]	PASIR RIS NPC
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

REFER TO POLICE REPORT - G/20180202/2139. ON 02/02/2018 AT ABOUT 1225 HOURS, I ARRIVED AT THE WEST PLAZA MSCP AND PARKED MY VEHICLE AT THE DECK D LOT 43. I OFF THE ENGINE, AND LEFT MY VEHICLE THERE AND HEADED TO THE COFFEE SHOP TO HAVE MY MEAL. AT ABOUT 1330HOURS, I NOTICED THAT THERE WAS A LOT OF COMMOTION AT THE CAR PARK AND I COULD ALSO SEE SMOKE COMING OUT FROM THE MSCP. I THEN HEADED OVER THERE AND NOTICED THAT CAR WAS ON FIRE AND THAT SCDF AND THE POLICE WERE ALSO AT SCENE. WHEN I ARRIVED, THE FIRE HAD BEEN PUT OUT. WHILE DRIVING MY VEHICLE, THERE WERE NO FAULTS OR ANYTHING AMISS FROM THE VEHICLE. THE LAST TIME I MAINTAINED THE VEHICLE WAS ON 22/01/2018. THERE HAS BEEN NO PROBLEMS WITH THE ENGINE OF OTHER PARTS. THIS IS THE FIRST TIME THAT SUCH AN INCIDENT HAS HAPPENED. I AM MAKING THIS POLICE REPORT FOR MY OWN INSURANCE CLAIM. THE SAID VEHICLE WAS TOWED AWAY. MY VEHICLE IS: SGG2789A, SLIVER IN COLOR, NISSAN SUNNY.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this form by insurance companies is not an admission of policy liability on the part of insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

 - (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured my vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes").
 - (b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
 - (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.


VERIFIED BY AJAX MARS
REPORTING OFFICER
MOHD FADZLY BIN ISMAIL

Policyholder's Signature / Date & Time

Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel

Sketch Plan

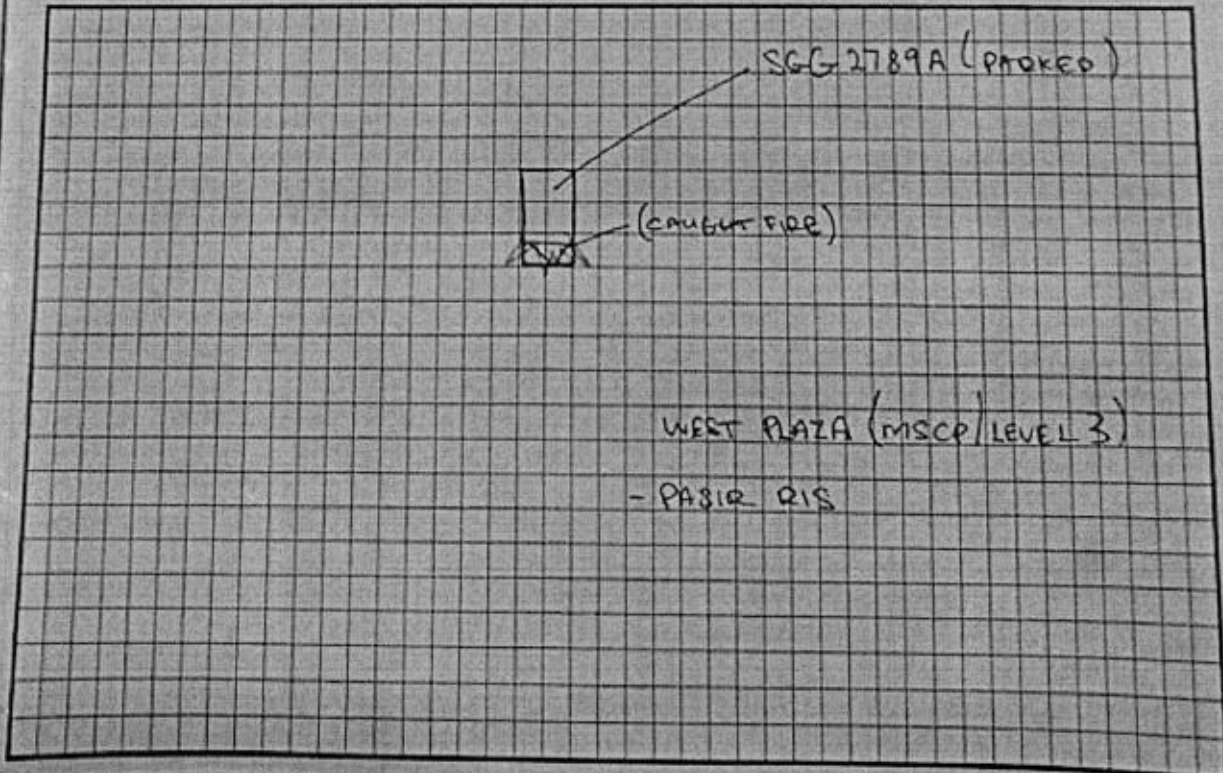

Police Report



**SINGAPORE
POLICE FORCE**



G/20180202/2139

1 of 2

POLICE REPORT (NP299)

Report No. G/20180202/2139

Police Station Of Origin
Pasir Ris N.P.C
1 Pasir Ris Drive 4 #01-01 SINGAPORE
519457
Tel No: 1800-5852999

Date/Time Report Made 02/02/2018 19:01	Vide Report No. G/20180202/0111	Station Diary No. 112	
Name Of Informant LEO CHOA HOO	Address APT BLK 765 PASIR RIS STREET 71 #05-102 SINGAPORE 510765		
ID Type / ID No NRIC NO / S7043587Z	Contact No Home/Office	Mobile 93865075	
Nationality SINGAPORE CITIZEN	Email Address		
Occupation ENGINEER	Sex Male	Age 47	Date of Birth 15/12/1970
Institution/School Name	Race Chinese		
	Language		
Date/Time Of Incident 02/02/2018 13:30	Location Of Incident 734 PASIR RIS STREET 72 PASIR RIS WEST PLAZA SINGAPORE 510734		

Brief details.

On 02/02/2018 at about 1225 hours, I arrived at the West Plaza MSCP and parked my vehicle at the deck D lot 43. I off the engine, and left my vehicle there and headed to the coffee shop to have my meal.

At about 1330 hours, I noticed that there was a lot of commotion at the car park and I could also see smoke coming out from the MSCP. I then headed over there and noticed that my car was on fire and that SCDF and the police were also at scene. When I arrived, the fire had been put out. While driving my

Signature Of Officer Recording The Report:

G / Sgt 1 ISAAC LIM JUN CHENG


Signature Of Informant:

Signature Of Interpreter:
Not applicableDate/Time
02/02/2018 19:01

Officer In-Charge Of Case.
G / Bedok Police Divisional Investigation Branch /
ASP NG YI JIE
Contact No: 62447200

Classification Of Case:

Authentication Stamp

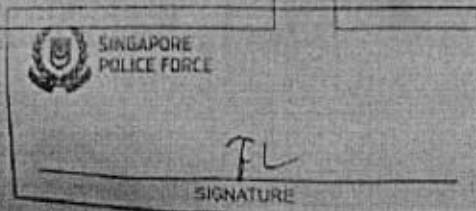

Police Report

SINGAPORE
POLICE FORCE

G/20180202/2139

2 of 2

POLICE REPORT (NP299)

CONTINUATION OF REPORT

Report No. G/20180202/2139

vehicle, there were no faults or anything amiss from the vehicle. The last time I maintained the vehicle was on 22/01/2018. There has been no problems with the engine or other parts. This is the first time that such an incident has happened. I am making this police report for my own insurance claim. The said vehicle was towed away. My vehicle is SGG2789A, silver in color, Nissan Sunny.

Signature Of Officer Recording The Report:

G / Sgt 1 ISAAC LIM JUN CHENG

Signature Of Informant:

Signature Of Interpreter:

Not applicable

Date/Time:

02/02/2018 19:01

Officer In-Charge Of Case:


G / Bedok Police Divisional Investigation Branch /

ASP NG YI JIE

Contact No. : 62447200

Classification Of Case

Authentication Stamp

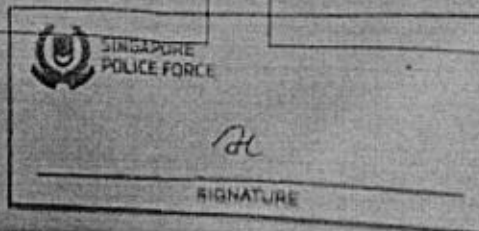

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	3587Z
Vehicle Details	
Vehicle No.:	SGG2789A
Vehicle to be Exported:	No
Intended De-registration Date:	08 Feb 2018
Vehicle Make:	NISSAN
Vehicle Model:	SUNNY 1.6EXM
Primary Colour:	Silver
Manufacturing Year:	2006
Engine No.:	QG16410439
Chassis No.:	JN1CFAN16Z0101135
Maximum Power Output:	81.0 kW (108 bhp)
Open Market Value:	\$11,099.00
Original Registration Date:	08 May 2006
First Registration Date:	08 May 2006
Transfer Count:	0
Actual ARF Paid:	\$12,209.00
Intended PARF Rebate Details	
PARF Eligibility:	Forfeited
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00
Intended COE Rebate Details	
COE Expiry Date:	07 May 2021
COE Category:	A - Car (1600cc & below)

COE Period(Years):	5
PQP Paid:	\$22,789.00
COE Rebate Amount:	\$14,797.00
Total Rebate Amount:	\$14,797.00

Message

Please note that the 5-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.

The information contained herein is correct as at 08 Feb 2018

ComfortDelGro Engineering Pte Ltd (Co. Reg. No: 199506048W)

320 UBI ROAD 3
Singapore 408649
Email: denisteo@cdge.com.sg

INSURER: Aviva Ltd (HQ)

PARTICULARS OF CLAIM

Claim Type:	OD (OWN DAMAGE)	Ref. No:	
Policy No:	10744311	Date of Loss:	02/02/2018
Vehicle Reg. No.:	SGG2789A	Driveable?	
Driver Age/Info:	47 / MALE	Party At Fault:	UNKNOWN
TP Injury Involved?	NO	Third Party Involved?	NO
Insured/Claimant:	LEO CHOA HOO	Contact No:	+6593865075
Driver:	LEO CHOA HOO		
Make/Model:	NISSAN SUNNY, 1.6 (A)	Vehicle Reg. Date:	08/05/2006
Vehicle Colour:	SILVER	Chassis No:	JN1CFAN16Z0101135
Engine No:	QG16410439		
Odometer:	180000 KM		
Paint Type:			
Total Loss?	YES		
Est. Duration of Repair (day)	45		
Description of Accident/Loss	REFER TO POLICE REPORT - G/20180202/2139. ON 02/02/2018 AT ABOUT 1225 HOURS, I ARRIVED AT THE WEST PLAZA MSCP AND PARKED MY VEHICLE AT THE DECK D LOT 43. I OFF THE ENGINE, AND LEFT MY VEHICLE THERE AND HEADED TO THE COFFEE SHOP TO HAVE MY MEAL. AT ABOUT 1330HOURS, I NOTICED THAT THERE WAS A LOT OF COMMOTION AT THE CAR PARK AND I COULD ALSO SEE SMOKE COMING OUT FROM THE MSCP. I THEN HEADED OVER THERE AND NOTICED THAT CAR WAS ON FIRE AND THAT SCDF AND THE POLICE WERE ALSO AT SCENE. WHEN I ARRIVED, THE FIRE HAD BEEN PUT OUT. WHILE DRIVING MY VEHICLE, THERE WERE NO FAULTS OR ANYTHING AMISS FROM THE VEHICLE. THE LAST TIME I MAINTAINED THE VEHICLE WAS ON 22/01/2018. THERE HAS BEEN NO PROBLEMS WITH THE ENGINE OF OTHER PARTS. THIS IS THE FIRST TIME THAT SUCH AN INCIDENT HAS HAPPENED. I AM MAKING THIS POLICE REPORT FOR MY OWN INSURANCE CLAIM. THE SAID VEHICLE WAS TOWED AWAY. MY VEHICLE IS; SGG2789A, SLIVER IN COLOR, NISSAN SUNNY.		
Remarks:	NOT ECONOMICAL REPAIR, ESTIMATE REPAIR COST ABOVE \$40K		
Present Location:	COMFORTDELGRO ENGINEERING PTE LTD (UBI)		

COST OF CLAIMS	Amount
Parts	33,025.19
Miscellaneous Items	0.00
Labour	7,334.32
Paintwork Labour	0.00
Towing	0.00
Gross Total (S\$)	40,359.51
+ GST 7.00% (S\$)	2,825.17
Nett Amount (S\$)	43,184.68

This claim is handled by: ANIKKA LAI SWEE KAM

Generated using Merimen e-Claims Internet Estimation & Adjusting System

REPAIR DETAILS**Reference**

Part Source: MRM-SG	Version: 1.0 (Last Synchronised: 06 Feb 2018)
Parts: 143	NISSAN SUNNY 1.6 (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's	(Price-denominated Standard List)
Print Code: ComfortDelGro Engineering Pte Ltd/SGG2789A/06/02/2018 14:58	
Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.	

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1	NA	*ACTIVE CARBON FILTER	0.00	0.00	*106.26 F
2	1	NA	*AIR DIST HOUSING	0.00	0.00	*- F
3	1	NA	*AIR FILTER ASSY	0.00	0.00	*333.77 F
4	1	NA	*AIR FILTER RESONATOR	0.00	0.00	*148.16 F
5	1	NA	*AIR FLOW METER	0.00	0.00	*529.76 F
6	1	NA	*AIR INTAKE COVER	0.00	0.00	*- F
7	1	NA	*AIR INTAKE HOSE	0.00	0.00	*53.31 F
8	1	NA	*AIR INTAKE HOSE	0.00	0.00	*101.43 F
9	1	NA	*AIRBAG CONTACT RING	0.00	0.00	*115.96 F
10	1	NA	*AIRBAG CONTROL UNIT	0.00	0.00	*- F
11	1	NA	*ALTERNATOR	0.00	0.00	*671.66 F
12	1	NA	*ALTERNATOR BELT	0.00	0.00	*24.98 F
13	1	NA	*ALTERNATOR BRACKET	0.00	0.00	*75.55 F
14	1	NA	*ALTERNATOR STRAP	0.00	0.00	*46.35 F
15	1	NA	*BASE ENGINE	0.00	0.00	*- F
16	1	NA	*BATTERY	0.00	0.00	*- F
17	1	NA	*BATTERY TRAY	0.00	0.00	*54.79 F
18	1	NA	*BONNET	0.00	0.00	*834.88 F
19	1	NA	*BONNET CABLE	0.00	0.00	*- F
20	1	NA	*BONNET INSULATION	0.00	0.00	*115.74 F
21	1	NA	*BONNET LOCK	0.00	0.00	*- F
22	1	NA	*BONNET SUPPORT	0.00	0.00	*10.60 F
23	1	NA	*BRAKE MASTER CYL	0.00	0.00	*- F
24	1	NA	*BRAKE POWER CONTROL	0.00	0.00	*809.21 F
25	1	NA	*BUMPER BRACKET	0.00	0.00	*136.45 F
26	1	NA	*CATALYST	0.00	0.00	*859.27 F
27	1	NA	*CENTRE AIR DUCT	0.00	0.00	*- F
28	1	NA	*CENTRE CONSOLE	0.00	0.00	*167.18 F
29	1	NA	*CLIP FASTENING	0.00	0.00	*13.25 F
30	1	NA	*CLIP FASTENING	0.00	0.00	*10.28 F
31	1	NA	*CLUTCH DISC	0.00	0.00	*101.75 F
32	1	NA	*CLUTCH MASTER CYL	0.00	0.00	*- F
33	1	NA	*CLUTCH PRESS PLATE	0.00	0.00	*154.17 F
34	1	NA	*COMBI SWITCH	0.00	0.00	*73.00 F
35	1	NA	*CONNECTION CHANNEL	0.00	0.00	*- F
36	1	NA	*CONSOLE COVER	0.00	0.00	*114.08 F
37	1	NA	*CROSS JOINT	0.00	0.00	*- F
38	1	NA	*CTR EXHAUST PIPE	0.00	0.00	*- F
39	1	NA	*CTR UPP FLOOR REINF	0.00	0.00	*38.50 F
40	1	NA	*DRIVER AIRBAG	0.00	0.00	*400.00 F
41	1	NA	*EARTH CABLE	0.00	0.00	*- F
42	1	NA	*EGR PIPE	0.00	0.00	*51.13 F
43	1	NA	*EGR VALVE	0.00	0.00	*194.52 F

ComfortDelGro Engineering Pte Ltd/SGG2789A/06/02/2018 14:58. Not valid without Reference section.

Generated using Merimen e-Claims IEAS

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
44	1	NA	*ELECTRIC FUEL PUMP	0.00	0.00	*291.60 F
45	1	NA	*ENGINE CARRIER	0.00	0.00	*164.10 F
46	1	NA	*ENGINE COMP HARNESS	0.00	0.00	*- F
47	1	NA	*ENGINE FIREWALL	0.00	0.00	*- F
48	1	NA	*ENGINE S-ABSORB	0.00	0.00	*35.89 F
49	1	NA	*EXHAUST MANIFOLD	0.00	0.00	*- F
50	1	NA	*EXPANSION TANK	0.00	0.00	*83.79 F
51	1	NA	*FILLER NECK	0.00	0.00	*114.15 F
52	1	NA	*FILLER NECK CAP	0.00	0.00	*29.28 F
53	1	NA	*FIREWALL INSULATION	0.00	0.00	*121.91 F
54	1	NA	*FLYWHEEL	0.00	0.00	*459.19 F
55	1	NA	*FRONT AXLE BEAM	0.00	0.00	*- F
56	1	NA	*FRONT BONNET SEAL	0.00	0.00	*13.61 F
57	1	NA	*FRONT BRAKE PAD SET NH	0.00	0.00	*116.02 F
58	1	NA	*FRONT BRAKE REP KIT NH	0.00	0.00	*41.20 F
59	1	NA	*FRONT BUMPER	0.00	0.00	*- F
60	1	NA	*FRONT EXHAUST PIPE	0.00	0.00	*81.29 F
61	1	NA	*FRONT FLOOR PANEL	0.00	0.00	*400.34 F
62	1	NA	*FRONT LAMBDA PROBE	0.00	0.00	*- F
63	1	NA	*FRONT NUMBER PLATE SVC	0.00	0.00	*18.00 F
64	1	NA	*FRONT PANEL CPL	0.00	0.00	*294.35 F
65	1	NA	*FRONT STABILISER	0.00	0.00	*318.17 F
66	1	NA	*FRT BUMPER CLAMP KIT	0.00	0.00	*- F
67	1	NA	*FRT BUMPER S-ABSORB	0.00	0.00	*- F
68	1	NA	*FRT BUMPER SUPPORT	0.00	0.00	*113.79 F
69	1	NA	*FRT CALIPER REP KIT NH	0.00	0.00	*102.00 F
70	1	NA	*FRT CAT HEAT PROTECT	0.00	0.00	*62.91 F
71	1	NA	*FRT ENG MNTG BRACKET	0.00	0.00	*10.06 F
72	1	NA	*FRT ENGINE MOUNTING	0.00	0.00	*73.54 F
73	1	NA	*FRT EXH-HEAT SHIELD	0.00	0.00	*71.84 F
74	1	NA	*FRT NO PLATE REINF	0.00	0.00	*5.00 F
75	1	NA	*FRT TOWING HOOK BRKT	0.00	0.00	*- F
76	1	NA	*FRT WATERBOX PANEL	0.00	0.00	*- F
77	1	NA	*FUEL DISTRIBUTOR	0.00	0.00	*- F
78	1	NA	*FUEL FILLER FLAP NH	0.00	0.00	*85.08 F
79	1	NA	*FUEL TANK NH	0.00	0.00	*250.56 F
80	1	NA	*FUEL TANK LID CABLE NH	0.00	0.00	*- F
81	1	NA	*FUEL TANK PROTECTION NH	0.00	0.00	*241.47 F
82	1	NA	*GLOVEBOX	0.00	0.00	*- F
83	1	NA	*GRILLE	0.00	0.00	*- F
84	1	NA	*HEATER BLOWER CPL	0.00	0.00	*- F
85	1	NA	*HEATER CONTROL	0.00	0.00	*- F
86	1	NA	*HEATER CPL	0.00	0.00	*962.80 F
87	1	NA	*HIGH TONE HORN	0.00	0.00	*78.49 F
88	1	NA	*HI-LEVEL BRAKELAMP	0.00	0.00	*116.40 F
89	1	NA	*IGNITION COIL 1	0.00	0.00	*119.84 F
90	1	NA	*IGNITION COIL 2	0.00	0.00	*119.84 F
91	1	NA	*IGNITION COIL 3	0.00	0.00	*119.84 F
92	1	NA	*IGNITION COIL 4	0.00	0.00	*119.84 F
93	1	NA	*IMMOBILISER COIL	0.00	0.00	*99.25 F
94	1	NA	*INJECT NOZZLE CYL 1	0.00	0.00	*329.10 F
95	1	NA	*INJECT NOZZLE CYL 2	0.00	0.00	*329.10 F
96	1	NA	*INJECT NOZZLE CYL 3	0.00	0.00	*329.10 F
97	1	NA	*INJECT NOZZLE CYL 4	0.00	0.00	*329.10 F
98	1	NA	*INJECTION MODULE	0.00	0.00	*- F
99	1	NA	*INLET PIPE	0.00	0.00	*43.75 F
100	1	NA	*INSTR PANEL SUPPORT	0.00	0.00	*- F

ComfortDelGro Engineering Pte Ltd/SGG2789A/06/02/2018 14:58. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1	NA	*INSTRUMENT COVER	0.00	0.00	*-F
102	1	NA	*INSTRUMENT PNL TRIM	0.00	0.00	*-F
103	1	NA	*INSTRUMENT W-HARNESS	0.00	0.00	*1,668.58 F
104	1	NA	*INTAKE MANIFOLD	0.00	0.00	*323.52 F
105	1	NA	*INTERIOR MIRROR	0.00	0.00	*70.55 F
106	1	NA	*INTERMEDIATE PLATE	0.00	0.00	*68.23 F
107	1	NA	*L/AIR DUCT	0.00	0.00	*-F
108	1	NA	*L/AXLE LINK MNTG SET	0.00	0.00	*-F
109	1	NA	*L/BRAKE DISC COVER NH	0.00	0.00	*49.95 F
110	1	NA	*L/BUMPER AIR GRILLE	0.00	0.00	*5.75 F
111	1	NA	*L/CTR AIR DUCT	0.00	0.00	*-F
112	1	NA	*L/DOOR MIRROR COVER NH	0.00	0.00	*41.20 F
113	1	NA	*L/DRIVE SHAFT CPL	0.00	0.00	*777.06 F
114	1	NA	*L/EXH MANIF GASKET	0.00	0.00	*6.18 F
115	1	NA	*L/F BELT HEIGHT ADJ	0.00	0.00	*78.91 F
116	1	NA	*L/F BRAKE CALIPER NH	0.00	0.00	*539.91 F
117	1	NA	*L/F BRAKE DISC NH	0.00	0.00	*48.69 F
118	1	NA	*L/F BRAKE HOSE NH	0.00	0.00	*-F
119	1	NA	*L/F BUMPER MOULDING	0.00	0.00	*-F
120	1	NA	*L/F COIL SPRING	0.00	0.00	*164.77 F
121	1	NA	*L/F DOOR CHECK NH	0.00	0.00	*47.70 F
122	1	NA	*L/F DOOR FOIL NH	0.00	0.00	*21.20 F
123	1	NA	*L/F DOOR WINDOW NH	0.00	0.00	*223.38 F
124	1	NA	*L/F FLOOR PNL S-MEMB	0.00	0.00	*55.34 F
125	1	NA	*L/F LWR AXLE ARM	0.00	0.00	*175.10 F
126	1	NA	*L/F OUT BUMPER BRKT	0.00	0.00	*20.60 F
127	1	NA	*L/F PRESSURE VALVE	0.00	0.00	*14.70 F
128	1	NA	*L/F SEAT BELT LOCK NH	0.00	0.00	*36.89 F
129	1	NA	*L/F SIDE MEMBER	0.00	0.00	*166.86 F
130	1	NA	*L/F STABI HANGER	0.00	0.00	*16.73 F
131	1	NA	*L/F STABILISER BUSH	0.00	0.00	*14.04 F
132	1	NA	*L/F STEERING KNUCKLE	0.00	0.00	*290.72 F
133	1	NA	*L/F STRUT	0.00	0.00	*144.20 F
134	1	NA	*L/F TYRE NH	0.00	0.00	*48.90 F
135	1	NA	*L/F WASHER JET NH	0.00	0.00	*19.32 F
136	1	NA	*L/F WHEEL NH	0.00	0.00	*74.46 F
137	1	NA	*L/F WHEEL BEARING	0.00	0.00	*56.12 F
138	1	NA	*L/F WHEEL BOLT SET	0.00	0.00	*40.00 F
139	1	NA	*L/F WHEEL COVER	0.00	0.00	*40.13 F
140	1	NA	*L/F WHEEL HUB	0.00	0.00	*231.70 F
141	1	NA	*L/F WHEELHOUSE COVER	0.00	0.00	*49.07 F
142	1	NA	*L/F WHEELHOUSE CPL	0.00	0.00	*273.91 F
143	1	NA	*L/F W-HOUSE RR REINF	0.00	0.00	*15.49 F
144	1	NA	*L/F WING	0.00	0.00	*136.59 F
145	1	NA	*L/F WING BRACKET	0.00	0.00	*13.50 F
146	1	NA	*L/F WING CLAMP KIT	0.00	0.00	*-F
147	1	NA	*L/F WING COVER	0.00	0.00	*47.70 F
148	1	NA	*L/F WING INN UPP CVR	0.00	0.00	*46.19 F
149	1	NA	*L/F WIPER ARM	0.00	0.00	*-F
150	1	NA	*L/F WIPER BLADE	0.00	0.00	*7.00 F
151	1	NA	*L/FLOOR CROSSMEMBER NH	0.00	0.00	*53.99 F
152	1	NA	*L/INNER SILL PANEL NH	0.00	0.00	*116.21 F
153	1	NA	*L/LOWER DOOR HINGE NH	0.00	0.00	*53.56 F
154	1	NA	*L/LWR INS PANEL TRAY NH	0.00	0.00	*-F
155	1	NA	*L/NO PLATE LAMP CPL NH	0.00	0.00	*25.39 F
156	1	NA	*L/OUTER AIR VENT NH	0.00	0.00	*73.59 F
157	1	NA	*L/R DOOR WINDOW NH	0.00	0.00	*169.71 F

ComfortDelGro Engineering Pte Ltd/SGG2789A/06/02/2018 14:58. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	NA		*L/R INNER LAMP H/L	0.00	0.00	*-F
159	1	NA	*L/R OUTER LAMP H/L	0.00	0.00	*-F
160	1	NA	*L/R QUARTER GLASS H/L	0.00	0.00	*67.18 F
161	1	NA	*L/R SIDE MEMBER H/L	0.00	0.00	*174.49 F
162	1	NA	*L/REP LAMP BULB HOLD H/L	0.00	0.00	*30.90 F
163	1	NA	*L/REPEATER LAMP BULB H/L	0.00	0.00	*3.34 F
164	1	NA	*L/S-ABSORB BOOT H/L	0.00	0.00	*39.32 F
165	1	NA	*L/S-MEMB COVER PANEL H/L	0.00	0.00	*-F
166	1	NA	*L/STABI CLAMP H/L	0.00	0.00	*21.60 F
167	1	NA	*L/UPP RADIATOR BRKT	0.00	0.00	*20.60 F
168	1	NA	*L/UPP SPRING SEAT	0.00	0.00	*165.29 F
169	1	NA	*L/UPP W-HOUSE REINF	0.00	0.00	*86.05 F
170	1	NA	*L/UPPER DOOR HINGE H/L	0.00	0.00	*55.08 F
171	1	NA	*L/WATER BOX REINF	0.00	0.00	*-F
172	1	NA	*L/W-HOUSE SPLASH PNL	0.00	0.00	*97.77 F
173	1	NA	*L/WINDSCREEN MLDG H/L	0.00	0.00	*65.08 F
174	1	NA	*L/WING STRUT H/L	0.00	0.00	*23.03 F
175	1	NA	*LEFT BONNET HINGE	0.00	0.00	*23.87 F
176	1	NA	*LEFT BUMPER BRACKET	0.00	0.00	*43.07 F
177	1	NA	*LEFT HEADLAMP ASSY	0.00	0.00	*-F
178	1	NA	*LOW TONE HORN	0.00	0.00	*-F
179	1	NA	*LWR RADIATOR HOSE	0.00	0.00	*35.34 F
180	1	NA	*LWR RUBBER BRG CLAMP	0.00	0.00	*-F
181	1	NA	*NUT	0.00	0.00	*4.12 F
182	1	NA	*NUT	0.00	0.00	*4.12 F
183	1	NA	*OIL FILTER	0.00	0.00	*8.10 F
184	1	NA	*OUTER TEMP SENSOR	0.00	0.00	*11.33 F
185	1	NA	*P/STRG COOLING COIL	0.00	0.00	*-F
186	1	NA	*PASSENGER AIRBAG	0.00	0.00	*-F
187	1	NA	*POLLEN FILTER	0.00	0.00	*15.01 F
188	1	NA	*POWER STEERING CPL	0.00	0.00	*675.04 F
189	1	NA	*POWER STEERING PUMP	0.00	0.00	*492.58 F
190	1	NA	*PRESSURE PIPE	0.00	0.00	*-F
191	1	NA	*PRESSURE REGULATOR	0.00	0.00	*97.31 F
192	1	NA	*P-STEERING PUMP BRKT	0.00	0.00	*120.00 F
193	1	NA	*PUMP OIL TANK	0.00	0.00	*178.43 F
194	1	NA	*R/AIR DUCT	0.00	0.00	*-F
195	1	NA	*R/AXLE LINK MNTG SET H/L	0.00	0.00	*-F
196	1	NA	*R/BRAKE DISC COVER H/L	0.00	0.00	*49.95 F
197	1	NA	*R/BUMPER AIR GRILLE H/L	0.00	0.00	*5.75 F
198	1	NA	*R/CTR AIR DUCT H/L	0.00	0.00	*-F
199	1	NA	*R/DRIVE SHAFT CPL	0.00	0.00	*960.42 F
200	1	NA	*R/ENGINE BRACKET	0.00	0.00	*86.72 F
201	1	NA	*R/ENGINE MOUNTING	0.00	0.00	*120.11 F
202	1	NA	*R/EXH MANIF GASKET	0.00	0.00	*6.18 F
203	1	NA	*R/F BELT HEIGHT ADJ H/L	0.00	0.00	*78.91 F
204	1	NA	*R/F BRAKE CALIPER H/L	0.00	0.00	*539.91 F
205	1	NA	*R/F BRAKE DISC H/L	0.00	0.00	*48.69 F
206	1	NA	*R/F BRAKE HOSE H/L	0.00	0.00	*-F
207	1	NA	*R/F COIL SPRING H/L	0.00	0.00	*164.77 F
208	1	NA	*R/F DOOR CHECK H/L	0.00	0.00	*47.70 F
209	1	NA	*R/F DOOR FOIL H/L	0.00	0.00	*21.20 F
210	1	NA	*R/F DOOR TRIM H/L	0.00	0.00	*-F
211	1	NA	*R/F DOOR WINDOW H/L	0.00	0.00	*111.69 F
212	1	NA	*R/F FLOOR REINF H/L	0.00	0.00	*52.79 F
213	1	NA	*R/F LOWER AXLE ARM H/L	0.00	0.00	*152.89 F
214	1	NA	*R/F OUT BUMPER BRKT H/L	0.00	0.00	*20.60 F

ComfortDelGro Engineering Pte Ltd/SGG2789A/06/02/2018 14:58. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
	1	NA	*R/F PRESSURE VALVE	0.00	0.00	*14.70 F
216	1	NA	*R/F SEAT BELT LOCK	0.00	0.00	*36.89 F
217	1	NA	*R/F SIDE MEMBER	0.00	0.00	*166.86 F
218	1	NA	*R/F STABI HANGER	0.00	0.00	*16.73 F
219	1	NA	*R/F STABILISER BUSH	0.00	0.00	*14.04 F
220	1	NA	*R/F STEERING KNUCKLE	0.00	0.00	*290.57 F
221	1	NA	*R/F STRUT	0.00	0.00	*144.20 F
222	1	NA	*R/F TYRE	0.00	0.00	*48.90 F
223	1	NA	*R/F WASHER JET	0.00	0.00	*19.32 F
224	1	NA	*R/F WHEEL	0.00	0.00	*74.46 F
225	1	NA	*R/F WHEEL BEARING	0.00	0.00	*56.12 F
226	1	NA	*R/F WHEEL BOLT SET	0.00	0.00	*40.00 F
227	1	NA	*R/F WHEEL COVER	0.00	0.00	*40.13 F
228	1	NA	*R/F WHEEL HUB	0.00	0.00	*231.70 F
229	1	NA	*R/F WHEELHOUSE COVER	0.00	0.00	*50.85 F
230	1	NA	*R/F WHEELHOUSE CPL	0.00	0.00	*342.32 F
231	1	NA	*R/F W-HOUSE RR REINF	0.00	0.00	*15.49 F
232	1	NA	*R/F WING	0.00	0.00	*136.59 F
233	1	NA	*R/F WING BRACKET	0.00	0.00	*30.90 F
234	1	NA	*R/F WING CLAMP KIT	0.00	0.00	*- F
235	1	NA	*R/F WING COVER	0.00	0.00	*47.70 F
236	1	NA	*R/F WING INN UPP CVR	0.00	0.00	*41.36 F
237	1	NA	*R/F WIPER ARM	0.00	0.00	*- F
238	1	NA	*R/F WIPER BLADE	0.00	0.00	*- F
239	1	NA	*R/INNER SILL PANEL	0.00	0.00	*116.21 F
240	1	NA	*R/LOWER DOOR HINGE	0.00	0.00	*26.58 F
241	1	NA	*R/LWR INS PANEL TRAY	0.00	0.00	*- F
242	1	NA	*R/NO PLATE LAMP CPL	0.00	0.00	*25.39 F
243	1	NA	*R/OUTER AIR VENT	0.00	0.00	*- F
244	1	NA	*R/R DOOR WINDOW	0.00	0.00	*102.30 F
245	1	NA	*R/R INNER LAMP CPL	0.00	0.00	*- F
246	1	NA	*R/R OUTER LAMP	0.00	0.00	*- F
247	1	NA	*R/R QUARTER GLASS	0.00	0.00	*67.18 F
248	1	NA	*R/R SIDE MEMBER	0.00	0.00	*189.00 F
249	1	NA	*R/R WING FRT BRACKET	0.00	0.00	*9.54 F
250	1	NA	*R/REP LAMP BULB HOLD	0.00	0.00	*30.90 F
251	1	NA	*R/REPEATER LAMP BULB	0.00	0.00	*3.34 F
252	1	NA	*R/S-ABSORB BOOT	0.00	0.00	*39.32 F
253	1	NA	*R/S-MEMB COVER PANEL	0.00	0.00	*- F
254	1	NA	*R/STABI CLAMP	0.00	0.00	*21.60 F
255	1	NA	*R/UPP SPRING SEAT	0.00	0.00	*165.29 F
256	1	NA	*R/UPP W-HOUSE REINF	0.00	0.00	*101.54 F
257	1	NA	*R/UPPER DOOR HINGE	0.00	0.00	*54.96 F
258	1	NA	*R/WATER BOX REINF	0.00	0.00	*- F
259	1	NA	*R/W-HOUSE SPLASH PNL	0.00	0.00	*100.24 F
260	1	NA	*R/W-HOUSE SUPPORT	0.00	0.00	*47.70 F
261	1	NA	*R/WINDSCREEN MLDG	0.00	0.00	*65.08 F
262	1	NA	*R/WING STRUT	0.00	0.00	*21.20 F
263	1	NA	*RADIATOR	0.00	0.00	*213.40 F
264	1	NA	*RADIATOR SHROUD CPL	0.00	0.00	*473.10 F
265	1	NA	*RADIO WITH CD	0.00	0.00	*- F
266	1	NA	*REAR ENGINE BRACKET	0.00	0.00	*74.23 F
267	1	NA	*REAR SCREEN	0.00	0.00	*540.96 F
268	1	NA	*REAR SCREEN BOND KIT	0.00	0.00	*31.62 F
269	1	NA	*REAR SCREEN SEAL	0.00	0.00	*25.83 F
270	1	NA	*REAR SCREEN SPACER	0.00	0.00	*8.06 F
271	1	NA	*REAR WINDOW MOULDING	0.00	0.00	*93.55 F

NH

ComfortDelGro Engineering Pte Ltd/SGG2789A/06/02/2018 14:58. Not valid without Reference section.

Generated using Merimen e-Claims IEAS