

REF: CS3/MSG18002832/RIg d3er

Meimlen

ASSIGNMENT (Office)

Specs Instruction

From (Person): Irene Tan of MSIG Date/Time: 05/01/2018

L/S: \$ 5,700.00

Estimated Cost: Bill to:

Third Parties:

Claimant:

Surveyor: Prestige Appraiser Services

Workshop: Brothers Motor

OD/TP Re-inspection Evaluation

To Inspect Vehicle No: FBL 1202R

Insured: SKF 2724

at Workshop/mis Brothers Motor

Tel: 9643 2540

of BIK 1016, Yishun Ind Prk A # 01-218

Policy No: B273 20261 SMP

Claim No: 549324

Sum Insured:

Excess:

Make of Veh:

D.O.A. 09/02/2018

(Client's Record)

'Do not Finalize'

H.O.D. Enforcement Date:

Date/Time: Person Contacted: Vehicle IN / OUT

Date/Time: Confirmed with Final Fig days (Red S / %; Original 4 days)

Date/Time: 09/05/18 Submit Final Fig 7600 4 days (Red S 3100 / 54 %; Original days)

Date/Time	Action/Instruction
	FBL 1202R - NA/MSG18002736/13
	SKF 2724 - NA/MSG18002736/13
	by Submit 11.04.2018

Para(1) : Parts found not replaced (To highlight R or UB, LR, Etc)

Para(2) : Comments on consistency of damages (Parts Not Consistent : NC)

RECEIVED 07 MAY 2018

Para(3) : Nett Value

Market Value :

Salvage Value :

Nett Value :

Inspected/
Evaluated by:

Fee Charged:

Basic & Add

Transport

Photos

Others

Total

Date:

1) Date/Time 07/05/18 File Pass to: [Signature]

3) Date/Time File Pass to:

5) Date/Time File Pass to:

2) Date/Time File Return to:

4) Date/Time File Return to:

6) Date/Time File Return to:

12/03/2018

ASS. REC. BY:

REF: CS3/MSG18002032/R1d3

Special Instruction:

Surveyor:
Menmen

Rasul

ASSIGNMENT (Office)

From (Person):

Irene Tan

of

MSG

Date/Time:

12/02/2018 @ 2:45pm

Estimated Cost:

Bill to:

OD / ~~IP~~ / WS / TP RES / OD RES / EVA / ENV / MV / CS

To Inspect Vehicle No:

FBL1202R

Insured:

SKF 2724

at Workshop m/s

Brothers Motor

Tel:

9643 2540

of

Blk 1016, Yishun Ind. Prk A # 01-218

Policy No:

B273 202615MP

Claim No:

549324

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A. 9/2/18

13/02/2018 @ 12pm-12:30pm

CA / REV / REP. / REV 24 HRS

1wp

H.O.D. Endorsement:

Date/Time:

4:28pm @ 12/2/18

Person Contacted:

Mr. Tat

Vehicle IN/OUT

Date/Time	Action/Instruction (X) Estimate	
	FBL1202R - NA/MSG18002732/r3	D.O.A: 9/2/18
	SKF2724 - NA/MSG18002736/r3	D.O.A: 9/2/18

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	12 Feb 2018		12 Feb 2018 14:45 Assign				New Assignment Cancel Case

Main

Reference

Claim Details

Documents

[Show All](#)

CLAIM SUBFOLDER DETAILS

[Created by insurer]

Insured:	CHUA CHENG SIONG, ID: S1559530B		
Main Claimant:	THIRUMARAN S/O SHANMUGAVEL, ID: S1741640E		
Vehicle Reg. No.:	FBL1202R	Date of Loss:	09/02/2018 07:00 - :59
Claim Type:	TP / 549324	Policy/Cover Note No.:	B27320261SMP Coverage: 25/04/2017 - 24/04/2018
Vehicle Reg. No. (Insured):	SKF272U	Policy No. (Claimant):	
		Excess:	
Repairer:	Brothers Motor (HQ) BLK 1016 YISHUN INDUSTRIAL PARK A #01-218, 768758 Yishun - Tel:		
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Irene Tan Gek Ing - 6594 2541]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Imm.Advice due 13/02/2018]		
Driver/Custodian (Insured):	TAN AI LAN (), NRIC: S1707157B		
Adj Asg. Remarks:	please assign Mr Kenneth Kong as the surveyor. Thank You.		

ASSOCIATED MAIL RECEIVED

[View All](#)[Compose Case Mail](#)

There are no mail for this case.

ALL ASSOCIATED TASKS

[View All](#)[Search Tasks](#)[Create New Task](#)[Complete](#)

Due Date Priority Type Task Group Subject Handler Assigned By Completed On Created On Done?

No results.

Centro-Legal Law Corporation

ADVOCATES AND SOLICITORS

151 Chin Swee Road
#02-21 Manhattan House
Singapore 169876
Tel: 6235 0633
Fax: 6235 6939

Your ref : SKF272U

Our ref : CLLC.0153.2018 LI

12 February 2018

MSIG INSURANCE (S) PTE LTD
4 Shenton Way #21-01 SGX Centre 2
Singapore 068807
Fax: 6827 6800

BY EMAIL & FAX

Attn: **Officer-In-Charge**
Dear Sirs,

**NOTICE TO INSURANCE TO CONDUCT PRE-REPAIR INSPECTION WITHIN 2
WORKING DAYS PURSUANT TO PARAGRAPH 6.2 OF RE-ACTION PROTOCOL
FOR NIMA CASE**

We act for THIRUMARAN, the owner of motor vehicle **FBL1202R**, who has appointed us to act on his behalf to claim against your insured's vehicle no SKF272U in regards to the road traffic accident on 09.02.2018

Please be informed that the said motor vehicle can be inspected at:-

BROTHERS MOTOR
Blk 1016 Yishun Industrial Park A
#01-218 Singapore 768758
Tel: 9643 2540 | Fax: 6754 2558
Email: brothermotors@live.com.sg

Kindly contact: **Mr Tat Tel: 9643 2540**

Please note that if you fail to conduct the pre-repair inspection within the next 2 working days excluding any intervening Saturday, Sunday or public Holiday, the said workshop will commence repairs thereafter without further reference to you.

Yours faithfully,

CENTRO-LEGAL LAW CORPORATION
Cc **Mr Tat**
FAX NO: 6754 2558



**SINGAPORE
POLICE FORCE**



T/20180212/2050

2 of 3

Police Station Of Origin:
Ang Mo Kio North N.P.C
51 Ang Mo Kio Avenue 9 SINGAPORE
569784
Tel No: 1800-4849999

Report No. T/20180212/2050

CONTINUATION OF REPORT

Rider			
Name	THIRUMARAN S/O SHANMUGAVEL	ID No.	S1741640E
Related Vehicle	FBL1202R (Motorcycle)	Contact No.	83223163
Hospital/Clinic	YIO CHU KANG MRT CLINIC PTE LTD	Class of Driving Licence & Expiry Date	Class: 2B,2A,2,3,4 Date of Expiry: NIL
Date Treatment	09/02/2018	Date Discharge	NIL
No. of Days granted Medical Leave	04	Degree of Injury	Slight

Brief Details.

On 09/02/2018 at about 0700hrs, I was leaving my house for work
On 09/02/2018 at about 0730hrs, as I was travelling along Junction of West Coast Way and West Coast Drive, towards Pandan Loop, a Black BMW Car (SKF272U) hit onto the left side of my motorcycle. The following part of my motorcycle was damaged:

1. Clutch Lever broken
2. Handlebar bend
3. Gear pedal bend
4. Radiator dented
5. Bar end scratches
6. Left mirror scratches
7. Left flaring scratches
8. Low cowling scratches.
9. Foot rest (Rider and pillion)

On 09/02/2018, I went to the clinic and I was given 4 days MC.



**SINGAPORE
POLICE FORCE**



T/20180212/2050

2 of 3

Police Station Of Origin:
Ang Mo Kio North N.P.C
51 Ang Mo Kio Avenue 9 SINGAPORE
569784
Tel No: 1800-4849999

Report No. T/20180212/2050

CONTINUATION OF REPORT

Rider			
Name	THIRUMARAN S/O SHANMUGAVEL	ID No.	S1741640E
Related Vehicle	FBL1202R (Motorcycle)	Contact No.	83223163
Hospital/Clinic	YIO CHU KANG MRT CLINIC PTE LTD	Class of Driving Licence & Expiry Date	Class: 2B,2A,2,3,4 Date of Expiry: NIL
Date Treatment	09/02/2018	Date Discharge	NIL
No. of Days granted Medical Leave	04	Degree of Injury	Slight

Brief Details.

On 09/02/2018 at about 0700hrs, I was leaving my house for work
On 09/02/2018 at about 0730hrs, as I was travelling along Junction of West Coast Way and West Coast Drive, towards Pandan Loop, a Black BMW Car (SKF272U) hit onto the left side of my motorcycle. The following part of my motorcycle was damaged:

1. Clutch Lever broken
2. Handlebar bend
3. Gear pedal bend
4. Radiator dented
5. Bar end scratches
6. Left mirror scratches
7. Left flaring scratches
8. Low cowling scratches
9. Foot rest (Rider and pillion)

On 09/02/2018, I went to the clinic and I was given 4 days MC.



M/S. _____
F/L 1202R

Date: 12/3/2018

Note: Goods sold are not returnable and refundable

Total/\$

Issued by

Centro-Legal Law Corporation

ADVOCATES AND SOLICITORS

Your ref : 549324
To be advised

Our ref : CLLC.0153.2018

16 MARCH 2018

MSIG Insurance (S) Pte Ltd
4 Shenton Way
#21-01 SGX Centre 2
Singapore 068807

Attn: **Manager (Motor Claims Department)**

CHUA CHENG SIONG
3 WEST COAST DRIVE
#03-59
SINGAPORE (128021)

Dear Sirs,

ACCIDENT ON 09-02-2018 ALONG JUNCTION OF WEST COAST DRIVE / WEST COAST WAY INVOLVING MOTOR VEHICLES FBL1202R AND SKF272U

We act THIRUMARAN S/O SHANMUGAVEL (E1741640S), the owner of the motor vehicle FBL1202R involved in the captioned accident.

From our insurance search, you are the insure of motor vehicle SKF272U.

We are instructed by our client to claim damages against your insured in connection with a road traffic accident on 09-02-2018 along JUNCTION OF WEST COAST DRIVE / WEST COAST WAY involving our client's motor vehicle no FBL1202R and motor vehicle no SKF272U was driven by your insured and/or your insured's servant and/or agent at the material time.

We are instructed that the accident was caused by your insured and/or your insured's servant and/or agent negligent driving and/or management of the motor vehicle. As a result of the accident, our client's motor vehicle was damaged and our client has been put to loss and expense, particulars of which are as follows:-

151 Chin Swee Road
#02-21 Manhattan House
Singapore 169876
Tel: 6235 0633
Fax: 6235 6939



**WITHOUT PREJUDICE
BY HAND ONLY**

EA
1. ↑ TPO to \$7,000/-
2. Upload ✓
3. WHI x 2 ✓
none
4/4/18

Irene Tan (0348)
Senior Executive
Claims Services

Centro-Legal Law Corporation

ADVOCATES AND SOLICITORS

151 Chin Swee Road
#02-21 Manhattan House
Singapore 169876
Tel: 6235 0633
Fax: 6235 6939

a)	Cost of repairs	\$ 5,700.00
b)	Loss of use/ rental	\$ 200.00
c)	Loss of use (PRI) \$50X2 days	\$ 100.00
d)	Survey report fee	\$ 486.00
e)	Colour copies \$1.00X18	\$ 18.00
f)	LTA search fee	\$ 7.49
g)	GIA reports fee	\$ 29.00
h)	Costs contribution	<u>\$ 1,000.00</u>
		<u>\$ 7,540.49</u>

A copy each of the following supporting documents marked [X] is enclosed:-

- [x] GIA reports
- [x] Repairers bill and evidence of payment
- [] Excess bill/receipt
- [] Vehicle Registration Card
- [] COE/PARF Certificate
- [] Names and addresses of witnesses
- [] Photographs of damage to our client's motor vehicle
- [x] Photocopied photographs of damage to our client's motor vehicle
- [] Rental Agreement, Invoice and receipt for rental
- [x] Supporting documents for all other expenses claimed

Please take note that you should send to us an acknowledgement of receipt of this letter within 14 days of your receipt of this letter, failing which our client will have no alternative but to commence proceedings against your insured without further notice to you.

Yours faithfully,

P KAMALA DEWI
CENTRO-LEGAL LAW CORPORATION
Enc.

Centro-Legal Law Corporation

ADVOCATES AND SOLICITORS

151 Chin Swee Road
#02-21 Manhattan House
Singapore 169876
Tel: 6235 0633
Fax: 6235 6939

NB: CHUA CHENG SIONG

Please note that we have notified your insurers. Please inform them of the claim. If your insurers are not the above-named and if you wish to claim under your insurance policy, you should immediately pass this letter and all the enclosed documents to your insurer.

Please note that you or your insurer should send us an acknowledgement of receipt of this letter within 14 days of your receipt of this letter, failing which, our client will have no alternative but to commence proceedings against you without further notice to you or your insurer.

Please also note that if you have a counterclaim arising out of the accident, you are also required to send us a letter giving full particulars of the counterclaim together with all relevant supporting documents within 8 weeks of your receipt of this letter.

PRESTIGE APPRAISER SERVICES

Insurance Loss Adjusters and Licensed Appraiser Regn. 652868584L
Blk 131 Rivervale Street #05-872 S'pore 540131 Tel:65528323 Fax:64574321

Our ref : PS/008/02/18
Date : 06th March 2018

Mr Thirumaran S/O Shanmugavel
c/o Blk 1016 Yishun Industrial Park A
#01-218
Singapore 768758

Dear Sir,

Re : **THIRD PARTY CLAIM**

We refer to your instruction to appraise the vehicle **FBL 1202 R** on 13th February 2018.

A static inspection was conducted during our survey and our report is enclosed for your perusal. The estimated repair cost submitted by **Messrs. Brother Motors** for **\$9,802.00** as per our attached schedule have been inspected thoroughly each and every item and revised by us against the actual damages found on the vehicle which have been recommended by us accordingly.

The repairer has agreed to undertake repairs at our revised amount of **\$5,700.00 lump sum** corresponding to supply of parts, labour charges and spray-painting. However, we have not given instruction to authorize the repairs.

Under normal circumstances, the estimated period of repairs would be **FOUR (4) days**. Photographs of the damaged vehicle taken by us during our inspection are enclosed.


We are reverting the matter to you for a decision.

Please do not hesitate to contact us if you need any clarification.

Assuring you of our best services.

Yours faithfully,

PRESTIGE APPRAISER SERVICES


FRANCIS S A NG CAE AMIMI
Dip. MTM. Automotive Engineer
Licensed Appraiser

Encl.

PRESTIGE APPRAISER SERVICES

VEHICLE INSPECTION REPORT

To: Mr Thirumaran S/O Shanmugavel
c/o Blk 1016 Yishun Industrial Park A
#01-218
Singapore 768758

Date : 06th March 2018
Our Ref : PS/008/02/18
Policy No :
Sum Insured :
Excess : T/P Claim

Assigned By : Mr Thirumaran S/O Shanmugavel
Assignment Date : 13th February 2018
Accident Date : 09th February 2018
Inspection Date : 13th February 2018
Workshop Name : Brother Motors
Survey Conducted At : Blk 1016 Yishun Industrial Park A
#01-218
Singapore 768758

PARTICULARS OF VEHICLE

Registration No	: FBL 1202 R	Mileage	: 35600km
Make/Model	: Honda NC750XA	Engine No	: RC88E5004981
Type Of Body	: Motorcycle	Chassis No	: JH2RC90A4GK003498
Year Of Manu./Regn.	: 2016	Passenger Cap.	: 1 Passenger
Colour	: Blue	Others	: -

CONDITION OF TYRES

Front Tyre : 5mm 120/70R17 Bridgestone
Rear Tyre : 5mm 160/60R17 Bridgestone

The above represent the estimated remaining life of the tyre treads.

PRE-ACCIDENT CONDITION (Static tests only)

Handbrake	: Serviceable	Body Work	: Good
Footbrake	: Serviceable	Paint Work	: Good
Steering	: Serviceable	Others	: -

POINT OF IMPACT

The vehicle sustained an impact on the front, R/H & L/H portion.

GENERAL DESCRIPTION OF DAMAGES

The main body frame, handle bar, forks, fuel tank, fork, exhaust muffler were dented/bent.

For details of damages please refer to schedule attached.

REMARKS :

This survey was conducted strictly without prejudice.

PRESTIGE APPRAISER SERVICES

Vehicle No : FBL 1202 R

Our Ref :

PS/008/02/18

Qty	Descriptions	Conditions	Repairer's Est.	Our Revised.
	<u>LIST ITEMS</u>			
2	front fork	warped	\$ 885.00	\$ 885.00 <i>R</i>
1	under bracket	dented	185.00	185.00 <i>X snc</i>
1	steering cone	necessary	168.00	168.00 <i>X snc</i>
1	front mudguard	sliced	225.00	225.00
1	front wheel rim	warped	698.00	698.00 <i>X snc</i>
1	front brake disc	serviceable	255.00	-
1	headlamp	scratched	326.00	326.00 <i>X snc</i>
1	headlamp cowling	serviceable	242.00	-
1	windshield	cracked	218.00	218.00
1	handle bar	bent	196.00	196.00
2	handle grip	necessary	82.00	82.00 <i>X snc</i>
2	handle balancer	sliced	96.00	96.00
1	clutch lever	fractured	98.00	98.00
1	brake lever	sliced	98.00	98.00
2 <i>1 pc</i>	front signal lamp	scratched	196.00	196.00 <i>1 pc</i>
1	radiator	dented	560.00	560.00
1	L/H engine cover	grazed - repair	298.00	-
1	engine lower dust cover	sliced	186.00	186.00
1	gear pedal	bent	68.00	68.00 <i>X snc</i>
1	L/H front foot rest	sliced	58.00	58.00
1	L/H rear foot rest	sliced	58.00	58.00
1	fuel tank	dented - repair	585.00	-
1	L/H fuel tank side cover	sliced	164.00	164.00
2	mirror	sliced	186.00	186.00
2	rear signal lamp	sliced	196.00	196.00
1	taillamp	scratched	215.00	215.00 <i>X snc</i>
1	rear mudguard	serviceable	225.00	-
1	pillion handle	sliced	108.00	108.00
1	R/H seat lower cover	sliced	115.00	115.00
1	R/H front foot rest	sliced	58.00	58.00
1	R/H rear foot rest	sliced	58.00	58.00
1	brake pedal	sliced	62.00	62.00 <i>X snc</i>
1	exhaust muffler	dented/sliced	789.00	789.00 <i>R</i>
1	exhaust protector	dented/sliced	95.00	95.00
			<u>8,052.00</u>	<u>6,447.00</u> <i>2871</i>
		Less 10%	-	644.70 <i>10%</i>
			\$ <u>8,052.00</u>	\$ <u>5,802.30</u> <i>2583.9</i>
	<u>S/NETT ITEMS</u>			
1	front number plate	necessary	25.00	18.00 <i>10</i>
1	rear number plate	dented	25.00	18.00 <i>X snc</i>
1	front tyre	wall cut	300.00	200.00 <i>X snc</i>
		Balance c/f	\$ <u>8,402.00</u>	\$ <u>6,038.30</u> <i>10</i>

PRESTIGE APPRAISER SERVICES

Vehicle No : FBL 1202 R

Our Ref : PS/008/02/18


Qty	Descriptions	Conditions	Repairer's Est.	Our Revised.
		Balance b/d	\$ 8,402.00	\$ 6,038.30
	<u>Labour Charges & Misc</u>			
	To dismantle & replace damaged parts, panel beat where necessary.		550.00	450.00 300
	To putty, apply primer & spray-paint on the affected portion.		480.00	350.00 250
	To align main body frame.		320.00	250.00 150
	Transportation charges.		50.00	40.00
			<u>\$ 9,802.00</u>	<u>\$ 7,128.30</u> 700

Note: The repairer has agreed to undertake the repairs at our adjusted amount of \$5,700.00 lump sum corresponding to supply of parts, labour and spray-painting charges.

Under normal circumstances, the estimated repair period would be FOUR (4) days.
Pursuant to your instruction we have not authorised repairs on your behalf.

2583.90
10.00
700.00
3293.90
2020
2,635.12
43-2,600
4 days

PRESTIGE APPRAISER SERVICES


FRANCIS S A NG CAE AMIMI (UK)
Licensed Appraiser
Dip. MTM. Automotive Engineer

Nivitha (LKK Auto)

From: Veron Chen (LKKAuto) <veronchen@lkkauto.com>
Sent: Thursday, 5 April 2018 2:16 PM
To: Irene Tan; Shiau Chan (LKKAuto); Olivia Lau (LKKAuto); Admin-D (LKKAuto); assignments; KKLau
Subject: RE: Please prepare & upload your final paper survey report on 3rd party's FBL1202R; Our claim no.: 549324/IT

Dear Irene,

Thank you for the email.

Dear Nivitha,

FYNA-CS3/MSG18002832/R1d3

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Irene Tan [mailto:irene_tan@sg.msig-asia.com]
Sent: Thursday, 5 April 2018 1:37 PM
To: Veron Chen (LKKAuto) <veronchen@lkkauto.com>; Shiau Chan (LKKAuto) <siewsc@lkkauto.com>; Olivia Lau (LKKAuto) <olivialau@lkkauto.com>; Admin-D (LKKAuto) <admin-d@lkkauto.com>; assignments <assignments@lkkauto.com>; KKLau <kklau@lkkauto.com>
Subject: Please prepare & upload your final paper survey report on 3rd party's FBL1202R; Our claim no.: 549324/IT
Importance: High

URGENT

Good afternoon Veron,

We refer to the PRI assignment given via the Merimen on 12.2.18.

Todate, your Company have not upload colour pictures on the surveyed damages and your Preliminary Advice into the Merimen.

But the 3rd party's law firm have already submitted their finalised total repair cost claim to us.

If the 3rd party's repairer still have not arrange for your surveyor to inspect the subject motorcycle, please let us know immediately so that we can request for a physical resurvey.

Otherwise, please prepare & upload your final paper survey report **asap or within the next 7 days by Wednesday, 11.4.18.**

Best Regards

Irene Tan

Senior Executive, Claims Services (Motor)

Direct line +65 6594 2541 | Direct fax +65 6225 7402 | irene_tan@sg.msig-asia.com



MSIG



Insurer Claims
Team of the Year
2016

MSIG Insurance (Singapore) Pte Ltd 16 Raffles Quay, #24-01 Hong Leong Building, Singapore 048581 | T: +65 6220 9644 | F: +65 6225 6371 | Co. Reg. No. 200412212G | msig.com.sg



A Member of **MS&AD** INSURANCE GROUP

CONFIDENTIALITY NOTICE

This e-mail (including any attachments) may contain information that is privileged or confidential. The sending of this e-mail to any person other than the intended recipient is not a waiver of the privilege or confidentiality that attaches to it. If you are not the intended recipient, please notify the sender immediately, delete the email and do not copy, distribute or disclose its contents.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	09/02/2018 15:23
Date Of Accident	09/02/2018 07:30
Exact Location Of Accident	JUNCTION OF WEST COAST WAY & WEST COAST DR
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	FBL1202R
Insured/Policyholder	
Name Of Registered Owner	THIRUMARAN S/O SHANMUGAVEL
NRIC No	S1741640E
Email Address	T.SHANMUGAVEL@VILHELMSEN.COM
Mobile Phone No	(LOCAL) +65-83223163
Alternative Phone No	Office-83223163

Vehicle Particulars

Manufacturer	HONDA
Model	NC750XA (LED)
Exact Purpose for which vehicle was being used at time of accident	PRIVATE
Are you claiming under your own Insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	MOTORCYCLE

Insurance Company

Name of Insurance Company	LIBERTY INSURANCE PTE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	SI17V08689
Cover Note Number	NA

Driver

Name of Driver	THIRUMARAN S/O SHANMUGAVEL
NRIC No	S1741640E
Date Of Birth	04/08/1966
Occupation	INDOOR
Date Of Driving Pass	14/01/1991
Driving Experience	27 YEARS AND 0 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-83223163

Fax Number	
Contact Number	OFFICE-83223163
Email Address	T.SHANMUGAVEL@WILHELMSSEN.COM
Address	HDB YISHUN RIVER GREEN, 325 YISHUN CENTRAL
Postcode	760325
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	COLLISION - MAJOR/MINOR RD
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

I was travelling along WEST COAST WAY when a car suddenly came out without stopping at the junction of WEST COAST DR, car SKF272U hit onto left side of my motorcycle FBL1202R. No serious injuries.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

Details of Witness 1

Name	NATHAN
Phone Number	83733923
Email Address	

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SKF272U
Vehicle Make/Model/Colour	BMW/520I 2.0L AT
Details Of Properties	NA
Vehicle Category	PRIVATE CAR
Name of Driver	TAN AI LAN

NRIC/Passport Number	S1707157B
Contact Number	97802117
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

Sketch Plan SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this form by insurance companies is not an admission of policy liability on the part of insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available application by interested parties.
7. By the lodging of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)


I understand, acknowledge, agree and consent that

 - (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this form and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes and packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.
 - (b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
 - (c) my Personal Information may/are be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.

VERIFIED BY AJAX MARS
REPORTING OFFICER
MOHD FADZLY BIN ISMAIL

Policyholder's Signature / Date & Time Driver's Signature (If driver is not the policyholder) / Date & Time Witnessed by Reporting Centre Personnel

Sketch Plan

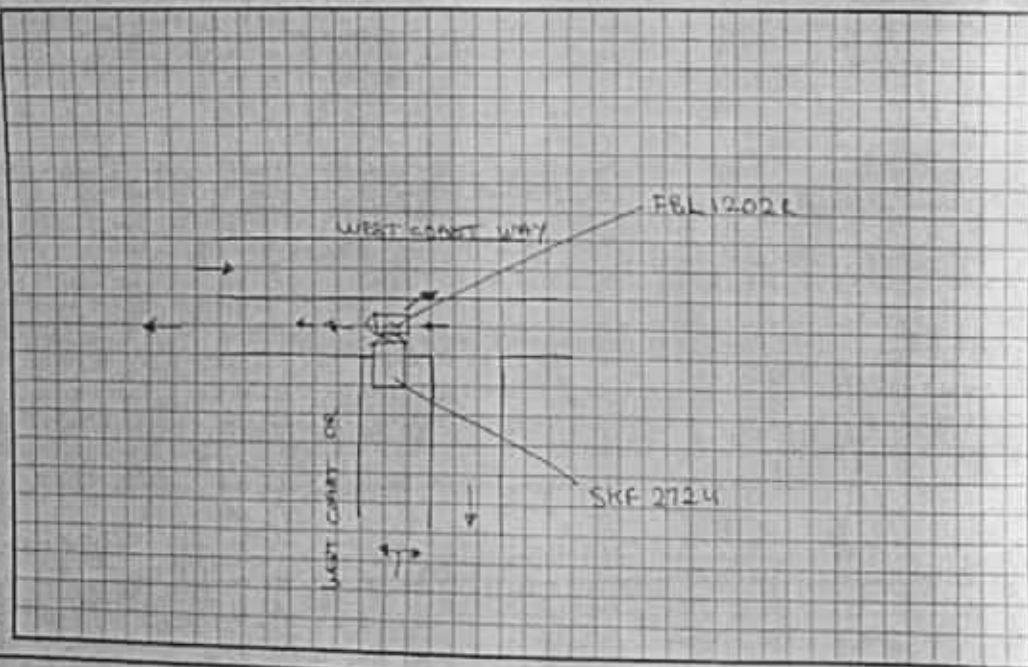

Common Statement

ACCIDENT STATEMENT (2000 characters)

I was travelling along WEST COAST WAY when a car suddenly came out without stopping at the junction of WEST COAST DR, car SKF272U hit onto left side of my motorcycle FBL1202R. No serious injuries.

Taxi Voucher No.:

DECLARATION

I/We declare that the above particulars & information provided above are true in every aspect

VERIFIED BY AJAX MARS REPORTING OFFICER -
MOHD FADZLY BIN ISMAIL

MARS Officer



Registered Owner or Driver's Signature

Job Complete Date/Time

9 February 2018 2:58 pm

Date/Time:

9 February 2018 2:59 pm


Accident Photo



Accident Photo



Accident Photo

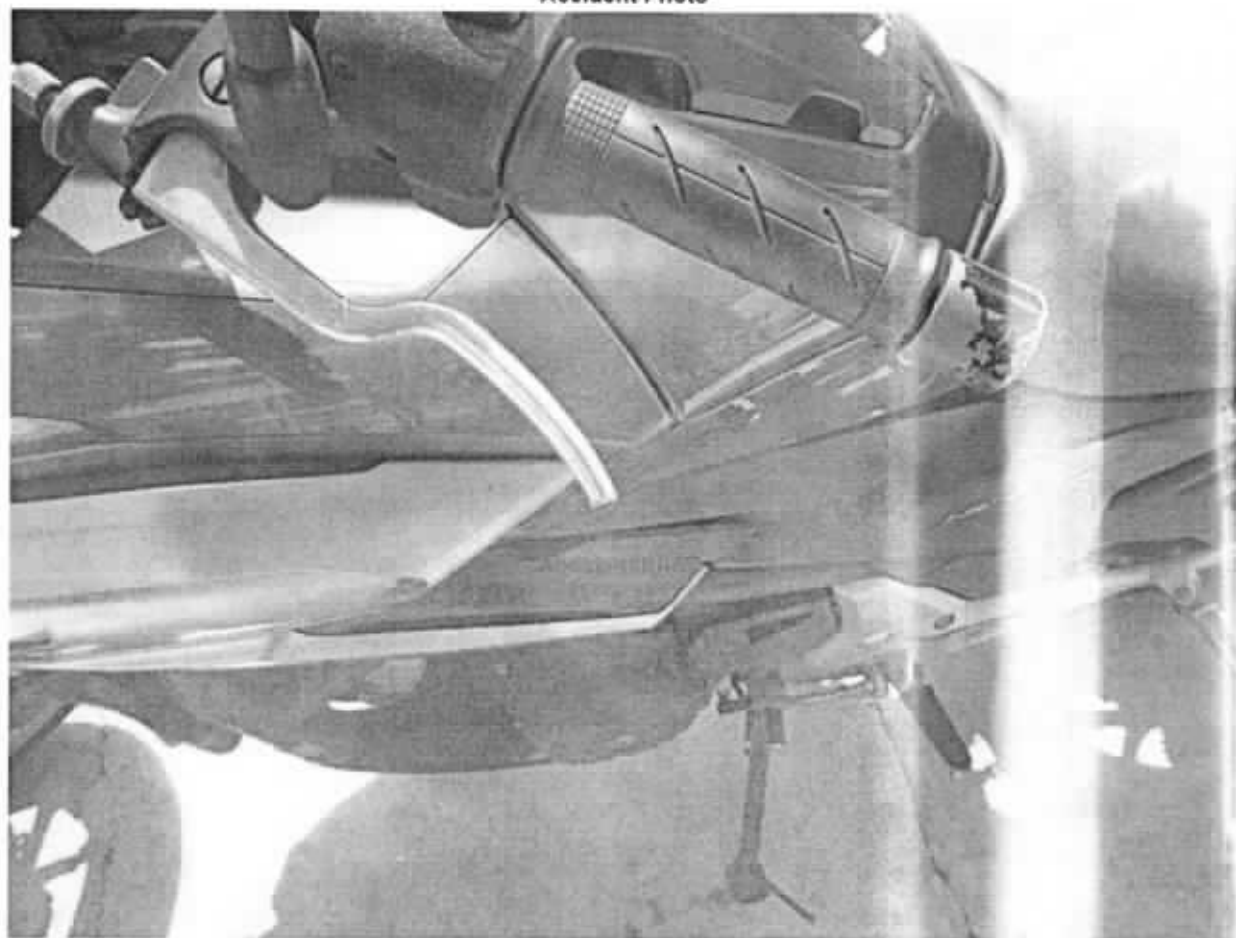

Accident Photo




Accident Photo



Accident Photo



Accident Photo

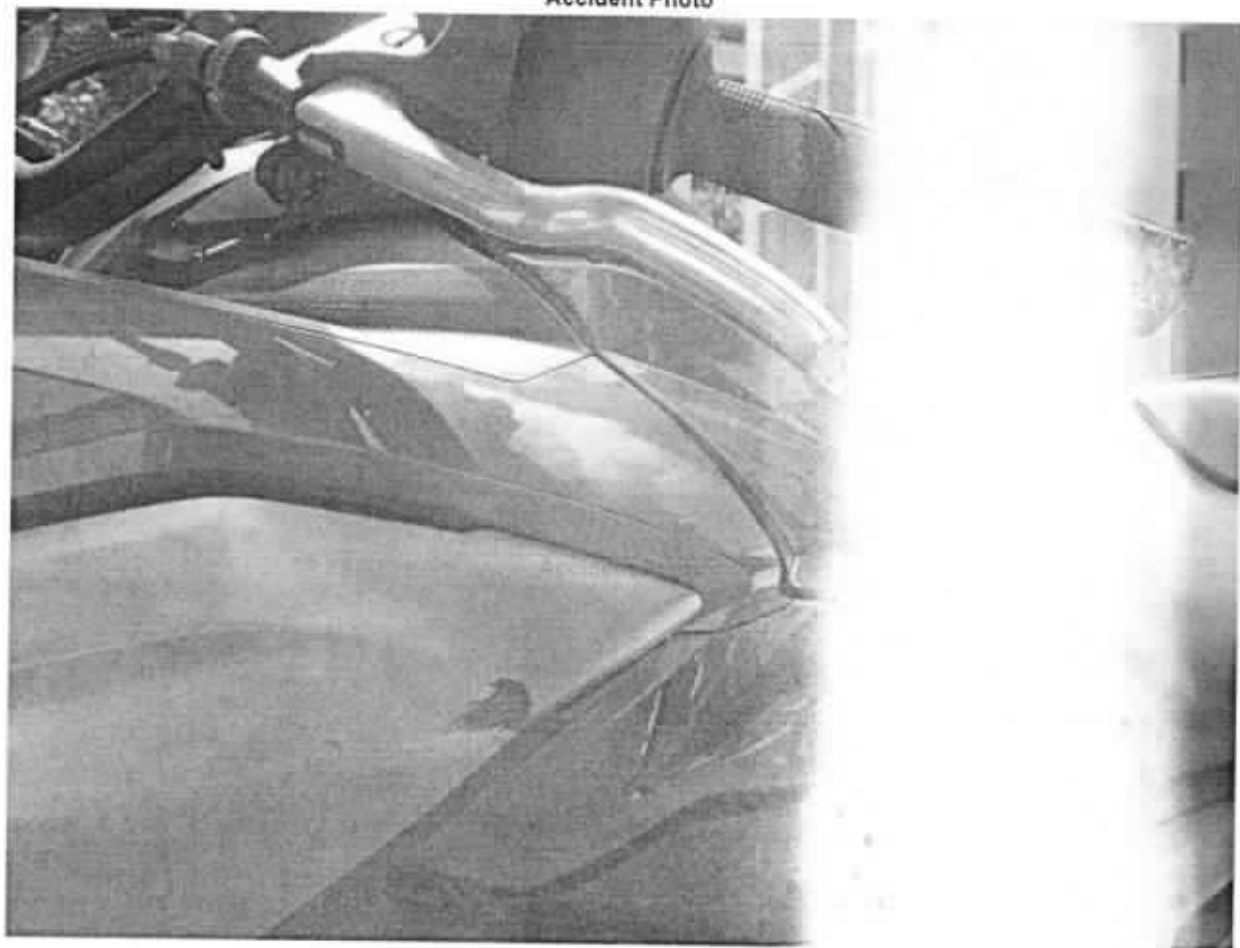

Accident Photo








































...CLAIM SUBFOLDER...(Pending for Survey Report)



















































CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	12 Feb 2018		12 Feb 2018 14:45 Edit Adj Rpt	S\$2,600.00 Edit Estimates	S\$2,600.00 View Rpt		Pending for Survey Report Cancel Case

























Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by insurer]									
Insured:	CHUA CHENG SIONG, ID: S15595308								
Main Claimant:	THIRUMARAN S/O SHANMUGAVEL, ID: S1741640E								
Vehicle Reg. No.:	FBL1202R	Date of Loss:	09/02/2018 07:00 - :59 [19 Months and 30 Days From LTA Reg Date (Man Yr)]						
Claim Type:	TP / 549324	Policy/Cover Note No.:	B27320261SMP Coverage: 25/04/2017 - 24/04/2018						
Vehicle Reg. No. (Insured):	SKF272U	Policy No. (Claimant):							
		Excess:							
Repairer:	Brothers Motor (HQ) BLK 1016 YISHUN INDUSTRIAL PARK A #01-218, 768758 Yishun - Tel:								
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Irene Tan Gek Ing - 6594 2541]								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by MOHD RASUL] ... [Imm.Advice due 13/02/2018]								
Driver/Custodian (Insured):	TAN AI LAN (), NRIC: S1707157B								
Adj Asg. Remarks:	please assign Mr Kenneth Kong as the surveyor. Thank You.								
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
There are no mail for this case.									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

*FBL1202R (549324)
[SKF272U]
TP
THIRUMARAN S/O SHANMUGAVEL
Feb 9 2018 7:00AM
[CHUA CHENG SIONG]
Brothers Motor

Upload Documents Upload Photos Compose New Letter			View View in Browser	
Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	07/05/18 15:45	Odometer Reading	 Load .JPG	<input checked="" type="checkbox"/>
2	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
3	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
4	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
5	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
6	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
7	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
8	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
9	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
10	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
11	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
12	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
13	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
14	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
15	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
16	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
17	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
18	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
19	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
20	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
21	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
22	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
23	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
24	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
25	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
26	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
27	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
28	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
29	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
30	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
31	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
32	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
33	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
34	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
35	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
36	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>
37	07/05/18 15:45	General View	 Load .JPG	<input checked="" type="checkbox"/>

Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
38	07/05/18 15:45	General View	 Load JPG	<input checked="" type="checkbox"/>
39	07/05/18 15:45	General View	 Load JPG	<input checked="" type="checkbox"/>
40	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
41	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
42	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
43	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
44	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
45	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
46	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
47	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
48	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
49	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
50	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
51	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
52	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
53	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
54	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
55	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
56	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
57	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
58	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
59	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
60	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
61	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
62	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
63	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
64	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
65	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
66	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
67	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
68	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
69	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
70	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
71	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
72	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
73	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
74	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
75	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
76	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
77	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
78	07/05/18 15:45	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
79	07/05/18 15:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
80	07/05/18 15:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
81	07/05/18 15:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
82	07/05/18 15:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
83	07/05/18 15:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
84	07/05/18 15:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
85	07/05/18 15:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
86	07/05/18 15:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
87	07/05/18 15:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>

Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
88	07/05/18 15:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
89	07/05/18 15:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
90	07/05/18 15:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
91	07/05/18 15:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
92	07/05/18 15:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
93	07/05/18 15:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
94	07/05/18 15:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
95	07/05/18 15:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
96	07/05/18 15:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
97	07/05/18 15:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
98	07/05/18 15:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
99	07/05/18 15:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
100	07/05/18 15:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
101	07/05/18 15:46	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
Documentation			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)	Thumbnail	Print
1	12/02/18 14:08	TP PRI Request	 Load PDF	
2	12/02/18 14:10	SKF272U E-FILE REPORT	 Load PDF	
3	12/02/18 14:10	FBL1202R E-FILE REPORT	 Load PDF	
4	12/02/18 14:48	TP agreed on common SJE - assign LKK	 Load PDF	
5	04/04/18 20:02	LOD	 Load PDF	
6	04/04/18 20:02	FINAL REPAIR BILL	 Load PDF	
7	04/04/18 20:02	SURVEY REPORT	 Load PDF	
8	04/04/18 20:02	SURVEY PHOTOS	 Load PDF	
9	05/04/18 13:38	our instruction for LKK to prepare and upload final survey report	 Load PDF	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	08/05/18 08:26	PHOTO	 Load PDF	

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			
Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ) <div style="border: 1px solid black; height: 40px; margin-top: 5px;"></div>			
Show Remarks To: <input type="checkbox"/> Handling Insurer <small>Note: Remarks are private unless you show it to other parties.</small>			

LKK Auto Consultants Pte Ltd (Co Reg No: 199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com; assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS3/MSG18002832/R1QD3E2

Date: 08/05/2018

REFERENCE

Handling Insurer: MSIG Insurance (Singapore) Pte. Ltd. Policy No: B27320261SMP
 Claimant Vehicle No: FBL1202R Insured Vehicle No: SKF272U
 Date of Loss: 09/02/2018 Nature of Claim: TP Claim No: 549324

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: FBL1202R Engine No: RC88E5004981
 Make & Model: HONDA NC750XA, 745cc Chassis No: JH2RC90A4GK003498
 Reg. Date: 10/06/2016 (Man. Year: 2016) Odometer: 35600 km
 Colour: Multi-colour
 Engine Capacity: 745 cc
 Market Value/New Car Price: N/A
 Sum Insured (S\$): Market Value/New Car Price

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
 Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

CONDITION OF TYRES

Front Tyre Size: 120/70Z R17 Rear Tyre Size: 160/60 R17
 Front Left Side: Bridgestone 4 mm Rear Left Side: Bridgestone 4 mm
 Front Right Side: 0 mm Rear Right Side: 0 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	8,402.00	2,593.90	5,808.10	69.13
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,400.00	740.00	660.00	47.14
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (S\$)	9,802.00	3,333.90	6,468.10	65.99
Approved Total (Overridden) (S\$)		2,600.00		
Nett Amount (S\$)	9,802.00	2,600.00	7,202.00	73.47

INSPECTION

Date of Assignment: 12/02/2018
 Date Inspected: 13/02/2018 Inspected At: Brothers Motor (HQ)
 BLK 1016 YISHUN INDUSTRIAL PARK A
 #01-218
 Singapore 768758
 Estimated Period of Repair: 4.0 days

Adjuster: MOHD RASUL

Manager: Nivitha Govindasamy

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference		
Part Source:	(Last Synchronised: 08 May 2018)	
Parts:	N/A	HONDA NC750XA 745cc (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for FBL1202R)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	2		*FRONT FORK	Repair	885.00 F	*- FL
2	1		*UNDER BRACKET	Serviceable	185.00 F	*- FL
3	1		*STEERING CONE	Serviceable	168.00 F	*- FL
4	1		*FRONT MUDGUARD	Sliced	225.00 F	*225.00 FL
5	1		*FRONT WHEEL RIM	Serviceable	698.00 F	*- FL
6	1		*FRONT BRAKE DISC	Serviceable	255.00 F	*- FL
7	1		*HEADLAMP	Serviceable	326.00 F	*- FL
8	1		*HEADLAMP COWLING	Serviceable	242.00 F	*- FL
9	1		*WINDSHIELD	Cracked	218.00 F	*218.00 FL
10	1		*HANDLE BAR	Bent	196.00 F	*196.00 FL
11	2		*HANDLE GRIP	Serviceable	82.00 F	*- FL
12	2		*HANDLE BALANCER	Sliced	96.00 F	*96.00 FL
13	1		*CLUTCH LEVER	Fractured	98.00 F	*98.00 FL
14	1		*BRAKE LEVER	Sliced	98.00 F	*98.00 FL
15	1		*FRONT SIGNAL LAMP (2PCS)	Scratched-1pc only	196.00 F	*98.00 FL
16	1		*RADIATOR	Dented	560.00 F	*560.00 FL
17	1		*L/H ENGINE COVER	Repair	298.00 F	*- FL
18	1		*ENGINE LOWER DUST COVER	Sliced	186.00 F	*186.00 FL
19	1		*GEAR PEDAL	Serviceable	68.00 F	*- FL
20	1		*L/H FRONT FOOT REST	Sliced	58.00 F	*58.00 FL
21	1		*L/H REAR FOOT REST	Sliced	58.00 F	*58.00 FL
22	1		*FUEL TANK	Repair	585.00 F	*- FL
23	1		*L/H FUEL TANK SIDE COVER	Sliced	164.00 F	*164.00 FL
24	2		*MIRROR	Sliced	186.00 F	*186.00 FL
25	2		*REAR SIGNAL LAMP	Sliced	196.00 F	*196.00 FL
26	1		*TAILLAMP	Serviceable	215.00 F	*- FL
27	1		*REAR MUDGUARD	Serviceable	225.00 F	*- FL
28	1		*PILLION HANDLE	Sliced	108.00 F	*108.00 FL
29	1		*R/H SEAT LOWER COVER	Sliced	115.00 F	*115.00 FL
30	1		*R/H FRONT FOOT REST	Sliced	58.00 F	*58.00 FL
31	1		*R/H REAR FOOT REST	Sliced	58.00 F	*58.00 FL
32	1		*BRAKE PEDAL	Serviceable	62.00 F	*- FL
33	1		*EXHAUST MUFFLER	Repair	789.00 F	*- FL
34	1		*EXHAUST PROTECTOR	Dented / Sliced	95.00 F	*95.00 FL
35	1		*FRONT NUMBER PLATE	Necessary	25.00 FS	*10.00 FS
36	1		*REAR NUMBER PLATE	Serviceable	25.00 FS	*- FS
37	1		*FRONT TYRE	Serviceable	300.00 FS	*- FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (S\$)	8,402.00	2,881.00
------------------------	-----------------	-----------------

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
- List Item Discount on L Items 0.00/10.00% (S\$)					0.00	287.10
Total Parts (S\$)					8,402.00	2,593.90

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	TO DISMANTLE & REPLACE DAMAGED PARTS, PANEL BEAT WHERE NECESSARY	New	550.00	300.00
2	TO PUTTY, APPLY PRIMER & SPRAY-PAINT ON THE AFFECTED PORTION	New	480.00	250.00
3	TO ALIGN MAIN BODY FRAME	New	320.00	150.00
4	TRANSPORTATION CHARGES	New	50.00	40.00
Gross Labour Cost (\$\$)			1,400.00	740.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >