

2/03/2002

ASS. REC. BY:

REF:

CS/MSG18003715/Uvd301

Special Instruction:

Surveyor:

Marcus Merimen

ASSIGNMENT (Office)

From (Person):

Joslin Kim

of

MSG

Date/Time:

27/2/18 @ 11:07am

Estimated Cost:

Bill to:

☒ TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SLK 4965P

Insured:

at Workshop m/s

Kim Chwee

Tel:

67452063

of

1 Kaki Bkt Ave 6 #01-48 Autobay

Policy No:

A29064321QMY

Claim No:

550266

Sum Insured:

Excess:

\$3,500.00

Make of Veh:

(Client's Record)

D.O.A.

16/2/18

CA / ☒ REV

REP. / REV 24 HRS

H.O.D. Endorsement:

Date/Time:

11:47am 27/2/18

Person Contacted:

Nancy

Vehicle ☒ IN ☐ OUT

Date/Time	Action/Instruction
	() Estimate
	SLK 4965P - x
1/3/18	Revert by merimen
5/3/18	Rece email from Jason CI withdraw od claim
5/3/18	Submit preli report

(08/11/13) wef

ASS. REC. BY: *Marcus*

REF:

MS/6/

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

☒ OD / ☐ TP / ☐ WS / ☐ TP RES / ☐ OD RES / ☐ EVA / ☐ INV / ☐ MV

To Inspect Vehicle No: *SLK 49657*

at Workshop m/s *Ken chue*

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: *3500*

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: *61k.*

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: *4* days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: *SLK 49657* Yr Regn: *1 / 17*

Type: ☒ M.Car / ☐ M.Cycle / ☐ Bus / ☐ Van / ☐ Lorry / ☐ Taxi / ☐ Prime Mover /

Truck / Trailer or *CA*

Make: *Mer* *ATTRAGE* c.c. *1193*

Colour: *Red* A/C: Insured / Std / NI / NA

Sp. Reading: *8846* T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: *MMBSTA13AH003839*

Gen. Cond: ☒ Good / ☐ Fair / ☐ Poor / ☐ Burnt

Steering: ☒ In order / ☐ Jammed / ☐ Leaked / ☐ Burnt or

Brake: ☒ In order / ☐ Jammed / ☐ Leaked / ☐ Burnt or

Modi: Nil / ☒ S/Rim / ☐ STD A/Rim or

Tyre Size: F: *185/55-15*

R: _____

☒ BS / ☐ DUN / ☐ EXNOVA / ☐ GY / ☐ FS / ☐ LIZA / ☐ MIC / ☐ OHTSU / ☐ PIR / ☐ SUMI /

TOYO / YOKO or

Front

Rear

R/Bal. *8* mm R/Bal. *8* mm

L/Bal. *8* mm L/Bal. *8* mm

D.O.A. _____ D.O.I. *28/1/18*

Survey held at _____

Des. of Damages: Frt / Rear / ☒ O/S / ☐ N/S / ☐ U/C / ☐ Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

Submit to insurance. below express
urgent

RECEIVED

Date/Time. File Pass to?

☐

: Preli. Report

1)

☐

: Final Report

Date/Time. File Return to?

2)

sp - typist

Report Format: *merimen*

Lump Sum / I.B.I: (\$ _____)

Days Of Repair: _____

Resurvey No. of Trip: _____

Survey Fee: _____

Transportation: _____

Add Fee:

☐

: Site Insp (\$ _____)

☐

: Interview (\$ _____)

☐

: Tech. Invs (\$ _____)

☐

: Weekend (\$ _____)

) \$ + RS. \$ _____

) Photos

) Others

TOTAL

200

10

210

Survey Department Check List (Case Handler)

Reference No. : CS/MSG/8003719/1/13
 Policy Type: OD / TP / TP RES / TL / EVA

Case Handler

Typist

Admin (): Case handler to make sure all Information created by the assignment team are **ACCURATE**.

(1) Office Assign Form

		Y-Date	N-Date	Y-Date	N-Date
C	Reference No.	✓			
C	Customer Code				
N	Assign From				
C	Assign Date	✓			
C	Veh No (Inspected)	✓			
C	Veh No (Insured)				
C	D.O.A	✓			
C	Policy No	✓			
C	Claim No	✓			
C	Insurance Authorisation (CA /REV/REP)	✓			
C	Report Type	✓			
C	Weekend Charges				
N	Survey held at/Repairer	✓			
C	Excess	✓			

Surveyor (): Case handler to make sure the surveyor completed all required information.

(1) Assignment Form

C	Vehicle No	✓			
C	Regn Month/Year	✓			
N	Vehicle Type	✓			
N	Make & Model	✓			
C	Engine Capacity. (C.C)	✓			
N	Colour	✓			
C	Odometer. (Sp.Reading)	✓			
C	Chassis No	✓			
N	General Condition	✓			
N	Steering	✓			
N	Brake	✓			
N	Modification (Modi)	✓			
C	Tyre Size	✓			
N	Tyre Make	✓			
C	Tyre Balance	✓			
C	Date of Inspection	✓			
N	Survey held	✓			
N	Des.of Damages	✓			

(2) System - (Views/Merimen)

C	Damaged Vehicle Photographs Uploaded	✓			
---	--------------------------------------	---	--	--	--

(3) Workshop Estimate/Assignment Form

N	ALL Parts condition	✓			
C	Market Value for OD cases	✓			
C	Estimate Repair Cost for PRI (RSI, TMI, MSIG)				
C	Days of repair	✓			
C	Finalised Amount				
C	Re-inspection Cases to Finalize within 5 Days				

(4) System - (Views/Merimen)

C	Resurvey photo Uploaded				
---	-------------------------	--	--	--	--

Check By: VERON 5/3/16
 Case Handler Date

*C: Critical *N: Non-Critical

21/05/2014



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

MSIG INSURANCE (SINGAPORE) PTE LTD

Ref : CS/MSG18003715/Uvd3

16 RAFFLES QUAY

#24-01 HONG LEONG BLDG SINGAPORE 048581

Date : 27-02-2018



Code : MSG

1. Policy Particulars :- OWN DAMAGE

Insured Veh.		Veh. Inspected	SLK 4965P
Policy No.	A29064321QMY	Coverage (\$)	0.00
Claim No.	550266	Excess (\$)	3,500.00
Assign From	MERIMEN (JOSLIN LIM)	Assign Date	27/02/2018

2. Vehicle Particulars & Condition

Make & Model		c.c	0
Engine No.	HIDDEN	Year of Reg.	
Chassis No.		Colour	
Odometer	-	Steering	
Brakes		Modification	
General			

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

4. Description of Damages

--	--

5. General Information

Accident Date	16/02/2018	Inspection Date	27/02/2018
Survey held at	KIM CHWEE AUTO PTE LTD 1 KAKI BUKIT AVENUE 6 #01-46/48/50 AUTOBAY SINGAPORE 417883		

5a. Remarks

A) THE MARKET VALUE IS S\$----- (EST. AVERAGE)
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE AUTHORISED REPAIRS.

View Received Message

This mail is associated with :

***SLK4965P (550266)**

OD

Feb 16 2018 10:00AM

[LIM KAY THAI]

Kim Chwee Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From MSIG Insurance (Singapore) Pte. Ltd. (MSIG_SG), sent on 02/03/2018 15:48 PM.
To LKK_HQ
Subject Alert - Adj Mandate Revoked - SLK4965P - Claim Handler: Joslin Lim

Revoked:Repair cost recommended (\$2969.90 including check items of \$583) is below excess of \$3500. => owner will handle on his own

DOCUMENTS SUMMARY

There are no documents.

Veron Chen (LKKAUTO)

From: Veron Chen (LKKAUTO)
Sent: Monday, 5 March 2018 12:46 PM
To: 'jason@fastechauto.com.sg'
Cc: 'Joslin Lim'; 'Nancy Lam'; SUR
Subject: RE: YOUR REF: SLK4965P OWN DAMAGE CLAIM (MSIG) DOA: 16/02/2018

Dear Jason,

Noted with thanks.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Jason Fastech Auto [mailto:jason@fastechauto.com.sg]
Sent: Monday, 5 March 2018 11:32 AM
To: Veron Chen (LKKAUTO) <veronchen@lkkauto.com>
Cc: 'Joslin Lim' <joslin_lim@sg.msig-asia.com>; 'Nancy Lam' <nancy.lam@fastechauto.com.sg>
Subject: YOUR REF: SLK4965P OWN DAMAGE CLAIM (MSIG) DOA: 16/02/2018

Without Prejudice

Dear Veron,

As spoken over the phone, our client wish to withdraw his Own Damage claim.

Thank you.

Best Regards

Jason Tang
Kim Chwee Auto Pte Ltd
1 Kaki Bukit Ave 6
#01-46/48/50 AutoBay
Singapore 417883
Tel: 67465405
Hp: 98218445
jason@fastechauto.com.sg

Please note that it is a condition of any settlement reached that it shall be without prejudice to any personal injury claim (if any) of the owner/claimant.

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	20 Feb 2018		27 Feb 2018 11:07 Assign				New Assignment Cancel Case

Main

Reference

Claim Details

Documents

[Show All](#)

CLAIM SUBFOLDER DETAILS

[Created by insurer]

Insured:	LIM KAY THAI, ID: S1113269C		
Vehicle Reg. No.:	SLK4965P	Date of Loss:	16/02/2018 10:00 - :59
Claim Type:	OD / 550266	Policy/Cover Note No.:	A29064321QMY (Comprehensive) Coverage: 19/01/2018 - 18/01/2019
		Excess:	S\$3,500.00
Repairer:	Kim Chwee Pte Ltd (HQ) KIM CHWEE PTE LTD, 1 KAKI BUKIT AVE 6 #01-48 AUTOBAY, 417883 Kaki Bukit - Tel: 67452063		
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Joslin Lim - 6643 1327]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Imm.Advice due 28/02/2018]		
Driver/Custodian:	LIM YU CAI (28 / Female), NRIC: S8928809F, Tel: +6598356923		
Adj Asg. Remarks:	Excess is \$3500. Young & Inexperienced driver excess \$3000 + Section I excess \$500 Please revert.		

ASSOCIATED MAIL RECEIVED

[View All](#)[Compose Case Mail](#)

There are no mail for this case.

ALL ASSOCIATED TASKS

[View All](#)[Search Tasks](#)[Create New Task](#)[Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

To: MSIG Insurance (Singapore) Pte. Ltd.
4 Shenton Way
#21-01 SGX Centre 2
Singapore 068807

From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Joslin Lim**Date:** 01 Mar 2018**Preliminary Advice**

Vehicle No	: SLK4965P	Accident Date	: 16/02/2018
Make	: MITSUBISHI ATTRAGE	Policy No.	: A29064321QMY
Assignment Date	: 27/02/2018	Excess	: S\$3,500.00
Date of Inspection	: 28/02/2018	Est. Duration of Repair	: 4.00
Inspection At	: KIM CHWEE PTE LTD (HQ) KIM CHWEE PTE LTD, 1 KAKI BUKIT AVE 6 #01-48 AUTOBAY SINGAPORE 417883		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages front portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	8,894.70
Revised Amount	:S\$	2,386.90
Check Items (Estimated)	:S\$	583.00
Total	:S\$	2,969.90

Lump Sum Repair	:S\$
------------------------	-------------

Total Loss Consideration

New for Old Value	:S\$	
Pre-Accident Value	:S\$	61,000.00
COE / PARF Rebate	:S\$	48,248.00
Salvage Value	:S\$	
Margin for Repair	:S\$	12,752.00

Remarks

(X)

The vehicle is economical for repair.

()

The above survey was conducted on a 'without prejudice' basis.

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Singapore NRIC
Owner ID: 3269C

Vehicle Details

Vehicle No.: SLK4965P
Vehicle to be Exported: No
Intended De-registration Date: 28 Feb 2018
Vehicle Make: MITSUBISHI
Vehicle Model: ATTRAGE 1.2 CVT
Primary Colour: Red
Manufacturing Year: 2016
Engine No.: 3A92UDP2684
Chassis No.: MMBSTA13AHH003839
Maximum Power Output: 57.0 kW (76 bhp)
Open Market Value: \$13,630.00
Original Registration Date: 19 Jan 2017
First Registration Date: 19 Jan 2017
Transfer Count: 0
Actual ARF Paid: \$5,000.00 2500

Intended PARF Rebate Details

PARF Eligibility: Yes
PARF Eligibility Expiry Date: 18 Jan 2027
PARF Rebate Amount: \$3,750.00

Intended COE Rebate Details

COE Expiry Date: 18 Jan 2027
COE Category: A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years): 10
QP Paid: \$50,101.00
COE Rebate Amount: \$44,498.00
Total Rebate Amount: \$48,248.00

The information contained herein is correct as at 28 Feb 2018

OK

FREE VALUATION

Let us tell you how much your car can sell for!

No obligations and it's FREE!

How much is my car worth?



Post an Advertisement

Sell it yourself! Advertise it at just

\$58 until it's SOLD!

Post an Ad

Advertiser Login

Ways of Selling

CNY Offer! Apr 2012 Volkswagen Golf 1.4 Offer \$50800.



In House Finance, Low Monthly
\$655, Depre \$9.4k And Mileage,
Regular Service.
Speedo Motoring StarAd

- Free VICOM evaluation
- Free grooming and 6 months maintenance
- In-house workshop ensures quality service
- Member of SVTA and hire purchase association
- 100% deposit refund for unapproved loan

YONG LEE SENG MOTOR PTE LTD

Browse by Category



Sort by Date Posted



20 results/page



20 vehicles

Mitsubishi Attrage

Advanced Search



Submit

	Make	Model	Price	Depreciation	Reg Date	Eng Cap	Mileage	Veh Type	Status
Search Selection	Mitsubishi Attrage		Any	Any	2017	Any	Any	Any	Available
	Mitsubishi Attrage	Mitsubishi Attrage 1.2A	\$63,300	\$6,780 /yr	17-Feb-2017	1,193 cc	21,000 km	Sedan	Available
Fully Serviced By Agent And Under Agent Warranty! \$0 Down Payment Available! Fast And Easy Loan Approval! We Are sgCarMart Premium Dealer 2015-2017! Buy With Confidence! No Hidden Cost! 100% Accident ...									
88 Motor Trading									
Posted: 27-Feb-2018 Tags: 2017 Mitsubishi Attrage, Mitsubishi Attrage, Mitsubishi, Attrage, Used Mitsubishi									
	Mitsubishi Attrage	Mitsubishi Attrage 1.2A	\$61,800	\$6,700 /yr	03-Jan-2017	1,193 cc	31,000 km	Sedan	Available
COE At \$51507! Fully Serviced By Agent And Under Agent Warranty! \$0 Down Payment Available! Fast And Easy Loan Approval! We Are sgCarMart Premium Dealer 2015-2017! Buy With Confidence! No Hidden Cost!...									
88 Motor Trading									
Posted: 27-Feb-2018 Tags: 2017 Mitsubishi Attrage, Mitsubishi Attrage, Mitsubishi, Attrage, Used Mitsubishi									
	Mitsubishi Attrage	Mitsubishi Attrage 1.2A	\$63,800	\$6,670 /yr	09-May-2017	1,193 cc	33,000 km	Sedan	Available
Fully Serviced By Agent And Under Agent Warranty! \$0 Down Payment Available! Fast And Easy Loan Approval! We Are sgCarMart Premium Dealer 2015-2017! Buy With Confidence! No Hidden Cost! 100% Accident ...									
88 Motor Trading									
Posted: 27-Feb-2018 Tags: 2017 Mitsubishi Attrage, Mitsubishi Attrage, Mitsubishi, Attrage, Used Mitsubishi									
	Mitsubishi Attrage	Mitsubishi Attrage 1.2A	\$63,800	\$6,770 /yr	21-Mar-2017	1,193 cc	23,000 km	Sedan	Available
Fully Serviced By Agent And Under Agent Warranty! \$0 Down Payment Available! Fast And Easy Loan Approval! We Are sgCarMart Premium Dealer 2015-2017! Buy With Confidence! No Hidden Cost! 100% Accident ...									
88 Motor Trading									
Posted: 27-Feb-2018 Tags: 2017 Mitsubishi Attrage, Mitsubishi Attrage, Mitsubishi, Attrage, Used Mitsubishi									
Car Buying Car Ownership Car Selling On The Move Car Aftermarket Lifestyle Buy Tyres Online! Latest Special Offers from Tyrepac!									
	Mitsubishi Attrage	Mitsubishi Attrage 1.2A	\$62,800	\$6,720 /yr	17-Feb-2017	1,193 cc	31,000 km	Sedan	Available
Fully Serviced By Agent And Under Agent Warranty! \$0 Down Payment Available! Fast And Easy Loan Approval! We Are sgCarMart Premium Dealer 2015-2017! Buy With Confidence! No Hidden Cost! 100% Accident ...									
88 Motor Trading									
Posted: 27-Feb-2018 Tags: 2017 Mitsubishi Attrage, Mitsubishi Attrage, Mitsubishi, Attrage, Used Mitsubishi									
	Mitsubishi Attrage	Mitsubishi Attrage 1.2A	\$69,800	\$7,430 /yr	21-Mar-2017	1,193 cc	15,350 km	Sedan	Available
5 Years Agent Warranty. Low Mileage! Very Fuel Saving Sedan Unit Is Here! Interior And Exterior Well Maintained By Previous Owner With Car Washed Frequently! Loans Are All Available! Low Down Payment!...									
Benefit Auto Enterprise Pte Ltd									
Posted: 25-Feb-2018 Tags: 2017 Mitsubishi Attrage, Mitsubishi Attrage, Mitsubishi, Attrage, Used Mitsubishi									

Compare

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	20/02/2018 15:46
Date Of Accident	16/02/2018 10:40
Exact Location Of Accident	ALONG SUNSHINE TERRACE
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLK4965P
Insured/Policyholder	
Name Of Registered Owner	LIM KAY THAI
NRIC No	S1113269C
Email Address	NOEMAIL
Mobile Phone No	(LOCAL) +65-97837761
Alternative Phone No	OFFICE-97837761

Vehicle Particulars

Manufacturer	MITSUBISHI
Model	ATTRAG

Exact Purpose for which vehicle was being used at time of accident

Are you claiming under your own insurance policy for repair to your vehicle? YES

If No, Please state action to be taken

Vehicle Category	PRIVATE CAR
------------------	-------------

Insurance Company

Name of Insurance Company	MSIG INSURANCE (SINGAPORE) PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	A29064321 QMY
Cover Note Number	

Driver

Name of Driver	LIM YU CAI
NRIC No	S8928809F
Date Of Birth	23/08/1989
Occupation	INDOOR
Date Of Driving Pass	29/09/2016
Driving Experience	1 YEAR AND 4 MONTHS
Gender	FEMALE
Mobile Number	(LOCAL) +65-98356923
Fax Number	
Contact Number	
Email Address	LIMYUCAI@GMAIL.COM

Address	BLK 47 JALAN TIGA #17-46
Postcode	390047
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	CHILDREN
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	CHAIN COLLISION
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

PLEASE SEE ATTACHED.

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	GBG2778X
Vehicle Make/Model/Colour	NA
Details Of Properties	NA
Vehicle Category	COMMERCIAL VEHICLE
Name of Driver	NA
NRIC/Passport Number	
Contact Number	NA
Address	NA
Postcode	NA
Insurance Company Name	
Nature Of Damage	NA
No. Of Passenger (Including Driver)	

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number	SKF8691R
-----------------------------	----------

Vehicle Make/Model/Colour	NA
Details Of Properties	NA
Vehicle Category	PRIVATE CAR
Name of Driver	NA
NRIC/Passport Number	
Contact Number	NA
Address	NA
Postcode	NA
Insurance Company Name	
Nature Of Damage	NA
No. Of Passenger (Including Driver)	

Accident Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or falsification of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Unit established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore (GIA) may and are permitted to collect, use, disclose and/or process my personal data/personal information set out in this Form, and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police) for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries from me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims collectively the "Purposes".
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may and are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes;
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection investigation and management in present and all future claims;
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud; regulators, law enforcement and government agencies as reasonably required for the purposes stated; or
 - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature

Date & Time

20 Feb 2018
3:30pm

Driver's Signature

(If driver is not the policyholder)

Date & Time

20 Feb 2018
3:30pm

Reporting Centre Personnel's Signature


Name

NR(C)EN No.

Accident Sketch Plan

SKETCH PLAN

Upper Serangoon Road

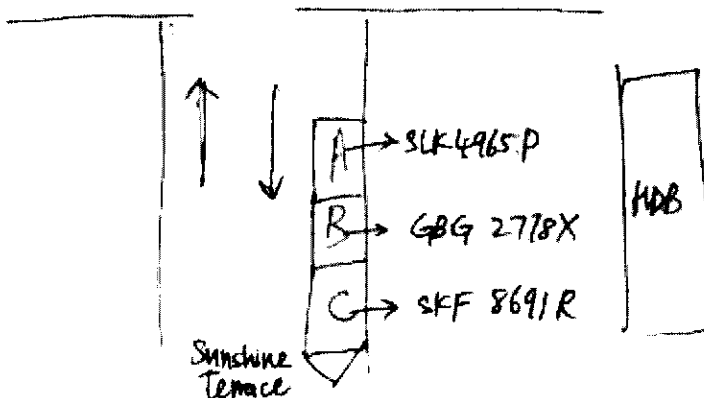

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

I have already parked the car into the parking lot,
but wanted to headjust the car's position slightly.
stepped on the accelerator too quickly in the end.

Insurance Co.	
Vehicle No.	Driver's License
☐ Reporting Only	@ Fastech Auto
☒ Own Damage Claim	
☐ Third Party Claim	

DECLARATION

(We declare the foregoing particulars are true in every respect)

Policyholder's Signature
Date & Time

20 Feb 2018
330 pm

Driver's Signature
(If driver is not the policyholder)

Date & Time
20 Feb 2018
330 pm

Reporting Centre Personnel's Signature
Name
NRIC/IN No

KIM CHWEE AUTO PTE LTD

1 Kaki Bukit Ave 6 #01-48 Autobay

Singapore 417883

Tel No: 67452063 / 67467158 Fax No: 67458520

Tax Reg No: 200006262-D

Estimate : 20164

Date : 27.02.2018

Vehicle Num : SLK4965P

Make/Model : MIT ATTRAG

Chassis/Engine no :

Accident Date : 16.02.2018

Claim No : 0218-20164

Not Authorized
to be phib. by company
4 dy -
541455 @ 3500?
28/2/18

Qty	Particular	Amount S\$
<u>List Item :</u>		
1 pc	Front bonnet	\$ 11 374.00 X
1 pc	Front bonnet lock	\$ 11 44.00 X
2 pc	Front bonnet hinge @ 33	\$ 11 66.00 X
1 pc	Front brace panel	\$ 11 55.00 X
2 pc	Front fender @ 265	\$ 11 530.00 X
2 pc	Front fender eco emblem @ 20	\$ 11 40.00
1 pc	Front support panel	\$ 11 520.00 X
1 pc	Front support panel top cover	\$ 11 42.00 X
2 pc	Front head lamp @ 310	\$ 01/SCN 620.00 12 C
1 pc	Front bumper	\$ 11/30m 395.00
1 pc	Front bumper reinformet	\$ 11 125.00
2 pc	Front bumper side retainer @ 11	\$ 11 22.00
1 pc	Front bumper air grille	\$ 11 90.00
1 pc	Front bumper tow cover	\$ 11 12.00
2 pc	Front bumper fog lamp @ 205	\$ 11 410.00 X
2 pc	Front bumper fog lamp cover @ 72	\$ 11 144.00 X
1 pc	Radiator assy	\$ 11 530.00 ?
1 pc	Radiator fan motor	\$ 11 180.00 X
1 pc	Radiator fan blade	\$ 11 45.00 X
1 pc	Radiator cowling	\$ 11 78.00 X
1 pc	Aircond condenser	\$ 11 420.00 X
List Item total :		\$ 4,742.00
Cost 10%		\$ 474.20
		\$ 5,216.20

Kim Chwee Auto (Singapore) hereby notify the Repairer of the following:

- Times may differ after spray painting
- To inspect damaged (panel) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification is allowed
- Supplementary items must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

Nett Item:

1 set	Front grille clip	\$ 11 30.00 X
1 set	Front bumper clip	\$ 11 50.00 30
1 pc	Front number plate	\$ 11 45.00 40
Nett Total:		\$ 125.00

Labour charge :

To check wiring	\$ 80.00 20
Remove & refit aircon condenser & refill aircon gas	\$ 11 150.00 X
Remove and refix radiator	\$ 11 120.00 X
To remove and replace spare part and panel beating	\$ 1,500.00 400
To spray painting and etc	\$ 1,500.00 600
Labour charge Total:	\$ 3,350.00

238690

238690

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING						
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Status
Main	20 Feb 2018		27 Feb 2018 11:07 Edit Adj Rpt	S\$2,386.90 Edit Estimates	S\$2,386.90 View Rpt	Pending for Survey Report

Main	Reference	Claim Details	Documents	Show All
------	-----------	---------------	-----------	--------------------------

CLAIM SUBFOLDER DETAILS				[Created by insurer]
Insured:	LIM KAY THAI, ID: S1113269C			
Vehicle Reg. No.:	SLK4965P	Date of Loss:	16/02/2018 10:00 - :59	
Claim Type:	OD / 550266	Policy/Cover Note No.:	A29064321QMY (Comprehensive) Coverage: 19/01/2018 - 18/01/2019	
		Excess:	S\$3,500.00	
Repairer:	Kim Chwee Pte Ltd (HQ) KIM CHWEE PTE LTD, 1 KAKI BUKIT AVE 6 #01-48 AUTOBAY, 417883 Kaki Bukit - Tel: 67452063			
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Joslin Lim - 6643 1327]			
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by MARCUS CHUA] ... [Final Rpt due 29/03/2018]			
Driver/Custodian:	LIM YU CAI (28 / Female), NRIC: S8928809F, Tel: +6598356923			
Adj Asg. Remarks:	Excess is \$3500. Young & Inexperienced driver excess \$3000 + Section I excess \$500 Please revert.			

ASSOCIATED MAIL RECEIVED		View All	Compose Case Mail
MSIG_SG (02/03/2018): Alert - Adj Mandate Revoked - SLK4965P - Claim Handler: Joslin Lim			

ALL ASSOCIATED TASKS ☐										View All	Search Tasks	Create New Task	Complete
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?				
No results.													

Claim Documents

***SLK4965P (550266)**

OD

Feb 16 2018 10:00AM

[LIM KAY THAI]

Kim Chwee Pte Ltd

[Upload Documents](#) | [Upload Photos](#) | [Compose New Letter](#)

View [View in Browser](#) ▼

Assessment Reports			1 per page ▼	
No	Finalized On	Kan Fook Sing Motor Workshop (Defu)	Thumbnail	Print
1	20/02/18 16:01	Accident Statement	Load HTM	
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	01/03/18 08:31	Adjuster Immediate Advice	Load HTM	
Photos/Images			3 per page ▼	
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	28/02/18 18:09	Chassis Number	Load JPG	
2	28/02/18 18:09	General View	Load JPG	
3	28/02/18 18:09	Odometer Reading	Load JPG	
4	28/02/18 18:09	General View	Load JPG	
5	28/02/18 18:09	General View	Load JPG	
6	28/02/18 18:09	General View	Load JPG	
7	28/02/18 18:09	General View	Load JPG	
8	28/02/18 18:09	General View	Load JPG	
9	28/02/18 18:09	General View	Load JPG	
10	28/02/18 18:09	General View	Load JPG	
11	28/02/18 18:09	General View	Load JPG	
12	28/02/18 18:09	General View	Load JPG	
13	28/02/18 18:09	General View	Load JPG	
14	28/02/18 18:09	General View	Load JPG	
15	28/02/18 18:09	General View	Load JPG	
16	28/02/18 18:09	General View	Load JPG	
17	28/02/18 18:09	General View	Load JPG	
18	28/02/18 18:09	General View	Load JPG	
19	28/02/18 18:09	General View	Load JPG	
20	28/02/18 18:09	General View	Load JPG	
21	28/02/18 18:09	General View	Load JPG	
22	28/02/18 18:09	General View	Load JPG	
23	28/02/18 18:09	General View	Load JPG	
24	28/02/18 18:09	General View	Load JPG	
25	28/02/18 18:09	General View	Load JPG	
26	28/02/18 18:09	General View	Load JPG	
27	28/02/18 18:09	General View	Load JPG	
28	28/02/18 18:09	General View	Load JPG	
29	28/02/18 18:09	General View	Load JPG	
30	28/02/18 18:09	General View	Load JPG	

31	28/02/18 18:09	General View	1	Load JPG	
32	28/02/18 18:09	General View	1	Load JPG	
33	28/02/18 18:09	General View	1	Load JPG	
34	28/02/18 18:09	General View	1	Load JPG	
35	28/02/18 18:09	General View	1	Load JPG	
36	28/02/18 18:09	General View	1	Load JPG	
37	28/02/18 18:09	General View	1	Load JPG	
38	28/02/18 18:09	General View	1	Load JPG	
39	28/02/18 18:09	General View	1	Load JPG	
40	28/02/18 18:09	General View	1	Load JPG	
41	28/02/18 18:09	General View	1	Load JPG	
42	28/02/18 18:09	General View	1	Load JPG	
43	28/02/18 18:09	General View	1	Load JPG	
44	28/02/18 18:09	General View	1	Load JPG	
45	28/02/18 18:09	General View	1	Load JPG	
46	28/02/18 18:09	General View	1	Load JPG	
47	28/02/18 18:09	General View	1	Load JPG	
48	28/02/18 18:09	General View	1	Load JPG	
49	28/02/18 18:09	General View	1	Load JPG	
50	28/02/18 18:09	General View	1	Load JPG	
51	28/02/18 18:09	General View	1	Load JPG	
52	28/02/18 18:09	General View	1	Load JPG	
53	28/02/18 18:09	General View	1	Load JPG	
54	28/02/18 18:09	General View	1	Load JPG	
55	28/02/18 18:09	General View	1	Load JPG	
56	28/02/18 18:09	General View	1	Load JPG	
57	28/02/18 18:09	General View	1	Load JPG	
58	28/02/18 18:09	General View	1	Load JPG	
59	28/02/18 18:09	General View	1	Load JPG	
60	28/02/18 18:09	General View	1	Load JPG	

Documentation			1 per page ▼	
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)		Thumbnail Print
1	26/02/18 17:37	Kim Chwe email + Estimate + Accident report	1	Load PDF
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail Print
1	01/03/18 08:33	MARK ESTIMATE	1	Load PDF

Linked Accident Report Documents

View View In Browser ▼

Assessment Reports			1 per page ▼	
No	Finalized On	Kan Fook Sing Motor Workshop (Defu)		Thumbnail Print
1	20/02/18 16:01	Accident Statement	1	Load HTM
Photos/Images			3 per page ▼	
No	Finalized On	Kan Fook Sing Motor Workshop (Defu)		Thumbnail Print
1	20/02/18 15:55	Accident Photo	1	Load JPG
2	20/02/18 15:55	Accident Photo	1	Load JPG
3	20/02/18 15:55	Accident Photo	1	Load JPG
4	20/02/18 15:55	Accident Photo	1	Load JPG

5	20/02/18 15:55	Accident Photo		Load JPG	☒
6	20/02/18 15:55	Accident Photo		Load JPG	☒
Documentation				1 per page ▾	
No	Finalized On	Kan Fook Sing Motor Workshop (Defu)		Thumbnail	Print
1	20/02/18 15:58	Accident Sketch Plan		Load JPG	☒
2	20/02/18 15:58	Accident Sketch Plan		Load JPG	☒
3	20/02/18 15:58	Accident Sketch Plan		Load TIF	
4	20/02/18 15:58	Accident Sketch Plan		Load TIF	

Documents Checklist

DOCUMENTS CHECKLIST

ResetSavePrint

There are no document checklists configured.

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)

Show Remarks To: ☐ Handling Insurer

Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

MSIG Insurance (Singapore) Pte. Ltd.
4 Shenton Way, #21-01 SGX Centre 2
Singapore 068807

Our File No: CS/MSG18003715/UVD3E2

Date: 08/03/2018

REFERENCE

Insured/Claimant:	LIM KAY THAI	Policy No:	A29064321QMY	
Date of Loss:	16/02/2018	Nature of Claim:	OD	Claim No: 550266

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SLK4965P	Engine No:	3A92UDP2684
Make & Model:	MITSUBISHI ATTRAGE, 1.2 CVT (A)	Chassis No:	MMBSTA13AHH003839
Reg. Date:	19/01/2017 (Man. Year: 2016)	Odometer:	8846 km
Colour:	Red		
Engine Capacity:	1193 cc		
Market Value/New Car Price:	S\$61,000.00		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	185/55 R15	Rear Tyre Size:	185/55 R15
Front Left Side:	Bridgestone 8 mm	Rear Left Side:	Bridgestone 8 mm
Front Right Side:	Bridgestone 8 mm	Rear Right Side:	Bridgestone 8 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	5,544.70	1,366.90	4,177.80	75.35
Miscellaneous Items	0.00	0.00	0.00	
Labour	3,350.00	1,020.00	2,330.00	69.55
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	8,894.70	2,386.90	6,507.80	73.16
+ GST 7.00/7.00% (S\$)	622.63	167.08	455.55	73.17
Nett Amount (S\$)	9,517.33	2,553.98	6,963.35	73.16

INSPECTION

Date of Assignment: 27/02/2018

Date Inspected: 28/02/2018 Inspected At:

Kim Chwee Pte Ltd (HQ)
1 KAKI BUKIT AVE 6 #01-48 AUTOBAY
Singapore 417883

Estimated Period of Repair: 4.0 days

Adjuster: MARCUS CHUA

Manager: VERON CHEN

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

OI wish to withdraw his Own Damage claim.

(REPAIR COST NOT CONCLUDE)

(EXCLUDE CHECK ITEMS S\$583.00 NETT)

EXCESS : \$3,500.00

REPAIR DETAILS

Reference

Part Source:	(Last Synchronised: 08 Mar 2018)	
Parts:	N/A	mitsubishi attrage 1.2 CVT (A) (Model not available in database)
Labour:	Repairer's	(Price-denominated Standard List)
Print Code:	(Unsubmitted, no print-code for SLK4965P)	
Validity:	These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info:	Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*FRONT BONNET (WCP)	Not Necessary	374.00 F	*-F
2	1		*FRONT BONNET LOCK (WCP)	Not Necessary	44.00 F	*-F
3	2		*FRONT BONNET HINGE (WCP)	Not Necessary	66.00 F	*-F
4	1		*FRONT BRACE PANEL (WCP)	Not Necessary	55.00 F	*-F
5	2		*FRONT FENDER (WCP)	Repair	530.00 F	*-F
6	2		*FRONT FENDER ECO EMBLEM (WCP)	Necessary	40.00 F	*40.00 F
7	1		*FRONT SUPPORT PANEL (WCP)	Repair	520.00 F	*-F
8	1		*FRONT SUPPORT PANEL TOP COVER (WCP)	Not Necessary	42.00 F	*-F
9	1		*FRONT HEAD LAMP (WCP)	O/S Cracked	620.00 F	*310.00 F
10	1		*FRONT BUMPER (WCP)	Dented / Torn	395.00 F	*395.00 F
11	1		*FRONT BUMPER REINFORCEMENT (WCP)	Dented	125.00 F	*125.00 F
12	2		*FRONT BUMPER SIDE RETAINER (WCP)	Bent	22.00 F	*22.00 F
13	1		*FRONT BUMPER AIR GRILLE (WCP)	Torn	90.00 F	*90.00 F
14	1		*FRONT BUMPER TOW COVER (WCP)	Missing	12.00 F	*12.00 F
15	2		*FRONT BUMPER FOG LAMP (WCP)	Not Necessary	410.00 F	*-F
16	2		*FRONT BUMPER FOG LAMP COVER (WCP)	Not Necessary	144.00 F	*-F
17	1		*RADIATOR ASSY (WCP)	* Check	530.00 F	*-F
18	1		*RADIATOR FAN MOTOR (WCP)	Not Necessary	180.00 F	*-F
19	1		*RADIATOR FAN BLADE (WCP)	Not Necessary	45.00 F	*-F
20	1		*RADIATOR COWLING (WCP)	Not Necessary	78.00 F	*-F
21	1		*AIRCOND CONDENSER (WCP)	Not Necessary	420.00 F	*-F
22	1		*FRONT GRILLE (WCP)	Scratched	185.00 F	*185.00 F
23	1		*SET FRONT GRILLE CLIP	Not Necessary	30.00 FS	*-FS
24	1		*SET FRONT BUMPER CLIP	Necessary	50.00 FS	*30.00 FS
25	1		*FRONT NUMBER PLATE	Bent	45.00 FS	*40.00 FS

F=Franchise part. S=SpcNett.

Sub Total (\$\$) 5,052.00 1,249.00

Report was unsubmitted during this print-out.

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
				+ Margin on L,N Items 10.00/10.00% (S\$)	492.70	117.90
				Total Parts (S\$)	5,544.70	1,366.90

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	TO CHECK WIRING	New	80.00	20.00
2	REMOVE & REFIT AIRCON CONDENSER & REFILL AIRCON GAS	New	150.00	0.00
3	REMOVE AND REFIX RADIATOR	New	120.00	0.00
4	TO REMOVE AND REPLACE SPARE PART AND PANEL BEATING	New	1,500.00	400.00
5	TO SPRAY PAINTING AND ETC	New	1,500.00	600.00
Gross Labour Cost (\$\$)			3,350.00	1,020.00

Report was unsubmitted during this print-out.

< END OF ESTIMATES >