

ASS. REC. BY:

REF: CS/CTI18004011/Utd3er Special Instruction:

Surveyor:

Menmen

ASSIGNMENT (Office)

From (Person):

Jowyn Tay

of

CTI

Date/Time:

11/3/18 @ 11:25pm

Estimated Cost:

Bill to:

OD/EP/WS/TP RES/OD RES/EVA/INV/MV/CS

To Inspect Vehicle No:

SJO 930H

Insured:

at Workshop m/s

Car City Auto

Tel:

6781 0300

of

Blk 9006 # 01-198 Tampines St. 93

Policy No:

DMPCSN1214511705

Claim No:

SNM18D01044C01

Sum Insured:

Excess:

\$85000

Make of Veh:

(Client's Record)

D.O.A

25/2/2018

CA / (REV) /

REP.

REV 24 HRS

H.O.D. Endorsement:

Date/Time:

2:30pm @ 11/3/18

Person Contacted:

Mr Ng

Vehicle:

IN/OUT

Date/Time

Action/Instruction

(✓) Estimate

12/3/18

Report via menmen

13/3/18

11:14ar - Authorise repair by repair Alfred toh excess \$850

13/3/18

@ 1:36pm inform car city authorise repair excess \$850

(08/11/13) Wef

REF: CS/CTI18004011/UTd3

ASS. REC. BY: Marcus

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TR / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: STQ9304at Workshop m/s C-104

of _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: 850

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

N/S	O/S

Bal. or Market Value: 2014

IDAC Accident Rpt: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: 5 days Res.: Yes or NoLum Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: STQ9304 Yr Regn: Y, 09

Type: M.Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or GAMake: Honda Stream c.c. 1799Colour: Brown A/C: Insured / Std / NI / NASp. Reading: 148912 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: RN61085237

Gen. Cond: Good / Fair / Poor / Burnt

Steering: In order / Jammed / Leaked / Burnt or

Brake: In order / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 205/65R15

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal. 6 mm R/Bal. 6 mmL/Bal. 6 mm L/Bal. 6 mmD.O.A. 25/2/18 D.O.I. 12/3/18

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

2/5 27A 12209 with 7791

Lump Sum \$4200, 5 days. (red: 2221.29 : 34%)

RECEIVED 07 FEB 2018

Date/Time, File Pass to?



Preli. Report

1) 4/5 Typist



Final Report

Date/Time, File Return to?

2) _____

Days Of Repair: 5Resurvey No. of Trip: 1

Add Fee:



Site Insp (\$



Interview (\$



Tech. Invs (\$



Weekend (\$

Survey Fee:

Transportation:

S + RS, \$

Photos

Others

TOTAL

Report Format: ODLump Sum / I.B.I: (\$ 4200)

220

220



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD

Ref : CS/CTI18004011/Utd3

3 ANSON ROAD #16-00
SPRINGLEAF TOWERS SINGAPORE 079909

Date : 01-03-2018



Code : CTI

1. Policy Particulars - OWN DAMAGE

Insured Veh.		Veh. Inspected	SJQ 930H
Policy No.	DMPCSN1214511705	Coverage (\$)	0.00
Claim No.	SNM18D01044C01	Excess (\$)	850.00
Assign From	MERIMEN (JOWYN TAY)	Assign Date	01/03/2018

2. Vehicle Particulars & Condition

Make & Model		c.c	0
Engine No.	HIDDEN	Year of Reg.	
Chassis No.		Colour	
Odometer	-	Steering	
Brakes		Modification	
General			

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

4. Description of Damages

--

5. General Information

Accident Date	25/02/2018	Inspection Date	
Survey held at	CAR CITY AUTO CENTRE PTE LTD BLK 9006 TAMPINES ST 93 #01-198 SINGAPORE 528840		

5a. Remarks

A) THE MARKET VALUE IS S\$----- (EST. AVERAGE)
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE AUTHORISED REPAIRS.

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	27 Feb 2018 Sendback Est	27 Feb 2018 16:57 S\$5,971.29	01 Mar 2018 11:22 Assign				New Assignment Cancel Case

Main

Reference

Claim Details

Documents

[Show All](#)

CLAIM SUBFOLDER DETAILS

Insured:	ZHU JINYOU, ID: S2684075I, Tel: +6590607638, Email: JINYOU.ZHU@GMAIL.COM		
Vehicle Reg. No.:	SJQ930H	Date of Loss:	25/02/2018 18:00 - :59
Claim Type:	OD / SNM18D01044C01	Policy/Cover Note No.:	DMPCSN1214511705 (Comprehensive)
		Excess:	S\$850.00
Repairer:	Car City Auto Centre Pte Ltd (HQ) Blk 9006 #01-198, Tampines Street 93, 528840 Tampines - Tel: 6781 0300		
Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Jowyn Tay - 6389 6174]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Final Rpt due 12/03/2018]		
Driver/Custodian:	ZHU JINYOU (52 / Male), NRIC: S2684075I, Tel: +6590607638		
Adj Asg. Remarks:	PLEASE PROCEED TO SURVEY & REVERT. EXCESS OF \$850.00 APPLIES.		

ASSOCIATED MAIL RECEIVED

[View All](#)[Compose Case Mail](#)

There are no mail for this case.

ALL ASSOCIATED TASKS ☐

[View All](#)[Search Tasks](#)[Create New Task](#)[Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	4075I
Vehicle Details	
Vehicle No.:	SJQ930H
Vehicle to be Exported:	No
Intended De-registration Date:	12 Mar 2018
Vehicle Make:	HONDA
Vehicle Model:	STREAM 1.8X A
Primary Colour:	Brown
Manufacturing Year:	2008
Engine No.:	R18A1794548
Chassis No.:	RN61085237
Maximum Power Output:	103.0 kW (138 bhp)
Open Market Value:	\$20,687.00
Original Registration Date:	23 Apr 2009
First Registration Date:	23 Apr 2009
Transfer Count:	0
Actual ARF Paid:	\$20,687.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	22 Apr 2019
PARF Rebate Amount:	\$11,377.00
Intended COE Rebate Details	
COE Expiry Date:	22 Apr 2019
COE Category:	B - Car (1601cc & above)
COE Period(Years):	10
QP Paid:	\$7,490.00
COE Rebate Amount:	\$832.00
Total Rebate Amount:	\$12,209.00

The information contained herein is correct as at 12 Mar 2018

OK

View Received Message

This mail is associated with :

SJQ930H (SNM18D01044C01)

OD

Feb 25 2018 6:00PM

[ZHU JINYOU]

Car City Auto Centre Pte Ltd

[Reply](#) [Reply All](#) [Mark as Unread](#) [Print Message](#) [Delete Message](#) [Forward](#)

From China Taiping Insurance (Singapore) Pte. Ltd. (HQ) (CHINA_TAIPING), sent on 13/03/2018 11:14 AM.
To LKK_HQ
Subject Alert - Adj Mandate Approved (\$4100.00) - SJQ930H - Claim Handler: Jowyn Tay

Approved:4100.00:Please proceed to authorize repairs at \$4,100.00 (lump sum) BEFORE Excess of \$850.00.

DOCUMENTS SUMMARY

There are no documents.

Denise Tay (LKKAUTO)

From: Denise Tay (LKKAUTO)
Sent: Tuesday, 13 March 2018 1:36 PM
To: 'ccacpl@singnet.com.sg'
Cc: SUR
Subject: SJQ 930H / OD CHINA

Dear Sir,

As instructed by our client, please proceed to repair the insured vehicle **SJQ 930H (Excess \$850/-)**. Lump sum repair

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right not to pay if there is no valid approval obtained before repair.

Best Regards,

Denise Tay | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: denisetay@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

CHINA TAIPING INSURANCE (S) PTE LTD

Ref : CS/CTI18004011/Utd3

3 ANSON ROAD #16-00
SPRINGLEAF TOWERS SINGAPORE 079909

Date : 01-03-2018



Code : CTI

1. Policy Particulars :- OWN DAMAGE

Insured Veh.		Veh. Inspected	SJQ 930H
Policy No.	DMPCSN1214511705	Coverage (\$)	0.00
Claim No.	SNM18D01044C01	Excess (\$)	850.00
Assign From	MERIMEN (JOWYN TAY)	Assign Date	01/03/2018

2. Vehicle Particulars & Condition

Make & Model		c.c	0
Engine No.	HIDDEN	Year of Reg.	
Chassis No.		Colour	
Odometer	-	Steering	
Brakes		Modification	
General			

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

4. Description of Damages

--	--

5. General Information

Accident Date	25/02/2018	Inspection Date	
Survey held at	CAR CITY AUTO CENTRE PTE LTD BLK 9006 TAMPINES ST 93 #01-198 SINGAPORE 528840		

5a. Remarks

A) THE MARKET VALUE IS S\$----- (EST. AVERAGE)
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE AUTHORISED REPAIRS.

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	26/02/2018 17:58
Date Of Accident	25/02/2018 18:30
Exact Location Of Accident	ALONG BUKIT BATOK AVE 2
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SJQ930H
Insured/Policyholder	
Name Of Registered Owner	ZHU JINYOU
NRIC No	S2684075I
Email Address	JINYOU.ZHU@GMAIL.COM
Mobile Phone No	(LOCAL) +65-90607638
Alternative Phone No	OTHERS-90607638

Vehicle Particulars

Manufacturer	HONDA
Model	STREAM-1.8 X (A)
Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE
Are you claiming under your own insurance policy for repair to your vehicle?	YES
If No, Please state action to be taken	

Vehicle Category	PRIVATE CAR
------------------	-------------

Insurance Company

Name of Insurance Company	CHINA TAIPING INSURANCE (SINGAPORE) PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	DMPCSN1214511705
Cover Note Number	

Driver

Name of Driver	ZHU JINYOU
NRIC No	S2684075I
Date Of Birth	24/11/1965
Occupation	INDOOR
Date Of Driving Pass	23/04/2003
Driving Experience	14 YEARS AND 10 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-90607638
Fax Number	
Contact Number	OTHERS-90607638
EMail Address	JINYOU.ZHU@GMAIL.COM

Address	28 BUKIT BATOK EASE AVE 2 #18-20
Postcode	659921
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	CHAIN COLLISION
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	3
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	3
Passenger 1	NAME: : WANG JUN GENDER: : FEMALE
Passenger 2	NAME: : ZHU JIAHUI, GRACE GENDER: : FEMALE

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

AS PER ATTACHED SKETCH PLAN

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SJX7417R
Vehicle Make/Model/Colour	KIA CERATO GREY COLOUR
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	TAN BOON TAI
NRIC/Passport Number	S7735331C
Contact Number	94567022
Address	BLK 248 BUKIT BATOK EAST AVE 5 #07-50
Postcode	650248
Insurance Company Name	

Nature Of Damage FRONT & REAR

No. Of Passenger (Including Driver) 1

DETAILS OF OTHER VEHICLE PROPERTY 2

Vehicle Registration Number SGV567H

Vehicle Make/Model/Colour BMW BLUE COLOUR

Details Of Properties

Vehicle Category PRIVATE CAR

Name of Driver LIAU WEE BOON

NRIC/Passport Number S7537964A

Contact Number 98436367

Address

Postcode

Insurance Company Name

Nature Of Damage REAR BUMPER

No. Of Passenger (Including Driver)

SKETCH PLAN

IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This Form must be **completed by the Policyholder and/or the Authorised Driver**.
3. Information provided must be as **truthful and accurate as possible**. Any wilful misrepresentation or withholding of material facts may allow insurance companies to **repudiate policy liability**.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims. (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature

Date & Time:

Driver's Signature

(If driver is not the policyholder)


Date & Time:

Reporting Centre Personnel's Signature

Name:

NRIC/FIN No.:

SKETCH PLAN

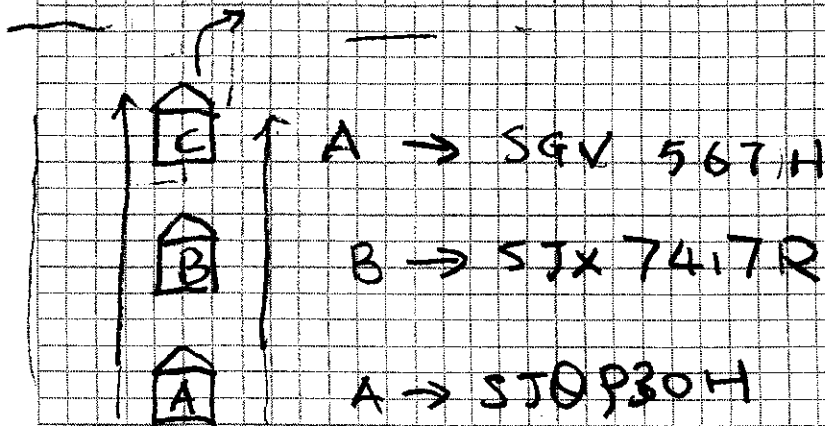


DESCRIBE CIRCUMSTANCES OF THE ACCIDENT


I drive along Bukit Batok East Ave 2, at the corner with Bukit Batok East Ave 3, fail to stop at the right lane and hit to the car (STX 7417R), photos was taken and information was exchanged. The photos were submitted to car workshop.

DECLARATION

I/We declare the foregoing particulars are true in every respect.


 Policyholder's Signature
 Date & Time: 26/2/2018 12:10 pm

Driver's Signature
 (If driver is not the policyholder)
 Date & Time:


 Reporting Centre Personnel's Signature
 Name:
 NRIC/FIN No.:

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Singapore NRIC

Owner ID: 40751

Vehicle Details

Vehicle No.: SJQ930H

Vehicle to be Exported: Yes

Intended De-registration Date: 28 Feb 2018

Vehicle Make: HONDA

Vehicle Model: STREAM 1.8X A

Primary Colour: Brown

Manufacturing Year: 2008

Engine No.: R18A1794548

Chassis No.: RN61085237

Maximum Power Output: 103.0 kW (138 bhp)

Open Market Value: \$20,687.00

Original Registration Date: 23 Apr 2009

First Registration Date: 23 Apr 2009

Transfer Count: 0

Actual ARF Paid: \$20,687.00

Intended PARF Rebate Details

PARF Eligibility: Yes

PARF Eligibility Expiry Date: 22 Apr 2019

PARF Rebate Amount: \$11,377.00

Intended COE Rebate Details

COE Expiry Date: 22 Apr 2019

COE Category: B - Car (1601cc & above)

COE Period(Years):

10

QP Paid:

\$7,490.00

COE Rebate Amount:

\$857.00

Total Rebate Amount:

\$12,234.00

The information contained herein is correct as at 26 Feb 2018

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars

Owner ID Type: Singapore NRIC
Owner ID: 40751

Vehicle Details

Vehicle No.: SJQ930H
Vehicle to be Exported: No
Intended De-registration Date: 12 Mar 2018
Vehicle Make: HONDA
Vehicle Model: STREAM 1.8X A
Primary Colour: Brown
Manufacturing Year: 2008
Engine No.: R18A1794548
Chassis No.: RN61085237
Maximum Power Output: 103.0 kW (138 bhp)
Open Market Value: \$20,687.00
Original Registration Date: 23 Apr 2009
First Registration Date: 23 Apr 2009
Transfer Count: 0
Actual ARF Paid: \$20,687.00 10347

Intended PARF Rebate Details

PARF Eligibility: Yes
PARF Eligibility Expiry Date: 22 Apr 2019
PARF Rebate Amount: \$11,377.00

Intended COE Rebate Details

COE Expiry Date: 22 Apr 2019
COE Category: B - Car (1601cc & above)
COE Period(Years): 10
QP Paid: \$7,490.00
COE Rebate Amount: \$832.00
Total Rebate Amount: \$12,209.00

The information contained herein is correct as at 12 Mar 2018

OK

Free Car Valuation

Unsure of how much your car is worth?

Let us tell you how much is the value - no charges & no obligations!

Post an Advertisement

Sell it yourself! Advertise it at just

\$58 until it's SOLD!

Post an Ad

Advertiser Login

Ways of Selling

New Honda Fit 1.3 GF Facelifted.



\$3000 Drive Away, Low Monthly!
Guaranteed COE Package,
Ready Stock For Delivery.
Apex Trading Pte Ltd StarAd

ABWIN

ONE-STOP
STREAMING SOLUTIONS



FAST & EASY

Browse by Category

« Back (1 2) Next »

Sort by Date Posted

20 results/page

25 vehicles

Honda Stream

Advanced Search

Submit

	Make	Model	Price	Depreciation	Reg Date	Eng Cap	Mileage	Veh Type	Status
Search Selection	Honda Stream		Any	Any	2009	Any	Any	Any	Available



Honda Stream 1.8A RSZ Sunroof

\$23,800 **\$11,910 /yr** **04-Jun-2009** **1,799 cc** **149,600 km** **MPV** **Available**

Just Serviced On 8th March 2018! Rare Black Sunroof RSZ Honda Stream With Low Mileage Done! Current Road Tax Till Jun 2018! Well-Maintained By Previous Owner! All-Time Favourite Japanese MPV In The Ma...

Ka-Hup Vehicles Trading

Posted: 12-Mar-2018 Tags: 2009 Honda Stream, Honda Stream, Honda, Stream, Used Honda

PREMIUM AD



Honda Stream 1.8A Style Edition

\$24,888 **\$9,990 /yr** **01-Jun-2009** **1,799 cc** **135,543 km** **MPV** **Available**

(100% Quality Buy!) 1St Owner Car. Low Mileage Unit. Vehicle Maintain By Agent (Kah Motor) With Servicing History. Purchase And Enjoy 6 Months Engine And Gearbox Protection Plan With 24/7 Roadside Ass...

Sincere Motoring Pte Ltd

Posted: 12-Mar-2018 Tags: 2009 Honda Stream, Honda Stream, Honda, Stream, Used Honda

PREMIUM AD



Honda Stream 1.8A

\$27,777 **\$8,930 /yr** **14-Nov-2009** **1,799 cc** **147,951 km** **MPV** **Available**

(Excellent Condition Guarantee!) We Have 6 Unit Of Quality Pre Owned (Honda Stream) Done Up In Showroom Condition For Your Selection. Purchase And Enjoy 6 Months Engine And Gearbox Protection Plan Wit...

Sincere Motoring Pte Ltd

Posted: 12-Mar-2018 Tags: 2009 Honda Stream, Honda Stream, Honda, Stream, Used Honda

PREMIUM AD



Honda Stream 1.8A

\$24,800 **\$11,170 /yr** **04-May-2009** **1,799 cc** **163,634 km** **MPV** **Available**

This Stream Is Up For Sale Now. Under KAH Motors. Great Condition On The Outside, Brilliant On The Inside. Hurry, Call Me Now.

Posted: 12-Mar-2018 Tags: 2009 Honda Stream, Honda Stream, Honda, Stream, Used Honda

Car Buying

Car Selling

Car Aftermarket

Buying a pre-owned car, but Unsure of its Condition?

Car Ownership

On The Move

Lifestyle

Get, STA Car Evaluation



Honda Stream 1.8A RSZ

\$27,000 **\$10,970 /yr** **11-Jun-2009** **1,799 cc** **178,609 km** **MPV** **Available**

High Spec. High OMV. Good Interior Condition. Nice And Smooth Engine.

Posted: 11-Mar-2018 Tags: 2009 Honda Stream, Honda Stream, Honda, Stream, Used Honda

DIRECT OWNER



Honda Stream 1.8A

\$29,800 **\$10,570 /yr** **20-Oct-2009** **1,799 cc** **107,388 km** **MPV** **Available**

1 Owner Just Arrived And Low Mileage. Beautiful And Beautiful Black Honda Stream 1.8A. Reliable And Low Maintenance Cost. Own By Careful Owner. Most Popular Honda MPV For Your Family Usage! 100% Accid...

Posted: 11-Mar-2018 Tags: 2009 Honda Stream, Honda Stream, Honda, Stream, Used Honda

Compare

\$21,888 **\$10,360 /yr** **09-Apr-2009** **1,799 cc** **150,985 km** **MPV** **Available**

REPAIR DETAILS**Reference****Part Source:** MRM-SG Version: 1.0 (Last Synchronised: 27 Feb 2018)**Parts:** M1-MPV HONDA STREAM 1.8 X (A) (Catalogue:Merimen Singapore 1.0)**Labour:** Repairer's (Price-denominated Standard List)**Print Code:** Car City Auto Centre Pte Ltd/SJQ930H/27/02/2018 16:57**Validity:** These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page**Further Info:** Items/values not in reference catalogue are prefixed with an asterisk *.**Estimates on Parts**

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1	NA	*COND/COMPRESSOR HOSE	0.00	0.00	nn *210.00 F
2	1	NA	*CONDENSER	0.00	0.00	Pum *500.00 F
3	1	NA	*FAN SHROUD	0.00	0.00	nn *85.00 F
4	1	NA	*FRONT BUMPER	0.00	DD/0.00	TORN *390.00 F ✓
5	1	NA	*FRONT PANEL CPL	0.00	0.00	Bent *360.00 F
6	1	NA	*FRT BUMPER BRACKET	0.00	0.00	Dented *185.00 F
7	1	NA	*FRT BUMPER CLAMP KIT	0.00	0.00	nn *12.00 F
8	1	NA	*GRILLE	0.00	0.00	Cra *165.00 F
9	1	NA	*GRILLE BADGE	0.00	0.00	hec *23.00 F
10	1	NA	*L/F HEADLAMP CPL	0.00	0.00	nn *450.00 F OR
11	1	NA	*L/F INN BUMPER TRIM	0.00	0.00	nn *26.00 F
12	1	NA	*L/F OUT BUMPER BRKT	0.00	0.00	Bent *18.00 F
13	1	NA	*L/F UPP BUMPER BRKT	0.00	0.00	Bent *32.00 F
14	1	NA	*R/F INN BUMPER CVR	0.00	0.00	nn *26.00 F
15	1	NA	*R/F OUT BUMPER BRKT	0.00	0.00	Bent *18.00 F
16	1	NA	*R/F UPP BUMPER BRKT	0.00	0.00	Bent *32.00 F
17	1	NA	*R/F WING CLAMP KIT	0.00	0.00	nn *18.00 F
18	1	NA	*R/WHEELHOUSE SHELL	0.00	0.00	nn *70.00 F
19	1	NA	*RAD GRILLE COVER	0.00	0.00	nn *55.00 F
20	1	NA	*RADIATOR	0.00	0.00	Bent/Pum *850.00 F
21	1	NA	*RADIATOR FAN	0.00	0.00	nn *65.00 F
22	1	NA	*RADIATOR FAN MOTOR	0.00	0.00	nn *110.00 F
23	1	NA	*RADIATOR GRILLE TRIM	0.00	0.00	Scr *160.00 F
24	1	NA	*RETURN PIPE	0.00	0.00	Bent *210.00 F

F=Franchise part.

Total Parts (S\$)**4,070.00**

Car City Auto Centre Pte Ltd/SJQ930H/27/02/2018 16:57. Not valid without Reference section.

Generated using Merimen e-Claims IEAS

Estimates on Miscellaneous Items

No	Qty	Particulars	Amount
Miscellaneous Items			
1	1	AIR-CON GAS	50.00
2	1	ANTI-FREEZE COOLANT	60.00
3	1	AUDATEX FEE	42.00
4	1	NUM PLATE & HOLDER	55.00
5	1	SUNDRY PARTS	100.00
Sub Total (S\$)			307.00

Estimates on Labour

No	Particulars	Lab.Type	Amount
Labour Items			
1	Total Paint Labour	New	451.80 474.60
2	Total Paint Materials	New	187.26 191.49
3	Total Panel/Mechanical Labour	New	491.40 928.20
Gross Labour Cost (S\$)			1,594.29

Car City Auto Centre Pte Ltd/SJQ930H/27/02/2018 16:57. Not valid without Reference section.
Generated using Merimen e-Claims IEAS

< END OF ESTIMATES >

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 20 Apr 2018)

Parts: M1-MPV HONDA STREAM 1.8 X (A) (Catalogue:Merimen Singapore 1.0)

Labour: Repairer's (Price-denominated Standard List)

Print Code: Car City Auto Centre Pte Ltd/SJQ930H/20/04/2018 15:45

Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page

Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Estimates on Parts

No.	Qty	Part No.	Particulars	%Disc	%Depr	Amount
1	1	ARD	*R/F HEADLAMP CPL	0.00	0.00	*450.00 F
Total Parts (S\$)						450.00

F=Franchise part.

Car City Auto Centre Pte Ltd/SJQ930H/20/04/2018 15:45. Not valid without Reference section.

Generated using Merimen e-Claims IEAS

**CAR CITY AUTO CENTRE
PTE LTD
BLK 9006 TAMPINES
STREE 93**

**#01-198
SINGAPORE 528840**

**Claim Reference: CCA00350
Assessment Number: CCA00352
Version: CAR CITY/1
Date Calculated: 27/02/2018 07:37**

**Full Report - V1
Registration: SJQ930H
Printed: 27/02/2018 15:37**

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	HO TOO BOON	Date of Incident:	25/02/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:	CCA00350	Estimated Repair Time:	
Policy Number:	DMPCSN1214511705	Quote Due Date:	
Other Reference:	OD/18056	Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer: HONDA
Model: Stream
Sub Model: LS
Model Sheet Number: H36 01
Registration: SJQ930H
Registration Month: April
Registration Year: 2009
VIN Number: RN61085237
Manufacture Year: 2008
Odometer: 148263
Colour: Other
Engine Number: R18A1794548
Fuel Level: %

Model Specs

AUTO AIR CON
ELECT DOOR MIRRORS
FOG LAMPS
PAINTED DOOR HANDLES
TOW BAR
AUTOMATIC GEARBOX
PAINTING OFF VEHICLE
TINTED WINDOWS
NAVIGATION SYSTEM
DRIVER SEAT ARMREST
PAINTED DOOR MIRRORS
1.7 LTR 92 KW
TWO COAT METALLIC

Vehicle Condition

Vehicle Status

Pre-Accident Condition: Good
Steering: Satisfactory
Brakes Pedal Travel: Satisfactory
Place of Inspection: Owner
Pre-Accident Damage:
Tyres Condition: Good
Tyres - Tread Depth (MM):

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Severity of Impact: Heavy Panel
Vehicle Status: Roadworthy
Inspection:
Date of Inspection: 26/02/2018


		Left Tyre	Right Tyre
	Axles	Depth	Depth
LHF	0	7.0	7.0
			RHF

CAR CITY AUTO CENTRE PTE LTD


Claim Reference: CCA00350
Assessment Number: CCA00352
Version: CAR CITY/1
Date Calculated: 27/02/2018 07:37

Full Report - V1
Registration: SJQ930H
Printed: 27/02/2018 15:37

LHR 1 2.0 2.0
 Damage Areas:

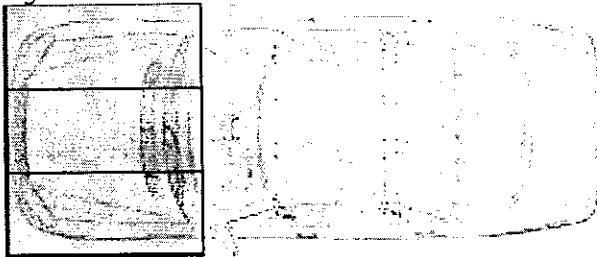

RHR
 Direction of Impact:

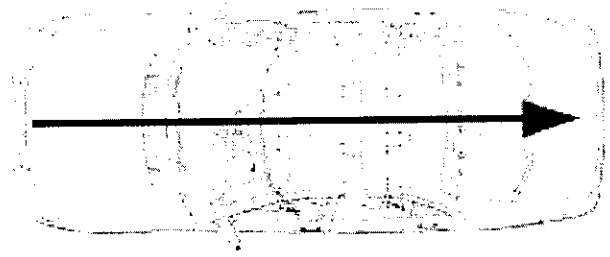

Addresses

Cost Summary

Total Labour	\$1,402.80
Total Paint/Material	\$191.49
Total Parts	\$4,170.00
Total of Additional Costs	\$207.00
Repair Cost Exc GST:	\$5,971.29
Overall Discount (0.0%):	- \$0.00
Excess:	-\$850.00
After Deduction -	
Grand Total Exc GST:	\$5,121.29
7 % GST:	\$358.49
Grand Total Inc GST:	\$5,479.78

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$42.00/HR
Price/Dent = \$42.00/HR

Repair /

Guide Number Repair Details

		WU	Cost Price (\$)
75700-S5A)	R + R FRONT BADGE	3.0	12.60
NO NUMBER	R + R BONNET	3.0	12.60
74111-S7A	R + R LOWER ENGINE PROTECTION	3.0	12.60
76840-S7A)	R + R FRONT WIPER RESERVOIR (BUMPER REMOVED)	3.0	12.60
38100-SX0	R + R LOW TONE HORN	2.0	8.40
38150-ST7)	R + R HIGH TON HORN	2.0	8.40
60211-S7A	R + R L/F WING	10.0	42.00
	INCLUDES: R + R FRONT BUMPER, HEADLAMP AND WHEELHOUSE COVER		
60211-S7A)	R + R R/F WING	5.0	21.00
	(BUMPER REMOVED)		
	DOES NOT INCLUDE: R + R WHEELHOUSE COVER		
	AND HEADLAMP		
04695-S7A	RENEW FRONT PANEL CPL	27.0	113.40
19010-PNA)	R + R RADIATOR CPL	16.0	67.20
80315-S7A)	R + R CONDENSER-/COMPRESSOR HOSE	1.0	4.20
80100-S7A)	R + R AIR CONDITIONING CONDENSER	2.0	8.40
80322-S7A)	R + R COMPRESSOR/EVAPORATOR HOSE	1.0	4.20
NO NUMBER	REFILL + VENT AIR CONDITIONING	10.0	42.00
0245	PANEL WORK FRONT	13.0*	54.60

CAR CITY AUTO CENTRE PTE LTD

Claim Reference: CCA00350

Assessment Number: CCA00352

Version: CAR CITY/1

Date Calculated: 27/02/2018 07:37

Full Report - V1

Registration: SJQ930H

Printed: 27/02/2018 15:37

9952	VEHICLE ON/OFF ADJUST CHASSIS JIG	17	5.0*	X	21.00
0471	REPAIR BONNET	10	17.0*		71.40
0475	REPAIR L/BONNET HINGE	11	7.0*	X	29.40
0476	REPAIR R/BONNET HINGE	11	7.0*	X	29.40
0741	REPAIR L/F WING	10	28.0*		117.60
0742	REPAIR R/F WING	10	28.0*		117.60
1252	REPAIR R/F SIDE MEMBER	11	28.0*	X	117.60
0351	CHECK L/F UPP BUMPER TRIM				
0352	CHECK R/F UPP BUMPER TRIM				
0562	CHECK R/F HEADLAMP CPL				
0637	CHECK L/F FOG LAMP				
0638	CHECK R/F FOG LAMP				
0841	CHECK L/WHEELHOUSE SHELL				
1436	CHECK WASHER RESERVOIR				
4455	CHECK AIR CON COMPRESSOR				
4483	CHECK COND/EVAPORATOR PIPE				
4485	CHECK AIR CON BLOWER FAN				
4487	CHECK FAN MOTOR				
4489	CHECK AIR CON FAN SHROUD				
7787	CHECK EXPANSION TANK				
9645	CHECK LOW TONE HORN				
9646	CHECK HIGH TONE HORN				

LABOUR COST

Total Work Units	221.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	22.1HRS	\$928.20
Paint Labour	11.3HRS	\$474.60
Total Labour	33.4HRS	\$1,402.80

PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$42.00/HR

Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PAINTING OFF VEHICLE		
340	FRT BUMPER BRACKET SURFACE PAINT	4.0	
1009	FRONT PANEL CPL SURFACE PAINT	7.0	
283	FRONT BUMPER NEW PART PAINT K1R	12.0	
412	RADIATOR GRILLE TRIMNEW PART PAINT K1R	4.0	
471	BONNET REPAIR PAINTING >50%	30.0	
741	L/F WING REPAIR PAINTING >50%	16.0	
742	R/F WING REPAIR PAINTING >50%	16.0	
1251	L/F SIDE MEMBER SURFACE PAINT	4.0	
1252	R/F SIDE MEMBER SURFACE PAINT	4.0	

LABOUR COST - PAINT

TIME(PAINT)	97.0	
Preparation Main Work Metal	11.0	
Preparation Comp. Work Plastic	5.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	113.0	
Total Paintwork Labour	11.3HRS	\$474.60

MATERIAL COST - PAINT

New Part Painting - Plastic K1R	\$61.01
---------------------------------	---------

CAR CITY AUTO CENTRE PTE LTD

Claim Reference: CCA00350
Assessment Number: CCA00352
Version: CAR CITY/1
Date Calculated: 27/02/2018 07:37

Full Report - V1
Registration: SJQ930H
Printed: 27/02/2018 15:37

Surface-/Blend Paint	\$27.14
Repair Painting	\$76.24
Material-Const Main Work Metal	\$18.10
Material-Const Comp. Work Plastic	\$9.00
Total Excluding Pearlescent Uplift	\$191.49
Pearlescent Uplift @ 0.0%	\$0.00
Total Paint Material Cost	\$191.49

PARTS

Guide No.Qty		Description	Part Number	Supplier	Price Valid: 01/06/2015	Bet.	Price (\$)
283	1	FRONT BUMPER	71101S7AG00ZE		0%	0%	390.00*
317	1	L/F OUT BUMPER BRKT	71198S7A000		0%	0%	18.00*
318	1	R/F OUT BUMPER BRKT	71193S7A000		0%	0%	18.00*
319	1	L/F UPP BUMPER BRKT	71190S7A000		0%	0%	32.00*
320	1	R/F UPP BUMPER BRKT	71140S7A000		0%	0%	32.00*
340	1	FRT BUMPER BRACKET	71130S7AE01ZZ		0%	0%	185.00*
347	1	L/F INN BUMPER TRIM	71108S7A000		0%	0%	26.00*
348	1	R/F INN BUMPER CVR	71103S7A000		0%	0%	26.00*
350	1	FRT BUMPER CLAMP KIT	USE SINGLE PARTS		0%	0%	12.00*
410	1	GRILLE	71121S7A003ZE		0%	0%	165.00*
411	1	RAD GRILLE COVER	71123S7A003		0%	0%	55.00*
412	1	RADIATOR GRILLE TRIM	71122S7A003ZE		0%	0%	160.00*
431	1	GRILLE BADGE	75700S5PE00		0%	0%	23.00*
561	1	L/F HEADLAMP CPL	33151S7AE01		0%	0%	450.00*
790	1	R/F WING CLAMP KIT	USE SINGLE PARTS		0%	0%	18.00*
842	1	R/WHEELHOUSE SHELL	74101S7A000		0%	0%	70.00*
1009	1	FRONT PANEL CPL	60400S7A306ZZ		0%	0%	360.00*
4465	1	CONDENSER	80100S7A305		0%	0%	500.00*
4481	1	COND/COMPRESSOR HOSE	80315S7A003		0%	0%	210.00*
4482	1	RETURN PIPE	80322S7AG01		0%	0%	210.00*
7761	1	RADIATOR	19010PNA902		0%	0%	850.00*
7767	1	FAN SHROUD	19015PSA003		0%	0%	85.00*
7789	1	RADIATOR FAN MOTOR	19030PAAA01		0%	0%	110.00*
7793	1	RADIATOR FAN	19020PLC003		0%	0%	65.00*
f: OEM Parts			Sub Total				\$4,070.00
g: Original			Mark Up From Cost	(0 %)			\$0.00
h: Secondhand			Sundry Parts	(Fixed)			\$100.00
p: Parallel			Total Parts				\$4,170.00
x: Exchange							

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
AUDATREX FEES	0%	\$42.00
NUM PLATE & HOLDER		\$55.00
ANTI-FREEZE COOLANT	0%	\$60.00
AIR-CON GAS		\$50.00
Total Extras		\$207.00

Final Calculation

Total Parts	\$4,170.00
Labour	

CAR CITY AUTO CENTRE PTE LTD

Claim Reference: CCA00350
Assessment Number: CCA00352
Version: CAR CITY/1
Date Calculated: 27/02/2018 07:37

Full Report - V1
Registration: SJQ930H
Printed: 27/02/2018 15:37

Total Panel/Mechanical	\$928.20	
Total Paintwork	\$474.60	
Total Labour		\$1,402.80
Additional Costs		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$207.00	
Total of Additional Costs		\$207.00
Total Paint/Material Costs		\$191.49
Repair Costs Excludes GST		\$5,971.29
Deductions		
Deduction for Excess (Fixed)	-\$850.00	
Total Deductions		-\$850.00
Grand Total Excludes GST (After Deduction)		\$5,121.29
GST @ 7 %		\$358.49
Grand Total Includes GST (After Deduction)		\$5,479.78

Assessment Notes

51 Ubi Avenue 1, #01-25
Paya Ubi Industrial Park
Singapore
408933

Claim Reference: SNM18D01044C01
Assessment Number: CCA00352
Version: CAR CITY/1
Date Calculated: 12/03/2018 09:40

Full Report - V1
Registration: SJQ930H
Printed: 12/03/2018 17:40

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	MR LAU	Date of Incident:	25/02/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	China Taiping Insurance (S) Pt	Repairs Authorised:	TBA
Claim Reference:	SNM18D01044C01	Estimated Repair Time:	
Policy Number:	DMPCSN1214511705	Quote Due Date:	
Other Reference:	OD/18056	Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details



Vehicle		Model Specs	
Manufacturer:	HONDA	AUTO AIR CON	TINTED WINDOWS
Model:	Stream	ELECT DOOR MIRRORS	NAVIGATION SYSTEM
Sub Model:	LS	FOG LAMPS	DRIVER SEAT ARMREST
Model Sheet Number:	H36 01	PAINTED DOOR HANDLES	PAINTED DOOR MIRRORS
Registration:	SJQ930H	TOW BAR	1.7 LTR 92 KW
Registration Month:	April	AUTOMATIC GEARBOX	TWO COAT METALLIC
Registration Year:	2009	PAINTING OFF VEHICLE	
VIN Number:	RN61085237		
Manufacture Year:	2008		
Odometer:	148263		
Colour:	Other		
Engine Number:	R18A1794548		
Fuel Level:	%		

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Good	Severity of Impact:	Heavy Panel
Steering:	Satisfactory	Vehicle Status on Inspection:	Roadworthy
Brakes Pedal Travel:	Satisfactory	Date of Inspection:	26/02/2018
Place of Inspection:	Owner		
Pre-Accident Damage:			
Tyres Condition:	Good		
Tyres - Tread Depth (MM):			

		Left Tyre	Right Tyre	
	Axles	Depth	Depth	
LHF	0	7.0	7.0	RHF
LHR	1	2.0	2.0	RHR
Damage Areas:			Direction of Impact:	

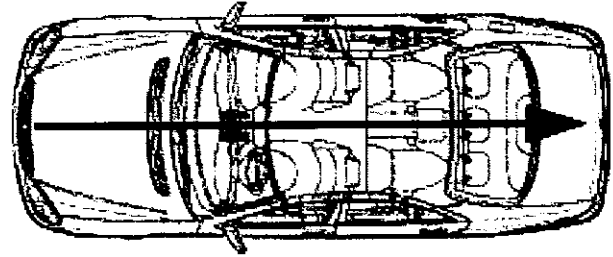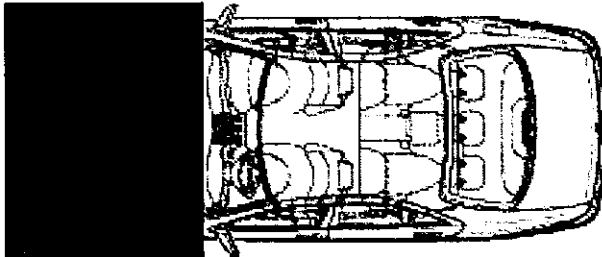

Addresses

Cost Summary

Total Labour	\$1,067.20
Total Paint/Material	\$187.26
Total Parts	\$3,680.50
Total of Additional Costs	\$152.00
Repair Cost Exc GST:	\$5,086.96
Overall Discount (0.0%):	- \$0.00
Excess:	-\$850.00
After Deduction -	
Grand Total Exc GST:	\$4,236.96
7 % GST:	\$296.59
Grand Total Inc GST:	\$4,533.55

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$46.00/HR
Price/Dent = \$46.00/HR

Repair /

Guide Number	Repair Details	WU	Cost Price (\$)
75700-S5A)	R + R FRONT BADGE	3.0	13.80
NO NUMBER	R + R BONNET	3.0	13.80
74111-S7A	R + R LOWER ENGINE PROTECTION	3.0	13.80
76840-S7A)	R + R FRONT WIPER RESERVOIR (BUMPER REMOVED)	3.0	13.80
38100-SX0	R + R LOW TONE HORN	2.0	9.20
38150-ST7)	R + R HIGH TON HORN	2.0	9.20
60211-S7A	R + R L/F WING INCLUDES: R + R FRONT BUMPER, HEADLAMP AND WHEELHOUSE COVER	10.0	46.00
60211-S7A)	R + R R/F WING (BUMPER REMOVED) DOES NOT INCLUDE: R + R WHEELHOUSE COVER AND HEADLAMP	5.0	23.00
04695-S7A	RENEW FRONT PANEL CPL	27.0	124.20
19010-PNA)	R + R RADIATOR CPL	16.0	73.60
80100-S7A)	R + R AIR CONDITIONING CONDENSER	2.0	9.20
NO NUMBER	REFILL + VENT AIR CONDITIONING	10.0	46.00
0471	REPAIR BONNET	17.0*	78.20
0741	REPAIR L/F WING	10.0*	46.00
0742	REPAIR R/F WING	10.0*	46.00
0351	CHECK L/F UPP BUMPER TRIM		
0352	CHECK R/F UPP BUMPER TRIM		
0562	CHECK R/F HEADLAMP CPL		
0637	CHECK L/F FOG LAMP		

0638	CHECK R/F FOG LAMP
0841	CHECK L/WHEELHOUSE SHELL
1436	CHECK WASHER RESERVOIR
4455	CHECK AIR CON COMPRESSOR
4483	CHECK COND/EVAPORATOR PIPE
4485	CHECK AIR CON BLOWER FAN
4487	CHECK FAN MOTOR
4489	CHECK AIR CON FAN SHROUD
7787	CHECK EXPANSION TANK
9645	CHECK LOW TONE HORN
9646	CHECK HIGH TONE HORN

LABOUR COST

Total Work Units	123.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	12.3HRS	\$565.80
Paint Labour	10.9HRS	\$501.40
Total Labour	23.2HRS	\$1,067.20

PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$46.00/HR

Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PAINTING OFF VEHICLE		
340	FRT BUMPER BRACKET SURFACE PAINT	4.0	
1009	FRONT PANEL CPL SURFACE PAINT	7.0	
283	FRONT BUMPER NEW PART PAINT K1R	12.0	
412	RADIATOR GRILLE TRIMNEW PART PAINT K1R	4.0	
471	BONNET REPAIR PAINTING >50%	30.0	
741	L/F WING REPAIR PAINTING >50%	16.0	
742	R/F WING REPAIR PAINTING >50%	16.0	
1251	L/F SIDE MEMBER SURFACE PAINT	4.0	

LABOUR COST - PAINT

TIME(PAINT)	93.0	
Preparation Main Work Metal	11.0	
Preparation Comp. Work Plastic	5.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	109.0	
Total Paintwork Labour	10.9HRS	\$501.40

MATERIAL COST - PAINT

New Part Painting - Plastic K1R	\$61.01
Surface-/Blend Paint	\$22.91
Repair Painting	\$76.24
Material-Const Main Work Metal	\$18.10
Material-Const Comp. Work Plastic	\$9.00
Total Excluding Pearlescent Uplift	\$187.26
Pearlescent Uplift @ 0.0%	\$0.00
Total Paint Material Cost	\$187.26

PARTS

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
283	1	FRONT BUMPER	71101S7AG00ZE		0%	390.00*

Price Valid: 01/06/2015

317	1	L/F OUT BUMPER BRKT	71198S7A000	0%	18.00*
318	1	R/F OUT BUMPER BRKT	71193S7A000	0%	18.00*
319	1	L/F UPP BUMPER BRKT	71190S7A000	0%	32.00*
320	1	R/F UPP BUMPER BRKT	71140S7A000	0%	32.00*
340	1	FRT BUMPER BRACKET	71130S7AE01ZZ	0%	185.00*
347	1	L/F INN BUMPER TRIM	71108S7A000	0%	26.00*
348	1	R/F INN BUMPER CVR	71103S7A000	0%	26.00*
410	1	GRILLE	71121S7A003ZE	0%	165.00*
412	1	RADIATOR GRILLE TRIM	71122S7A003ZE	0%	160.00*
431	1	GRILLE BADGE	75700S5PE00	0%	23.00*
561	1	L/F HEADLAMP CPL	33151S7AE01	0%	450.00*
1009	1	FRONT PANEL CPL	60400S7A306ZZ	0%	360.00*
4465	1	CONDENSER	80100S7A305	0%	500.00*
7761	1	RADIATOR	19010PNA902	0%	850.00*
7789	1	RADIATOR FAN MOTOR	19030PAAA01	0%	110.00*
7793	1	RADIATOR FAN	19020PLC003	0%	65.00*
f: OEM Parts		Sub Total			\$3,410.00
g: Original		Mark Up From Cost			\$170.50
h: Secondhand		Sundry Parts			\$100.00
p: Parallel		Total Parts			\$3,680.50
x: Exchange					

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
AUDATREX FEES	SPECIALIST 0%	\$42.00
NUM PLATE & HOLDER	SPECIALIST	\$40.00
ANTI-FREEZE	SPECIALIST 0%	\$20.00
COOLANT		\$50.00
AIR-CON GAS	SPECIALIST	\$50.00
Total Extras		\$152.00

Final Calculation

Total Parts	\$3,680.50
Labour	
Total Panel/Mechanical	\$565.80
Total Paintwork	\$501.40
Total Labour	\$1,067.20
Additional Costs	
Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00
Cost of Specialist	\$152.00
Total of Additional Costs	\$152.00
Total Paint/Material Costs	\$187.26
Repair Costs Excludes GST	\$5,086.96
Deductions	
Deduction for Excess (Fixed)	-\$850.00
Total Deductions	-\$850.00
Grand Total Excludes GST (After Deduction)	\$4,236.96
GST @ 7 %	\$296.59
Grand Total Includes GST (After Deduction)	\$4,533.55

51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference: SNM18D01044C01

Full Report - V1

Assessment Number: CCA00352

Registration: SJQ930H

Version: CAR CITY/1

Printed: 12/03/2018 17:40

Date Calculated: 12/03/2018 09:40

Assessment Notes

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING						
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd
Main	27 Feb 2018 Sendback Est	27 Feb 2018 16:57 S\$5,971.29	01 Mar 2018 11:22 Edit Adj Rpt	S\$4,200.00 Edit Estimates	S\$4,200.00 View Rpt	
Supp #1	20 Apr 2018 15:44	20 Apr 2018 15:45 S\$450.00	20 Apr 2018 15:45			(Combined)
						Pending for Survey Report Cancel Case
						Combined with Main Uncombine Suppl.

Main	Reference	Claim Details	Documents	Show All
-------------	------------------	----------------------	------------------	-----------------

CLAIM SUBFOLDER DETAILS

Insured:	ZHU JINYOU, ID: S2684075I, Tel: +6590607638, Email: JINYOU.ZHU@GMAIL.COM		
Vehicle Reg. No.:	SJQ930H	Date of Loss:	25/02/2018 18:00 - :59 [106 Months and 2 Days From LTA Reg Date (Man Yr)]
Claim Type:	OD / SNM18D01044C01	Policy/Cover Note No.:	DMPCSN1214511705 (Comprehensive)
		Excess:	S\$850.00
Repairer:	Car City Auto Centre Pte Ltd (HQ) Blk 9006 #01-198, Tampines Street 93, 528840 Tampines - Tel: 6781 0300		
Handling Insurer:	China Taiping Insurance (Singapore) Pte. Ltd. (HQ) - Tel: 6389 6111 ... [Handled by Jowyn Tay - 6389 6174]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by MARCUS CHUA] ... [Final Rpt due 12/03/2018]		
Driver/Custodian:	ZHU JINYOU (52 / Male), NRIC: S2684075I, Tel: +6590607638		
Adj Asg. Remarks:	PLEASE PROCEED TO SURVEY & REVERT. EXCESS OF \$850.00 APPLIES.		

ASSOCIATED MAIL RECEIVED

[View All](#)
[Compose Case Mail](#)

- CHINA TAIPING (13/03/2018): Alert - Adj Mandate Approved (S\$4100.00) - SJQ930H - Claim Handler: Jowyn Tay

ALL ASSOCIATED TASKS

[View All](#)
[Search Tasks](#)
[Create New Task](#)
[Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents





































SJQ930H (SNM18D01044C01)


















































OD
















Feb 25 2018 6:00PM

[ZHU JINYOU]



















Car City Auto Centre Pte Ltd

Upload Documents		Upload Photos	Compose New Letter	View View in Browser <input type="button" value="v"/>	
Assessment Reports				1 per page <input type="button" value="v"/>	<input checked="" type="checkbox"/>
No	Finalized On	Car City Auto Centre Pte Ltd (HQ)		Thumbnail	Print
1	27/02/18 16:57	Repairer Estimates		Load HTM	
2	20/04/18 15:45	Repairer Estimates Suppl. #1		Load HTM	
No	Finalized On	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	12/03/18 17:48	Adjuster Immediate Advice		Load HTM	
Photos/Images				3 per page <input type="button" value="v"/>	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)		Thumbnail	Print
1	12/03/18 19:16	Chassis Number		Load JPG	<input checked="" type="checkbox"/>
2	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
3	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
4	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
5	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
6	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
7	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
8	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
9	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
10	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
11	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
12	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
13	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
14	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
15	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
16	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
17	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
18	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
19	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
20	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
21	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
22	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
23	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
24	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
25	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
26	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
27	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
28	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
29	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
30	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
31	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
32	12/03/18 19:16	General View		Load JPG	<input checked="" type="checkbox"/>
33	12/03/18 19:16	General View		Load JPG	

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Car City Auto Centre Pte Ltd (HQ)	Thumbnail	Print
				<input checked="" type="checkbox"/>
34	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
35	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
36	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
37	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
38	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
39	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
40	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
41	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
42	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
43	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
44	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
45	12/03/18 19:16	Odometer Reading	 Load JPG	<input checked="" type="checkbox"/>
46	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
47	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
48	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
49	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
50	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
51	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
52	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
53	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
54	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
55	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
56	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
57	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
58	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
59	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
60	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
61	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
62	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
63	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
64	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
65	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
66	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
67	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
68	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
69	12/03/18 19:16	General View	 Load JPG	<input checked="" type="checkbox"/>
70	12/03/18 19:17	General View	 Load JPG	<input checked="" type="checkbox"/>
71	12/03/18 19:17	General View	 Load JPG	<input checked="" type="checkbox"/>
72	12/03/18 19:17	General View	 Load JPG	<input checked="" type="checkbox"/>
73	12/03/18 19:17	General View	 Load JPG	<input checked="" type="checkbox"/>
74	12/03/18 19:17	General View	 Load JPG	<input checked="" type="checkbox"/>
75	12/03/18 19:17	General View	 Load JPG	<input checked="" type="checkbox"/>
76	12/03/18 19:17	General View	 Load JPG	<input checked="" type="checkbox"/>
77	13/03/18 20:06	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
78	13/03/18 20:06	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
79	13/03/18 20:06	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
80	13/03/18 20:06	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
81	13/03/18 20:06	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
82	13/03/18 20:06	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Car City Auto Centre Pte Ltd (HQ)	Thumbnail	Print
83	13/03/18 20:06	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
84	13/03/18 20:06	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
85	13/03/18 20:06	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
86	13/03/18 20:06	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
87	13/03/18 20:06	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
88	13/03/18 20:06	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
89	13/03/18 20:06	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
90	13/03/18 20:06	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
91	13/03/18 20:06	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
92	13/03/18 20:06	Reinspection Photo	 Load JPG	<input checked="" type="checkbox"/>
93	04/05/18 09:13	Reinspection Photo	 Load PDF	
94	04/05/18 09:13	General View	 Load PDF	
Documentation			1 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	12/03/18 17:39	MARKING ESTIMATE	 Load PDF	
2	12/03/18 17:41	audatex	 Load PDF	
3	11/05/18 11:41	Supplementary	 Load PDF	

Linked Accident Report Documents

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Car City Auto Centre Pte Ltd (HQ)	Thumbnail	Print
1	26/02/18 18:12	Accident Statement	 Load HTM	
Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Finalized On	Car City Auto Centre Pte Ltd (HQ)	Thumbnail	Print
1	26/02/18 18:08	SCENE PHOTO	 Load JPG	<input checked="" type="checkbox"/>
2	26/02/18 18:08	INSURED CAR	 Load JPG	<input checked="" type="checkbox"/>
3	26/02/18 18:08	3RD PARTY CAR	 Load JPG	<input checked="" type="checkbox"/>
4	26/02/18 18:08	3RD PARTY CAR	 Load JPG	<input checked="" type="checkbox"/>
5	26/02/18 18:08	3RD PARTY CAR	 Load JPG	<input checked="" type="checkbox"/>
6	26/02/18 18:08	3RD PARTY CAR	 Load JPG	<input checked="" type="checkbox"/>
7	26/02/18 18:08	INSURED CAR	 Load JPG	<input checked="" type="checkbox"/>
8	26/02/18 18:08	INSURED CAR	 Load JPG	<input checked="" type="checkbox"/>
9	26/02/18 18:08	INSURED CAR	 Load JPG	<input checked="" type="checkbox"/>
10	26/02/18 18:08	INSURED CAR CHASSIS NUMBER	 Load JPG	<input checked="" type="checkbox"/>
11	26/02/18 18:08	INSURED CAR	 Load JPG	<input checked="" type="checkbox"/>
12	26/02/18 18:08	INSURED CAR	 Load JPG	<input checked="" type="checkbox"/>
13	26/02/18 18:08	INSURED CAR	 Load JPG	<input checked="" type="checkbox"/>
Documentation			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	Car City Auto Centre Pte Ltd (HQ)	Thumbnail	Print
1	26/02/18 18:05	Sketch Plan	 Load TIF	
2	26/02/18 18:05	Sketch Plan #2	 Load TIF	
3	26/02/18 18:05	CI	 Load TIF	
4	26/02/18 18:05	OWNER / DRIVER IC N DL	 Load TIF	

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print

There are no document checklists configured.

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)

Show Remarks To: ☐ Repairer ☐ Handling Insurer

Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd (Co.Reg No:199607198R)

51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park

Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

China Taiping Insurance (Singapore) Pte. Ltd.
3 Anson Road, #16-00 Springleaf Tower
Singapore 079909

Our File No: CS/CTI18004011/UTDE2

Date: 11/05/2018

REFERENCE

Insured/Claimant: ZHU JINYOU Policy No: DMPCSN1214511705
Date of Loss: 25/02/2018 Nature of Claim: OD Claim No: SNM18D01044C01

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No: **SJQ930H**
Make & Model: HONDA STREAM, 1.8 X (A) Engine No: R18A1794548
Reg. Date: 23/04/2009 (Man. Year: 2008) Chassis No: RN61085237
Colour: Brown Odometer: 148912 km
Engine Capacity: 1799 cc
Market Value/New Car Price: S\$20,000.00
Sum Insured (\$\$): **Market Value/New Car Price**

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition: Steering (Serviceable): Yes Footbrake (Serviceable): Yes
Handbrake (Serviceable): Yes Engine Modification: No Pre-accident Condition: Yes

CONDITION OF TYRES

Front Tyre Size: 205/65 R15 Rear Tyre Size: 205/65 R15
Front Left Side: Yokohama 6 mm Rear Left Side: Yokohama 6 mm
Front Right Side: Yokohama 6 mm Rear Right Side: Yokohama 6 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	4,520.00	3,843.00	677.00	14.98
Miscellaneous Items	307.00	252.00	55.00	17.92
Labour	1,594.29	1,136.46	457.83	28.72
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Calculated Gross Total (\$\$)	6,421.29	5,231.46	1,189.83	18.53
Approved Total (Overridden) (\$\$)		4,200.00		
- Excess (\$\$)	850.00	850.00	0.00	0.00
(\$\$)	5,571.29	3,350.00	2,221.29	39.87
+ GST 7.00/7.00% (\$\$)	389.99	234.50	155.49	39.87
Nett Amount (\$\$)	5,961.28	3,584.50	2,376.78	39.87

INSPECTION

Date of Assignment: 01/03/2018 Present Location:
Date Inspected: 12/03/2018 Inspected At:

Car City Auto Centre Pte Ltd (HQ)
Blk 9006 #01-198, Tampines Street 93
Singapore 528840

Estimated Period of Repair: 5.0 days

Adjuster: MARCUS CHUA

Manager: DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference

Part Source: MRM-SG Version: 1.0 (Last Synchronised: 11 May 2018)
Parts: M1-MPV HONDA STREAM 1.8 X (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's (Price-denominated Standard List)
Print Code: (Unsubmitted, no print-code for SJQ930H)
Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page
Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1	NA	*COND/COMPRESSOR HOSE	Not Necessary	210.00 F	*- F
2	1	NA	*CONDENSER	Punctured	500.00 F	*500.00 F
3	1	NA	*FAN SHROUD	Not Necessary	85.00 F	*- F
4	1	NA	*FRONT BUMPER	Dented / Torn	390.00 F	*390.00 F
5	1	NA	*FRONT PANEL CPL	Bent	360.00 F	*360.00 F
6	1	NA	*FRT BUMPER BRACKET	Dented	185.00 F	*185.00 F
7	1	NA	*FRT BUMPER CLAMP KIT	Not Necessary	12.00 F	*- F
8	1	NA	*GRILLE	Cracked	165.00 F	*165.00 F
9	1	NA	*GRILLE BADGE	Necessary	23.00 F	*23.00 F
10	1	NA	*L/F HEADLAMP CPL	Cracked	450.00 F	*450.00 F
11	1	NA	*L/F INN BUMPER TRIM	Not Necessary	26.00 F	*- F
12	1	NA	*L/F OUT BUMPER BRKT	Bent	18.00 F	*18.00 F
13	1	NA	*L/F UPP BUMPER BRKT	Bent	32.00 F	*32.00 F
14	1	NA	*R/F INN BUMPER CVR	Not Necessary	26.00 F	*- F
15	1	NA	*R/F OUT BUMPER BRKT	Bent	18.00 F	*18.00 F
16	1	NA	*R/F UPP BUMPER BRKT	Bent	32.00 F	*32.00 F
17	1	NA	*R/F WING CLAMP KIT	Not Necessary	18.00 F	*- F
18	1	NA	*R/WHEELHOUSE SHELL	Not Necessary	70.00 F	*- F
19	1	NA	*RAD GRILLE COVER	Not Necessary	55.00 F	*- F
20	1	NA	*RADIATOR	Bent / Punctured	850.00 F	*850.00 F
21	1	NA	*RADIATOR FAN	Not Necessary	65.00 F	*- F
22	1	NA	*RADIATOR FAN MOTOR	Not Necessary	110.00 F	*- F
23	1	NA	*RADIATOR GRILLE TRIM	Scratched	160.00 F	*160.00 F
24	1	NA	*RETURN PIPE	Bent	210.00 F	*210.00 F
Supplementary #1						
25	1		*R/F HEADLAMP CPL	Cracked	450.00 F	*450.00 F
F=Franchise part.						
Total Parts (S\$)					4,520.00	3,843.00

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

No	Qty	Particulars	Repairer's	Amount
Miscellaneous Items				
1	1	AIR-CON GAS (NECESSARY)	50.00	50.00
2	1	ANTI-FREEZE COOLANT (NECESSARY)	60.00	20.00
3	1	AUDATEX FEE	42.00	42.00
4	1	NUM PLATE & HOLDER (BENT)	55.00	40.00
5	1	SUNDRY PARTS (NECESSARY)	100.00	100.00
Sub Total (S\$)			307.00	252.00

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
Labour Items				
1	Total Paint Labour	New	474.60	457.80
2	Total Paint Materials	New	191.49	187.26
3	Total Panel/Mechanical Labour	New	928.20	491.40
Gross Labour Cost (S\$)			1,594.29	1,136.46

Report was unsubmitted during this print-out.

< END OF ESTIMATES >