

ASS. REC. BY:

REF: CS/ASM18005040/Sqd3² Special Instruction:

Surveyor:

Sebastian

ASSIGNMENT (Office)

From (Person):

Peter Wang

of

ASM

Date/Time:

16/3/18

Estimated Cost:

Bill to:

☒ OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SIL 2162Y

Insured:

at Workshop m/s

Trans Eurokars

Tel:

6363 3003

of

12 Sungai Keroh Ave

Policy No:

Claim No:

S8 M00ARJ

Sum Insured:

Excess:

\$ 700.00

Make of Veh:

D.O.A

12/3/2018

(Client's Record)

19/03/18 @ Morning

CA / ☒ REV

REP. / REV 24 HRS

H.O.D. Endorsement:

Date/Time:

3:44pm @ 16/3/18

Person Contacted:

Jobi

Vehicle:

☒ IN / OUT

Date/Time	Action/Instruction (✓) Estimate
	SIL 2162Y-X
20/3/18 @ 2:28pm	revert to Peter Wang via Smart Claim.
20/3/18 @ 3:14pm	Peter Wang informed C/A & EX: \$700 via Smart Claim.
20/3/18 @ 4:23pm	Informed Jobi C/A & EX: \$700 by email.
	Sebastian finalised final fig @ 10771.11
	Chkd @ 1390, 11%.

REF: ASM(AXA)

ASSIGNMENT

From:

Date:

19/3/18

Estimated Cost:

☒ TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

SL 2162Y

at Workshop m/s

Trans Euro Cars

of

12 Sungai Kadut Ave

Insured:

Policy No.

Claims No.

Sum Insured:

Excess:

\$700.00


(Client's Record)

Jobi @ Morning

Make of Veh:

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

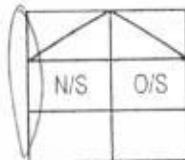

Bal. or Market Value:

98k.

IDAC Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

8

days

Res.: Yes or No

Lum Sum:

%

3 Val.: Yes or No

CA / ☒ REV / REP. / 24 HRS

Vehicle: IN / OUT

Date:

Person Contacted:

Date / Time

Action / Instruction

Veh No:

SL 2162Y

Yr Regn:

17/3/17

Type: ☒ M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

Mini Cooper

E55.

cc. 1198

Colour:

Red

A/C:

Insured / Std / NI / NA

Sp. Reading

14740

T/Radio:

Insured / Std / NI / NA

Eng/No:

C/No:

WMWX51202021579666

Gen. Cond: Good / ☒ Fair / Poor / BurntSteering: ☒ In order / Jammed / Leaked / Burnt orBrake: ☒ In order / Jammed / Leaked / Burnt orModi: ☒ Nil / S/Rim / STD A/Rim or

Tyre Size:

F:

195/55R16

R:

U

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or

Goodyear

Front

Rear

R/Bal.

7

mm

R/Bal.

7

mm

L/Bal.

7

mm

L/Bal.

7

mm

D.O.A.

12/3/18

D.O.I.

19/3/18

Survey held at

Trans Euro Cars

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision.

RECEIVED 1 MAY 2018

21/5/2018

Date/Time: File Pass to?



Preli. Report

1) 21/5/18



Final Report

Date/Time: File Return to?

2)

Days Of Repair:

8

Resurvey No. of Trip:

1

Survey Fee:

Transportation

) \$ + \$5 \$

) Photos

) Others

TOTAL

Add Fee:



Site Insp \$



Interview \$



Tech. Insp \$



Weekend \$

Report Format:

Smart Claim

Lump Sum / I.B.I. \$

60771.11



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

AXA INSURANCE PTE LTD

Ref : CS/ASM18005040/Sqd3

8 SHENTON WAY #24-01
AXA TOWERS SINGAPORE 068811

Date : 16-03-2018



Code : ASM

1. Policy Particulars :- OWN DAMAGE

Insured Veh.	Veh. Inspected	SLL 2162Y
Policy No.	Coverage (\$)	0.00
Claim No. S8M00ARJ	Excess (\$)	700.00
Assign From SMARTCLAIM (PETER WANG)	Assign Date	16/03/2018

2. Vehicle Particulars & Condition

Make & Model	c.c	0
Engine No. HIDDEN	Year of Reg.	
Chassis No.	Colour	
Odometer -	Steering	
Brakes	Modification	
General		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

4. Description of Damages

--

5. General Information

Accident Date 12/03/2018	Inspection Date
Survey held at TRANS EUROKARS PTE LTD 12 SUNGEI KADUT AVE SINGAPORE 729648	

5a. Remarks

A) THE MARKET VALUE IS S\$----- (EST. AVERAGE)
B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE AUTHORISED REPAIRS.

Service Request Details

Claim

S8M00ARJ

LKK AUTO CONSULTANTS PTE LTD (OD) ▾

Reference

None 

Loss Date

March 12, 2018

Request Date

March 16, 2018

Due Date

March 23, 2018

Vendor Name

LKK AUTO CONSULTANTS PTE LTD (OD)

Type of Loss

Own Damage

Services

Accelerated workshop survey

Actions

Next Step

Agree to perform service

Decline WorkAccept Work

Vehicle Information

Incident Vehicle Registration #

SLL2162Y

Make

MINI

Service Address

12 Sungei Kadut Avenue, , , 729648

Primary Contact/Insured

AMIRKHANIAN NATALIA

27 KEPPEL BAY VIEW, #09-80, 098416, Singapore

MOTOR.OPERATIONS@GNM.COM.SG

Claim Handler

WANG Peter

peter.xiao@axa.com.sg

Additional Instructions

Wkshop: Trans Eurokars Excess: \$700 Survey WP

[Messages](#)[Invoices](#)[History](#)[Documents](#)[Assessment](#)[Metrics](#)[Notes](#)[New Message](#)

Nivitha (LKK Auto)

From: jobithomas@eurokars.com.sg
Sent: Friday, 16 March 2018 1:46 PM
To: SG AXA Insurance SM AXA SGP - Motor Survey; SG AXA Insurance SM Claims Service Team
Subject: OUR REF: SLL2162Y OWN DAMAGE CLAIM (CAR IS IN THE WORKSHOP)
Attachments: 2865_001.pdf
Categories: Shekhar

OUR REF: SLL2162Y OWN DAMAGE CLAIM (CAR IS IN THE WORKSHOP)

Dear Sir/Mdm,

Please arrange the survey of our client's vehicle ASAP.

Attached is the ESTIMATE, SAS REPORT, SKETCH PLAN for your perusal.

Best Regards.



Jobi Thomas
Insurance Claims Executive

TRANS EUROKARS PTE LTD
12 Sungei Kadut Avenue
Singapore 729648
T: (65) 6363 3003 D: (65) 6360 2446 F: (65) 6360 2899
E: jobithomas@eurokars.com.sg

Shiau Chan (LKKAUTO)

From: Shiau Chan (LKKAUTO)
Sent: Tuesday, 20 March 2018 4:23 PM
To: jobithomas@eurokars.com.sg; jess.francis@eurokars.com.sg;
jessicahs@eurokars.com.sg; catherinechua@eurokars.com.sg
Cc: SUR
Subject: VEHICLE SLL 2162Y (DOA: 12/03/2018)

Dear Jobi,

As instructed by our client AXA Insurance, please proceed to repair the insured vehicle **SLL 2162Y (excess \$700/-)**.

If there are any check items or supplementary items please inform our office's Assignment Team at Tel: 6741 8434 to arrange our surveyor for inspection.

All supplementary items and unconfirm items are subjected to further approval from insurance company before completion of the repair.

*Our client reserve their right **not to pay** if there is no valid approval obtained before repair.

Best Regards,

Shiau Chan (Ms) | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: siewsc@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

Authorized

Type

 Question

Message

Please proceed to authorize repair. OD Excess: \$700

Reply



Auto
Consultants
Pte Ltd

51 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Your Ref: S8M00ARJ

Date: 20th March 2018

Our Ref: CS/ASM18005040/Sqd3

The Motor Claims Department
AXA Insurance Singapore Pte L td

Attn: Peter

Dear Sirs/Mdm


PRELIMINARY ADVICE OF VEHICLE NO. SLL 2162Y

We thank you for the instruction on 16/03/2018.

Please be informed that we had conducted the inspection of the abovementioned vehicle on 19/03/2018 (11.22am) at the premises of M/s TRANS EUROKARS and have the following to report:-

Workshop Estimate Amount	: S\$ <u>12,161.11</u>
Revised Estimate Amount	: S\$ <u>10,771.11</u>
"Check" Items Amount	: S\$ <u>-</u>
Total	: S\$ <u>10,771.11</u>
Market Value	: S\$ <u>98,000.00</u>
LTA Reimbursement Value	: S\$ <u>52,601.00</u>
Nett Value	: S\$ <u>45,399.00</u>

Description of Damage:
The vehicle sustained damages at the o/s portion.

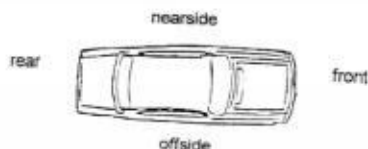

Comments/ Present Status:

Damages consistent.

Repair cost economical.

Estimated normal period for repairs: 08 working days.

We have not authorised the repairs.

Yours faithfully

Sebastian
Automobile Assessor

THE WISH LIST.



MINI COOPER S 3 DOOR

\$156,088



MINI ONE 5 DOOR SPORT EDITION

\$116,088

MINI COOPER S 5 DOOR

\$159,088



MINI COOPER S CONVERTIBLE

\$170,088



MINI COOPER CLUBMAN

\$144,088

MINI COOPER S CLUBMAN

\$163,088

MINI JOHN COOPER WORKS CLUBMAN

\$206,088



MINI COOPER COUNTRYMAN

\$153,088

MINI COOPER S COUNTRYMAN

\$184,088

MINI JOHN COOPER WORKS COUNTRYMAN

\$222,088

Prices quoted are in Singapore Dollars.

Prices quoted are applicable for automatic and manual transmission and are based on standard specifications.

Financing available at 2.79% subject to change without prior notice.

All the above retail prices are inclusive of GST (where applicable).

Prices are inclusive of COE, 1 Year road tax, registration fee and number plate.

Warranty: 3 Years / 200,000km whichever comes first (does not include wear and tear).

We reserve the right to make changes to the prices and standard equipment without prior notice. Valid till 30 March 2018.



Eurokars Habitat Pte Ltd
Eurokars Group of Companies

27 Tang Kue Road, Singapore 159098
Tel (+65) 6473 3777 • Fax (+65) 6473 0500

Showroom: Open Mon - Sat 8.30 AM - 7.00 PM
Sunday and public holidays 10.00 AM - 6.00 PM

MINI.COM.SG
FACEBOOK.COM/MINTSINGAPORE

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	16/03/2018 13:06
Date Of Accident	12/03/2018 15:10
Exact Location Of Accident	JALAN AHMAD IBRAHIM
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLL2162Y
Insured/Policyholder	
Name Of Registered Owner	AMIRKHANIAN NATALIE
Passport No/FIN	G3428149T
Email Address	NATS147@LIST.RU
Mobile Phone No	(LOCAL) +65-98658880
Alternative Phone No	OTHERS-98658880

Vehicle Particulars

Manufacturer	MINI
Model	MINI ONE 5DR HATCH
Exact Purpose for which vehicle was being used at time of accident	PRIVATE USE
Are you claiming under your own insurance policy for repair to your vehicle?	YES
If No, Please state action to be taken	

Vehicle Category	PRIVATE CAR
------------------	-------------

Insurance Company

Name of Insurance Company	AXA INSURANCE PTE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	GA333037/1
Cover Note Number	

Driver

Name of Driver	AMIRKHANIAN NATALIE
Passport No/FIN	G3428149T
Date Of Birth	08/04/1975
Occupation	INDOOR
Date Of Driving Pass	07/12/2004
Driving Experience	13 YEARS AND 3 MONTHS
Gender	FEMALE
Mobile Number	(LOCAL) +65-98658880
Fax Number	
Contact Number	OTHERS-98658880
Email Address	NATS147@LIST.RU

Address	27 KEPPEL BAY VIEW #09-80
Postcode	098416
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

General Information of the Accident

Type Of Accident	SIDE SWIPE
Weather Conditions	RAINING
Road Surface	WET

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

REFER SKETCH PLAN & STATEMENT

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	GBC3095S
Vehicle Make/Model/Colour	TOYOTA HIACE
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	NUR YUMAU BIN YUMAAT
NRIC/Passport Number	S8512561C
Contact Number	98535857
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	1

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents(including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all Insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature
Date & Time:

16.03.2018
11:15

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

PLAN

Malam Shuaib Ibrahim

While bypassing B van on the right side
of my car A hit position hit car B

I/We declare the foregoing particulars are true in every respect.


 16.03.2018
 Policyholder's Signature
 Date & Time: 11:15

Driver's Signature
(If driver is not the policyholder)
Date & Time:


Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:



redefining / insurance

AXA Insurance Pte Ltd
 1800 880 4888 (Within Singapore)
 (65) 6880 4888 (International)
 (65) 6880 4740
 customer.care@axa.com.sg
 www.axa.com.sg

Certificate of Insurance

account number
 10837

Motor Vehicles (Third-Party Risks and Compensation) Act, (Chapter 189) - Motor Vehicles (Third-Party Risks and Compensation) Rules, 1960 - Road Transport Act, 1987 (Malaysia)
 Motor Vehicles (Third-Party Risks) Rules, 1959 (Malaysia)

Policy details

Policyholder name	AMIRKHAMIAN NATALIA	Certificate number	GA333037 / 1
Cover	Comprehensive	Chassis number	WMWXS120202E79666
Plan name	Flexi	Engine number	F123H411B38A12A
NCD applicable	0%		
Vehicle registration number	SLL2162Y		
Period of Insurance	from 12/03/2018 to 11/03/2019 (both dates inclusive)		
Finance loan company	Nil		

Persons or classes of persons entitled to drive*

- (a) The Policyholder
 (b) Any person who is driving on the Policyholder's order or with their permission

Provided that the person driving is permitted in accordance with the licensing or other laws or regulations to drive the Motor Vehicle or has been so permitted and is not disqualified by order of a Court of Law or by reason of any enactment or regulation in that behalf from driving the Motor Vehicle.

Limitation as to use*

Use only for social, domestic and pleasure purposes and for the Policyholder's business.

The policy does not cover - use for hire or reward, racing, pace-making, reliability trial, speed testing, the carriage of goods other than samples in connection with any trade or business or use for any purpose in connection with motor trade; or when the Motor Car, whether stationary, in use or otherwise, is in or on, a racing track, circuit, route, course or any other roads by whatever name called that are typically used for racing, pace-making or such similar purposes.

* Limitations rendered inoperative by Section 8 of the Motor Vehicles (Third-Party Risks and Compensation) Act, (Chapter 189) and Section 95 of the Road Transport Act, 1987 (Malaysia), are not to be included under these headings.

EXCESS	Basic Own Damage Excess	SGD 700.00
	Windscreen Excess	SGD 100.00

An Additional Excess is applicable as follows:

1. S\$500 for unnamed *Authorised Driver*
2. S\$500 for declared *Young and Inexperienced Driver*
3. S\$5,000 for undecleared *Young and Inexperienced Drivers*. This additional excess is reduced to S\$2,500 if you have chosen AXA Premium Workshops.

Additional clauses & endorsements to your policy

Nil

I/We hereby certify that the policy to which this Certificate relates is issued in accordance with the provision of the Motor Vehicles (Third-Party Risks and Compensation) Act, (Chapter 189) and Part IV of the Road Transport Act, 1987 (Malaysia).

AXA Insurance Pte Ltd

Authorised signature

Important note

Policyholders are warned that on the sale of a motor vehicle they must surrender the Certificate of Insurance and the Policy to the insurance company. If the Certificate of Insurance has been lost or destroyed a Statutory Declaration to that effect must be made. Failure to comply with this obligation is an offence under the Motor Vehicle (Third-Party Risks and Compensation) Act (Cap. 189).

The Premium Warranty Clause requires the premium to be paid in full within a specific period failing which there would be no liability under the policy, renewal certificate, endorsement, etc.

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Foreign Identification Number
Owner ID:	8149T
Vehicle Details	
Vehicle No.:	SLL2162Y
Vehicle to be Exported:	No
Intended De-registration Date:	20 Mar 2018
Vehicle Make:	MINI
Vehicle Model:	ONE 5DR HB 1.2 A/T D/AB ABS DSC
Primary Colour:	Red
Manufacturing Year:	2017
Engine No.:	F123H411B38A12A
Chassis No.:	WMWXS120202E79666
Maximum Power Output:	75.0 kW (100 bhp)
Open Market Value:	\$21,880.00
Original Registration Date:	17 Feb 2017
First Registration Date:	17 Feb 2017
Transfer Count:	1
Actual ARF Paid:	\$12,632.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	16 Feb 2027
PARF Rebate Amount:	\$9,474.00
Intended COE Rebate Details	
COE Expiry Date:	16 Feb 2027
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$48,401.00
COE Rebate Amount:	\$43,127.00
Total Rebate Amount:	\$52,601.00

The information contained herein is correct as at 20 Mar 2018

OK

Enquire PARF/COE Rebate for Registered Vehicle**Vehicle Owner Particulars**

Owner ID Type:

Owner ID:

Foreign Identification Number

8149T

Vehicle Details

Vehicle No.:

SLL2162Y

Vehicle to be Exported:

Yes

Intended De-registration Date:

19 Mar 2018

Vehicle Make:

MINI

Vehicle Model:

ONE 5DR HB 1.2 A/T D/AB ABS DSC

Primary Colour:

Red

Manufacturing Year:

2017

Engine No.:

F123H411B38A12A

Chassis No.:

WMWXS120202E79666

Maximum Power Output:

75.0 kW (100 bhp)

Open Market Value:

\$21,880.00

Original Registration Date:

17 Feb 2017

First Registration Date:

17 Feb 2017

Transfer Count:

1

Actual ARF Paid:

\$12,632.00

Intended PARF Rebate Details

PARF Eligibility:

Yes

PARF Eligibility Expiry Date:

16 Feb 2027

PARF Rebate Amount:

\$9,474.00

Intended COE Rebate Details

COE Expiry Date:

16 Feb 2027

COE Category:

A - Car up to 1600cc & 97kW (130bhp)

COE Period(Years):

10

QP Paid:

\$48,401.00

COE Rebate Amount:

\$38,720.00

Total Rebate Amount:**\$48,194.00**

The information contained herein is correct as at 19 Mar 2018

OK

Employer of
CATERPI

Name
AMIRKHANIAN NATALIA
Occupation
PRODUCT CONSULTANT

FIN G3428149T	Date of Application 09-11-2017
	Date of Issue 31-01-2018
	Date of Expiry 31-01-2020



L8595084



VISIT PASS
Immigration Regulations

Name

AMIR KHANIAN NATALIA



Date of Birth	Sex	Nationality
08-04-1975	F	RUSSIAN
FIN	Date of Issue	Date of Expiry
G3428149T	31-01-2018	31-01-2020

MULTIPLE JOURNEY VISA ISSUED

YOU ARE TO SURRENDER THIS CARD WHEN IT IS CANCELLED OR HAS EXPIRED, OR WHEN A NEW CARD IS ISSUED TO YOU.



A	07.12.2004	12.12.2024	AS
A1	12.12.2014		
B			
B1			
C			
C1			
D			
D1			
BE			
CE			
C1E			
DE			
D1E			
M			
Tm			
Tb			

с 2004 г. 77ххх171871.

77 21 527558

РОССИЙСКАЯ ФЕДЕРАЦИЯ
(РОССИЯ)



МЕЖДУНАРОДНОЕ
АВТОМОБИЛЬНОЕ ДВИЖЕНИЕ

МЕЖДУНАРОДНОЕ
ВОДИТЕЛЬСКОЕ УДОСТОВЕРЕНИЕ
99 DD 026101

INTERNATIONAL DRIVING PERMIT

Конвенция о дорожном движении от 8 ноября 1968 года
Convention on Road Traffic of 8 November 1968

Действительно до 09.01.2021
Valid until

Выдано STATE ROAD TRAFFIC SAFETY INSPECTOR
Issued by

MOSKVA

at

Дата 09.01.2018
Date

Номер национального
водительского удостоверения

77 21 527558
Number of domestic driving permit



(подпись должностного лица)

1. AMIRKHANIAN

2. NATALIA

3. MOSKVA

4. 08.04.1975

5. MOSKVA, RUSSIA

CACHET	CACHET
A X	A1 X
B	B1
C X	C1 X
D X	D1 X
BE X	
CE X	C1E X
DE X	D1E X

EXCLUSIONS

Le titulaire est privé du droit
de conduire sur le territoire de

Jusqu'au

Le



Signature du titulaire



EUROKARS HABITAT PTE LTD
NO:12 SUNGEI KADUT, SINGAPORE 729648
ESTIMATE COST OF REPAIRS



AXA INSURANCE PTE LTD		NAME :	MS AMIRKHANIAN NATALIA	WIP :	17351
8 SHENTON WAY		ADDRESS :	27 KEPPEL BAY VIEW	EXCESS :	
#24-01 AXA TOWER			#09-80	DATE:	19-Mar-18
SINGAPORE 068811			SINGAPORE 098416		
ATTN. :	MOTOR CLAIMS	TEL :	98658880		
FAX :					
VEH NO :	SLL2162Y	DATE IN :		CONTACT PERSON :	JOBI THOMAS 6360 2446
CHASSIS NO :	WMWXS120202E79666	MILEAGE :		TYPE OF CLAIM :	OWN DAMAGE CLAIM
MODEL :	MINI COOPER F55	DATE REG.:	17-Feb-17	POLICY NO. :	

NATURE OF WORKS

S/NO	Parts Description		QTY	REVISED	PRICES
1	WING MIRROR COVER LH	✓ cut	1		\$ 91.19
2	WING MIRROR HOUSING LH	✓ cut	1		\$ 663.94
3	WING MIRROR MOTOR LH	✓ DMG (3)	1		\$ 434.63
4	WING MIRROR GLASS LH	✓ CRK	1		\$ 216.56
5	FRONT QUARTER GARNISH LH	✓ CRK	1		\$ 29.69
6	FRONT DOOR CHROME OUTER LH	✓ SCR	1		\$ 87.81
7	REAR DOOR HANDLE LH	✓ SCR	1		\$ 130.81
8	FRONT WHEEL ARCH LH	✓ SCR	1		\$ 165.44
9	REAR DOOR ARCH LH	✓ SCR	1		\$ 88.06
10	REAR WHEEL ARCH LH	✓ SCR	1		\$ 99.25
11	WHEEL ARCHCLIP	✓ N/C	8		\$ 12.48
12	FRONT DOOR GLASS LH	✓ SCR	1		\$ 157.13
13	FRONT DOOR HANDLE LH	✓ SCR	1		\$ 134.12
	TOTAL PARTS				\$ 2,311.11
					\$ -
	TOTAL PARTS COST				\$ 2,311.11
	Labour Description				
					2520 ✓
1	TO REPLACE WING MIRROR ASSY LH. TO REPAIR ALL REAR FENDER LH, FRONT DOOR LH AND FRONT FENDER LH AREAS AFFECTED BY THE ACCIDENT.				\$ 2,700.00
		840/day			
2	TO RESPRAY REAR FENDER LH, REAR DOOR LH, FRONT DOOR LH, FRONT FENDER LH AND WING MIRROR COVER LH.				\$ 3,800.00
		800/panel			3600 ✓
3	TO CARRY-OUT BODY CAVITY PRESERVATION.				\$ 150 250.00
4	TO REMOVE & REFIT CARPET & TRIMS ON THE REAR LH SECTION TO GIVE WAY TO THE REPAIR ON THE REAR LH SECTION.				\$ 1,000.00
					840 ✓
5	TO REPLACE THE FRONT DOOR GLASS LH.			NETT	\$ 560.00 ✓
6	TO SUPPLY SOLAR FLIM ON THE FRONT DOOR GLASS LH.			NETT	\$ 280.00 ✓

7	TO CHECK STEERING GEOMETRY & CONDUCT FULL WHEEL ALIGNMENT.	NETT	\$ 560.00
8	TO CHECK ELECTRICAL SYSTEM FOR PROPER FUNCTIONING.		\$ 250.00
9	TO REPROGRAMME AFTER THE ACCIDENT REPAIR WORKS.		\$ 350.00
10	SUNDRIES.	NETT	\$ 100.00
			\$ 50
		TOTAL LABOUR	\$ - \$ 9,850.00
		TOTAL PARTS	\$ - \$ 2,311.11
		TOTAL	\$ - \$ 12,161.11
		LESS EXCESS	\$ - \$ -
		TOTAL AFTER EXCESS	\$ - \$ -
		GST 7%	\$ - \$ -
		GRAND TOTAL	\$ - \$ -

REMARKS:

THIS IS ONLY AN ESTIMATE FROM VISUAL INSPECTION AND SHOULD THERE BE MORE DAMAGES FOUND DURING THE PROCESS OF REPAIRING, YOU WILL BE INFORMED BEFORE THE REPAIRS ARE BEING CARRIED OUT.

TAKE NOTE THAT SHOULD YOU DECIDE NOT TO PROCEED WITH THE REPAIRS, A QUOTATION FEE OF \$400.00 WILL BE APPLY AS ACCORDINGLY FOR MAN-HOURS INVOLVED IN SOURCING FOR PARTS PRICE AS WELL AS LABOUR CHARGES.

Sebastian
17/3/18.
- Part by part repair -
- Photo Before & After Paint.
- Excess: \$700.
- Revert

[Signature]
20/3/18

8 days.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

90036121
sebastianyeang@lkkauto.com



EUROKARS HABITAT PTE LTD
NO:12 SUNGEI KADUT, SINGAPORE 729648
FINALIZATION COST OF REPAIRS



AXA INSURANCE PTE LTD		NAME : MS AMIRKHANIAN NATALIA		WIP : 17351	
8 SHENTON WAY		ADDRESS : 27 KEPPEL BAY VIEW		EXCESS :	
#24-01 AXA TOWER		#09-80		DATE: 19-Mar-18	
SINGAPORE 068811		SINGAPORE 098416			
ATTN : MOTOR CLAIMS		TEL : 98658880			
FAX :					
VEH NO :	SLL2162Y	DATE IN :		CONTACT PERSON :	JOBI THOMAS 6360 2446
CHASSIS NO :	WMWXS120202E79666	MILEAGE :		TYPE OF CLAIM :	OWN DAMAGE CLAIM
MODEL :	MINI COOPER F55	DATE REG.:	17-Feb-17	POLICY NO. :	

NATURE OF WORKS

S/NO	Parts Description			REVISED	PRICES
	QTY				
1	WING MIRROR COVER LH ✓ 2nd	1	M51.16.7.401.231	\$ 91.19	\$ 91.19
2	WING MIRROR HOUSING LH ✓ 2nd	1	M51.16.7.401.095	\$ 663.94	\$ 663.94
3	WING MIRROR MOTOR LH ✓ Dmg	1	B67.13.7.337.847	\$ 434.63	\$ 434.63
4	WING MIRROR GLASS LH ✓ EXH	1	M51.16.7.366.041	\$ 216.56	\$ 216.56
5	FRONT QUARTER GARNISH LH ✓ CRK	1	M51.47.7.322.509	\$ 29.69	\$ 29.69
6	FRONT DOOR CHROME OUTER LH ✓ SCR	1	M51.33.7.322.513	\$ 87.81	\$ 87.81
7	REAR DOOR HANDLE LH ✓ SCR	1	M51.21.7.327.339	\$ 130.81	\$ 130.81
8	FRONT WHEEL ARCH LH ✓ SCR	1	M51.77.7.300.819	\$ 165.44	\$ 165.44
9	REAR DOOR ARCH LH ✓ SCR	1	M51.77.7.329.031	\$ 88.06	\$ 88.06
10	REAR WHEEL ARCH LH ✓ SCR	1	M51.77.7.318.829	\$ 99.25	\$ 99.25
11	WHEEL ARCHCLIP ✓ N/A	8	M07.14.2.754.954	\$ 12.48	\$ 12.48
12	FRONT DOOR GLASS LH ✓ SCR	1	M51.33.7.320.285	\$ 157.13	\$ 157.13
13	FRONT DOOR HANDLE LH ✓ SCR	1	M51.21.7.317.634	\$ 134.12	\$ 134.12
TOTAL PARTS				\$ 2,311.11	\$ 2,311.11
TOTAL PARTS COST				\$ 2,311.11	\$ 2,311.11
Labour Description					
1	TO REPLACE WING MIRROR ASSY LH. TO REPAIR ALL REAR FENDER LH, FRONT DOOR LH AND FRONT FENDER LH AREAS AFFECTED BY THE ACCIDENT.			\$ 2,520.00	\$ 2,700.00
2	TO RESPRAY REAR FENDER LH, REAR DOOR LH, FRONT DOOR LH, FRONT FENDER LH AND WING MIRROR COVER LH.			\$ 3,600.00	\$ 3,800.00
3	TO CARRY-OUT BODY CAVITY PRESERVATION.			\$ 150.00	\$ 250.00
4	TO REMOVE & REFIT CARPET & TRIMS ON THE REAR LH SECTION TO GIVE WAY TO THE REPAIR ON THE REAR LH SECTION.			\$ 840.00	\$ 1,000.00
5	TO REPLACE THE FRONT DOOR GLASS LH.			\$ 560.00	\$ 560.00
6	TO SUPPLY SOLAR FLIM ON THE FRONT DOOR GLASS LH.			\$ 280.00	\$ 280.00
7	TO CHECK STEERING GEOMETRY & CONDUCT FULL WHEEL ALIGNMENT.			\$ -	\$ 560.00

8	TO CHECK ELECTRICAL SYSTEM FOR PROPER FUNCTIONING.	\$ 180.00	\$ 250.00
9	TO REPROGRAMME AFTER THE ACCIDENT REPAIR WORKS.	\$ 280.00	\$ 350.00
10	SUNDRIES.	\$ 50.00	\$ 100.00
TOTAL LABOUR		\$ 8,460.00	\$ 9,850.00
TOTAL PARTS		\$ 2,311.11	\$ 2,311.11
TOTAL		\$ 10,771.11	\$ 12,161.11
LESS EXCESS		\$ 700.00	\$ -
TOTAL AFTER EXCESS		\$ 10,071.11	
GST 7%		\$ 704.98	\$ -
GRAND TOTAL		\$ 10,776.09	\$ -

NUMBER OF DAYS: 8 WORKING DAYS(EXCLUDE WAITING FOR SURVEY,AUTHORIZATION,PARTS,SAT,SUN & PH)

Sebastian
17/5/18

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Eurokars Habitat Pte Ltd

Distributor of MINI Vehicles and Parts

27 Leng Kee Road Singapore 159098
Tel: (+65) 6473 3777 Fax: (+65) 6473 0500**AXA INSURANCE PTE LTD**8 Shenton Way
#24-01 AXA Tower
Singapore 068811**ATTN : MOTOR CLAIMS DEPARTMENT**

DATE: 21/05/2018

Car Regn No : **SLL2162Y****Accident involving SLL2162Y & GBC3095S on 12/03/2018****Own Damage Claim**

Dear Sirs

The repairs have been completed for **SLL2162Y**. We submit the following documents for
your perusal :

- | | |
|---------------------------------------|---------------------|
| 1) Invoice No : 13325492 | \$ 10,776.09 |
| 2) Discharge voucher signed by client | |

TOTAL	\$ 10,776.09
--------------	---------------------

Please pay **Eurokars Habitat Pte Ltd** the sum of **\$10,776.09** as soon as possible and mail
your cheque to **12 Sungei Kadut Avenue Singapore 729648.**

Yours faithfully,


Stanley Ngu**Manager - Body & Paint Division**

DID: 63602845

FAX: 63602899

e-mail: stanley@eurokars.com.sg

Eurokars Habitat Pte Ltd

Distributor of MINI Vehicles and Parts

27 Leng Kee Road Singapore 159098

Tel: (+65) 6473 3777 Fax: (+65) 6473 0500



*P

TAX INVOICE

GST Reg No: M90364005A

CODE: A0030
CUSTOMER: AXA Insurance Pte Ltd
ADDRESS: 8, Shenton Way
#24-01 AXA Tower
Singapore 068811

Singapore
TEL NO: 6880 4888
MODEL: MINI One 5DR Hatch
CHASSIS NO: WMWXS120202E79666
ENGINE NO: F123H411B38A12A
DESCRIPTION: Body repair

PAGE NO: 4
DOCUMENT NO: 13325492
DATE IN: 24/04/2018
DATE PRINTED: 17/05/2018
JOB NO: 17351
PRINTED BY: Phipps Sarah Ca
EXT. WTY:
REGN NO: SIL2162Y
REGN DATE: 17/02/2017
MILEAGE: 15982
SERVICE ADV: Phipps Sarah Ca
REQUISITION NO:

Item	Description	Unit	U/Price	Disc%	Con%	Amount
51.33.7.320.285	Door window,	1.0	157.13	0.00		157.13
51.21.7.327.339	Door handle,	1.0	134.12	0.00		134.12
18	Excess Element of Insurance Repair paid by insured party	700.00	1.00	0.00		-700.00

Parts 2,311.11
Surcharge 0.00
Labour 8,180.00
Menus 280.00

Net 10071.11
G.S.T. 7% 704.98
Total 10776.09
Paid 0.00
Amount Due 10776.09

Note: MINI car that are found with non-approved tuning or conversion installed are not subject to MINI Warranty and the warranty of the car will be void accordingly.

Customer's Signature

Authorized Signature

GST REGN. NO. M90364005A
CO. REGN. NO. 199806095Z
ID: M05

Eurokars Habitat Pte Ltd

Distributor of MINI Vehicles and Parts

27 Leng Kee Road Singapore 159098

Tel: (+65) 6473 3777 Fax: (+65) 6473 0500



TAX INVOICE

GST Reg No: M90364005A

PAGE NO: 1
DOCUMENT NO: 13325492
DATE IN: 24/04/2018
DATE PRINTED: 17/05/2018
JOB NO: 17351

PRINTED BY: Phipps Sarah Can
EXT. WTY:

REGN NO: SIL2162Y
REGN DATE: 17/02/2017
MILEAGE: 15982

SERVICE ADV: Phipps Sarah Can
REQUISITION NO:

CODE: A0030
CUSTOMER: AXA Insurance Pte Ltd
ADDRESS: 8, Shenton Way
#24-01 AXA Tower
Singapore 068811

TEL NO: Singapore
6880 4888
MODEL: MINI One 5DR Hatch
CHASSIS NO: WMWXS120202E79666
ENGINE NO: F123H411B38A12A
DESCRIPTION: Body repair

Item	Description	Unit	U/Price	Disc%	Con%	Amount
01	INS CLAIM:OD CLAIM DATE OF ACCIDENT:12.03.2018 VEHICLE DATE IN:24.04.2018 VEHICLE DATE OUT:03.05.2018 SURVEYED BY/ON:SEBASTIAN/19.03.2018 AUTHORISED BY/ON:SHIAU CHAN/20.03.2018	0.00	0.00	0.00		0.00
02	EXCESS:SGD700.00 CUSTOMER NAME: AMIRKHANIAN NATALIE CUSTOMER'S CONTACT:98658880	0.00	0.00	0.00		0.00
03	To Replace LH Wing Mirror Assembly. To Repair LHR Fender, LHF Door & LHF Fender. To Repair All Areas Affected By The Accident	2520.00	1.00	0.00		2520.00
04	To Respray LHR Fender,	3600.00	1.00	0.00		3600.00

Eurokars Habitat Pte Ltd

Distributor of MINI Vehicles and Parts

27 Leng Kee Road Singapore 159098

Tel: (+65) 6473 3777 Fax: (+65) 6473 0500



•P

TAX INVOICE

GST Reg No:M90364005A

CODE: A0030
CUSTOMER: AXA Insurance Pte Ltd
ADDRESS: 8, Shenton Way
#24-01 AXA Tower
Singapore 068811
Singapore
TEL NO: 6880 4888
MODEL: MINI One SDR Hatch
CHASSIS NO: WMWXS120202E79666
ENGINE NO: F123H411B39A12A
DESCRIPTION: Body repair

PAGE NO: 2
DOCUMENT NO: 13325492
DATE IN: 24/04/2018
DATE PRINTED: 17/05/2018
JOB NO: 17351
PRINTED BY: Phipps Sarah Ca
EXT. WTY:
REGN NO: SIL2162Y
REGN DATE: 17/02/2017
MILEAGE: 15982
SERVICE ADV: Phipps Sarah Ca
REQUISITION NO:

Item	Description	Unit	U/Price	Disc%	Con%	Amount
	LHR Door, LHF Door, LHF Fender & LH Wing Mirror Cover					
05	To Carry Out Body Cavity Preservation	150.00	1.00	0.00		150.00
06	To Remove & Refit Carpet & Trims On The LHR Section To Give Way To The Repair on The LHR Section	840.00	1.00	0.00		840.00
07	To Replace LHF Door Glass	560.00	1.00	0.00		560.00
08	To Supply Solar Film On The LHF Door Glass	280.00	1.00	0.00		280.00
09	To Check Electrical System	180.00	1.00	0.00		180.00

GST REGN. NO. M90364005A

CO. REGN. NO. 199806095Z

Eurokars Habitat Pte Ltd

Distributor of MINI Vehicles and Parts

27 Leng Kee Road Singapore 159098

Tel: (+65) 6473 3777 Fax: (+65) 6473 0500



*P

TAX INVOICE

GST Reg No: M90364005A

CODE: A0030
CUSTOMER: AXA Insurance Pte Ltd
ADDRESS: 8, Shenton Way
#24-01 AXA Tower
Singapore 068811

Singapore
TEL NO: 6880 4888
MODEL: MINI One 5DR Hatch
CHASSIS NO: WMWXS120202E79666
ENGINE NO: F123H411B38A12A
DESCRIPTION: Body repair

PAGE NO: 3
DOCUMENT NO: 13325492
DATE IN: 24/04/2018
DATE PRINTED: 17/05/2018
JOB NO: 17351
PRINTED BY: Phipps Sarah Ca
EXT. WTY:
REGN NO: SIL2162Y
REGN DATE: 17/02/2017
MILEAGE: 15982
SERVICE ADV: Phipps Sarah Ca
REQUISITION NO:

Item	Description	Unit	U/Price	Disc%	Con%	Amount
10	For Proper Function To Conduct Reprogramming After Acci	0.00	1.00	0.00		280.00
1XS21001220	To Conduct Reprogramming After Accident Repairs					
11	Sundries	50.00	1.00	0.00		50.00
51.16.7.401.231	Cover for mi	1.0	91.19	0.00		91.19
51.16.7.401.095	Exterior mir	1.0	663.94	0.00		663.94
67.13.7.337.847	Drive, outsi	1.0	434.63	0.00		434.63
51.16.7.366.041	Mirror glas	1.0	216.56	0.00		216.56
51.47.7.322.509	End cover, d	1.0	29.69	0.00		29.69
51.33.7.322.513	Decorative s	1.0	87.81	0.00		87.81
51.21.7.327.339	Door handle,	1.0	130.81	0.00		130.81
51.77.7.300.819	Cover, wheel	1.0	165.44	0.00		165.44
51.77.7.329.031	Trim cover,	1.0	88.06	0.00		88.06
51.77.7.318.829	Cover, wheel	1.0	99.25	0.00		99.25
07.14.2.754.954	Clip	8.0	1.56	0.00		12.48

GST REGN. NO. M90364005A

CO. REGN. NO. 199806095Z



DISCHARGE VOUCHER

I / We hereby acknowledge having received from the under-mentioned
repairers my/our vehicle No: SLL2162Y which has been
repaired to my satisfaction and I/we admit that the payment for such
repairs by Eurokars Habitat Pte Ltd is in full and final discharge of my claim
under policy number: GIA333037/1 in respect of damage
caused to the said vehicle as a result of an accident that occurred on
12/03/18 at Jalam Ahmad Ibrahim.

Witnessed by Repairers

03/05/18

Date

Signature by Insured

03/05/18

Date

SERVICE REQUESTS MESSAGES CLAIMS

<< Service Request Details

Claim	S8M00ARJ	Vehicle Information	
Reference		Incident Vehicle	SLL2162Y
None 	Loss Date	Registration #	Service Address
March 12, 2018	Request Date	Model	MINI ONE 1.2
March 16, 2018	Due Date		Sungei Kadut Avenue, ...
June 16, 2018	Vendor Name		729648
LKK AUTO CONSULTANTS PTE LTD (OD)	Type of Loss	Primary Contact/Insured	
Own Damage	Services	AMIRKHANIAN NATALIA 27 KEPPEL BAY VIEW, #09-80, 098416, Singapore MOTOR.OPERATIONS@GNM.COM.SG	

Actions

Next Step

Finish the work

Complete Work

More

NAME	TYPE	SUB-TYPE	AUTHOR	DATE UPLOADED
SLL2162Y Inspection Photo.pdf	Evidence	Photos	LKK AUTO CONSULTANTS PTE LTD (OD)	May 18, 2018
SLL2162Y Resurvey Photo.pdf	Evidence	Photos	LKK AUTO CONSULTANTS PTE LTD (OD)	May 18, 2018
SLL2162Y IA.pdf	Reports & Statement	Others	LKK AUTO CONSULTANTS PTE LTD (OD)	March 20, 2018
SLL2162Y ESTIMATE.pdf	Reports & Statement	Estimate / Quotation	LKK AUTO CONSULTANTS PTE LTD (OD)	March 20, 2018
EMAIL FROM WORKSHOP OD PRI.msg	Letters and Correspondence	Workshop	VISHNU BATHAM Shekhar	March 16, 2018
GIA REPORT OF GBC3095S (TP).pdf	Reports & Statement	GIA Report	KADRI Mateen	March 14, 2018

Service Request Details

Claim	S8M00ARJ
Reference	
None	Loss Date
March 12, 2018	Request Date
March 16, 2018	Due Date
June 16, 2018	Vendor Name
LKK AUTO CONSULTANTS PTE Loss LTD (OD)	Type of
Own Damage	Services

Next Step

Finish the work

Complete Work

More

Vehicle Information

Incident Vehicle Registration #

SLL2162Y

Service Address

MINI ONE 1.2

729648

Sungei Kadut Avenue, , ,

Primary Contact/Insured

AMIRKHANIAN NATALIA

27 KEPPEL BAY VIEW, #09-80,

098416, Singapore

MOTOR.OPERATIONS@GNM.COM.SG



SERVICE REQUESTS

MESSAGES

CLAIMS



Assessment Details

General & Workshop Details

Vehicle & Driver Details

Vehicle Condition

Taxes & Ratio

Parts & Labour

Miscellaneous

Summary

General Details

Involving

1 2017 MINI ONE 1.2 (SLL2162Y)

Date of Loss

March 12, 2018

Time of Loss

15.00

Loss Description

SLL2162Y (INSD) C/W GBC30955 (TP)

Comment

Workshop Details

Total Rebate Amount

48194

Nett Loss Amount

\$49,806.00

Assigned Workshop

LKK AUTO CONSULTANTS PTE LTD (OD)

Target Date of Completion *

03/23/2018



Days of work completion *

7



SERVICE REQUESTS

MESSAGES

CLAIMS

English (default)

LKK AUTO CONSULTANTS PTE LTD (OD)

Assessment Details

General & Workshop Details

Vehicle & Driver Details

Vehicle Condition

Taxes & Ratio

Parts & Labour

Miscellaneous

Summary

Vehicle & Driver Details

Vehicle Registration#

SLL2162Y

Registration State

SINGAPORE

Purchase Date

mm/dd/yyyy

Registration Date *

02/17/2017

Mileage

14740

Age of Vehicle

1

CATEGORY

Manufacturing Year

POLICY INFORMAT... 2017

CATEGORY

Driver Name

ASSESSMENT INFO... 2017

FNOL INFORMATI...

POST SURVEY INF...

ASSESSMENT INFO... WMWXS120202E79666

FNOL INFORMATI... POST SURVEY INF...

CATEGORY Engine No
POLICY INFORMAT... F123H411B38A12A
ASSESSMENT INFO... F123H411B38A12A

CATEGORY License Type
FNOL INFORMATI...
POST SURVEY INF...

CATEGORY Engine Capacity
POLICY INFORMAT...
ASSESSMENT INFO... 1198 cc

CATEGORY License Issue Date
FNOL INFORMATI...
POST SURVEY INF... mm/dd/yyyy

CATEGORY Sum Insured
POLICY INFORMAT... 0
ASSESSMENT INFO... 0

CATEGORY License Expiration Date
FNOL INFORMATI...
POST SURVEY INF... mm/dd/yyyy

CATEGORY Market Value
POLICY INFORMAT... 0
ASSESSMENT INFO... 98000

CATEGORY Address
FNOL INFORMATI...
POST SURVEY INF...

CATEGORY Address type

-  SERVICE REQUESTS
- MESSAGES
- CLAIMS

Assessment Details

- General & Workshop Details
- Vehicle & Driver Details
- Vehicle Condition
- Taxes & Ratio
- Parts & Labour
- Miscellaneous
- Summary

Front left side

GOODYEAR 7mm

Front right side

GOODYEAR 7mm

Rear left side

GOODYEAR 7mm

Rear right side

GOODYEAR 7mm

SERVICE REQUESTS MESSAGES CLAIMS

Assessment Details

General & Workshop Details										Vehicle & Driver Details				Vehicle Condition				Taxes & Ratio				Parts & Labour				Miscellaneous				Summary				Parts			
Add		Approve		Deny		EDIT		SR NO	QUAN TITY	MATERIAL	SIDE	PART NAME	PART NUMBER	REPAIR/REPLACE (PARTS)	CONDITION	LIST PRICE	DEPR/L BTTR%	DISC OUNT%	SALV AGE%	PART PRICE(NET)	ACTIO (PART																
				1	1			WING MIRROR COVER LH				WING MIRROR COVER LH			Cut	91.19				91.19	Revie																
				2	1			WING MIRROR HOUSING LH				WING MIRROR HOUSING LH			Cut	663.94				663.94	Revie																
				3	1			WING MIRROR MOTOR LH				WING MIRROR MOTOR LH			Damaged	434.63				434.63	Revie																
				4	1			WING MIRROR GLASS LH				WING MIRROR GLASS LH			Cracked	216.56				216.56	Revie																
				5	1			FRONT QUARTER GARNISH LH				FRONT QUARTER GARNISH LH			Cracked	29.69				29.69	Revie																
				6	1			FRONT DOOR CHROME OUTER LH				FRONT DOOR CHROME OUTER LH			Damaged	87.81				87.81	Revie																
				7	1			REAR DOOR HANDLE LH				REAR DOOR HANDLE LH			Damaged	130.81				130.81	Revie																

Claim Portal		Claim Portal							F	
EDIT	SR NO	REPAIR/REPLACE (LABOUR)	PART NAME	LABOUR RER	LABOUR REPAIR	PAINT	ACTION (LABOUR)	COMMENT		
	5		TO REPLACE THE FRONT DOOR GLASS LH.	560	0	0	Reviewing			
	6		TO CHECK STEERING GEOMETRY & CONDUCT FULL WHEEL ALIGNMENT.	0	0	0	Reviewing			
	7		TO CHECK ELECTRICAL SYSTEM FOR PROPER FUNCTIONING.	180	0	0	Reviewing			
	8		TO REPROGRAMME AFTER THE ACCIDENT REPAIR WORKS.	280	0	0	Reviewing			

SERVICE REQUESTS

MESSAGES

CLAIMS

<< Assessment Details

General & Workshop Details

Vehicle & Driver Details

Vehicle Condition

Taxes & Ratio

Parts & Labour

Miscellaneous

Summary

Add

Approve

Deny

EDIT	SR NO	NAME	ACTION	AMOUNT	COMMENT	REMOVE
☐	1	DAYS OF REPAIR	Reviewing	8		
☐	2	SOLAR FILM ON THE FRONT DOOR GLASS LH	Reviewing	280	NECESSARY	
☐	3	SUNDRIES	Reviewing	50	NECESSARY	

SERVICE REQUESTS MESSAGES CLAIMS

<< **Assessment Details**

General & Workshop Details	Vehicle & Driver Details	Vehicle Condition	Taxes & Ratio	Parts & Labour	Miscellaneous
Summary	Claim Amount	\$10,071.11	Claim Amount	\$10,071.11	

CATEGORY	ESTIMATE	REVISED AMOUNT
----------	----------	----------------

Labour	\$8,130.00	\$8,130.00
--------	------------	------------

Miscellaneous	\$330.00	\$330.00
---------------	----------	----------

Excess	-\$700.00	-\$700.00
--------	-----------	-----------

Submit for Review