


SMRT Accident Vehicle Repair Estimates

Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHB1052M
Ref. No : TAX/03/18/2150
Reg. Date : 15/11/2013
Vehicle Type : TAXI
Make : TOYOTA PRIUS
Model : PRIUS
Name of Driver : NOOR RAMLI BIN MD NOR
Type of Accident : SIDE SWIPE
Date / Time of Accident : 31/03/2018 09:50:00 PM
Accident Reported Date / Time : 02/04/2018 12:00:00 AM
Surveyor is Required? : Yes
Survey by :
Vehicle is Towed Back? : No
Towed Back Date/Time :
Replacement Vehicle issued? : No
Accident Repair Job Card No : 000024095329
Special Instruction to ARC,if any :
SJV6809K - LONPAC
Prepared Date : 02/04/2018 05:16:48 PM

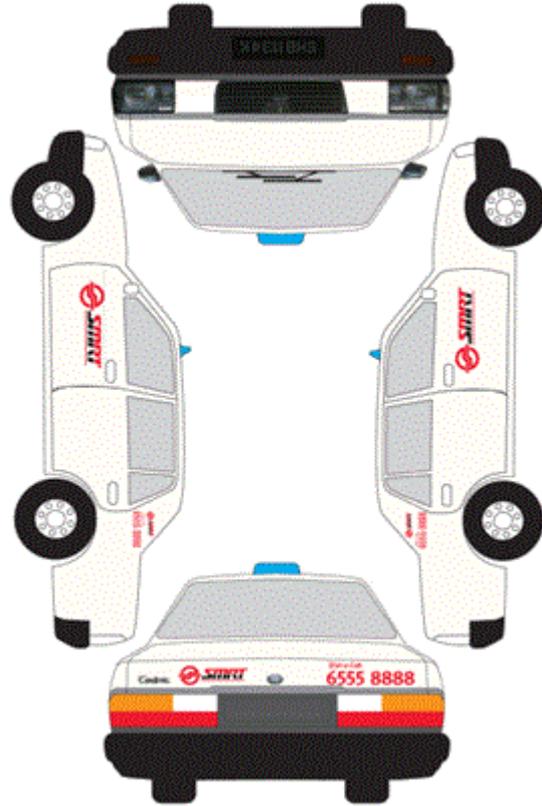

Section B - To be Completed by Service Advisor, Accident Repair Centre

Chassis No : JTDKN36U50-5706535 Mileage : 0

Work Shop : Repair Completed Date / Time :

Summary of Repair Estimates

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges :	845.00	0.00
Total Spray Painting Charges :	936.00	0.00
Total Material Charges :	2,017.42	2,017.42
Other Charges :	600.00	0.00
TOTAL :	4,398.42	0.00
Lum Sum Total :	4,400.00	0.00
No. of Repair Days :	5.00	0.00
Prepared / Adjusted By :		
Arc / Surveyor Sing Off Date :	02/04/2018 06:22:26 PM	01/01/1900 12:00:00 AM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 02/04/2018 06:20:27 PM

Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair

Quotation No : Invoice No :
Quotation Date : Invoice Date :
Invoice Amount : 0.00 Prepared Date : 4/2/2018 6:22:54 PM

Section D - Details of Repair Estimates

Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR RH REAR PORTION	845.00	0.00
Total Labour	845.00	0.00

Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY REAR BUMPER	378.00	0.00
TO RESPRAY REAR FENDER RH	378.00	0.00
TO RESPRAY RIM	180.00	0.00
Total Spray Painting & Panel Beating	936.00	0.00

Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	0.00
TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	0.00
TO TEST AND REFIX REVERSE SENSOR SYSTEM	120.00	0.00
TO WASH AND VACUUM	60.00	0.00
TO DO WHEEL ALIGNMENT / TYRE BALANCING	120.00	0.00
TO REMOVE AND REFIT TYRE RIM (SPRAYING PURPOSE)	120.00	0.00
Total Other Costs	600.00	0.00

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
52159-47905		6505548	BUMPER REAR	1	458.60	25.00	343.95	Replace	Replace	No
76087-47020		6505618	BUMPER LIP COVER RR/RH	1	118.10	25.00	88.57	Replace	Replace	No
52591-47021			BUMPER SEAL, RR RH	1	65.70	25.00	49.27	Replace	Replace	No
			PIXEL STICKER	2	60.00	0.00	120.00	Replace	Replace	No
61604-47090			FENDER RR/RH	1	766.80	25.00	575.10	Replace	Replace	No
	COMMO N		SMRT LOGO	1	7.80	0.00	7.80	Replace	Replace	No
			STICKER DECAL 65558888	1	21.60	0.00	21.60	Replace	Replace	No
		6503707	TYRE	1	126.74	0.00	126.74	Replace	Replace	No
42611-47140		6505658	WHEEL, DISC	1	1,490.20	25.00	1,117.65	Replace	Replace	No
52575-47020		6505549	BUMPER SIDE RETAINER RR/RH	1	94.80	25.00	71.10	Replace	Replace	No
TOTAL MATERIALS								2,521.79	2,521.78	
TOTAL MATERIALS(Discounted)								2,017.42	2,017.42	

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
TOTAL SUPPLEMENTARY MATERIALS									