

27/03/2002

ASS. REC. BY:

REF:

CS/FCI 18006407/8vd3/1

Special Instruction:

Surveyor:

CWS

ASSIGNMENT (Office)

From (Person):

Eileen Lee

of

FCI

Date/Time:

06/04/18 @ 4:00pm

Estimated Cost:

Bill to:

OD / TP WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SL4 7619S

Insured:

SHC 3078X

at Workshop m/s

Weames Automotive

Tel:

9129 4556

of

45 Jeng Kee Road

Policy No:

Claim No:

D18002635 MPSTH

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A.

24/03/2018

CA / REV / REP. / REV 24 HRS 'DS'

H.O.D. Endorsement

Date/Time:

4:23pm @ 6/4/18

Person Contacted:

Michelle

Vehicle IN/OUT

Date/Time	Action/Instruction (✓) Estimate
	SL4 7619S - X
	SHC 3078X - NS/INC17011599/H/Vbe2 D.O.A: 13/6/17
12/4/18	Email preli revised to FCI
13/4/18	@ 311pm Michelle will email finalise
18/4/18	Final fig \$10,242.83 confirmed by email (Red 2918-31 22/9)

REF: **FA**

ASSIGNMENT

From: _____ Date: **10-04-2018**

Estimated Cost:

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: **SLU 76195**

at Workshop m/s **Wearnes**

of **45 Leng Kee Rd**

Insured:

Policy No:

Claims No:


Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: **Michelle**

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

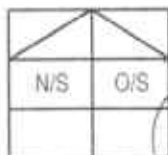

Bal. or Market Value:

IDAC Accident Report: _____ Consistent? : Yes or No

GIA / PR Seen: _____ Consistent? : Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____

Vehicle: IN / OUT

Veh No: **SLU 76175** Yr Regn: **13/12/2017**

Type: **M. Car** / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make: **Volvo** **360** c.c. **1969**

Colour: **Red** A/C: Insured / Std / NI / NA

Sp. Reading: **2777** T/Radio: Insured / Std / NI / NA

Eng/No:

C/No: **YV1F540 L0J2458592**

Gen. Cond: **Good** / Fair / Poor / Burnt

Steering: **In order** / Jammed / Leaked / Burnt or

Brake: **In order** / Jammed / Leaked / Burnt or

Modi: **NI** / S/Rim / STD A/Rim or

Tyre Size: F: **215 / 50 R17**

R: **11**

BS / DUN / EXNOVA / GY / FS / LIZA / **MIC** / OHTSU / PIR / SUMI / TOYO / YOKO or

Front:

Rear

R/Bal. **7** mm R/Bal. **7** mm

L/Bal. **7** mm L/Bal. **7** mm

D.O.A. **27/3/18** D.O.I. **10/4/18**

Survey held at **Wearnes**

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

O/S Rear

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

RECEIVED 01 AUG 2018

31/7/2018

Date/Time, File Pass to?

☐ : Preli. Report
☐ : Final Report

Days Of Repair: **4**

Resurvey No. of Trip: **1**

Survey Fee:

Transportation:

G + RS St

Photos

Others

TOTAL

Add Fee: ☐ : Site Insp (\$

☐ : Interview (\$

☐ : Tech. Invs (\$

☐ : Weekend (\$

Report Format: **CWS**

Lump Sum / I.B.I. (\$) **10,242.83**

170
50
50
56
326



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607188R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
FIRST CAPITAL INSURANCE LTD			Ref : CS/FCI18006407/Svd3	
36 ROBINSON ROAD #16-01 CITY HOUSESINGAPORE 068877			Date : 06-04-2018	
			Code : FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
Insured Veh.	SHC 3078X	Veh. Inspected	SLU 7619S	
Policy No.		Coverage (\$)	0.00	
Claim No.	D18002635MFSH	Excess (\$)	0.00	
Assign From	CWS (EILEEN LEE)	Assign Date	06/04/2018	
2. Vehicle Particulars & Condition				
Make & Model		c.c	0	
Engine No.	HIDDEN	Year of Reg.		
Chassis No.		Colour		
Odometer	-	Steering		
Brakes		Modification		
General				
3. Conditions of Tyres				
	Size	Make	Balance	
R/H Front Tyre			mm	
L/H Front Tyre			mm	
R/H Rear Tyre			mm	
L/H Rear Tyre			mm	
4. Description of Damages				
5. General Information				
Accident Date	29/03/2018	Inspection Date		
Survey held at	WEARNES AUTOMOTIVE PTE LTD 45 LENG KEE ROAD SINGAPORE 159103.			
5a. Remarks				
A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.				

Job Sheet (/ClaimWS/Surveyor/JobSheet/236594)



PRI Documents



Close



PRI Header Details

Claim No	D18002635MFSH	Policy No	D-18088936MFSH	Claimant S.No & Name	1 & WEARNES
Workshop Name	WEARNES AUTOMOTIVE PTE LTD (Contact Person : MICHELLE ONG)	Survey Location & Contact Details	45 LENG KEE ROAD Mobile: 91294556 , Phone: 0 , Fax: 62647137 EmailId: MICHELLE.ONG@WEARNES.COM		
Our Surveyor	LKK AUTO CONSULTANTS PTE LTD	Instructions To Surveyor	DIRECT SETTLEMENT:		
Insured Name	COMFORT TRANSPORTATION PTE LTD	Insured Vehicle No	SHC3078X	TP Vehicle No	SLU7619S
PRI Recieved Date	03-04-2018 05:55:02 PM	Surveyor Appointed Date	06-04-2018 03:58:59 PM	Surveyor Accept Date	06-04-2018 0

Survey Report Upload

Surveyor Inspection Date *:		Surveyor Report Date	06-04-2018	Upload Survey Report *:	Choose File
-----------------------------	----------------------	----------------------	------------	-------------------------	--

Vehicle Particulars

Make	Please Select Make	Model	Please Select Model	Year	Select Year
Chasis No		Engine No		Mileage	
Color		Cubic Capacity			

Multiple Documents Upload

Upload Multiple Documents	
File Name	Action

Surveyor Job Remarks

Remarks		Save
---------	----------------------	-------------------------------------

MOTOR SURVEY ASSIGNMENT

Date	03-04-2018	Our Ref No. D18002635MFSH
Accident Date	29-03-2018	Claim Type. Third Party
Insured Vehicle	SHC3078X	Third Party Vehicle. SLU7619S
Survey Location	45 LENG KEE ROAD	
Contact Person.	MICHELLE ONG	
Contact No.	0/ 91294556	Fax No. 62647137
Survey Type	DIRECT SETTLEMENT:	
Appointed Surveyor	LKK AUTO CONSULTANTS PTE LTD	
Contact Person	NA	Fax No. 68416315
Contact Number.	NA	

FOR DIRECT SETTLEMENT

Please submit to us the Tax Invoice together with letter of claim for Rental OR Loss of use (based on NIMA Benchmark rates) together with your survey report.

THIRD PARTY SURVEY REQUEST

Cc : Workshop	WEARNES AUTOMOTIVE PTE LTD	Attention. NIL
Cc : TP Solicitor	NA	TP Solicitor Fax No. NA
Officer Incharge	EILEEN LEE	

IMPORTANT NOTE

Kindly submit the survey report via CWS within 14 days for survey assignment and 7 days for re-inspection.
This is a computer generated letter, no signature required.

Veron Chen (LKKAUTO)

From: Veron Chen (LKKAUTO)
Sent: Thursday, 12 April 2018 3:06 PM
To: 'Claim Workflow System'
Cc: EILEENLEE@MSFIRSTCAPITAL.COM.SG; SUR
Subject: RE: SURVEY ASSESSMENT - D18002635MFSH/1, SLU 7619S
Attachments: SLU 7619S PRELI ADVISED.pdf

Dear Sir/Madam,

Enclosed preliminary revised of vehicle SLU 7619S
Date of survey: 10/4/2018
Number of days:4 days

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Admin-D (LKKAUTO)
Sent: Friday, 6 April 2018 4:27 PM
To: 'Claim Workflow System' <cwsmotorclaims@msfirstcapital.com.sg>; assignments <assignments@lkkauto.com>
Cc: EILEENLEE@MSFIRSTCAPITAL.COM.SG; SUR <sur@lkkauto.com>
Subject: RE: SURVEY ASSESSMENT - D18002635MFSH/1

Dear Sir/Mdm,

Thank you for the assignment.

Please be informed vehicle not in workshop, repairer will arrange.

BEST REGARDS,

G.Nivitha | Admin

LKK Auto Consultants Pte Ltd

Phone: 6841-1972 | email: assignments@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Claim Workflow System [<mailto:cwsmotorclaims@msfirstcapital.com.sg>]
Sent: Friday, 6 April 2018 3:59 PM
To: ASSIGNMENTS@LKKAUTO.COM
Cc: CWSMOTORCLAIMS@MSFIRSTCAPITAL.COM.SG; EILEENLEE@MSFIRSTCAPITAL.COM.SG
Subject: PRI: SURVEY ASSESSMENT - D18002635MFSH/1

Dear Sir/Mdm,

We refer to the above reference.

Please find attached the necessary documents for survey.

Kindly submit your report via CWS within the next 14 days.

Best Regards,
Admin Team
Claim Workflow System
Motor Claims Department
MS First Capital Insurance Limited
Tel : 6507 3848
Fax : 6507 3849

PS: This is a system generated mail. Please do not reply to this mail.



Auto
Consultants
Pte Ltd

Company Registration No. 199607198R

51 UBI AVE 1, #02-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Your ref: D18002635MFSH
Our ref: CS/FCI18006407/Svd3

Date: 12/4/18

The Motor Claims Department
M/s First Capital Insurance Limited

Without Prejudice

Dear Sir/Madam

INITIAL INSPECTION REPORT OF VEHICLE NO. SLU 7619S


We thank for your instruction on 6/4/2018

Please be informed that we had conducted the inspection of the above mentioned vehicle on vehicle on 10/4/2018 at the premises of M/s WEARNES AUTOMOTIVE PTE LTD and have the following to report:-

Workshop Estimate Amount	: S\$10,116.50
Revised Estimate Amount	: S\$7,437.50
"Check" Items Amount	: S\$
Market Value	: S\$
LTA Reimbursement Value	: S\$
Nett Value	: S\$

Description of Damage:

The vehicle sustained damages at the o/s rear portion.

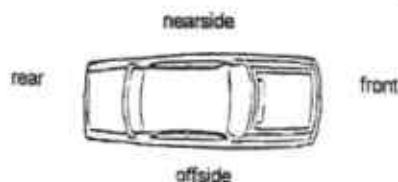

Comments/Present Status:

Damages Consistent

Yours faithfully,

YEANG WAI KEEN
Automotive Assessor

WEARNES AUTO PROTECTOR (VOLVO) PRIVATE VEHICLE

Name of Policyholder : ONG HSING JEN EDDIE null
 Period of Insurance : 13 Dec 2017 To 12 Dec 2019
 Engine No. : B4204T112315968
 Chassis No. : YV1FS40LDJ2458592

Vehicle No. : SLU7619S
 Policy No. : 1700078542
 Endorsement No. :
 Issued Date : 02 Jan 2018

ABOUT THE COVER

Make/Model	VOLVO S60 T5 DRIVE-E		
Engine Capacity/Tonnage	1.969.00 CC	Sum Insured	Market Value
Driver Restriction	NA	Off Peak Car	No
		First Year of Registration	2017
		Insuring with COE/PAFF	Yes

Person or Classes of Persons Entitled to Drive*

a) The Policyholder

b) Any other person who is driving on the Policyholder's order or with his/her permission

This Policy will indemnify the Policyholder or any authorized driver only if he/she meets the specified age condition

You have to pay an additional sum of \$2,000 as "Inexperienced Driver Excess" (IDEX) if you are or your Authorized Driver named or connected has less than 2 years' driving experience

Age Condition 40 years old and above

Limitation as to use*

Use only for social, business and pleasure purposes and for the Policyholder's business

This Policy does not cover use for hire or reward, driving tuition, driving test, racing, track racing, vehicle trial or speed testing, the carriage of goods other than samples in connection with air trade or otherwise or use for any purpose in connection with Motor Trade

Loss of Use 2000cc

* Limitations mentioned inoperative in Section E of the Motor Vehicles (Third Party Risks and Compensation) Act (Cap. 183) and Section 15 of the Road Transport Act, 1987 (Malaysia) are not to be included under these headings

EXCESS**Section 1**

Fire - \$0; Own Damage - \$800; Theft - \$0; Flood Cover - \$0

Section 2

Property Damage - \$0

Windscreen - \$100

Named Driver and Excess (where applicable)

ONG HSING JEN EDDIE

APPROVED REPORTING CENTRES/AUTHORISED REPAIRERS (FOR CLAIMS RELATED REPAIRS)

* Wearnes Automotive Pte Ltd Add: 243 Alexandra Road Singapore 119932 64364000 62789255

For other Approved Reporting Centres/AIG Authorized Repairers, please contact our 24-hour accident emergency hotline at +65 6338 6200. Alternatively, you may refer to AIG website www.aig.com.sg or AIG SG Mobile App. Simply search and download "AIG SG" from iTunes or Google Play

IMPORTANT NOTES

Hire Purchase Company/Employer's Loan: NA

We hereby certify that the policy to which this Certificate of Insurance relates is issued in accordance with the provisions of the Motor Vehicles (Third Party Risks and Compensation) Act (Cap. 183) Part IV of the Road Transport Act, 1987 (Malaysia) and Motor Vehicles (Third Party Risks) Rules, 1989 (Malaysia).

0503485555

WEARNES AUTOMOTIVE-SALESMAN CAR

45 LENG KEE ROAD

SINGAPORE 159103

AIG

AIG Asia Pacific Insurance Pte. Ltd.

11, 12, 13, 14, 15, 16, 17, 18, 19, 20, 21, 22, 23, 24, 25, 26, 27, 28, 29, 30, 31, 32, 33, 34, 35, 36, 37, 38, 39, 40, 41, 42, 43, 44, 45, 46, 47, 48, 49, 50, 51, 52, 53, 54, 55, 56, 57, 58, 59, 60, 61, 62, 63, 64, 65, 66, 67, 68, 69, 70, 71, 72, 73, 74, 75, 76, 77, 78, 79, 80, 81, 82, 83, 84, 85, 86, 87, 88, 89, 90, 91, 92, 93, 94, 95, 96, 97, 98, 99, 100

PUBLIC OF SINGAPORE DRIVING LICENCE

License Number **S71226061**

Name **ONG HSING JEN EDDIE**

Birth Date **27 Jun 1971**

Issue Date **14 Feb 2003**

000163087K



REPUBLIC OF SINGAPORE

IDENTITY CARD NO. **S71226061**

Name **ONG HSING JEN EDDIE**

王森仁

Race **CHINESE**

Date of Birth **27-06-1971**

Sex **M**

Country of Birth **SINGAPORE**





YOU ARE LICENSED TO DRIVE VEHICLES IN THE FOLLOWING CLASS(ES)

Class 2 Motor Cars and Motor Tractors the weight of which unladen does not exceed 2500 kilograms

PASS DATE **06 Jan 2002**

License No: **S71226061**

NP 428A



0171488

0171488

REC No: **S71226061**

8 CHISELHURST GROVE
SINGAPORE 558592

NPIC No: **S71226061**

81

Blood Group **B+**

Date of issue **30-11-1991**

Date: **12/04/2011**

No: **6742837**




SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Complete and submit this Form to Allied World's Authorised Reporting Centre ("ARC") for e-filing.
2. Please report correctly the details of the accident to speed up the claims process.
3. This Form must be completed by the Policyholder and/or the Authorised Driver.
4. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
5. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
6. Any false reporting may be referred to the Traffic Police Department for investigation.

ACCIDENT STATEMENT

Date and Time of Accident Date: 29/03/2018 Time: 2150hrs - 2145hrs
Exact Location of Accident Stadium Drive Circus

DETAILS OF OWN VEHICLE

Vehicle Registration Number SLU 76195

INSURED / POLICYHOLDER (OWN VEHICLE)

Name of Registered Owner (See Insurance Cert.) Ong Hsing Jen Eddie
Personal Identification - NRIC (Singaporean/PR) S7122606I
- FIN/Passport Number
- Not Applicable

VEHICLE PARTICULARS (OWN VEHICLE)

Vehicle Make / Model Manufacturer Volvo Model S60
Type of Vehicle* ☒ Saloon ☐ MPV ☐ CRV ☐ Van ☐ Lorry
☐ Bus ☐ M/cycle ☐ Others,
Exact Purpose for which vehicle was being used at time of accident Social
Are you claiming under your own insurance policy for repair to your vehicle? ☐ Yes ☒ No (If No, Pts select: ☒ Third Party ☐ Reporting)
Vehicle Category* ☒ Private ☐ Commercial ☐ Motorcycle

INSURANCE COMPANY (OWN VEHICLE)

Name of Insurance Company * AIG
Type of Policy ☒ Comprehensive ☐ Third Party Fire & Theft ☐ TP Only
Fleet Policy ☐ Yes ☒ No
Policy Number A00078542
Motor Cl

DRIVER

☒ Same as Insured above
Name of Driver Ong Hsing Jen Eddie
Personal Identification - NRIC (Singaporean/PR) S7122606I
- FIN/Passport Number
Date of Birth 27 dd/ 06 mm/ 1971 yy
Driving Date Pass 06 dd/ 01 mm/ 1992 yy
Year of Driving Experience Year(s) Month(s)
Occupation ☒ Indoor ☐ Outdoor
Gender ☒ Male ☐ Female
Contact Number / Mobile Phone / Fax No 9811 2543

Address of Driver	8 Chiselhurst Grove		
	Postcode (558592)		
Email Address			
Was driver an employee of the Insured's Company?	☐ Yes	☒ No	
If No, Relationship of the Driver with the Insured	Owner		
Vehicle Registration Number of Driver's Own	☐ Yes	☒ No	
Vehicle Registration Number of Driver's Own Vehicle (if applicable)			
Insurance Company of Driver's Own Vehicle (if applicable)			
GENERAL INFORMATION OF THE ACCIDENT			
Type of Collision (Eg. Chain collision, Head-On collision, Side Swipe, Front to Rear)	Side Swipe		
Weather Conditions	☒ Clear	☐ Raining	☐ Others
Road Surface	☒ Dry	☐ Wet	☐ Others
OTHER INFORMATION			
Was any foreign vehicle involved in this accident?	☐ Yes	☒ No	
Was any body injured in the accident?	☐ Yes	☒ No	
Was any other vehicle or property damaged?	☒ Yes	☐ No	
Was there any video captured by Car Camera?	☐ Yes	☐ No	
Number of Passengers (Including Driver)	01		
DETAILS OF POLICE ACTION			
Was the Accident reported to the Police?	☐ Yes	☒ No (If Yes, please state which Police Station.)	
Police Station Name			
Police Station Address			
Police Station Contact	Tei No.	Fax No.	
Was notice of intended Prosecution given?	☐ Yes	☒ No (If Yes, against whom?)	
DETAILS OF OTHER VEHICLE / PROPERTY 1			
Vehicle Registration Number	87HC 3078X		
Vehicle Make/ Model/ Colour	Compa Taxi		
Details of Properties			
Name of Driver	Toh Chew Lim		
Personal Identification - NRIC (Singaporean/PR)	S1174747G		
- FIN/Passport Number			
Contact Number	9628 0120		
Address			
Name of Insurance Company			
Nature of Damage			
No. of Passenger (Including Driver)			

(Note: - Please use page 6 if you need to add more vehicles.)

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	02/04/2018 10:53
Date Of Accident	29/03/2018 21:45
Exact Location Of Accident	STADIUM DRIVE CIRCUS
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLU7619S
Insured/Policyholder	
Name Of Registered Owner	ONG HSING JEN EDDIE
NRIC No	S7122606I
Email Address	NOEMAIL
Mobile Phone No	(LOCAL) +65-98172543
Alternative Phone No	OTHERS-98172543

Vehicle Particulars

Manufacturer	VOLVO
Model	S60-2.0 T5 (A)
Exact Purpose for which vehicle was being used at time of accident	SOCIAL
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE CAR

Insurance Company

Name of Insurance Company	AIG ASIA PACIFIC INSURANCE PTE. LTD.
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	1700078542
Cover Note Number	

Driver

Name of Driver	ONG HSING JEN EDDIE
NRIC No	S7122606I
Date Of Birth	27/06/1971
Occupation	INDOOR
Date Of Driving Pass	06/01/1992
Driving Experience	26 YEARS AND 2 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-98172543
Fax Number	
Contact Number	OTHERS-98172543
EMail Address	NOEMAIL

Address 8 CHISELHURST GROVE
558592

Postcode

Was driver an employee of the Insured's Company NO

If No, Relationship of the Driver with the Insured OWNER

Vehicle Registration Number of Driver's Own Vehicle -

Insurance Company of Driver's Own Vehicle -

General Information of the Accident

Type Of Accident SIDE SWIPE

Weather Conditions CLEAR

Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident? NO

Number of vehicles involved in the accident

Was any body injured in the Accident? NO

Was any injured conveyed to hospital by ambulance? NO

Was any other material or property damaged? YES

I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO

Number of Passengers (Including Driver) 1

Details of Police Action

Was the accident reported to the police? NO

If Yes, Please state which Police Station

Was notice of intended Prosecution given? NO

If Yes, against whom?

Circumstances of Accident

REFER TO ATTACHMENT.

Attachment(s)

Are accident photos available for attachment? YES

Was there any video captured by Car Camera? NO

Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number SHC3078X

Vehicle Make/Model/Colour COMFORT TAXI

Details Of Properties

Vehicle Category TAXI

Name of Driver TOH CHEW LIM

NRIC/Passport Number S1174747G

Contact Number 96280120


Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

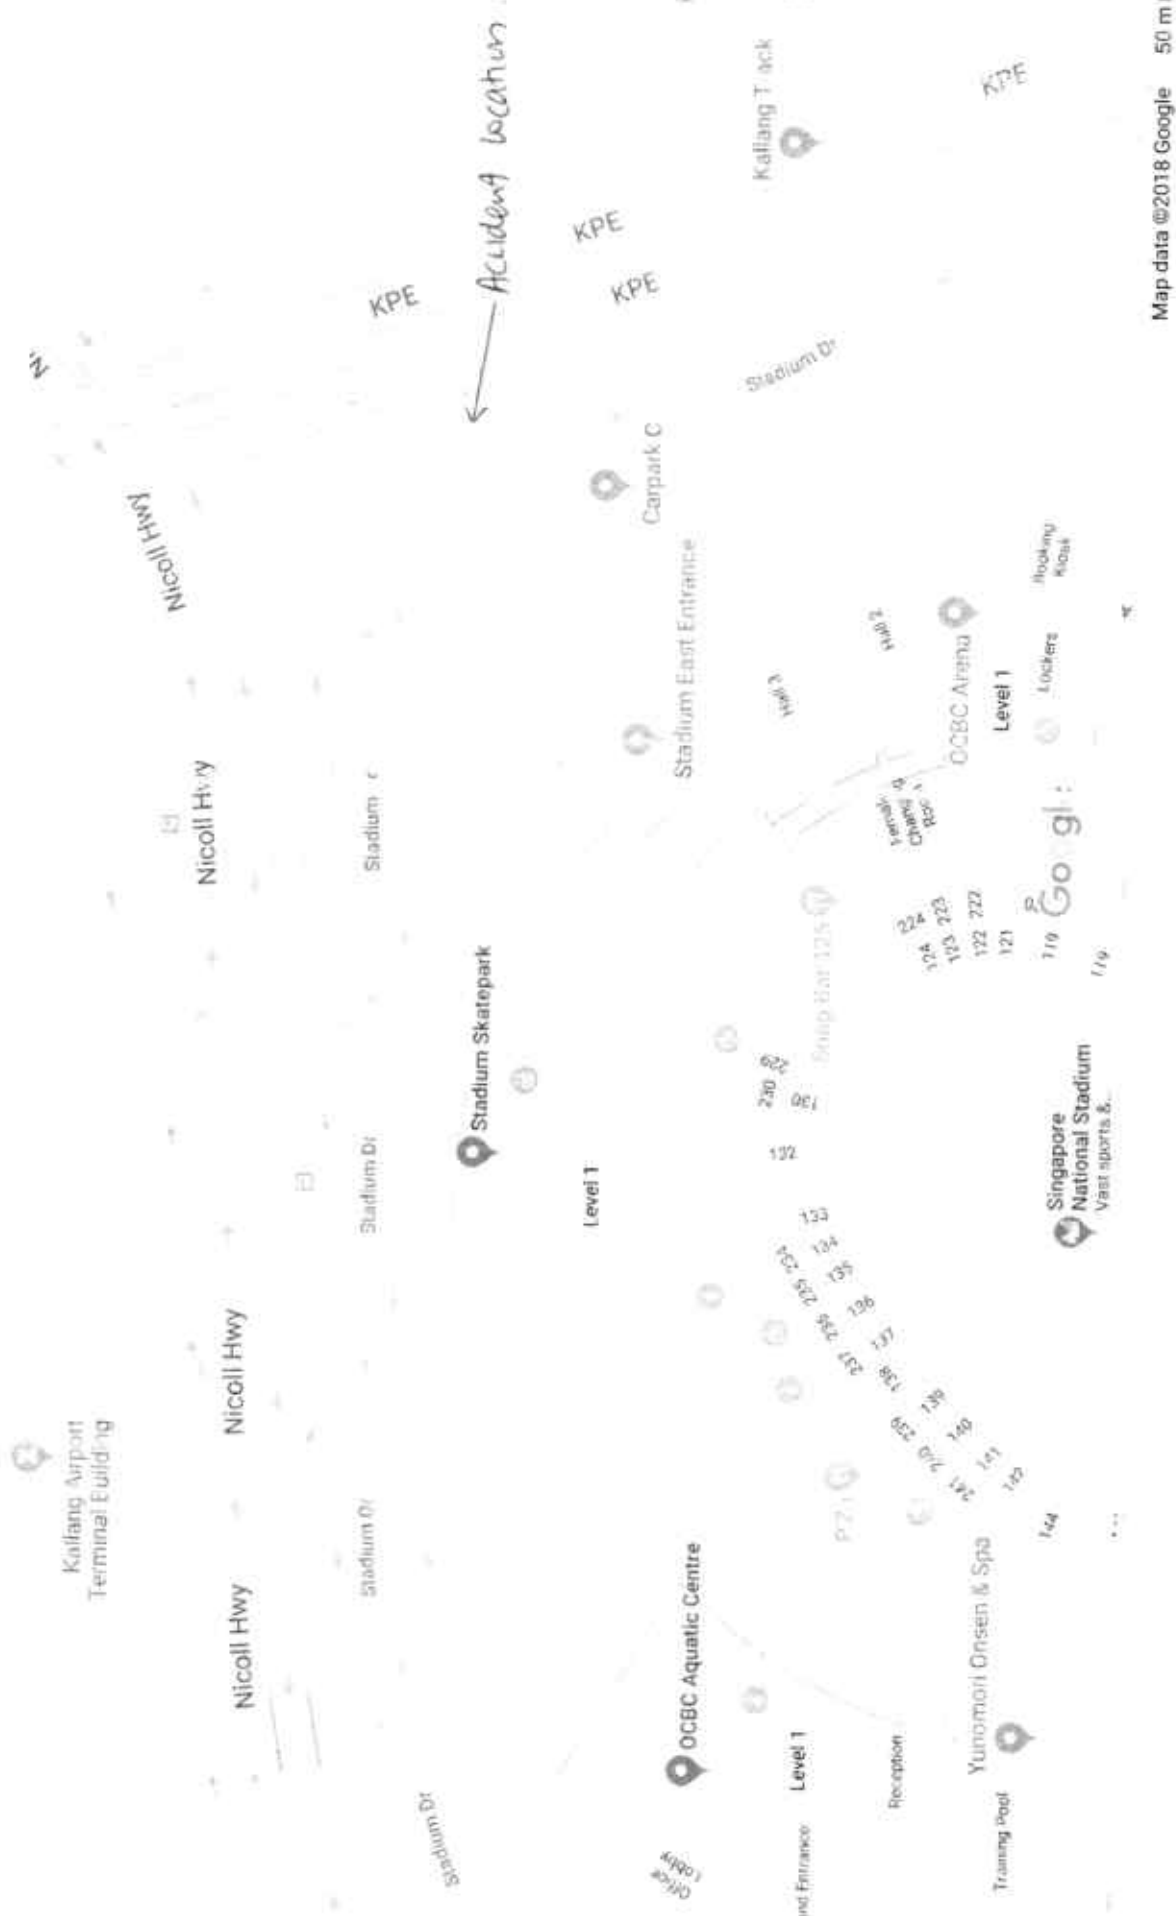

SKETCH PLAN


IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Traffic Police Department for investigation.
6. This report will be forwarded by the insurers to the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:


- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' law firms/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' law firms/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.


Policyholder's Signature / Date & Time

Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel

Sketch Plan

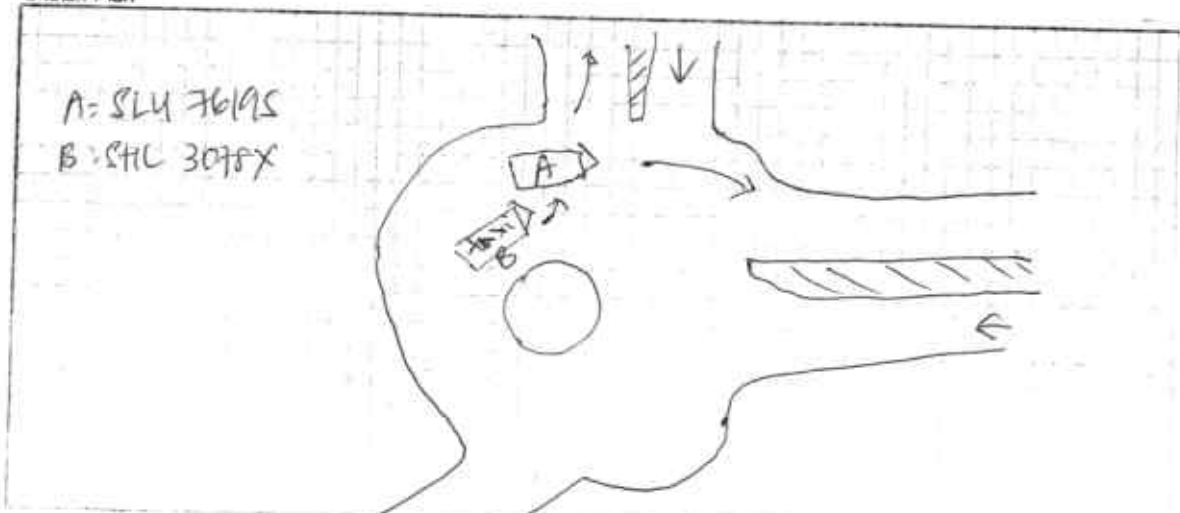

Describe Circumstance of the Accident

I entered stadium drive circus heading towards Stadium Car Park E. I was travelling on the extreme left lane towards the circus exit.

A taxi vehicle no. SK 3078X suddenly hit onto my rear right side of my car.

After the hit, when I got down from my vehicle and spoke to the taxi driver I then realized he was trying to exit from the middle lane of the circus to the exit near Car Park C.

IMPORTANT NOTE

Under General Condition – Conduct of Claim of the Motor Policy, you have to decide within 21 days of occurrence or discovery of damage whether or not to claim under the policy. Please check your policy for more information.

Declaration

I/We declare the foregoing particulars are true in every respect.



Policyholder's Signature / Date & Time

Driver's Signature (if driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel

SERVICE ESTIMATE

70200 - C00001 SL: SERVICE SALES - PC

Mr Ong Hsing Jen Eddie
8 Chiselhurst Grove

GST Reg.No:M28920628X

Inv.No. : B&P 0 Page 1

Inv.date : 02/04/2018

WIP No. : 53181

Veh.In/Out:

*Tel.No. : Mobile: 98172543

Reg.No. : SLU7619S

Reg.date : 13/12/2017

Mileage : 0

Chassis No: YV1FS40LDJ2458592

Singapore 558592

Closed by : Michelle Ong Siew Be

Svc Consultant :

Remarks : Mr Ong Hsing Jen Edd

Op.No	Description	Mech Qty	Price	Disc%	Pkg	Amount	G
802	TO REPLACE REAR BUMPER, REAR BRACKET, REAR RH FENDER, ETC	800/1 day 0	3200.00	0		3,200.00 S	2400 ✓
800	TO PUTTY SPRAY PAINT ON REAR RH FENDER, REAR BUMPER, ETC	700/panel 0	2100.00	0		2,100.00 S	1900 ✓
031	TO REPLACE REAR RH RIM	0	50.00	0		50.00 S	✓
10	COMPUTERISED WHEEL ALIGNMENT	0	280.00	0		280.00 S	✓
280	TO CHECK WIRING INCLUDE RESETTING OF ALL ELECTRICAL MODULES	0	450.00	0		450.00 S	✓
1	BUMPER COVER REAR S6 ✓ cut	1.0 EA	1428.70			1,428.70 S	1285.83
2	BUMPER BRACKET LHR S X	1.0 EA	54.30			54.30 S	48.57
3	BUMPER BRACKET RHR S ✓	1.0 EA	54.30			54.30 S	48.57
4	BUMPER BRACKET LHR S X	1.0 EA	54.30			54.30 S	48.57
5	BUMPER BRACKET RHR S ✓	1.0 EA	54.30			54.30 S	48.57
6	BUMPER BRACKET CTR R X	1.0 EA	88.70			88.70 S	79.83
7	DIFFUSER SLIVER REAR x MV	1.0 EA	1179.00			1,179.00 S	
8	ALLOY RIM "Rodinia" ✓ cut	1.0 EA	792.50			792.50 S	713.25

4 days.

Sebastian
10/4/18.

- Port by part repair
- Photo Before Paint


LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

SERVICE ESTIMATE

70200 - C00001 SL: SERVICE SALES - PC

Mr Ong Hsing Jen Eddie
8 Chiselhurst Grove

GST Reg.No:M28920628X

Inv.No. : B&P 0 Page 2

Inv.date. : 02/04/2018

WIP No. : 53181

Veh.In/Out:

*Tel.No. : Mobile: 98172543

Reg.No. : SLU7619S

Reg.date. : 13/12/2017

Mileage : 0

Chassis No: YV1FS40LDJ2458592

Singapore 558592

Closed by : Michelle Ong Siew Be

Svc Consultant :

Remarks : Mr Ong Hsing Jen Edd

Op.No	Description	Mech Qty	Price	Disc%	Pkg	Amount	G
-------	-------------	----------	-------	-------	-----	--------	---

9	BLIND RIVET 4.0*21MM ✓ NEC	10.0 EA	3.00			30.00 S	27
10	BUMPER CLIP ✓ NEC	10.0 EA	4.80			48.00 S	43.20
11	PLASTIC RIVET P/W RA ✓ NEC	10.0 EA	6.90			69.00 S	62.10
12	BUMPER INSTALLING MT ✓ NEC	1.0 EA	83.40			83.40 S	75.66
13	ADHESIVE TUBE CHEMIC ✓ NEC	2.0 EA	50.00			100.00 S	136.44

13,161.14

Gross Total. 10,116.50

Labour Total 6,080.00
Parts Total 4,036.50
Package Total 0.00

Net..... 10,116.50
GST @ 7.0% 708.16
Total..... 10,824.65
Paid..... 0.00
Please Pay.. 10,824.65

GST: S=StdRated; O=OutOfScope; Z=ZeroRated

Wheel alignment test report

Client name: Vehicle plate No.: SLU 7619 S Mileage:
Contact: Address:
Manufacturer name: VOLVO
Model: 1 S60 Start year:2012 End year:2016

Parameter	Before adj.	MIN spec	MAX spec	After adj.
Front Total Toe	0.03°	0.00°	0.20°	0.03°
FL Toe	-0.78°	0.00°	0.10°	-0.78°
FR Toe	0.81°	0.00°	0.10°	0.81°
FL Camber	-1.40°	-1.29°	0.60°	-1.40°
FR Camber	-1.00°	-1.29°	0.60°	-1.00°
Left Caster	2.64°	2.18°	5.00°	2.64°
Right Caster	2.85°	2.18°	5.00°	2.85°
Left SAI	16.49°			16.49°
Right SAI	12.13°			12.13°
Rear Total Toe	-0.97°	0.00°	0.40°	-0.97°
RL Toe	0.38°	0.00°	0.20°	0.38°
RR Toe	-1.35°	0.00°	0.20°	-1.35°
RL Camber	-1.96°	-2.01°	0.40°	-1.96°
RR Camber	-1.43°	-2.01°	0.40°	-1.43°
Thrust Angle	-0.87°			-0.87°
Wheelbase Dif.	0.50°			0.50°
Tread width Dif.	-0.68°			-0.68°
Included angle FL	15.09°			15.09°
Included angle FR	11.13°			11.13°
Toe-out on turn L	12.16°			12.16°
Toe-out on turn R	11.83°			11.83°
MAX left turn angle				
MAX right turn angle				

Test date:2018-04-10 9:47

Operator:

Fault cause:

Remark:

Name : VOLVO WEARNES Pte Ltd

Address : 249 ALEXANDRA RD.

Tel : 63789358

Fax : Setting of Garage fax

Post Code : Setting of Garage post code

SERVICE ESTIMATE

0 - F00003 SL: FIRST CAPITAL INSURANCE LTD
 FIRST CAPITAL INSURANCE LTD GST Reg.No:M28920628X
 36 ROBINSON ROAD Inv.No. . : B&P 0 Page 1
 #16-01, CITY HOUSE Inv.date. : 25/07/2018
 SINGAPORE WIP No. . : 53181
 Singapore 068877 Veh.In/Out: 10/04/2018 14/04/2018
 *Tel.No. . :

Closed by : Michelle Ong Siew Be
 Svc Consultant : ACC
 Remarks : Mr Ong Hsing Jen Edd

Reg.No. . : SLU7619S
 Reg.date .: 13/12/2017
 Mileage .. : 5,132
 Chassis No: YV1FS40LDJ2458592

Op.No	Description	Mech Qty	Price	Disc%	Pkg	Amount	G
802	TO REPLACE REAR BUMPER, REAR	0	2400.00	0	2,400.00	S	✓
	BRACKET, REAR RH FENDER, ETC						
800	TO PUTTY SPRAY PAINT ON REAR	0	1400.00	0	1,400.00	S	✓
	RH FENDER, REAR BUMPER, ETC						
031	TO REPLACE REAR RH RIM	0	50.00	0	50.00	S	✓
280	TO CHECK WIRING INCLUDE	0	450.00	0	450.00	S	✓
	RESETTING OF ALL ELECTRICAL						
	MODULES						
10	COMPUTERISED WHEEL ALIGNMENT	0	280.00	0	280.00	S	✓
287	TO REPLACE REAR RH UNDERCARRIA	0	1200.00	0	1,200.00	S	(A)
PARTS							
	① BUMPER COVER REAR S6	1.0 EA	1428.70	10	1,285.83	S	
	② BUMPER BRACKET RHR S	1.0 EA	54.30	10	48.87	S	
	③ BUMPER BRACKET RHR S	1.0 EA	54.30	10	48.87	S	
	④ ALLOY RIM "Rodinia"	1.0 EA	792.50	10	713.25	S	
	⑤ ADHESIVE TUBE CHEMIC	2.0 EA	75.80	10	136.44	S	
	ABSORBER REAR T4 S60 -supp	1.0 EA	195.20	10	175.68	S	(A)

SERVICE ESTIMATE

0 - F00003 SL: FIRST CAPITAL INSURANCE LTD
 FIRST CAPITAL INSURANCE LTD GST Reg.No:M28920628X
 36 ROBINSON ROAD Inv.No. . : B&P 0 Page 2
 #16-01, CITY HOUSE Inv.date. : 25/07/2018
 SINGAPORE WIP No. . : 53181
 Singapore 068877 Veh.In/Out: 10/04/2018 14/04/2018
 *Tel.No. . :
 Reg.No. . : SLU7619S
 Closed by : Michelle Ong Siew Be Reg.date. : 13/12/2017
 Svc Consultant : ACC Mileage . : 5,132
 Remarks : Mr Ong Hsing Jen Edd Chassis No: YV1FS40LDJ2458592

Op.No	Description	Mech Qty	Price	Disc%	Pkg	Amount	G
	ANTI ROLL BAR LINK R	1.0 EA	137.60	10		123.84	S
	ANTI ROLL BAR BUSH L	1.0 EA	55.00	10		49.50	S
	ANTI ROLL BAR BUSH U	1.0 EA	55.00	10		49.50	S
	SUSPENSION STAY RHR	1.0 EA	631.90	10		568.71	S
	WHEEL HUB+BEARING RE	1.0 EA	446.50	10		401.85	S
	SUSPENSION STAY REAR	1.0 EA	90.00	10		81.00	S
	CONTROL ARM UPPER RE	1.0 EA	234.50	10		211.05	S
	CONTROL ARM REAR S60	1.0 EA	203.90	10		183.51	S
	② BUMPER INSTALLING MT	1.0 EA	83.40	10		75.06	S
	② BLIND RIVET 4.0*21MM	10.0 EA	3.00	10		27.00	S
	① PLASTIC RIVET P/W RA	10.0 EA	6.90	10		62.10	S
	① BUMPER CLIP	10.0 EA	4.80	10		43.20	S
	② BUMPER BRACKET LHR S	1.0 EA	54.30	10		48.87	S
	② BUMPER BRACKET LHR S	1.0 EA	54.30	10		48.87	S
	② BUMPER BRACKET CTR R	1.0 EA	88.70	10		79.83	S

Gross Total. 10,242.83

Labour Total 5,780.00
 Parts Total 4,462.83
 Package Total 0.00

Net..... 10,242.83
 GST @ 7.0% 717.00
 Total..... 10,959.83
 Paid..... 0.00
 Please Pay.. 10,959.83

GST: S=StdRated; O=OutOfScope; Z=ZeroRated

Supplementary List

SERVICE ESTIMATE

0 - F00003 SL: FIRST CAPITAL INSURANCE LTD
 FIRST CAPITAL INSURANCE LTD GST Reg.No:M28920628X
 36 ROBINSON ROAD Inv.No. : B&P 0 Page 1
 #16-01, CITY HOUSE Inv.date. : 25/07/2018
 SINGAPORE WIP No. : 53181
 Singapore 068877 Veh.In/Out: 10/04/2018 14/04/2018
 *Tel.No. :
 Reg.No. : SLU7619S
 Reg.date : 13/12/2017
 Mileage : 5,132
 Chassis No: YV1FS40LDJ2458592

Closed by : Michelle Ong Siew Be
 Svc Consultant : ACC
 Remarks : Mr Ong Hsing Jen Edd

Op.No	Description	Mech Qty	Price	Disc%	Pkg	Amount	G
287	TO REPLACE REAR RH UNDERCARRIA	0	1200.00	0		1,200.00	S
PART3							
	ABSORBER REAR T4 S60	1.0 EA	195.20	10		175.68	S
	ANTI ROLL BAR LINK R	1.0 EA	137.60	10		123.84	S
	ANTI ROLL BAR BUSH L	1.0 EA	55.00	10		49.50	S
	ANTI ROLL BAR BUSH U	1.0 EA	55.00	10		49.50	S
	SUSPENSION STAY RHR	1.0 EA	631.90	10		568.71	S
	WHEEL HUB+BEARING RE	1.0 EA	446.50	10		401.65	S
	SUSPENSION STAY REAR	1.0 EA	90.00	10		81.00	S
	CONTROL ARM UPPER RE	1.0 EA	234.50	10		211.05	S
	CONTROL ARM REAR S60	1.0 EA	203.90	10		183.51	S

Gross Total. 3,044.64

Labour Total 1,200.00
 Parts Total 1,844.64
 Package Total 0.00

Net..... 3,044.64
 GST @ 7.0% 213.12
 Total..... 3,257.76
 Paid..... 0.00
 Please Pay.. 3,257.76

GST: S=StdRated; 0=OutOfScope; Z=ZeroRated

Veron Chen (LKKAuto)

From: Veron Chen (LKKAuto)
Sent: Wednesday, 1 August 2018 11:33 AM
To: 'Michelle Ong Siew Bee'; SUR
Subject: RE: PENDING FINALIZE

Dear Michelle,

WITHOUT PREJUDICE

Finalize amount \$10,242.83 before GST @ 4 working days.

Kindly send Final invoice and all supporting documents to First Capital Ins Ltd.

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Michelle Ong Siew Bee <michelle.ong@wearnes.com>
Sent: Friday, 27 July 2018 10:58 AM
To: Veron Chen (LKKAuto) <veronchen@lkkauto.com>
Subject: FW: PENDING FINALIZE

Best regards,

Michelle Ong
Service Consultant
Bodyshop & Paint



Wearnes Automotive Pte. Ltd.
249 Alexandra Road Singapore 159103
M (65) 9129 4556 F (65) 6264 7137
www.wearnes.com michelle.ong@wearnes.com

*This email, including any attachment, is confidential and may also be privileged.
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you.*

From: Michelle Ong Siew Bee
Sent: Friday, July 27, 2018 10:55 AM
To: 'veronchen@lkkauto.com' <veronchen@lkkauto.com>
Subject: FW: PENDING FINALIZE

Best regards,

Michelle Ong
Service Consultant
Bodyshop & Paint



Wearnes Automotive Pte. Ltd.
249 Alexandra Road Singapore 159103
M (65) 9129 4556 F (65) 6264 7137
www.wearnes.com michelle.ong@wearnes.com

*This email, including any attachment, is confidential and may also be privileged.
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you.*

From: Michelle Ong Siew Bee
Sent: Wednesday, July 25, 2018 7:19 PM
To: 'Veron Chen (LKKAUTO)' <veronchen@lkkauto.com>
Subject: RE: PENDING FINALIZE

Dear Veron,

Please refer to Final Bill as attached.

Best regards,

Michelle Ong
Service Consultant
Bodyshop & Paint



Wearnes Automotive Pte. Ltd.
249 Alexandra Road Singapore 159103
M (65) 9129 4556 F (65) 6264 7137
www.wearnes.com michelle.ong@wearnes.com

*This email, including any attachment, is confidential and may also be privileged.
If you have received it in error, please notify us immediately by reply email and then delete this message from your system.
Please do not copy it or use it for any purpose, or disclose its contents or any attachment to any other person. Thank you.*

From: Veron Chen (LKKAUTO) [<mailto:veronchen@lkkauto.com>]
Sent: Wednesday, July 25, 2018 2:53 PM
To: Michelle Ong Siew Bee <michelle.ong@wearnes.com>
Cc: Richmond Ho <richmond.ho@wearnes.com>
Subject: RE: PENDING FINALIZE

Dear Michelle,

Kindly advise vehicle status.

If vehicle has been repaired, please finalize with us.

- 1) SLU 7619S-DOA: 29/3/18 (FCI-TP)
- 2) SGX 7878D-DOA:21/4/18 (CHINA TAIPING-TP)

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Veron Chen (LKKAuto)

Sent: Tuesday, 10 July 2018 4:46 PM

To: 'Michelle Ong Siew Bee' <michelle.ong@wearnes.com>

Cc: Richmond Ho (richmond.ho@wearnes.com) <richmond.ho@wearnes.com>

Subject: RE: PENDING FINALIZE

Dear Michelle,

Kindly advise vehicle status.

If vehicle has been repaired, please finalize with us.

- 1) SLU 7619S-DOA: 29/3/18 (FCI-TP)
- 2) SGX 7878D-DOA:21/4/18 (CHINA TAIPING-TP)

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Veron Chen (LKKAuto)

Sent: Friday, 29 June 2018 4:35 PM

To: 'Michelle Ong Siew Bee' <michelle.ong@wearnes.com>

Subject: PENDING FINALIZE

Dear Michelle,

Kindly advise vehicle status.

If vehicle has been repaired, please finalize with us.

- 1) SLU 7619S-DOA: 29/3/18 (FCI-TP)
- 2) SGX 7878D-DOA:21/4/18 (CHINA TAIPING-TP)

Best Regards,

Veron Chen | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email :sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile				
FIRST CAPITAL INSURANCE LTD			Ref : CS/FCI18006407/Nvd3q2	
36 ROBINSON ROAD #16-01 CITY HOUSES SINGAPORE 068877			Date : 24-08-2018	
			Code : FCI2	
1. Policy Particulars :- THIRD PARTY CLAIM				
	Insured Veh.	SHC 3078X	Veh. Inspected	SLU 7619S
	Policy No.	D-18088936MFSH	Coverage (\$)	0.00
	Claim No.	D18002635MFSH	Excess (\$)	0.00
	Assign From	EILEEN LEE	Assign Date	06/04/2018
2. Vehicle Particulars & Condition				
	Make & Model	VOLVO S60	c.c	1969
	Engine No.	HIDDEN	Year of Reg.	2017
	Chassis No.	YV1FS40LDJ2458592	Colour	RED
	Odometer	2777	Steering	IN ORDER
	Brakes	IN ORDER	Modification	NIL
	General	GOOD		
3. Conditions of Tyres				
		Size	Make	Balance
	R/H Front Tyre	215/50 R17	MICHELIN	7 mm
	L/H Front Tyre	215/50 R17	MICHELIN	7 mm
	R/H Rear Tyre	215/50 R17	MICHELIN	7 mm
	L/H Rear Tyre	215/50 R17	MICHELIN	7 mm
4. Description of Damages				
	THE VEHICLE SUSTAINED DAMAGES AT THE O/S REAR PORTION. DAMAGES SEE DETAILS.			
5. General Information				
	Accident Date	29/03/2018	Inspection Date	10/04/2018
	Survey held at	WEARNES AUTOMOTIVE PTE LTD 45 LENG KEE ROAD SINGAPORE 159103.		
5a. Remarks				
	A) DAMAGES CONSISTENT TO ACCIDENT REPORT. B) THE INSPECTION WAS CONDUCTED ON A "WITHOUT PREJUDICE" BASIS. C) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.			
5b. Estimate Days of Repair				
	ESTIMATED NORMAL PERIOD FOR REPAIR:		4 Working Days	



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLU 7619S

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	REPLACEMENT OF PARTS			
1	BUMPER COVER REAR S6 (SN)	CUT	1,428.70	1,285.83
1	BUMPER BRACKET LHR S (SN)	NECESSARY	54.30	48.87
1	BUMPER BRACKET RHR S (SN)	NECESSARY	54.30	48.87
1	BUMPER BRACKET LHR S (SN)	NECESSARY	54.30	48.87
1	BUMPER BRACKET RHR S (SN)	NECESSARY	54.30	48.87
1	BUMPER BRACKET CTR R (SN)	NECESSARY	88.70	79.83
1	DIFFUSER SLIVER REAR (SN)	NOT NECESSARY	1,179.00	-
1	ALLOY RIM 'RODINIA' (SN)	CUT	792.50	713.25
10	BLIND RIVET 4.0*21MM (SN)	NECESSARY	30.00	27.00
10	BUMPER CLIP (SN)	NECESSARY	48.00	43.20
10	PLASTIC RIVET P/W RA (SN)	NECESSARY	69.00	62.10
1	BUMPER INSTALLING MT (SN)	NECESSARY	83.40	75.06
2	ADHESIVE TUBE CHEMIC (SN)	NECESSARY	136.44	136.44
1	ABSORBER REAR T4 S60 (ADDITIONAL)	BENT	175.68	175.68
1	ANTI ROLL BAR LINK R (ADDITIONAL)	BENT	123.84	123.84
1	ANTI ROLL BAR BUSH L (ADDITIONAL)	BENT	49.50	49.50
1	ANTI ROLL BAR BUSH U (ADDITIONAL)	BENT	49.50	49.50
1	SUSPENSION STAY RHR (ADDITIONAL)	BENT	568.71	568.71
1	WHEEL HUB+BEARING RE (ADDITIONAL)	BENT	401.85	401.85
1	SUSPENSION STAY REAR (ADDITIONAL)	BENT	81.00	81.00
1	CONTROL ARM UPPER RE (ADDITIONAL)	BENT	211.05	211.05
1	CONTROL ARM REAR S60 (ADDITIONAL)	BENT	183.51	183.51
			5,917.58	4,462.83
	LABOUR			
	TO REPLACE REAR BUMPER ,REAR BRACKET ,REAR RH FENDER ,ETC .		3,200.00	2,400.00
	TO PUTTY SPRAY PAINT ON REAR RH FENDER ,REAR BUMPER ,ETC .		2,100.00	1,400.00
	TO REPLACE REAR RH RIM .		50.00	50.00
	COMPUTERISED WHEEL ALIGNMENT .		280.00	280.00
	TO CHECK WIRING INCLUDE RESETING OF ALL ELECT		450.00	450.00

Report Ref No. CS/FCI18006407/Nvd3q2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	TO REPLACE REAR RH UNDERCARRIAGE PARTS .		1,200.00	1,200.00
			7,280.00	5,780.00
GRAND TOTAL			13,197.58	10,242.83
RECOMMENDED COST OF REPAIRS				10,242.83

Report Ref No. CS/FCI18006407/Nvd3q2

MUHAMMAD NAZRIL BIN ABDULLAH

Automotive Assessor

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.