


## SMRT Accident Vehicle Repair Estimates

### Section A - To be completed by claims Advisor/Duty officer at Accident Reporting Centre

Reg. No : SHF362D  
Ref. No : TAX/04/18/2132  
Reg. Date : 14/12/2017  
Vehicle Type : TAXI  
Make : TOYOTA PRIUS  
Model : PRIUS4  
Name of Driver : POH SWEE KHENG  
Type of Accident : SIDE SWIPE  
Date / Time of Accident : 27/04/2018 07:35:00 PM  
Accident Reported Date / Time : 28/04/2018 12:00:00 AM  
Surveyor is Required? : Yes  
Survey by :  
Vehicle is Towed Back? : No  
Towed Back Date/Time :  
Replacement Vehicle issued? : No  
Accident Repair Job Card No : 000024095794  
Special Instruction to ARC,if any :  
GBH1411A - AXA  
Prepared Date : 28/04/2018 08:41:54 AM

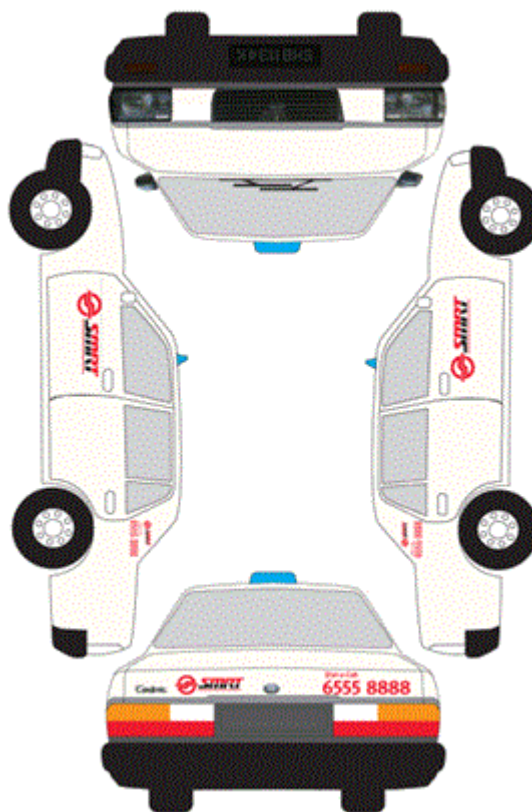

**Section B - To be Completed by Service Advisor, Accident Repair Centre**

Chassis No : JTDKB3FU603576608

Mileage : 0

Work Shop :

Repair Completed Date / Time :

**Summary of Repair Estimates**

	Quotation from ARC	Adjusted by Surveyor, if applicable
Total Labour Charges :	1,014.00	0.00
Total Spray Painting Charges :	1,314.00	0.00
Total Material Charges :	4,032.82	4,032.82
Other Charges :	460.00	0.00
<b>TOTAL :</b>	<b>6,820.82</b>	<b>0.00</b>
<b>Lum Sum Total :</b>	<b>0.00</b>	<b>0.00</b>
No. of Repair Days :	6.00	0.00
Prepared / Adjusted By :		
Arc / Surveyor Sign Off Date :	28/04/2018 10:51:00 AM	01/01/1900 12:00:00 AM



Prepared / Adjusted Date :

Remarks :

Prepared Date : 28/04/2018 10:49:59 AM

**Section C - To be Completed by Admin Assistant, Accident Repair Centre, Upon Completion of Repair**

Quotation No :	Invoice No :
Quotation Date :	Invoice Date :
Invoice Amount :	Prepared Date :

## Section D - Details of Repair Estimates

### Part 1 - Labour Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPAIR RH FRONT PORTION	1,014.00	0.00
<b>Total Labour</b>	<b>1,014.00</b>	<b>0.00</b>

### Part 2 - Spray Painting & Panel Beating Related Works

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO REPSRAY FRONT BUMPER	378.00	0.00
TO RESPRAY FRONT FENDER RH	378.00	0.00
TO RESPRAY FRONT DOOR RH	378.00	0.00
TO RESPRAY VIEW MIRROR	180.00	0.00
<b>Total Spray Painting &amp; Panel Beating</b>	<b>1,314.00</b>	<b>0.00</b>

### Part 3 - Other Costs - Accident and Accident Repair Related Expenses

Job Scope	Quotation from ARC	Adjusted by Surveyor, if applicable
TO CHECK WIRING AND SYSTEM FUNCTION	80.00	0.00
TO APPLY RUST-PROOFING ON AFFECTED AREA	100.00	0.00
TO TRANSFER DOOR MECHANISM	120.00	0.00
TO REPLACE SUNDRY PARTS	100.00	0.00
TO WASH AND VACUUM	60.00	0.00
<b>Total Other Costs</b>	<b>460.00</b>	<b>0.00</b>

Part 4 - Spare Parts / Material Usage

Part Number	Portion	Stock No	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Recommended	Surveyor Approved	Photos Attached
5211947962			COVER, FR BUMPER	1	495.50	25.00	371.62	Replace	Replace	No
5211547050			SUPPORT, FR BUMPER RH	1	76.90	25.00	57.67	Replace	Replace	No
5380147080			FENDER SUB-ASSY, FR , RH	1	933.10	25.00	699.82	Replace	Replace	No
7537447140			EMBLEM, SIDE PANEL ( HYBRID)	1	52.90	25.00	39.67	Replace	Replace	No
5387547070			LINER, FR FENDER, RH	1	198.40	25.00	148.80	Replace	Replace	No
6700147152			PANEL SUB-ASSY, FRONT DOOR RH	1	1,249.60	25.00	937.20	Replace	Replace	No
6871012151			HINGE ASSY, FRONT DOOR , UPPER RH	1	82.10	25.00	61.57	Replace	Replace	No
6873012120			HINGE ASSY, FRONT DOOR , LOWER RH	1	92.10	0.00	92.10	Replace	Replace	No
6861047040			CHECK ASSY, FRONT DOOR	1	153.50	25.00	115.12	Replace	Replace	No
			STICKER DECAL SMRT (DOOR)	1	60.00	0.00	60.00	Replace	Replace	No
8791047450			MIRROR ASSY, OUTER REAR VIEW , RH	1	1,373.50	10.00	1,236.15	Replace	Replace	No
8173047010			LAMP ASSY, SIDE MIRROR TURN SIGNAL , RH	1	162.20	10.00	145.98	Replace	Replace	No
8791547070A1			COVER, OUTER MIRROR, RH	1	89.50	25.00	67.12	Replace	Replace	No
TOTAL MATERIALS							4,032.86	4,032.82		
TOTAL MATERIALS(Discounted)							4,032.82	4,032.82		

Added Spare Parts / Material Usage After Surveyor Signed off

Part Number	Portion	Part Name	Qty	List Price (\$)	Discount (%)	Final Price (\$)	ARC Check	Surveyor Check	LT Check
TOTAL SUPPLEMENTARY MATERIALS									