

(06/11/13) wef
ASS. REC. BY: Morley

REF: TP /

ASSIGNMENT

From: _____ Date: _____

Veh No: SLE6610G Yr Regn: 7 16

Estimated Cost: _____

Type: Car / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

Truck / Trailer or CAI 1395

To Inspect Vehicle No: SLE6610G

Make: Volkswagen Golf variant R-line

at Workshop n/s 221

Colour: white A/C: Insured / Std / NI / NA

of _____

Sp. Reading: 5-2986 T/Radio: Insured / Std / NI / NA

Insured: _____

Eng/No: _____

Policy No. _____

C/No: WVWZZZAUZGP500141

Claims No. _____

Gen. Cond: Good / Fair / Poor / Burnt

Sum Insured: _____ Excess: _____

Steering: In order / Jammed / Leaked / Burnt or Affected

(Client's Record)

Brake: In order / Jammed / Leaked / Burnt or _____

Make of Veh: _____

Modi: Nil / S/Rim / STD A/Rim or _____

(Policy Condition)

Tyre Size: F: 235/35ZR19

Remark: The veh had commenced its repair at the time of inspection.

<input checked="" type="checkbox"/>	<input type="checkbox"/>
N/S	O/S
<input type="checkbox"/>	<input type="checkbox"/>

R: _____

Bal. or Market Value: 92

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI / TOYO / YOKO or _____

IDAS Accident Report: _____ Consistent? : Yes or No

Front 6 Rear 6

G/A / PR Seen: 9 Consistent? : Yes or No

R/Bal. 6 mm L/Bal. 6 mm

Est. Repairs: 6 days Res.: Yes or No

L/Bal. 6 mm D.O.A. 17/5/18 D.O.I. 22/5/18

Lum Sum: 10 % 3 Val.: Yes or No

Survey held at _____

CA / REV / REP. / 24 HRS

Des. of Damages: Frt / Rear / O/S / N/S / UIC / Rooftop or At N/S 2

Date: _____ Person Contacted: _____

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction LTA 61652 445 2mb. Rep 10h.

N/Acc Ajax huge lower chrome assembly 3pc
partic/new parts replent.

Repair sum \$9200 (red: 5843.43; :38%)

RECEIVED 19 JUN 2018.

Date/Time, File Pass to? : Prel. Report

Days Of Repair: 6

1) 19/6 Typist : Final Report

Resurvey No. of Trip: 3

Date/Time, File Return to?

Survey Fee:	<u>5x15 = 75</u>
Transportation:	<u>170 + 75</u>
	<u>50</u>
	<u>50 + 50 + 50</u>
Police:	<u>104</u>
Others:	<u>80</u>
TOTAL:	<u>629</u>

Report Format: TP

Add Fee: : Site Insp (\$)
 : Interview (\$)
 : Tech. Invs (\$)
 : Weekend (\$)

Lump Sum / I.B.I: (\$ 9200)

Ref. No : <u>CS/TP18009268/UTBⁿ²</u>	Res. Date: <u>24/5/18</u>	Date Received:
Veh. No : <u>SLE 66106</u>	SP: <u>7/6/18</u>	WKSP: <u>BW</u>
C/No :		
Action/Instruction:		
1.File	2.Submit Photo? YES / NO	
3.Indicate Res. Date On Photo Page?	YES / NO	Message:
If No, due to	a) No authorisation b) Days of repair	
others:		
Final Re-inspection or Progress Photos		Inspected By:

17/05 2018 THU 17:23 FAX

MSME18054541 / SME Motor Ptd Ltd - Kaki Bukit
ENTRY DATE & TIME: 17/05/2018 17:22
SUBMITTED BY: Chia Pei Ying

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorized Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	17/05/2018 17:22
Date Of Accident	17/05/2018 15:15
Exact Location Of Accident	BLK 22 BOON KENG RD CARPARK
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SLE6610G
Insured/Policyholder	
Name Of Registered Owner	CHUA AIJIA
NRIC No	S8530310D
Email Address	NOEMAIL
Mobile Phone No	(LOCAL) +65-82009440
Alternative Phone No	OFFICE-82009440
Vehicle Particulars	
Manufacturer	VOLKSWAGEN
Model	GOLF
Exact Purpose for which vehicle was being used at time of accident	
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	PRIVATE CAR
Insurance Company	
Name of Insurance Company	HL ASSURANCE PTE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	MP306069
Cover Note Number	
Driver	
Name of Driver	TEO ZIQUAN
NRIC No	S8608248I
Date Of Birth	22/03/1986
Occupation	INDOOR
Date Of Driving Pass	11/03/2005
Driving Experience	13 YEARS AND 2 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-91688200
Fax Number	
Contact Number	
Email Address	NOEMAIL

17/05 2018 THU 17:34 FAX

Address BLK 10C BENDEMEER ROAD #34-129
 Postcode 333010
 Was driver an employee of the Insured's Company NO
 If No, Relationship of the Driver with the Insured SPOUSE
 Vehicle Registration Number of Driver's Own Vehicle -
 Vehicle -
 Insurance Company of Driver's Own Vehicle -

General Information of the Accident

Type Of Accident COLLISION - HEAD ON COLLISION
 Weather Conditions CLEAR
 Road Surface DRY
 Other Information
 Was any foreign vehicle involved in this accident? NO
 Number of vehicles involved in the accident
 Was any body injured in the Accident? NO
 Was any injured conveyed to hospital by ambulance? NO
 Was any other material or property damaged? YES
 I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO
 Number of Passengers (Including Driver) 3
 Passenger 1 NAME: GILBERT TAN
 GENDER: MALE

Passenger 2 NAME: LYNN PHUA
 GENDER: FEMALE

Details of Police Action

Was the accident reported to the police? NO
 If Yes, Please state which Police Station
 Was notice of intended Prosecution given? NO
 If Yes against whom?

Circumstances of Accident

ON 17/05/2018 AT ABOUT 3.15PM, I WANTED TO EXIT THE CARPARK OF BLK 22 BOON KENG ROAD. SUDDENLY, VEHICLE B CAME OUT FROM A LOT AND COLLIDED ONTO THE FRONT LEFT PORTION OF MY VEHICLE A.

Attachment(s)

Are accident photos available for attachment? YES
 Was there any video captured by Car Camera? NO
 Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number EQ57M
 Vehicle Make/Model/Colour
 Details Of Properties VEHICLE B
 Vehicle Category PRIVATE CAR
 Name of Driver LEO AH EE
 NRIC/Passport Number S0931069G
 Contact Number 98315764
 Address
 Postcode

17/05 2018 THU 17:34 FAX

Insurance Company Name
Nature Of Damage
No. Of Passenger (Including Driver)

Sketch Plan Pg. 1


SKETCH PLAN

IMPORTANT NOTICE

- 1. Please report correctly the details of the accident to speed up the claims process.
- 2. This Form must be completed by the Policyholder and/or the Authorised Driver.
- 3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to renewdate policy liability.
- 4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
- 5. Any false reporting may be referred to the Police for investigation.
- 6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
- 7. By the lodgment of this report to the Insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
- 8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this (form) and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes;
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature: 
 Date & Time: 17/5/18, 4:30pm

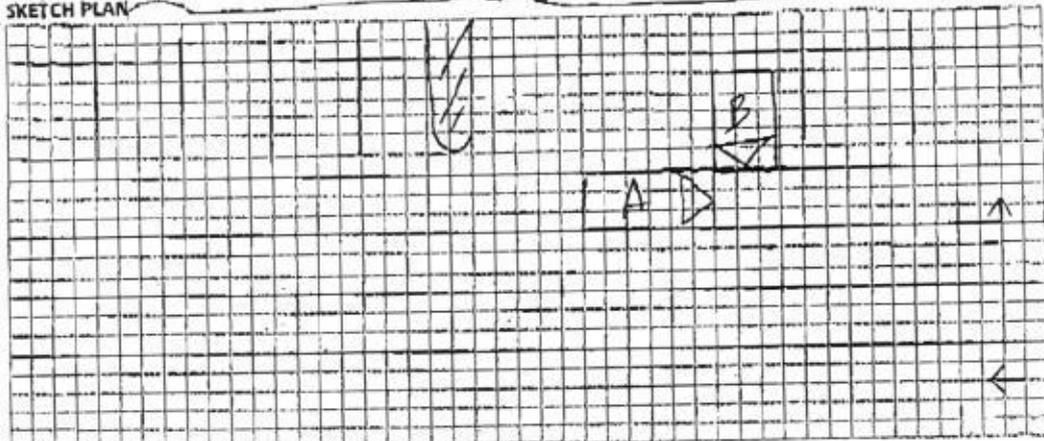
Driver's Signature: 
 (If driver is not the policyholder)
 Date & Time: 17/5/18, 4:30pm

Reporting Centre Personnel's Signature: _____
 Name: _____
 NRIC/FIN No.: _____

Sketch Plan #2 Pg. 1

car park lots

SKETCH PLAN




DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

On 17/5/18 at about 3:50pm, I wanted to exit the car park of BK2-2 Boon Keng Road. Suddenly vehicle B came out from a lot and collided onto the front left side (on) of my vehicle (A)

DECLARATION

I/We declare the foregoing particulars are true in every respect.


 Policyholder's Signature
 Date & Time: 17/5/18, 4:30pm


 Driver's Signature
 (If driver is not the policyholder)
 Date & Time: 17/5/18, 4:30pm

Reporting Centre Personnel's Signature
 Name:
 NRIC/PIN No.:

> **Back to OneMotoring**

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	0310D
Vehicle Details	
Vehicle No.:	SLE6610G
Vehicle to be Exported:	No
Intended De-registration Date:	23 May 2018
Vehicle Make:	VOLKSWAGEN
Vehicle Model:	GOLF VARIANT R-LINE 1.4 TSI AT SR
Primary Colour:	White
Manufacturing Year:	2015
Engine No.:	CZC041706
Chassis No.:	WVWZZZAUZGP500141
Maximum Power Output:	92.0 kW (123 bhp)
Open Market Value:	\$30,297.00
Original Registration Date:	28 Jul 2016
First Registration Date:	28 Jul 2016
Transfer Count:	0
Actual ARF Paid:	\$24,416.00 <i>12208</i>
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	27 Jul 2026
PARF Rebate Amount:	\$18,312.00
Intended COE Rebate Details	
COE Expiry Date:	27 Jul 2026
COE Category:	A - Car up to 1600cc & 97kW (130bhp)
COE Period(Years):	10
QP Paid:	\$53,000.00
COE Rebate Amount:	\$43,340.00
Total Rebate Amount:	\$61,652.00

The information contained herein is correct as at 23 May 2018

OK



Post an Advertisement
 Sell it yourself! Advertise it at just
\$58 until it's SOLD!

New 5 Years COE Renewal Toyota Vios 1.5A



\$2500 Downpayment! Monthly \$580 Onwards! Lowest 3.68% P.a. @ GV Cars Financing! GV Credit Pte Ltd StarAd



[Post an Ad](#) [Advertiser Login](#) [Ways of Selling](#)

Browse by Category ▾

Sort by

2 vehicles

Volkswagen Golf variant

Advanced

	Make	Model	Price	Depreciation	Reg Date	Eng Cap	Mile
Search Selection	Volkswagen	Golf variant	Any	Any	2016	Any	
	Volkswagen	Golf Variant 1.4A TSI R-Line	\$96,800	\$11,110 /yr	03-Mar-2016	1,395 cc	21
Car Warranty By Volkswagen Till March 2019, With One Free Servicing Left. This Low Mileage Beauty Is Definitely The Best For A Large Boot Space, Sporty Outlook That Comes With...							
Posted: 18-Apr-2018 Tags: 2016 Volkswagen Golf, Volkswagen Golf, Volkswagen, Golf, Used Volkswagen							
	Volkswagen	Golf Variant 1.4A TSI R-Line	\$99,800	\$10,930 /yr	29-Jul-2016	1,395 cc	30
In Excellent Condition. Well Maintained By Owner. Regularly Serviced. Call Now For Viewing Appointment. High Loan Amount							
Posted: 05-Apr-2018 Tags: 2016 Volkswagen Golf, Volkswagen Golf, Volkswagen, Golf, Used Volkswagen							

Save this search criteria, to get email alerts whenever a match is found.

Make Model Price Depreciation Reg Date Eng Cap Mile

For old advertisements, view [Expired ads](#)

sgCarMart is the number one car classifieds for parallel import cars, Toyota, Honda, Nissan, Mitsubishi & BMW. There are plenty of cars for sale, cars or stationwagons, SUV, MPV, hatchback, to COE cars & OPC cars. You can also buy from a car auction, look up car loans, low mileage cars, buy used Volkswagen Golf variant, Volkswagen Golf variant Singapore, used Volkswagen Golf variant Singapore, used Volkswagen Golf variant Singapore. We have new car dealers comprising parallel importers, authorised car dealers, and used car dealers on our site and new car promotions. Visit our partner sites for job openings for Singapore jobs, real estate properties for sale, mover, car performance parts, vehicle leasing & COE results.

All prices displayed on sgCarMart.com are gathered from sources and based on algorithms that are believed by sgCarMart.com to be accurate, complete or current. sgCarMart.com does not assume any responsibility for errors or omissions or warranties.

[Compare](#)



BLUWEL AUTOMOTIVE SERVICE PTE LTD

Workshop: 1 Kaki Bukit Ave 6 (Unit B) #01-28
 (Unit C) #01-28-53/55 Singapore 417883
 Hp: 9755 2088 Tel: 6745 2088 Fax: 6841 2088
 Website: www.bluwel.com.sg Email: bluwel2088@yahoo.com.sg
 Co. Reg. No.: 200704951N
 GST Reg. No.: 200704951N

Not filled
 Repair sum \$9200
 6 dy.

SLE 6610 G

	Bonnet	R	1206.36	X
	front grille	tw/cne	509.37	/
	front grille logo	neu	78.50	/
	front bumper	DIS	1169.88	/
	front bumper centre grille	tw/1	239.45	/
	front bumper nozzle cover n/s	tw/1	62.00	/
	front bumper nozzle spray n/s	cne	178.57	/
2pc	front bumper pdc sensors n/s @ 166.02	shuld	332.04	/
	front bumper fog lamp n/s	bro	322.05	/
	front bumper fog lamp cover n/s	tw/1	166.50	/
	front bumper lower cover	dra	299.42	/
	front bumper chrome moulding centre	neu	115.00	/
2pc	front bumper chrome moulding sides @ 92.00	neu	184.00	/
	front bumper sponge	top/1	105.22	/
	front bumper reinforcement bracket n/s	sup	145.00	/
	front bumper side holder n/s	cne	48.50	/
1set	front bumper clips	neu	45.00	/
	headlamp H10 n/s	cne	2959.71	/
	front support panel	cne	482.35	/
	front fender n/s	suc	381.69	/
	front fender inner shield n/s	bro	171.96	/
1set	front fender inner shield clips n/s	neu	50.00	/
	wiper washer tank	DIS	158.30	/
	wiper washer tank motor	Daye	125.00	/
	headlamp top panel n/s	R	86.11	X
	front knuckle arm n/s	sup	690.31	/
	front knuckle arm bearing n/s	neu	400.10	/
	front fender inner panel n/s	R	821.15	X
			11533.48	

(57)

921980



BLUWEL AUTOMOTIVE SERVICE PTE LTD

Workshop: 1 Kaki Bukit Ave 6 (Unit B) #01-28
(Unit C) #01-10-33/55 Singapore 417883
Hp: 9755 2088 Tel: 6745 2088 Fax: 6841 2088
Website: www.bluwel.com.sg Email: bluwel2088@yahoo.com.sg
Co. Reg. No.: 200704951N
GST Reg. No.: 200704951N

SLE6610G

To towing charge king roller	150.00	120
To check wiring	80.00	30
To spray rust proofing	150.00	50
To dismantle & replacing pdc sensor	80.00	50
To conduct wheel alignment	120.00	✓
To Dismantle & replacing front undercarriage	200.00	150
To refill air con gas	150.00	100
labour for panel beating & replacing parts	1080.00	800
To putty & spray painting	1500.00	1000
TOTAL		15043.48

Auto Insurers hence notify
insurer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer:
Signature: _____
Date: _____



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

BLUWEL AUTOMOTIVE SERVICE PTE LTD

Ref : CS/TP18009268/Utnb2

BLK 1 KAKI BUKIT AVE 6
#01-28/51/53/55(MAIN OFFICE)SINGAPORE
417883

Date : 22-06-2018



ON BEHALF OF CHUA AIJIA

Code : TP149

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	Veh. Inspected	SLE 6610G
Policy No.	Coverage (\$)	0.00
Claim No.	Excess (\$)	0.00
Assign From	Assign Date	22/05/2018

2. Vehicle Particulars & Condition

Make & Model	VOLKSWAGEN GOLF VARIANT R-LINE (A)	c.c	1395
Engine No.	HIDDEN	Year of Reg.	2016
Chassis No.	WVWZZZAUZGP500141	Colour	WHITE
Odometer	52986	Steering	AFFECTED
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	235/35 ZR19	YOKOHAMA	6 mm
L/H Front Tyre	235/35 ZR19	YOKOHAMA	6 mm
R/H Rear Tyre	235/35 ZR19	YOKOHAMA	6 mm
L/H Rear Tyre	235/35 ZR19	YOKOHAMA	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE FRONT N/S PORTION.THE UNDERCARRIAGE AFFECTED DUE TO COLLISION.

DAMAGES SEE DETAILS.

5. General Information

Accident Date	17/05/2018	Inspection Date	22/05/2018
Survey held at	BLUWEL AUTOMOTIVE SERVICE PTE LTD BLK 1 KAKI BUKIT AVE 6 #01-28/51/53/55(MAIN OFFICE) SINGAPORE 417883		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS.
B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR: **6 Working Days**



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SLE 6610G

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
REPLACEMENT OF PARTS				
1	BONNET	TO REPAIR SEE LABOUR	1,206.36	-
1	FRONT GRILLE	TWISTED / CRACKED	509.37	509.37
1	FRONT GRILLE LOGO	NECESSARY	78.50	78.50
1	FRONT BUMPER	DISTORTED	1,169.88	1,169.88
1	FRONT BUMPER CENTRE GRILLE	TWISTED	239.45	239.45
1	FRONT BUMPER NOZZLE COVER N/S	TWISTED	62.00	62.00
1	FRONT BUMPER NOZZLE SPRAY N/S	CRACKED	178.51	178.51
2	FRONT BUMPER PDC SENSORS N/S @\$166.02	SHORTED	332.04	332.04
1	FRONT BUMPER FOG LAMP N/S	BROKEN	322.05	322.05
1	FRONT BUMPER FOG LAMP COVER N/S	TWISTED	166.50	166.50
1	FRONT BUMPER LOWER COVER	CRACKED	299.42	299.42
1	FRONT BUMPER CHROME MOULDING CENTRE	NECESSARY	115.00	115.00
2	FRONT BUMPER CHROME MOULDING SIDES @\$92.00	NECESSARY	184.00	184.00
1	FRONT BUMPER SPONGE	TORN	105.22	105.22
1	FRONT BUMPER REINFORCEMENT BRACKET N/S	BENT	145.00	145.00
1	FRONT BUMPER SIDE HOLDER N/S	CRACKED	48.50	48.50
1	SET FRONT BUMPER CLIPS	NECESSARY	45.00	45.00
1	HEADLAMP HID N/S	CRACKED	2,959.71	2,959.71
1	FRONT SUPPORT PANEL	CRACKED	482.35	482.35
1	FRONT FENDER N/S	BUCKLED	381.69	381.69
1	FRONT FENDER INNER SHIELD N/S	TORN	171.96	171.96
1	SET FRONT FENDER INNER SHIELD CLIPS N/S	NECESSARY	50.00	50.00
1	WIPER WASHER TANK	DISTORTED	158.30	158.30
1	WIPER WASHER TANK MOTOR	DAMAGED	125.00	125.00
1	HEADLAMP TOP PANEL N/S	TO REPAIR SEE LABOUR	86.11	-
1	FRONT KNUCKLE ARM N/S	BENT	690.31	690.31
1	FRONT KNUCKLE ARM BEARING N/S	NECESSARY	400.10	400.10
1	FRONT FENDER INNER PANEL N/S	TO REPAIR SEE LABOUR	821.15	-
	LESS 5% DISCOUNT		-	-470.99
			11,533.48	8,948.87



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	LABOUR			
	TOWING CHARGE KING ROLLER.		150.00	120.00
	TO CHECK WIRING.		80.00	30.00
	TO SPRAY RUST PROOFING.		150.00	50.00
	TO DISMANTLE & REPLACING PDC SENSOR.		80.00	50.00
	TO CONDUCT WHEEL ALIGNMENT.		120.00	120.00
	TO DISMANTLE & REPLACING FRONT UNDERCARRIAGE.		200.00	150.00
	TO REFILL AIR CON GAS.		150.00	100.00
	LABOUR FOR PANEL BEATING & REPLACING PARTS.INCLUSIVE OF THE REPAIR OF BONNET,HEADLAMP TOP PANEL N/S AND FRONT FENDER INNER PANEL N/S.		1,080.00	800.00
	TO PUTTY & SPRAY PAINTING.		1,500.00	1,000.00
			3,510.00	2,420.00
	GRAND TOTAL		15,043.48	11,368.87
RECOMMENDED COST OF REPAIR SUM				9,200.00

Report Ref No. CS/TP18009268/Utbn2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.