

(08/11/13) wef

REF:

CS/TP 18010866/UB012

ASS. REC. BY: Marcus

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD / TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SJ 7 6549Xat Workshop n/s 321

of: _____

Insured: _____

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

Bal. or Market Value: 18k.

ID: Accident Rpt: _____ Consistent?: Yes or No

G/A / PR Seen: 2 Consistent?: Yes or NoEst. Repairs: 7 days Res.: Yes or NoLump Sum: 20 % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Date: _____ Person Contacted: _____ Vehicle: IN / OUT

Veh No: SJ 7 6549X Yr Regn: 10.09Type: Motor / M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /Truck / Trailer or CA /Make: K.A Cerato Forte o/c: 159 /Colour: Grey A/C: Insured / Std / NI / NASp. Reading: 81633 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: KNATFWH11MAS124209Gen. Cond: Good / Fair / Poor / BurntSteering: Insider / Jammed / Leaked / Burnt orBrake: Insider / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 2.5 / 4R17

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or roadstoneFront 6 mm Rear 6 mmR/Bal. 6 mm R/Bal. 6 mmL/Bal. 6 mm L/Bal. 6 mmD.O.A. 11/6/18 D.O.I. 14/6/18

Survey held at _____

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

Rear

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

18/6/18 Muc Max 27A9690 1y11 4m1. Dep 9k. net + 8310
L/S 6500 (Real 8686, 5790)
Report Date: 20/6/18

RECEIVED 18 JUN 2018

Date/Time, File Pass to?

☐ : Prel. Report

1)

☐ : Final Report

Date/Time, File Return to?

2) 18/6 - typistReport Format: TPLump Sum / I.B.I: (\$) 6500/2Days Of Repair: 7Resurvey No. of Trip: 1

Add Fee:

☐ : Site Insp (\$ _____)☐ : Interview (\$ _____)☐ : Tech. Invs (\$ _____)☐ : Weekend (\$ _____)

Survey Fee:

Transportation:

S + RS: \$ _____

Photos

Others

TOTAL

5x15 = 75

170 + 75

50

50

135

80

560

Ref. No : <u>CS/TP18010866</u>	Res. Date: <u>14/6/18</u>	Date Received:
Veh. No : <u>SJ76549XSP</u>		WKSP: <u>[Signature]</u>
C/No :		
Action/Instruction:		
1. File	2. Submit Photo? YES / NO	
3. Indicate Res. Date On Photo Page?	YES / NO	Message:
If No, due to	a) No authorisation b) Days of repair	
others:	<u>[Signature]</u>	
Final Re-inspection or Progress Photos		Inspected By: <u>[Signature]</u>



CONNECTING CAR BUYERS & SELLERS.

We'll handle your loans, insurance & other paperwork for FREE.

[Find o](#)

[Home](#) » [Used Cars](#) » [Direct Owners](#) » [Kia Cerato Forte 1.6A SX](#)

Resources

[Car Buying](#)
[Car Selling](#)
[Car Ownership](#)
[Car Aftermarket](#)
[On The Move](#)
[Lifestyle](#)

Car Rental

For Private &
Commercial Vehicles
Rental From

\$50/Day



Kia Cerato Forte 1.6A SX

[Overview](#)
[Financial](#)
[Accessories](#)
[Similar](#)
[Research](#)
[Photos](#)
[Map](#)
[Add to Shortlist](#)
[Add to Compare](#)
[Add a Note](#)
[Report Error](#)
[More Actions](#)

Car Details

Price	\$18,200	
Depreciation	\$9,330 /yr	?
	View models with similar depreciation	
Reg Date	24-Aug-2009	
	(1yr 2mths 10days COE left)	
Manufactured	2009	?
Mileage	106,000 km (12k /yr)	
Transmission	Auto	
Engine Cap	1,591 cc	
Road Tax	\$738 /yr	?
Power	92.7 kW (124 bhp)	
	View specs of the Kia Cerato Forte (2009-2013)	
Curb Weight	1,251 kg	?
Features	Reliable 1.6L, 4 Cylinders Inline 16 Valves DOHC Engine, Producing A 122Bhp With A 4 Speed Automatic Transmission. Multi Steering Wheel, ABS, Airbags.	
Accessories	Leather Seats, Factory Fitted MP3/WMA Player With Audio Steering Control, Reverse Sensors.	
Description	Low Mileage Done And In Superb Condition. Low Depreciation. Recently Serviced And Did Maintenance. New Road Tax Paid. Very Affordable Mid Size Sedan In Singapore.	
COE	\$13,658	?
OMV	\$14,116	?
ARF	\$14,116	?
Dereg Value	\$9,395 as of today (change)	?



Preferred Viewing A

Seller Infor

Contact Perso

Contact No.

Enquiry

USEFUL FOR

» Indemnity

» Receipt

» M01

Instruction
consumer de

Regardless c
your paperw

[Compare](#)

> **Back to OneMotoring**

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	44531
Vehicle Details	
Vehicle No.:	SJT6549X
Vehicle to be Exported:	No
Intended De-registration Date:	13 Jun 2018
Vehicle Make:	KIA
Vehicle Model:	CERATO FORTE 1.6 AT SX ABS D/AB 2WD 4DR
Primary Colour:	Brown
Manufacturing Year:	2009
Engine No.:	G4FC9H291446
Chassis No.:	KNAFW411MA5124209
Maximum Power Output:	92.7 kW (124 bhp)
Open Market Value:	\$13,822.00
Original Registration Date:	26 Oct 2009
First Registration Date:	26 Oct 2009
Transfer Count:	1
Actual ARF Paid:	\$13,822.00 6911
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	25 Oct 2019
PARF Rebate Amount:	\$7,602.00
Intended COE Rebate Details	
COE Expiry Date:	25 Oct 2019
COE Category:	A - Car (1600cc & below)
COE Period(Years):	10
QP Paid:	\$15,291.00
COE Rebate Amount:	\$2,088.00
Total Rebate Amount:	\$9,690.00

The information contained herein is correct as at 13 Jun 2018

OK

12/06 2018 TUE 9:57 FAX

001/006

MSME18070057 / S&B Agency Pte Ltd - Kaki Bukit
ENTRY DATE & TIME: 12/06/2018 09:21
SUBMITTED BY: Chia Pei Ying

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorized Driver.
3. Information provided must be as truthful and accurate as possible. Any willful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report 12/06/2018 09:21
Date Of Accident 11/06/2018 15:15
Exact Location Of Accident TOH GUAN RD TWDS PIE
Country/State of Loss SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number SJT6549X
Insured/Policyholder
Name Of Registered Owner WIN MYINT
NRIC No S2744453I
Email Address NOEMAIL
Mobile Phone No (LOCAL) +85-96405797
Alternative Phone No OFFICE-96405797
Vehicle Particulars
Manufacturer KIA
Model CERATO FORTE-1.6 (A)
Exact Purpose for which vehicle was being used at time of accident

Are you claiming under your own insurance policy for repair to your vehicle? NO

If No, Please state action to be taken

THIRD PARTY

Vehicle Category

PRIVATE CAR

Insurance Company

Name of Insurance Company

AXA INSURANCE PTE LTD

Type Of Coverage

COMPREHENSIVE

Fleet Policy

NO

Policy Number

GA070016

Cover Note Number

Driver

Name of Driver

NYEIN CHAN WIN

NRIC No

S8272865A

Date Of Birth

08/03/1982

Occupation

INDOOR

Date Of Driving Pass

19/11/2010

Driving Experience

7 YEARS AND 6 MONTHS

Gender

MALE

Mobile Number

(LOCAL) +65-96405797

Fax Number

Contact Number

Email Address

NOEMAIL

12/06 2018 TUE 9:58 FAX

Address BLK 6 TOH YI DRIVE #14-257
 Postcode 590006
 Was driver an employee of the Insured's Company NO
 If No, Relationship of the Driver with the Insured CHILDREN
 Vehicle Registration Number of Driver's Own Vehicle -
 Insurance Company of Driver's Own Vehicle -

General Information of the Accident

Type Of Accident CHAIN COLLISION
 Weather Conditions CLEAR
 Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident? NO
 Number of vehicles involved in the accident
 Was any body injured in the Accident? NO
 Was any injured conveyed to hospital by ambulance? NO
 Was any other material or property damaged? YES
 I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO
 Number of Passengers (Including Driver) 1

Details of Police Action

Was the accident reported to the police? NO
 If Yes, Please state which Police Station
 Was notice of intended Prosecution given? NO
 If Yes, against whom?

Circumstances of Accident

ON THE ABOVE MENTIONED DATE AND TIME, I WAS DRIVING ALONG TOH GUAN ROAD. A BIKE IN FRONT OF ME CAME TO A STOP AND I MANAGED TO STOP IN TIME TOO WITHOUT HITTING THE BIKE. SUDDENLY, I FELT AN IMPACT AT THE REAR OF MY CAR. I ALIGHT FROM MY CAR AND FOUND OUT THAT I WAS INVOLVED IN A 3 CARS CHAIN COLLISION.

Attachment(s)

Are accident photos available for attachment? YES
 Was there any video captured by Car Camera? NO
 Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number SHB8929M
 Vehicle Make/Model/Colour
 Details Of Properties VEHICLE B
 Vehicle Category TAXI
 Name of Driver LIM POH CHIANG
 NRIC/Passport Number S9030083G
 Contact Number
 Address
 Postcode
 Insurance Company Name
 Nature Of Damage
 No. Of Passenger (Including Driver)

DETAILS OF OTHER VEHICLE PROPERTY 2

12/06 2018 TUE 9:58 FAX

Vehicle Registration Number	SLW1044D
Vehicle Make/Model/Colour	
Details Of Properties	VEHICLE C
Vehicle Category	PRIVATE CAR
Name of Driver	RAJA RUSHDY
NRIC/Passport Number	
Contact Number	
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

12/06/2018 TUE 9:38 FAX

Sketch Plan Pg. 1

SKETCH PLANIMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers or the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. Consent under the Personal Data Protection Act (PDPA)

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this (form) and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "insurers"); the insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be filed outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

Policyholder's Signature

Date & Time: 12/6/18, 5pm

Driver's Signature

(If driver is not the policyholder)

Date & Time: 12/6/18, 5pm

Reporting Centre Personnel's Signature


Name:

NRIC/FIN No.:

12/06 2018 TUE 9:58 FAX

Sketch Plan #2 Pg. 1

SKETCH PLAN

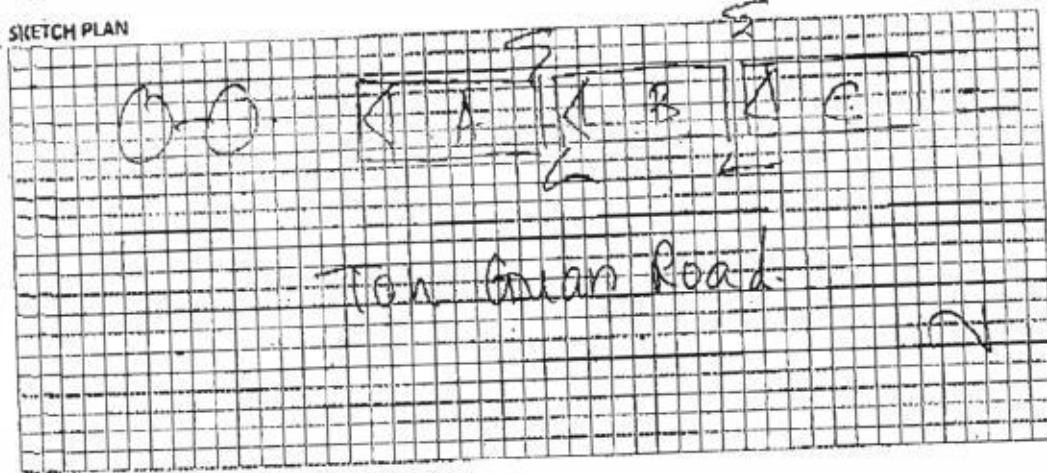

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

On the above mentioned date and time I was driving along Tol Gun Road. A bike instant of me came to a stop and I managed to stop in time too without hitting the bike. Suddenly I felt an impact at the rear of my car. I alighted from my car and found out that I was involved in a 3 cars chain collision.

A - SJT 6549X

B - 81B 8929W

C - SLW 104PD.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature

Date & Time: 12/6/18, 5pm

G:\HMC Sketch\Plan\01m_V3

Driver's Signature

(If driver is not the policyholder)

Date & Time: 12/6/18, 5pm

Reporting Centre Personnel's Signature

Name:

NRIC/FIN No.:

7



BLUWEL AUTOMOTIVE SERVICE PTE LTD

Workshop: 1 Kaki Bukit Ave 6 (Unit B) #01-28
 (Unit C) #01-28-53/55 Singapore 417883
 Hp: 9755 2088 Tel: 6745 2088 Fax: 6841 2088
 Website: www.bluwel.com.sg Email: bluwei2088@yahoo.com.sg
 Co. Reg. No.: 200704951N
 GST Reg. No.: 200704951N

not filled
 nr
 1/546500
 7th

STT 6549X

	Bootlid	Surf/3uc	792.00	✓
	Bootlid 'cerato' emblem	nr	38.00	✓
	Bootlid 'forte' emblem	nr	35.00	✓
	Bootlid C&C logo	nr	39.00	✓
	Bootlid inner lock	1wl	115.00	✓
	Bootlid weatherstrip	1wl	145.00	✓
	Rear bumper	20/1x	695.00	✓
	Rear bumper lower garnish	2x/1wl	166.00	✓
2pc	Rear bumper side retainers @ 45.00	Surf	90.00	✓
	Rear bumper clips	nr	50.00	✓
	Rear bumper sponge	10x1	148.00	✓
	Rear bumper reinforcement	Cue	366.00	✓
2pc	Rear bumper reinforcement beams @ 105.00	Surf	210.00	✓
5pc	Rear bumper reinforcement brackets @ 20.00	1wl	100.00	✓
4pc	Rear bumper ultrason sensors @ 240	slat	960.00	2pc
2	tailamps @ 305.00	one	610.00	✓
2pc	tailamp housing panel @ 175.00	1	350.00	X
	Rear end panel	3x/100	498.00	✓
	Rear end panel top garnish	1wl	181.00	✓
2pc	Rear fenders @ 975.00	1	1950.00	X
2pc	Rear fender inner trims @ 241.00	2x/10x	482.00	✓
	Rear floor panel	R	1128.00	X
	Rear floor panel top board	2x/1wl	362.00	✓
	Rear exhaust	1	622.00	X
	Rear exhaust chrome pipe	Surf	80.00	✓
		10%	10216.00	5680
				5117.4
	S-Notif			
	Rear end panel sealant	nr	50.00	✓
1set	Rear floor panel insulator	nr	300.00	100



BLUWEL AUTOMOTIVE SERVICE PTE LTD

Workshop: 1 Kaki Bukit Ave 6 (Unit B) #01-28
 (Unit C) #01-28-53/55 Singapore 417883
 Hp: 9755 2088 Tel: 6745 2088 Fax: 6841 2088
 Website: www.bluwel.com.sg Email: bluwel2088@yahoo.com.sg
 Co. Reg. No.: 200704951N
 GST Reg. No.: 200704951N

SIT 6549X

1st

Rear bumper sticker	MR	200.00	100
Rear licence plate w/holder	11	100.00	X
To check wiring		80.00	30
To transfer Booted mechanism		80.00	60
To Dismantle & replacing reverse sensor		80.00	50
To Dismantle & refix seat cushion upholstery		150.00	100
To Dismantle & refix rear exhaust		100.00	60
To Dismantle & refix rear windscreen	11	150.00	X
To conduct Chassis alignment	11	380.00	X
labour for panel beating, cut, weld & straighten		1800.00	1200
replacing parts		1500.00	1200
To putty & spray painting			
TOTAL		8151.80	00

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

BLUWEL AUTOMOTIVE SERVICE PTE LTD

Ref : CS/TP18010866/Uvbn2

BLK 1 KAKI BUKIT AVE 6
#01-28/51/53/55(MAIN OFFICE)SINGAPORE
417883

Date : 20-06-2018



ON BEHALF OF WIN MYINT

Code : TP149

1. Policy Particulars :- THIRD PARTY CLAIM

Insured Veh.	Veh. Inspected	SJT 6549X
Policy No.	Coverage (\$)	0.00
Claim No.	Excess (\$)	0.00
Assign From	Assign Date	14/06/2018

2. Vehicle Particulars & Condition

Make & Model	KIA CERATO FORTE (A)	c.c	1591
Engine No.	HIDDEN	Year of Reg.	2009
Chassis No.	KNAFW411MA5124209	Colour	GREY
Odometer	81633	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	215/45 R17	ROADSTONE	6 mm
L/H Front Tyre	215/45 R17	ROADSTONE	6 mm
R/H Rear Tyre	215/45 R17	ROADSTONE	6 mm
L/H Rear Tyre	215/45 R17	ROADSTONE	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE REAR PORTION. DAMAGES SEE DETAILS.
--

5. General Information

Accident Date	11/06/2018	Inspection Date	14/06/2018
Survey held at	BLUWEL AUTOMOTIVE SERVICE PTE LTD BLK 1 KAKI BUKIT AVE 6 #01-28/51/53/55(MAIN OFFICE) SINGAPORE 417883		

5a. Remarks

A)THE INSPECTION WAS CONDUCTED ON A"WITHOUT PREJUDICE" BASIS. B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE NOT AUTHORISED REPAIRS.
--

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	7 Working Days
-------------------------------------	----------------



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 2

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SJT 6549X

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	BOOTLID	BENT / BUCKLED	792.00	792.00
1	BOOTLID "CERATO" EMBLEM	NECESSARY	38.00	38.00
1	BOOTLID "FORTE" EMBLEM	NECESSARY	35.00	35.00
1	BOOTLID C&C LOGO	NECESSARY	39.00	39.00
1	BOOTLID INNER LOCK	TWISTED	115.00	115.00
1	BOOTLID WEATHERSTRIP	TWISTED	145.00	145.00
1	REAR BUMPER	DENTED / DEFORMED	695.00	695.00
1	REAR BUMPER LOWER GARNISH	DEFORMED / TWISTED	166.00	166.00
2	REAR BUMPER SIDE RETAINERS @\$45.00	BENT	90.00	90.00
1	REAR BUMPER CLIPS	NECESSARY	50.00	50.00
1	REAR BUMPER SPONGE	TORN	148.00	148.00
1	REAR BUMPER REINFORCEMENT	CRACKED	366.00	366.00
2	REAR BUMPER REINFORCEMENT BEAMS @\$105.00	BENT	210.00	210.00
5	REAR BUMPER REINFORCEMENT BRACKETS @\$20.00	TWISTED	100.00	100.00
4	REAR BUMPER ULTRASON SENSORS @\$240.00	SHORTED (2 PCS ONLY)	960.00	480.00
2	TAILLAMPS @\$305.00	CRACKED	610.00	610.00
2	TAILLAMP HOUSING PANELS @\$175.00	TO REPAIR SEE LABOUR	350.00	-
1	REAR END PANEL	BADLY DENTED	498.00	498.00
1	REAR END PANEL TOP GARNISH	TWISTED	185.00	185.00
2	REAR FENDERS @\$975.00	TO REPAIR SEE LABOUR	1,950.00	-
2	REAR FENDER INNER TRIMS @\$241.00	DEFORMED / TORN	482.00	482.00
1	REAR FLOOR PANEL	TO REPAIR SEE LABOUR	1,128.00	-
1	REAR FLOOR PANEL TOP BOARD	DEFORMED / TWISTED	362.00	362.00
1	REAR EXHAUST	TO REPAIR SEE LABOUR	622.00	-
1	REAR EXHAUST CHROME PIPE	BENT	80.00	80.00
	LESS 10% DISCOUNT		-	-568.60
			10,216.00	5,117.40

Report Ref No. CS/TP18010866/Uvbn2



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:2 of 2

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>SPECIAL NETT ITEMS</u>			
1	REAR END PANEL SEALANT (SN)	NECESSARY	50.00	50.00
1	SET REAR FLOOR PANEL INSULATOR (SN)	NECESSARY	300.00	120.00
1	SET REAR BUMPER STICKER (SN)	NECESSARY	200.00	100.00
1	REAR LICENCE PLATE W/HOLDER (SN)	NOT NECESSARY	100.00	-
			650.00	270.00
	<u>LABOUR</u>			
	TO CHECK WIRING.		80.00	30.00
	TO TRANSFER BOOTLID MECHANISM.		80.00	60.00
	TO DISMANTLE & REPLACING REVERSE SENSOR.		80.00	50.00
	TO DISMANTLE & REFIX SEAT,CUSHION UPHOLSTERY.		150.00	100.00
	TO DISMANTLE & REFIX REAR EXHAUST.		100.00	60.00
	TO DISMANTLE & REFIX REAR WINDSCREEN.	NOT NECESSARY	150.00	-
	TO CONDUCT CHASSIS ALIGNMENT.	NOT NECESSARY	380.00	-
	LABOUR FOR PANEL BEATING,CUT,WELD,STRAIGHTEN & REPLACING PARTS.INCLUSIVE OF THE REPAIR OF TAILLAMP HOUSING PANELS,REAR FENDERS,REAR FLOOR PANEL AND REAR EXHAUST.		1,800.00	1,200.00
	TO PUTTY & SPRAY PAINTING.		1,500.00	1,280.00
			4,320.00	2,780.00
	GRAND TOTAL		15,186.00	8,167.40
	RECOMMENDED COST OF LUMP SUM REPAIRS (TO ITS PRE-ACCIDENT CONDITION)			6,500.00

Report Ref No. CS/TP18010866/Uvbn2

CHUA KANG SENG

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report. No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.