

SURVEYOR COPY

**Ah Lim Motor Company
10 Ang Mo Kio Industrial
Park 2A**

**#01-09 AMK Autopoint
Singapore 568047**

Claim Reference: 3 PARTY CLAIM

Assessment Number: AH000861

Version: AHLIM001/1

Date Calculated: 13/07/2018 09:59

Full Report - V1

Registration: SLM9312E

Printed: 13/07/2018 17:00

LKK 1pm

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	Ahlim ahlim	Date of Incident:	
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	AXA Insurance S'pore Pte Ltd	Repairs Authorised:	TBA
Claim Reference:	3 PARTY CLAIM	Estimated Repair Time:	
Policy Number:		Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:	True	Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	MITSUBISHI
Model:	Attrage
Sub Model:	BASE MODEL
Model Sheet Number:	GAT 01
Registration:	SLM9312E
Registration Month:	April
Registration Year:	2017
VIN Number:	MMBSTA13AHH003935
Manufacture Year:	2016
Odometer:	Not Known
Colour:	
Engine Number:	3A92UDP3745
Fuel Level:	%

Model Specs

FROM 10/2015	FOG LAMPS
LED DAYT RUN LAMPS	1.2 LTR 59KW
CVT AUTOMATIC	TWO COAT METALLIC
PAINTING OFF VEHICLE	

*Not Authorised
1.13.1
Resurvey Bk pain
3 days*

Vehicle Condition

Vehicle Status

Pre-Accident Condition:
Steering:

Brakes Pedal Travel:
Place of Inspection:
Pre-Accident Damage:

Tyres Condition:
Tread Depth LHF:
Tread Depth LHR:
Damage Areas:

Severity of Impact:

Vehicle Status on

Inspection:

Date of Inspection: 13/07/2018

Tread Depth LHF:
Tread Depth LHR:
Direction of Impact:

**LKK Auto Consultants hence notify
the Repairer of the following:**

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- This prices are subject to confirmation
- This party survey is on a "Without Prejudice" basis
- In place modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Ah Lim Motor Company

Claim Reference: 3 PARTY CLAIM

Assessment Number: AH000861



Version: AHLIM001/1

Date Calculated: 13/07/2018 09:59

Full Report - V1

Registration: SLM9312E

Printed: 13/07/2018 17:00

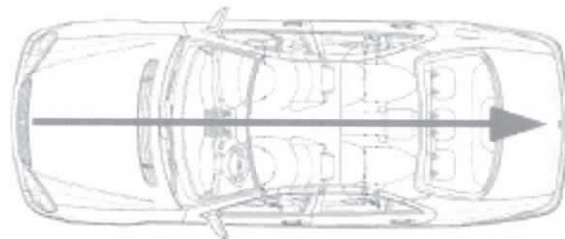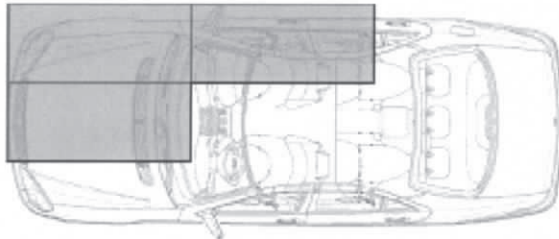

Addresses

Cost Summary

Total Labour	\$625.50
Total Paint/Material	\$139.97
Total Parts	\$2,750.80
Excess:	TBA
Grand Total Exc GST:	\$3,516.27
7 % GST:	\$246.14
Grand Total Inc GST:	\$3,762.41

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR
Price/Dent = \$45.00/HR

Repair /

Guide Number Repair Details

		WU	Cost Price (\$)
NO NUMBER	PREPARATION TIME	2.0	9.00
NO NUMBER	RENEW FR NUMBER PLATE	1.0	4.50
514110 00)	R + R FRONT BUMPER	4.0	18.00
514121 10)	R + R FRONT BUMPER ATTACHED PARTS	5.0	22.50
NO NUMBER	RENEW FRONT BUMPER REINFORCEMENT	8.0	36.00
	PART IS WELDED AND SCREWED		
541070 00)	R + R L/DAYTIME RUNNING LAMP	1.0	4.50
541070 00)	R + R R/DAYTIME RUNNING LAMP	1.0	4.50
541010 00)	R + R LEFT HEADLAMP	1.0	4.50
422022 10)	RENEW R/FR WING	8.0	36.00
	INCLUDES: R/HEADLAMP ASSY, WHEELARCH-TRIM RIGHT R + R		
NO NUMBER	ADJUST HEADLAMPS	2.0	9.00
1003	REPAIR R/RADIATOR BRACKET	10.0*	45.00
1009	REPAIR FRONT PANEL CPL	20.0*	90.00
1118	REPAIR R/F WHEELHOUSE	20.0*	90.00

LABOUR COST

Total Work Units	83.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	8.3HRS	\$373.50
Paint Labour	5.6HRS	\$252.00
Total Labour	13.9HRS	\$625.50

PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$45.00/HR

Guide Number Description	WU	Cost Price (\$)
--------------------------	----	-----------------

Ah Lim Motor Company

Claim Reference: 3 PARTY CLAIM

Assessment Number: AH000861

Version: AHLIM001/1

Date Calculated: 13/07/2018 09:59

Full Report - V1

Registration: SLM9312E

Printed: 13/07/2018 17:00

	- TWO COAT METALLIC		
	- PAINTING OFF VEHICLE		
742	R/F WING NEW PART PAINTING	10.0	
283	FRONT BUMPER NEW PART PAINT K1R	14.0	
1003	R/RADIATOR BRACKET SURFACE PAINT	4.0	
1009	FRONT PANEL CPL SURFACE PAINT	6.0	
1118	R/F WHEELHOUSE SURFACE PAINT	6.0	
LABOUR COST - PAINT			
	TIME(PAINT)	40.0	
	Preparation Main Work Metal	11.0	
	Preparation Comp. Work Plastic	5.0	
	Preparation Work Multi Layer Paint	0.0	
	Total Work Units (10WU/HR)	56.0	
	Total Paintwork Labour	5.6HRS	\$252.00
MATERIAL COST - PAINT			
	New Part Painting		Cost Price
	New Part Painting - Plastic K1R		\$19.61
	Surface-/Blend Paint		\$69.86
	Material-Const Main Work Metal		\$23.40
	Material-Const Comp. Work Plastic		\$18.10
	Total Excluding Pearlescent Uplift		\$9.00
	Pearlescent Uplift @ 0.0%		\$139.97
	Total Paint Material Cost		\$0.00
			\$139.97

PARTS

					Price Valid: 01/06/2015	
Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
257	1	FRONT NUMBER PLATE	KNPL3		0%	35.00* X
283	1	FRONT BUMPER	6400H293		0%	390.00* ✓
318	1	R/F UPP BUMPER BRKT	6400F222		0%	10.00* 7
340	1	FRT BUMPER REINF	5256B727		0%	120.00* 7
350	1	FRT BUMPER MNTG KIT	USE SINGLE PARTS		0%	24.00* 7
411	1	LWR RADIATOR GRILLE	6402A268		0%	110.00* X
415	1	GRILLE	6402A300		0%	280.00* ✓
561	1	L/F HEADLAMP	8301C545		0%	300.00* X
562	1	R/F HEADLAMP	8301C546		0%	300.00* ✓
648	1	R/F FOG LAMP	8321A365		0%	220.00* X
651	1	L/DAYT RUNNING LAMP	SEE GUIDE NO. 0650		0%	80.00* X
652	1	R/DAYT RUNNING LAMP	SEE GUIDE NO. 0650		0%	80.00* X
742	1	R/F WING	5220H942		0%	250.00* X
790	10	R/F WING CLAMP KIT	MS100222		0%	20.00* X
842	1	R/F WHEELHOUSE COVER	5370B890		0%	75.00* X
1000	1	FRONT GRILLE CLPX10	Renew		0%	20.00* ✓
1000	1	H LAMP LOW BEAM LH	Renew		0%	10.00* X
1000	1	H LAMP LOW BEAM RH	Renew		0%	10.00* 7
1000	1	H LAMP CLIPS X4	Renew		0%	8.00* 7
1000	1	F FENDER LGO ECO RH	Renew		0%	0.00 X
1000	1	F FEN SIG OT CHRO RH	Renew		0%	50.00* X
f: OEM Parts						\$2,392.00
g: Original						\$358.80
h: Secondhand						\$2,750.80
p: Parallel						
Sub Total						
Mark Up From Cost (15 %)						
Total Parts						

Ah Lim Motor Company

Claim Reference: 3 PARTY CLAIM

Assessment Number: AH000861

Version: AHLIM001/1

Date Calculated: 13/07/2018 09:59

Full Report - V1

Registration: SLM9312E

Printed: 13/07/2018 17:00

x: Exchange

**THIS ASSESSMENT CONTAINS UNPRICED PARTS
NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER**

Total Extras

\$0.00

Final Calculation

Total Parts **\$2,750.80**

Labour

Total Panel/Mechanical

\$373.50

Total Paintwork

\$252.00

Total Labour

\$625.50

Total Paint/Material Costs

\$139.97

Grand Total Excludes GST

\$3,516.27

GST @ 7 %

\$246.14

Grand Total Includes GST

\$3,762.41

Assessment Notes