

ASS. REC. BY

REF

CS/ASM18015934/L

Rep 3

Special Instruction

Surveyor

Mr. Lau

ASSIGNMENT (Office)

From (Person)

Yvonne Ang Theng

ASM(CXA)

Date/Time

29/08/2018

Estimated Cost

Bill to

OD TP/WS/TP RES/OD RES/EVA/INV/MV/CS

To Inspect Vehicle No

SGV 222L

Insured

at Workshop m/s

Itai Auto
30 Leng Kee Road

Tel

64751118

Policy No

Claim No

S8M007P3

Sum Insured

Excess

\$ 20,000.00

Make of Veh

D.O.A

08/08/2018

(Client's Record)

CA / REV

REP. / REV 24 HRS

H.O.D. Endorsement

Date/Time

12:24pm @ 29/8/18

Person Contacted

Pauline

Vehicle

IN/OUT

Date/Time	Action/Instruction (✓) Estimate
	SGV 222L-X
	29/8/18 - wksp in-charge person not around; 30/8/18 MC.
03/9/18 @	4.40pm revert to Yvonne Ang via Smart Claim.
28/9/18	Submit Unconsequential Total Loss Report.

(08/1/13) *Wol
ASS. REC. BY: *Paul*

REF: ASM(AXA)

62128

call Mr. Lau at 2.55pm.

ASSIGNMENT

COE XPRY: 2021/NOV

Front Date: 31/08/18

Estimated Cost:

☒ TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No:

SGY 222L

at Workshop m/s

Itai Auto

of

30 Leng Kee Road

Insured:

Policy No.

Claims No.

Sum Insured:

Excess: \$20,000.00

(Client's Record)


- 3pm

Make of Veh:

Shane pascoe.

(Policy Condition)

Remark: The veh had commenced its
repair at the time of inspection.

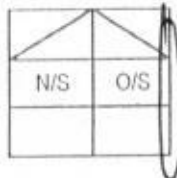

Bal. or Market Value:

370K

IDAG Accident Rpt:

Consistent? : Yes or No

GIA / PR Seen:

Consistent? : Yes or No

Est. Repairs:

days Res.: Yes or No

Lum Sum:

% 3 Val.: Yes or No

CA / ☒ REV / REP. / 24 HRS

Vehicle: IN / OUT

Date:

Person Contacted:

Veh No: SGY 222L

Yr Regn: 2011 / NOV

Type: ☒ M.Cycle / Bus / Van / Lorry / Taxi / Prime Mover /

Truck / Trailer or

Make:

FERRARI CALIFORNIA 4.3 A c.c. 4297

Colour

Red

A/C: Insured / Std / NI / NA

Sp. Reading

56406

T/Radio: Insured / Std / NI / NA

Eng/No:

C/No:

2FFL65C000183579

Gen. Cond: Good / ☒ Fair / Poor / Burnt

Steering: ☒ Inorder / Jammed / Leaked / Burnt or

Brake: ☒ Inorder / Jammed / Leaked / Burnt or

Modi: Nil / ☒ S/Rim / STD A/Rim or

Tyre Size:

F: 245/35Z R20

R:

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU ☒ PIR / SUMI /

TOYO / YOKO or

Front

Rear

R/Bal.

6 mm

R/Bal.

6 mm

L/Bal.

6 mm

L/Bal.

6 mm

D.O.A.

08/08/18

D.O.I.

31/08/18

Survey held at

ITML

Des. of Damages: Frt / Rear / ☒ N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time

Action / Instruction

03/09/18

Vehicle is uneconomical to repair. Recommended total loss

RECEIVED 20 SEP 2018

Date/Time, File Pass to?

☐

: Preli. Report

1) 28/9 2018

☐

: Final Report

Date/Time, File Return to?

2)

Days Of Repair:

Resurvey No. of Trip:

Add Fee:

☐

: Site Insp (\$

☐

: Interview (\$

☐

: Tech. Invs (\$

☐

: Weekend (\$

Report Format :

Smart Claim - TL - U

Lump Sum / I.B.I: (\$

Survey Fee:

300

Transportation:

) \$ + RS, \$

) Photos

) Others

TOTAL

Service Request Details

Claim

S8M00TP3

Reference

None 

Loss Date

August 8, 2018

Request Date

August 29, 2018

Due Date

September 5, 2018

Vendor Name

LKK AUTO CONSULTANTS PTE LTD (OD)

Type of Loss

Own Damage

Services

Accelerated workshop survey

Actions

Next Step

Agree to perform service

Vehicle Information

Incident Vehicle Registration #

SGY222L

Make

FERRARI CALIFORNIA 4.3L A/T

Model
FERXXX

Service Address

...

Primary Contact/Insured

CHUA LI JIN (CAI LI JIN)
35 JALAN REMAJA, 668695, Singapore

DIYAISCUTE@HOTMAIL.COM

Claim Handler

ANG Yvonne
6568804461
yvonne.ang@axa.com.sg

Additional Instructions

EXCESS 20,000 PENDING INVESTIGATION REQUEST MR LAU TO SURVEY THE VEHICLE

[Messages](#)[Invoices](#)[History](#)[Documents](#)[Assessment](#)[Metrics](#)[Notes](#)[New Message](#)

DHAKAL Raghav

From: Shane Pascoe <shanepascoe@italauto.com.sg>
Sent: Tuesday, August 28, 2018 5:00 PM
To: SG AXA Insurance SM AXA SGP - Motor Survey
Cc: Pauline Neo May Fong
Subject: ACCIDENT OD CLAIM SGY222L
Attachments: GIA REPORT.PDF; PART LIST California - SGY222L - VIN-183579 (3).pdf; SGY222L AXA ACCIDENT QUOTATION 130717.pdf

Categories: Raghav

Dear Claims officer,

OD claim involving you insured.

Best regards,

Shane Pascoe
Service Advisor



OFFICIAL FERRARI IMPORTER SINGAPORE

Ital Auto Pte Ltd

Ital Auto Pte Ltd 30 Leng Kee Road Singapore 159100

M (+65) 92777057

T (+65) 64751118 Ext 513 F (+65) 64743336

E shanepascoe@italauto.com.sg

W www.italauto.com.sg | facebook.com/Ferrari | twitter.com/Ferrari | instagram/Ferrari



RE: MECHANICAL ISSUE - URGENT

Type

🔍 Question

Message

Dear Yvonne, according to our surveyor that is no mechanical issue found at the time of inspection. - Shiau Chan

Reply



MECHANICAL ISSUE - URGENT

Type

🔗 Question

Message

Please advise any mechanical issue upon survey the vehicle

Reply



POLICY BASED ON SUM INSURED \$365,000

Type

🔔 Question

Message

PLEASE TAKE NOTE ABOVE SUM INSURED

Reply



Auto
Consultants
Pte Ltd

51 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Immediate Advice

To : AXA Insurance Pte Ltd

Date: 03/09/18

Survey Details:

Date of loss	8-Aug-18
Date of appointment	29-Aug-18
Date of survey	31-Aug-18
Location of survey	ITAL AUTO

Vehicle Details:

Claim Type:	Own Damage
Vehicle number	SGY 222L
Make and Model	FERRARI CALIFORNIA 4.3L A/T
Date of registration	11/11/2011
Excess	\$ 20,000.00
Market Value	\$ 370,000.00
Parf Rebate	\$ 196,091.00
Nett Loss	\$ 173,909.00

Repair details:

Initial Estimate	\$ 328,458.50
------------------	---------------

Proposed/Revised repair cost:

Parts	\$ 214,373.20
Check items (estimate)	\$ 27,166.43
Labour	\$ 76,600.00
Total	\$ 318,139.63
Lump Sum(if applicable)	\$

Number of days for repair	<u>45</u>
---------------------------	-----------



Auto
Consultants
Pte Ltd

51 UBI AVE 1, #01-25 PAYA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563561 FAX : (065) 62564315

Remarks:

DAMAGES CONSISTENT. REPAIR COST NOT ECONOMICAL.
WE HAVE NOT AUTHORISE REPAIR.

Mandate:

Liability(TP)	%	
Proposed repair cost	\$	
Loss of use	\$	no. of days
Loss of rental	\$	no. of days
Loss of income	\$	no. of days
LTA search fees	\$	
Others	\$	
Proposed Total	#VALUE!	

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	08/08/2018 16:44
Date Of Accident	08/08/2018 04:30
Exact Location Of Accident	BKE TOWARDS UPPER BUKIT TIMAH
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SGY222L
Insured/Policyholder	
Name Of Registered Owner	CHUA LI JIN (CAI LI JIN
NRIC No	S8916212B
Email Address	DIYAISCUTE@HOTMAIL.COM
Mobile Phone No	(LOCAL) +65-86882666
Alternative Phone No	OFFICE-92777057

Vehicle Particulars

Manufacturer	FERRARI
Model	CALIFORNIA-4.3 (A)
Exact Purpose for which vehicle was being used at time of accident	TRANSPORTATION
Are you claiming under your own insurance policy for repair to your vehicle?	YES
If No, Please state action to be taken	
Vehicle Category	PRIVATE CAR

Insurance Company

Name of Insurance Company	AXA INSURANCE PTE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	P2014613
Cover Note Number	CN000521

Driver

Name of Driver	CHUA LI JIN (CAI LI JIN
NRIC No	S8916212B
Date Of Birth	12/05/1989
Occupation	INDOOR
Date Of Driving Pass	01/09/2014
Driving Experience	3 YEARS AND 11 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-86882666
Fax Number	
Contact Number	OFFICE-92777057
Email Address	DIYAISCUTE@HOTMAIL.COM

Address BLK 525 JELAPANG ROAD

Postcode

Was driver an employee of the Insured's Company NO

If No, Relationship of the Driver with the Insured OWNER

Vehicle Registration Number of Driver's Own Vehicle -

Insurance Company of Driver's Own Vehicle -

General Information of the Accident

Type Of Accident SIDE SWIPE

Weather Conditions CLEAR

Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident? NO

Number of vehicles involved in the accident

Was any body injured in the Accident? NO

Was any injured conveyed to hospital by ambulance?

Was any other material or property damaged? NO

I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO

Number of Passengers (Including Driver) 1

Details of Police Action

Was the accident reported to the police? YES

If Yes, Please state which Police Station

Police Station Name TRAFFIC POLICE DIVISION HQ

Police Station Address ROAD: 10 UBI AVENUE 3 , POSTCODE: 408865 , COUNTRY: SINGAPORE

Police Station Contact TEL NO: 65470000 - FAX NO:

Was notice of intended Prosecution given? NO

If Yes, against whom?

Circumstances of Accident

LAST NIT WEDNESDAY, 8 AUG 2018 AT AROUND 4.30AM I WAS DRIVING ALONG BKE TOWARD UPPER BUKIT TIMAH, 1 HAPPEN TO SKID AND BANG INTO THE DIVIDER.

Attachment(s)

Are accident photos available for attachment? YES

Was there any video captured by Car Camera? YES

Was there any audio recorded? NO

Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE

1. Please report **correctly** the details of the accident to speed up the claims process.
2. This Form must be **completed by the Policyholder and/or the Authorised Driver**.
3. Information provided must be as **truthful and accurate as possible**. Any wilful misrepresentation or withholding of material facts may allow insurance companies to **repudiate policy liability**.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

Sketch Plan

Describe Circumstances of the Accident

at around 4.30 am
Last night, Wednesday, 8 August 2018, I was driving along
Bike towards upper Bukit Timah, I happen to skid and
bang into road divider.

Declaration

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature / Date & Time

Driver's Signature (If driver is not the policyholder) / Date & Time

Witnessed by Reporting Centre Personnel

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	6212B
Vehicle Details	
Vehicle No.:	SGY222L
Vehicle to be Exported:	No
Intended Deregistration Date:	03 Sep 2018
Vehicle Make:	FERRARI
Vehicle Model:	CALIFORNIA 4.3L A/T ABS D/AB 2WD 2DR HID
Primary Colour:	Blue
Manufacturing Year:	2011
Engine No.:	178478
Chassis No.:	ZFFLJ65C000183579
Maximum Power Output:	338.0 kW (453 bhp)
Open Market Value:	\$270,798.00
Original Registration Date:	11 Nov 2011
First Registration Date:	11 Nov 2011
Transfer Count:	3
Actual ARF Paid:	\$270,798.00
Intended PARF Rebate Details	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	10 Nov 2021
PARF Rebate Amount:	\$176,018.00
Intended COE Rebate Details	
COE Expiry Date:	10 Nov 2021
COE Category:	E - Open Category
COE Period(Years):	10
QP Paid:	\$65,589.00
COE Rebate Amount:	\$20,073.00
Total Rebate Amount:	\$196,091.00

The information contained herein is correct as at 03 Sep 2018

OK

370,500
196,091

173,909

REPUBLIC OF SINGAPORE
IDENTITY CARD NO. S8916212B



Name

CHUA LI JIN
(CAI LIJIN)

蔡立锦

Race

CHINESE

Date of birth

12-05-1989

Sex

M

S8916212B

Country of birth

SINGAPORE

DRIVING LICENSE



DRIVING LICNESE

LI JIN (NIN)

8916212B


GAPORE



YOU ARE LICENSED TO DRIVE VEHICLES IN THE FOLLOWING CL


EFFECTIVE

Class 3 Motor Cars= $\leq$ 3000kg with $\leq$ 7 passengers, exclusive of the driver; and other motor vehicles $\leq$ 2500kg 01 Sep 2014



Licence No: S8916212B

3539185

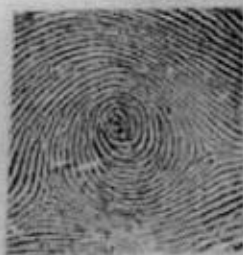

NRIC No. **S8916212B**

Date of issue
18-05-2004

Address
**APT BLK 525 JELAPANG ROAD
#06-113
SINGAPORE 670525**

COVER NOTE

AXA INSURANCE PTE LTD

6 Shenton Way, #24-01
AXA Tower, Singapore 069811
Customer Service Centre #81-01
Tel: 6338 7288 Fax: 6338 2522
Website: www.axa.com.sg
GST Registration Number: 199903512M

**Original**Agent Code: **15423**Policy No. (if any): **P2014613****Extension with Premium**

SmartDrive Quote Ref:

MOTOR COVER NOTENo. **CN000521**

- The Motor Vehicle (Third Party Risks and Compensation) Act (Cap 189) - Republic of Singapore; or
- The Road Transport Act 1987 of Malaysia; or
- The Agreement between the Minister of Finance (Singapore) and the Motor Insurers' Bureau of Singapore dated 22 February 1975; or
- The Agreement between the Minister for Transport (Malaysia) and the Motor Insurers' Bureau of West Malaysia dated 30 March 1992;
- And any subsequent revisions to the above Acts and Agreements

The Insured mentioned in the Schedule, having proposed for insurance in respect of the Motor Vehicle described in the Schedule, is hereby HELD COVERED under the terms of the Company's usual form of Motor Policy applicable thereto for the period mentioned in the Schedule unless the cover be terminated by the Company by notice in writing in which case the insurance will thereupon cease and a proportionate part of the annual premium otherwise payable for such insurance will be charged for the time the Company has been on risk.

SCHEDULE

THE COMPANY	AXA INSURANCE PTE LTD
INSURED	CHUA LI JIN (CAI LI JIN)
MAKE AND DESCRIPTION OF VEHICLE	FERRARI CALIFORNIA 4.3L A/T
VEHICLE REGISTRATION NO.	SGY222L
YEAR OF MANUFACTURE	2011
ENGINE NO.	178478
CHASSIS NO.	ZFFLJ65C000183579
ENGINE CAPACITY/TONNAGE	4297 CC
COVER TYPE	COMPREHENSIVE
HIRE PURCHASE	NIL
VALUE (\$)	S\$365000
PERIOD OF INSURANCE	FROM: 26/10/2018 TO: 10/11/2018
EXCESS (\$)	AS PER POLICY
AXA PREMIUM WORKSHOP?	NO

I/WE HEREBY CERTIFY THAT POLICY TO WHICH THIS CERTIFICATE RELATES IS ISSUED IN ACCORDANCE WITH THE PROVISIONS OF THE MOTOR VEHICLES (THIRD-PARTY RISK AND COMPENSATION) ACT (CHAPTER 189) AND PART IV OF THE ROAD TRANSPORT ACT 1987 (MALAYSIA).

AXA INSURANCE PTE LTD

Authorised Signature

Issued by Seelam RAJ on 09/05/2018 4:55 pm

Note: This Cover Note is only valid for 60 days from the date of issue unless replaced by the Certificate of Insurance issued by the Company.

- Premium for time on risk will be charged subject to minimum of S\$53.50 (inclusive of GST), if the policy is cancelled after the inception date.
- An administrative fee of S\$26.75 (inclusive of GST) will be charged :
 - Cover note issued and cancelled before inception.
 - Retaining the old registration number for a new vehicle insuring with AXA.

PREMIUM WARRANTY

For Individual Customers:


Please note that the premium in full should be paid before inception date shown above in order for the insurance cover to be valid.

For Non-Individual Customers:

Please note that where the period of cover is for more than 60 days, the premium in full should be paid within 60 days on inception / renewal / endorsement. For all other cases, the premium in full should be paid before inception.

NTR/CNOTE/01/03

Accident Photo

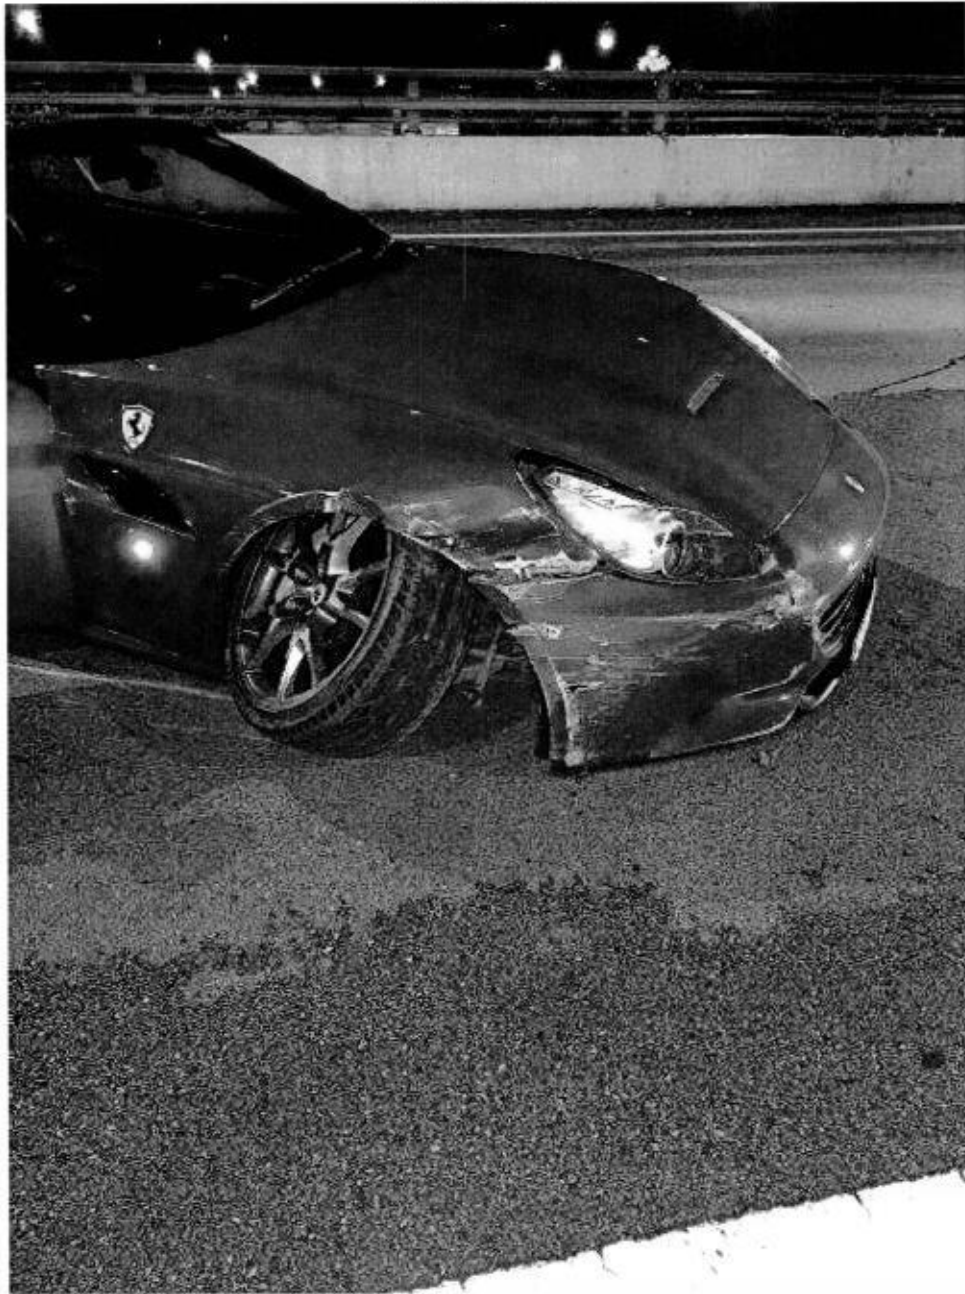



OFFICIAL FERRARI IMPORTER SINGAPORE

Ital Auto Pte LtdLKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to confirmation from Insurance Company

Date: 28-Aug-18

QUOTATION

To: AXA INSURANCE SINGAPORE PTE LTD
8 Shenton Way #27-01/02 AXA Tower
Singapore 068811

Tel: 6338 7288 Fax: 68804838
email:

Acknowledged by Repairer
Our Ref: 183579
Signature: SGY222L
Date: Reg. No
Model: CALIFORNIA
VIN: 183579
Mileage: 45457
Terms: INSURANCE

Item	Description	Qty	Unit Price Excl. GST	Line Discount	Line Amount Excl. GST
------	-------------	-----	-------------------------	---------------	--------------------------

LABOUR

40 DAYS

L	REMOVE AND REPLACE DAMAGED PARTS AND ACCESSORIES- FRONT BUMPER, REAR BUMPER, HEADLIGHTS, RIGHT TAIL LIGHT, RIGHT SIDE MIRROR, RIGHT DOOR TRIM PANEL, AIRBAG, RIGHT FRONT SUSPENSION AND SHOCK COMPONENTS, STEERING RACK AND RIGHT BRAKE COMPONENTS, FRONT AIR DUCTS, UNDERBODY SHIELDS AND WHEEL HOUSE, WHEEL AND TYRES. TO CUT AND WELD BODY REPAIR AND REPLACE FRONT CROSS MEMBER FRONT LEFT AND RIGHT UPPER SPRAG, FRONT RIGHT FENDER AND BRACKET, RIGHT REAR FENDER, REMOVE ROOF AND INTERIOR FOR REPAIR	35 40	\$ 1,920.00		\$ 67,200 76,800.00
---	--	----------	-------------	--	------------------------

L	RESPRAY PAINT - FRONT BUMPER, REAR BUMPER, RIGHT FRONT FENDER, RIGHT REAR FENDER, BONNET, SIDE MIRROR, INTERNAL STRUCTURES,	7	\$ 1,200.00		\$ 8,400.00
---	---	---	-------------	--	-------------

Sub Total \$ 85,200.00
Total Amount Include GST: \$ 91,164.00

PARTS

P REFER TO PARTS LIST

TYRES

TYRES ADDITIONAL \$1000

\$ 91,900.82 \$ 243,258.50
Sub Total \$ 243,258.50
Total Amount Include GST: \$ 260,286.60

Grand Total before Tax: \$ 328,458.50
Grand Total Including GST: \$ 351,450.60

This is an estimate only and does not represent a contract for services. This estimate is based on the scope of the work to be completed for the job as described above. This estimate is based on our evaluation of the requirements necessary to complete the job and does not include material price increases or additional labor and material which may be required should unforeseen problems arise after the work has started. This quotation is valid for thirty (30) days only.

S/N	TABLE	Ref.	Description	Qty	U/PRICE	E/PRICE	REMARKS
1	0009	1	FUEL VAPOUR FILTER ?	1	655.57	655.57	
2	0009	16	VAPOR FILTER COVER ?	1	153.74	153.74	
3	0010	7	RH BRACKET PA	1	873.2	873.2	
4	0014	1	COMPL. AIR DUCT CPA	1	4040.77	4040.77	
5	0039	4	COMPLETE R.H. FRONT CALIPER - yellow cut	1	7916.37	7916.37	
6	0039	7	RH BRAKE PIPE cut	1	109.71	109.71	
7	0039	8	CLIP ne	2	2.1	4.2	
8	0039	9	RUBBER PIPE cut	2	210.82	421.64	
9	0039	10	CLIP ne	2	6.59	13.18	
10	0042	1	RACK TYPE STEERING BOX BPO	1	11817.8	11817.8	
11	0042	33	NUT ne	2	1.37	2.74	
12	0042	34	WASHER ne	2	1.81	3.62	
13	0044	3	BALL JOINT ne	1	298.3	298.3	
14	0044	17	COMPL. FRONT SHOCK ABSORBER - cut	1	6720.75	6720.75	
15	0045	1	UPPER RH ARM cut	1	2084.54	2084.54	
16	0045	2	COMPL. LOWER RH FRONT ARM - cut	1	2377.92	2377.92	
17	0045	3	COMPL. RH FRONT HUB CARRIER PA	1	5453.8	5453.8	
18	0045	10	NUT ne	2	3.11	6.22	
19	0045	11	WASHER ne	2	1.78	3.56	
20	0045	12	NUT ne	2	8.1	16.2	
21	0045	13	WASHER ne	2	21.16	42.32	
22	0048	1	FRONT WHEEL RIM 20" -SPORT- cut	1	5547.78	5547.78	
23	0048	1	REAR WHEEL RIM 20" -SPORT- cut	1	5991.61	5991.61	
24	0100	2	R.H. BRAKE AIR INTAKE FIXING PA	1	2000.22	2000.22	
25	0100	6	COMPL. RH HEADLIGHT TUB BPO	1	1003.73	1003.73	Request ASM authorisation
26	0100	8	COMPLETE R.H. FRONT FENDER LINKAGE BRACKET PA	1	373.7	373.7	Request ASM authorisation
27	0100	14	CPL. RH. FRONT MODGUARD -Scuderia pne	1	11569.9	11569.9	
28	0100	25	RH STIFFENER CROSS MEMBER. PA	1	49.58	49.58	
29	0100	28	HEADLIGHT MOUNTING BRACKET PA	2	15.43	30.86	
30	0100	30	RIVET -3.9 x 5.5- ne	100	1.7	170	
31	0100	30	RIVET -3.9 x 5.5- ne	100	1.7	170	
32	0100	30	RIVET -3.9 x 5.5- ne	100	1.7	170	

33	0100	30	RIVET -3.9 x 5.5-	na/		100	1.7	170	
34	0100	30	RIVET -3.9 x 5.5-	na/		100	1.7	170	
35	0100	30	RIVET -3.9 x 5.5-	na/		100	1.7	170	
36	0102	8	COMPLETE R.H. LATERAL PANEL	PA/		1	30395.24	30395.24	Request ASM authorisation
37	0106	2	COMPL. UPPER FRONT CROSS MEMBER	?		1	8428.6	8428.6	Request ASM authorisation
38	0106	5	L.H. UPPER SPRAG FRONT BRACKET	?		1	1138.76	1138.76	Request ASM authorisation
39	0106	5	R.H. UPPER SPRAG FRONT BRACKET -	?		1	1138.76	1138.76	Request ASM authorisation
40	0106	6	LH UPPER STRUT	?		1	4625	4625	Request ASM authorisation
41	0106	6	RH UPPER STRUT	?		1	4625	4625	Request ASM authorisation
42	0106	16	L.H. FRONT PILLAR CRASH BOX	?		1	3200.5	3200.5	Request ASM authorisation
43	0106	16	R.H. FRONT PILLAR CRASH BOX	?		1	3200.5	3200.5	Request ASM authorisation
44	0112	1	FRONT SECTION OF FRONT FLAT UNDERFLOOR	CR4/		1	1203.77	1203.77	
45	0112	3	FRONT AERODYNAMIC BOTTOM CENTRAL PART	CR4/		1	1176.6	1176.6	
46	0112	7	COMPL. REAR FLAT UNDERTRAY SECTION -Standard	CR4/		1	1239.19	1239.19	
47	0113	1	FRONT GRAVEL GUARD FOR RH FRONT WHEELHOUSE	TORN/		1	705.07	705.07	
48	0113	3	FRONT GRAVEL GUARD FOR R.H. REAR WHEEL	TORN/		1	705.07	705.07	
49	0113	9	REAR GRAVEL GUARD FOR R.H. REAR WHEEL	DE/		1	990.12	990.12	
50	0114	1	COMPLETE FRONT BUMPER	TORN/		1	12746.5	12746.5	
51	0114	2	FRONT SPOILER -	SCR-/		1	2509.54	2509.54	
52	0114	3	FRONT BUMPER GRILL	DB/		1	5610.07	5610.07	
53	0114	6	R.H. BRAKE AIR INTAKE	CR4/		1	159.1	159.1	
54	0114	26	CLIP	na/		16	2.95	47.2	
55	0115	1	COMPL. REAR BUMPER	DB/		1	14945.53	14945.53	
56	0115	2	REAR BUMPER SPOILER -	SCR-/		1	2644.75	2644.75	
57	0115	3	FIN -	SCR-/		2	1213.48	2426.96	
58	0115	13	RH BRACKET	na/		1	276.69	276.69	
59	0122	1	ACTIVE ROLLBAR	ACT-/		1	13693.7	13693.7	
60	0127	16	GASKET	na/		1	750.06	750.06	
61	0127	17	STRIKER PLATE	PA/		1	120.92	120.92	
62	0127	20	LID LOCK	PA/		1	456.62	456.62	
63	0130	8	COMPL. RH DOOR TRIM PANEL	TORN/		1	13496.03	13496.03	
64	0130	10	RH OUTER PANEL -	TORN/		1			ModisCS No data & price
65	0130	24	ANTIVIBRATION	na/		2	476.04	952.08	

66	0132	1	COMPLETE R.H. OUTER REAR VIEW MIRROR	PRG ✓	1	2349.51	2349.51	
67	0132	4	COMPL. LH EXTERNAL REAR VIEW MIRROR GLASS	PRG ✓	1	87.73	87.73	
68	0134	27	SCREW - M8 X 25-	NE ✓	6	4.63	27.78	
69	0141	5	ROLL OVER CONTROL UNIT	ACC ✓	1	2027.97	2027.97	
70	0141	13	DOOR AIR-BAG CABLE	NE ✓	2	118.84	237.68	
71	0141	14	RH HEAD AIRBAG	ACC ✓	1	1415.58	1415.58	
72	0141	14	LH HEAD AIRBAG	X	1	1415.58	1415.58	
73	0141	16	RH BRACKET	NE ✓	1	303.29	303.29	
74	0141	16	LH BRACKET	X	1	303.29	303.29	
75	0142	3	SATELLITE CRASH SENSOR	ACC ✓	2	159.8	319.6	
76	0144	1	R.H. FRONT HEADLIGHT	CRG ✓	1	14719.87	14719.87	
77	0144	2	L.H. FRONT HEADLIGHT	CRG ✓	1	14719.87	14719.87	
78	0144	8	LATERAL TURN INDICATOR	SCA ✓	1	103.31	103.31	
79	0145	1	R.H. REAR LIGHT FIXED SIDE	CRG ✓	1	1015.98	1015.98	
						SS	243258.5	

<< Service Request Details

Claim	S8M00TP3	Document Type	
Reference			
CS/ASM18015934/LR1qd3s2	Loss Date	Document SubType	
August 8, 2018	Request Date		
September 5, 2018	Due Date		
November 29, 2018	Vendor Name		
LKK AUTO CONSULTANTS PTE LTD (OD)	Type of Loss		
Own Damage	Services		
Accelerated workshop survey			
Vehicle Information			
Incident Vehicle Registration #	SGY222L	Service Address	
Make	FERRARI CALIFORNIA 4.3L AT	Model	...
Primary Contact/Insured	FERXXX		
	CHUA LI JIN (CAI LI JIN)		
	35 JALAN REMAJA, 668695, Singapore		
	DYVASCUTE@HOTMAIL.COM		
Claim Handler			
	KHOR Saw Theng		
	6568804754		
	sawtheng.khor@axa.com.sg		
Additional Instructions			
EXCESS 20,000 PENDING INVESTIGATION REQUEST MR LAU TO SURVEY THE VEHICLE			
NAME	TYPE	SUB-TYPE	AUTHOR
			DATE UPLOADED
		Messages	Invoices
		Assessment	History
			Documents
			Metrics
			Notes

<< Assessment Details

General & Workshop Details	Vehicle & Driver Details	Vehicle Condition	Taxes & Ratio	Parts & Labour	Miscellaneous	Summary
General Details						
Involving	1 2011 FERRARI CALIFORNIA 4.3L A/T FERXXX (SGY222L)					
Date of Loss	August 8, 2018					
Time of Loss	4:30					
Loss Description	SGY222L (INSD) SKIDDED					
Comment	EXCESS: 20000					
Workshop Details						
Total Rebate Amount	196091					
Nett Loss Amount	\$173,909.00					
Assigned Workshop	LKK AUTO CONSULTANTS PTE LTD (ODI)					
Days of work completion *	7					

Assessment Details

General & Workshop Details Vehicle & Driver Details Vehicle Condition Taxes & Ratio Parts & Labour Miscellaneous Summary

Vehicle & Driver Details

Vehicle Registration# SGY222L Purchase Date mm/dd/yyyy

Registration State SINGAPORE Registration Date * 11/11/2011

Mileage 56406 Age of Vehicle 6

Driver Details

CATEGORY	POLICY INFORMATION	ASSESSMENT INFORMATION	CATEGORY	PNOL INFORMATION	POST SURVEY INFORMATION
Manufacturing Year	2011				
Make	FERRARI CALIFORNIA 4.3L A/T	FERRARI	Driver Name	CHUA LI JIN CAI LI JIN	
Model	FERRARI	CALIFORNIA 4.3L A/T A	Date of Birth	May 12, 1989	mm/dd/yyyy
Type			Age	29	
Type of Paint			Occupation	Unknown	
Chassis No	ZFFLJ65C000183579	ZFFLJ65C000183579	Education Qualification	Other	
Engine No	178478	178478	Driving Experience	0	
Engine Capacity		4297 cc	Driver License #		

Assessment Details

- General & Workshop Details
- Vehicle & Driver Details
- Vehicle Condition
- Taxes & Ratio
- Parts & Labour
- Miscellaneous
- Summary

Detailed Assessment

Inspection Date *

08/31/2018

Total Loss

Yes

No

Towing Charges

0

Voluntary Excess

0

Compulsory Excess

0

Young/Inexperienced/Unlicensed Driver Excess

0

Other Excess

Condition of Vehicle at time of survey

General condition

Fair

Steering (Serviceable)

Yes

No

Footbrake (Serviceable)

Yes

No

Handbrake (Serviceable)

Yes

No

Engine Modification

Yes

No

Pre-accident condition

Good

Tyre Condition

Age of Tyres

Front Tyre Size

245/35ZR20

Front left side

PIRELLI 6mm

Front right side

PIRELLI 6mm

Spare wheel

Rear Tyre Size

245/35ZR20

Rear left side

PIRELLI 6mm

Rear right side

PIRELLI 6mm