

ASS. REC. BY:

REF:

CS/MSG/8010573/Rtd307

Special Instruction:

Sub. V. of
menmen

ASSIGNMENT (Office)

From (Person): Monica chung

of

MSG

Date/Time: 11/9/18 @ 4:06pm

Estimated Cost:

Bill to:

OD (TP) WS / TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No: SHB 8491 H

Insured:

SKX2098Z

at Workshop m/s

Premier taxis

Tel:

65446689

of 23 Chengji South Ave 2 # 03-02

Policy No: 80454195QMX

Claim No:

569784

Sum Insured:

Excess:

Make of Veh:

(Client's Record)

D.O.A.

09/09/18

CA / REV / REP. / REV 24 HRS

'up'

12/09/18

H.O.D. Endorsement:

Date/Time: 5:12pm @ 11/9/18

Person Contacted:

Vincent

Vehicle IN OUT

Date/Time

Action/Instruction (✓) Estimate

SHB 8491 H-CC41AXA12006728/H1he3f1

DOA: 28/3/12

SKX 2098Z-X

26/9-

Revert

preli advise via email.

Lump Sum \$20500. (Red: 983.76; 32%)

Surveyor: Faisal

REF:

4975 H

ASSIGNMENT

From: _____ Date: _____

Estimated Cost: _____

OD TP / WS / TP RES / OD RES / EVA / INV / MV

To Inspect Vehicle No: SHB 8491H

at Workshop m/s PREMIER TAXI

of 23, CHANHI SOUTH MC 2

Insured: MSIC

Policy No. _____

Claims No. _____

Sum Insured: _____ Excess: _____

(Client's Record)

Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: _____

IDAC Accident Rpt: _____ Consistent?: Yes or No

GIA / PR Seen: _____ Consistent?: Yes or No

Est. Repairs: _____ days Res.: Yes or No

Lum Sum: _____ % 3 Val.: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: SHB 8491H Yr Regn: 2013 / OUT

Type: M.Car / M.Cycle / Bus / Van / Lorry Taxi / Prime Mover /

Truck / Trailer or _____

Make: KIA OPTIMA 1.7 A c.c 1685

Colour: GREEN A/C: Insured / Std / NI / NA

Sp. Reading: 486399 T/Radio: Insured / Std / NI / NA

Eng/No: _____

C/No: KNAGM 414ME544 6967

Gen. Cond: Good / Fair / Poor / Burnt

Steering: Inorder / Jammed / Leaked / Burnt or

Brake: Inorder / Jammed / Leaked / Burnt or

Modi: Nil / S/Rim / STD A/Rim or

Tyre Size: F: 185/65R16

R: _____

BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /

TOYO / YOKO or Hankook

Front 5 mm Rear 5 mm

R/Bal. 5 mm

L/Bal. 5 mm

D.O.A. 09/09/18 D.O.I. 12/09/18

Survey held at PREMIER

Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

O/S REAR & O/S FRT

The U/C / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction

RECEIVED 15 OCT 2018

[Signature]

12/10/2018

Date/Time, File Pass to? : Preli. Report

1) 15/10 Typist : Final Report

Date/Time, File Return to?

2) _____

Days Of Repair: 4

Resurvey No. of Trip: _____ Survey Fee: _____

Transportation: _____

Add Fee: : Site Insp (\$) S + RS_

: Interview (\$) Photos

: Tech. Invs (\$) Others

: Weekend (\$)

Report Format : TP
Lump Sum / I.B.I: (\$ 2050/-)

...CLAIM SUBFOLDER...(New Assignment)

CLAIM SUBFOLDER TRACKING

Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'd	Status
Main	10 Sep 2018		11 Sep 2018 16:06 Assign				New Assignment Cancel Case

[Main](#)
[Reference](#)
[Claim Details](#)
[Documents](#)
[Show All](#)

CLAIM SUBFOLDER DETAILS

[\[Created by insurer\]](#)

Insured:	TAN TZE HOW, ID: S7121188F		
Main Claimant:	PREMIER TAXIS PTE LTD, Co. Reg. No.: 200304975H		
Vehicle Reg. No.:	SHB8491H	Date of Loss:	09/09/2018 10:00 - :59 [59 Months From LTA Reg Date (Man Yr)]
Claim Type:	TP / 569784	Policy/Cover Note No.:	80454195QMX (Comprehensive) Coverage: 06/03/2018 - 05/03/2019
Vehicle Reg. No. (Insured):	SKX2098Z	Policy No. (Claimant):	
		Excess:	
Repairer:	Premier Taxis Pte Ltd - Changi (HQ) 23 Changi South Ave 2 #03-02, 486443 Changi - Tel:		
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Monica Chung Pei Zhen - 6594 2552]		
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Imm.Advice due 12/09/2018]		
Driver/Custodian (Insured):	TAN YI, DARYL (), NRIC: S9627299E, Tel: +6581681913		
Adj Asg. Remarks:	SJE AGREE LKK - KALVIN ANG. LIAB 100%. VEHICLE AVAILABLE FOR SURVEY. PLS CONTACT 65446676 / 65446689		

ASSOCIATED MAIL RECEIVED

There are no mail for this case.

[View All](#)
[Compose Case Mail](#)

ALL ASSOCIATED TASKS

[View All](#)
[Search Tasks](#)
[Create New Task](#)
[Complete](#)

Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Shiau Chan (LKKAuto)

From: Goh Wee Dek <weedek.goh@premiertaxi.com>
Sent: Monday, 17 September 2018 1:17 PM
To: Rasul (LKKAuto)
Cc: SUR; Gary Shi
Subject: SHB8491H- FINALIZE(AUDATEX)
Attachments: IMG_7395.JPG; IMG_7396.JPG; IMG_7397.JPG; IMG_7398.JPG; IMG_7399.JPG; IMG_7400.JPG; IMG_7401.JPG; IMG_7402.JPG; IMG_7403.JPG; 20180914_164341.jpg; 20180914_164343.jpg; 20180914_164347.jpg; 20180914_164355.jpg; 20180914_164358.jpg

Dear Rasul

Please confirm l/sum \$2150, 4days.

No check items.

Regards

Goh Wee Dek
Assistant Claims Manager
Premier Automotive Services Pte Ltd

Address: 23 Changi South Ave 2, #01-02 Singapore 486443
Tel: 6214 8880 Ext 068 | DID: 6544 6682 | Fax: 6214 1511
Visit us at: www.premiertaxi.com.sg

Confidentiality Notice | This e-mail message, including any attachments, is for the sole use of the intended recipient(s) and may contain confidential or proprietary information. Any unauthorized review, use, disclosure or distribution is prohibited. If you are not the intended recipient, immediately contact the sender by reply e-mail and destroy all copies of the original message.

 Please Consider Your Environmental Responsibility Before Printing This E-mail. SAVE OUR TREES and REDUCE POLLUTION

Denise Tay (LKKAuto)

From: Goh Wee Dek <weedek.goh@premiertaxi.com>
Sent: Monday, 15 October 2018 10:05 AM
To: Denise Tay (LKKAuto); Rasul (LKKAuto)
Cc: SUR; Gary Shi
Subject: RE: SHB8491H- FINALIZE(AUDATEX)

Dear Denise


Ok, accept at \$2,050 4days.

Regards

Goh Wee Dek
Assistant Claims Manager
Premier Automotive Services Pte Ltd

Address: 23 Changi South Ave 2, #01-02 Singapore 486443
Tel: 6214 8880 Ext 068 | DID: 6544 6682 | Fax: 6214 1511
Visit us at: www.premiertaxi.com.sg

Confidentiality Notice | This e-mail message, including any attachments, is for the sole use of the intended recipient(s) and may contain confidential or proprietary information. Any unauthorized review, use, disclosure or distribution is prohibited. If you are not the intended recipient, immediately contact the sender by reply e-mail and destroy all copies of the original message.

 Please Consider Your Environmental Responsibility Before Printing This E-mail. SAVE OUR TREES and REDUCE POLLUTION


From: Denise Tay (LKKAuto) [mailto:denisetay@lkkauto.com]
Sent: Monday, 15 October, 2018 9:14 AM
To: Goh Wee Dek; Rasul (LKKAuto)
Cc: SUR; Gary Shi
Subject: RE: SHB8491H- FINALIZE(AUDATEX)

Dear Wee Dek,

Finalized at lump sum \$2050, 4days

Please check and confirm

Best Regards,

Denise Tay | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: denisetay@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Goh Wee Dek <weedek.goh@premiertaxi.com>
Sent: Monday, 17 September 2018 1:17 PM
To: Rasul (LKKAuto) <Rasul@lkkauto.com>
Cc: SUR <sur@lkkauto.com>; Gary Shi <gary.shi@premiertaxi.com>
Subject: SHB8491H- FINALIZE(AUDATEX)

LKK Auto Consultants Pte Ltd (Co.Reg.No:199607198R)51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

To: MSIG Insurance (Singapore) Pte. Ltd.
4 Shenton Way
#21-01 SGX Centre 2
Singapore 068807From: LKK Auto Consultants Pte Ltd
51 Ubi Ave 1 #01-25
Paya Ubi Industrial Park
Singapore 408933

Attn: Monica Chung Pei Zhen

Date: 26 Sep 2018

Preliminary Advice

Insured Vehicle No	: SKX2098Z	Accident Date	: 09/09/2018
TP Vehicle No	: SHB8491H	Assignment Date	: 11/09/2018
Make	: KIA OPTIMA	Est. Duration of Repair	: 4.00
Date of Inspection	: 12/09/2018		
Inspection At	: PREMIER TAXIS PTE LTD - CHANGI (HQ) 23 CHANGI SOUTH AVE 2 #03-02 SINGAPORE 486443		

Point of Impact / General Description of Damages

The vehicle sustained impact / damages o/s rear and o/s front portion and parts claimed are consistent to the accident.

Repairer's Estimate (Gross)	:S\$	3,033.76
Revised Amount	:S\$	1,904.61
Check Items (Estimated)	:S\$	969.15
Total	:S\$	2,873.76
Lump Sum Repair	:S\$	

Total Loss Consideration

New for Old Value	:S\$
Pre-Accident Value	:S\$
COE / PARF Rebate	:S\$
Salvage Value	:S\$
Margin for Repair	:S\$

Remarks

- () The vehicle is economical/not economical for repair.
- (x) The above survey was conducted on a 'without prejudice' basis.

Enquire Transaction History**Transaction History Details**

Log Date/Time:	09 Oct 2013 / 09:56:23	Receipt No.:	AACCK001-AX239-131009-000017
Asset Type:	Vehicle	Transaction Amount:	\$73,954.00
Asset ID:	SHB8491H	Channel:	AA Counterless - CYCLE & CARRIAGE KIA PTE LTD
Transaction Type:	01.02 Register New Vehicle (AA)		
Business Transaction Reference No.:	20131009095623128803		
Vehicle No.:	SHB8491H		
Vehicle Type:	H10 - Public Transport Taxi (Motor Car)		
Vehicle Attachment 1:	Air-Con (Taxi)		
Vehicle Attachment 2:	-		
Vehicle Attachment 3:	-		
Vehicle Scheme:	Taxi (Company)		
First Registration Date:	09 Oct 2013		
Original Registration Date:	09 Oct 2013		
Vehicle Make:	KIA		
Vehicle Model:	OPTIMA 1.7(A) DIESEL		
Chassis No.:	KNAGM414ME5446967		
Engine No.:	D4FDDH308156		
Motor No.:	-		
Trailer Chassis No.:	-		
Propellant:	Diesel		
Passenger Capacity:	4		
Engine Capacity:	1685		
Power Rating:	-		
Unladen Weight:	1584		
Maximum Laden Weight:	2050		
Primary Color:	Silver		
Secondary Color:	-		
Manufacturing Year:	2013		
Open Market Value:	\$19,990.00		
Minimum PARF Benefit:	\$7,494.00		
PARF Eligibility:	Y		
No. of Transfer:	0		
Effective Ownership Date/Time:	09 Oct 2013 09:56:23		
COE No.:	2013100901000744R		
COE Expiry Date:	08 Oct 2021		
COE Bid Category:	-		
Actual QP/PQP Paid Amount:	\$61,324.00		
Lifespan Expiry Date:	08 Oct 2021		
Owner ID Type:	Company		

R **Victory Recovery** (Business Reg No.: 53096358B)
65 Teban Gardens Rd #23-617, Singapore 600065.
Mobile: 9618 0311 Fax: 6267 8996

CASH /
W.O. No. 95892

TOW JOB WORKS ORDER

Premier taxi Svc Date 9. 9. 18
Make/Model taxi Vehicle No. SHB 8491
Licence/Plate No./Card No. _____ Contact No. _____
Call Rec'd 10:20 Arrived 11:50 Completed 12:36
Charge S\$ Accident, KJ doily \$ 75 Tow Truck No JN 3661
Destination (from) 97. tank Tol (to) 23 Changi LI
Remarks (if any) _____

Driver's Signature S Member's Signature _____

- | | | |
|---|---|--|
| <input type="checkbox"/> Change Tyres & Towing | <input type="checkbox"/> Using King Dolley | <input type="checkbox"/> Use Car Carrier |
| <input type="checkbox"/> Basement / Multi Carpark | <input type="checkbox"/> Low Spoiler / Low Oil Sump | <input type="checkbox"/> Release Brake / Shaft |
| <input type="checkbox"/> Causeway / 2nd Link | <input type="checkbox"/> Accident / Over-turn | <input type="checkbox"/> Loaded |

! : The owner or his representative is required to follow along to the towing destination, failing which the tow operator shall not be liable for any alleged damages to the car nor missing items from the same. Vehicle is towed at owner's risk. The tow operator accepts no responsibility for any damages to the owner's vehicle whilst being towed.

SINGAPORE ACCIDENT STATEMENT

OKV 4114

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	10/09/2018 11:03
Date Of Accident	09/09/2018 09:55
Exact Location Of Accident	CLEMENCEAU AVE - IN FRONT OF CHURCH
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SHB8491H
Insured/Policyholder	
Name Of Registered Owner	PREMIER TAXIS PTE LTD
Co Reg No	200304975H
Email Address	NOEMAIL
Mobile Phone No	
Alternative Phone No	OFFICE-62148880

Vehicle Particulars

Manufacturer	KIA
Model	OPTIMA-1.7 D (A)
Exact Purpose for which vehicle was being used at time of accident	HIRED & REWARDS
Are you claiming under your own insurance policy for repair to your vehicle?	NO
If No, Please state action to be taken	THIRD PARTY
Vehicle Category	TAXI

Insurance Company

Name of Insurance Company	NTUC INCOME INSURANCE CO-OPERATIVE LTD
Type Of Coverage	THIRD PARTY
Fleet Policy	YES
Policy Number	5095103893
Cover Note Number	

Driver

Name of Driver	LIM ONG MENG
NRIC No	S1217253B
Date Of Birth	27/12/1955
Occupation	OUTDOOR
Date Of Driving Pass	30/09/1981
Driving Experience	36 YEARS AND 11 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-96372004
Fax Number	
Contact Number	
EEmail Address	NOEMAIL

Address	BLK 57 #06-471 TEBAN GARDENS ROAD
Postcode	600057
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OTHER - HIRER
Vehicle Registration Number of Driver's Own Vehicle	- - -
Insurance Company of Driver's Own Vehicle	- - -

General Information of the Accident

Type Of Accident	SIDE SWIPE
Weather Conditions	CLEAR
Road Surface	DRY

Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	2
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

Circumstances of Accident

BOTH VEHICLES - NO PAX

Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SKX2098Z
Vehicle Make/Model/Colour	HONDA ODYSSEY
Details Of Properties	VEH. B
Vehicle Category	PRIVATE CAR
Name of Driver	TAN YI, DARYL
NRIC/Passport Number	S9627299E
Contact Number	81681913
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	1

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims.(collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the Insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the Insurers and/or GIA to their third party service providers or agents(including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
 - (ii) for complying with requirements under any regulations, laws or court orders.

10 SEP 2018



Policyholder's Signature
Date & Time:

Driver's Signature
(If driver is not the policyholder)
Date & Time:

Reporting Centre Personnel's Signature
Name:
NRIC/FIN No.:

SHB 1217253/B

SHB 8491H
α

Describe Circumstance of the Accident.

ON 09/09/2018 @ 0955HRS, I WAS IN MY TAXI (SHB 8491 H) STATIONARY - ALONG CLEMENCEAU AVE (IN FRONT OF THE CHURCH), IN THE LEFT LANE - ALIGHTING MY PASSENGERS.

WHILE STILL STATIONARY & AS THE PASSENGERS WAS ABOUT TO CLOSE THE REAR LEFT DOOR - SUDDENLY I FELT AN IMPACT FROM MY RIGHT.


WHEN INSPECTED, I DISCOVERED THAT VEHICLE B (SKX 2098 Z - HONDA ODYSSEY) WHICH WAS APPROACHING FROM MY RIGHT - HAD COLLIDED ONTO THE RIGHT PORTION OF MY TAXI.

DUE TO THE IMPACT, MY TAXI HAD DAMAGES ON THE RIGHT PORTION AND PUNCTURED ON THE RIGHT REAR TYRE. I WAS NOT AWARE OF DAMAGES TO VEHICLE B.


NO INJURY INVOLVED.
NO PASSENGERS ONBOARD BOTH VEHICLES.

*VIDEO FOOTAGE CAPTURED

DAMAGES FOUND ON VEHICLE A & VEHICLE B

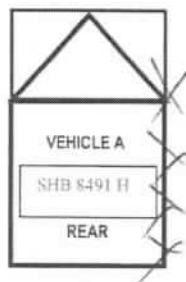

PREMIER TAXI

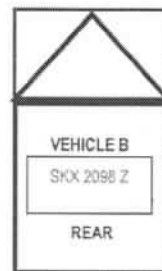

THIRD PARTY VEHICLE

 or/wi 1217253/B

Driver's Signature & NRIC Number
Monday, September 10, 2018 @ 11:19:42 AM

(attended by )

Sketch Plan Pg. 4

PREMIER TAXIS	HIRER / RELIEF / SUPER RELIEF
VEHICLE NO.	SHB8491H
CONTACT NO.	96372004
NEW MAILING ADDRESS (if any)	

REPUBLIC OF SINGAPORE
IDENTITY CARD NO. S1217253B




Name
LIM ONG MENG
林 鴻 明

Race
CHINESE

Date of Birth
27-12-1955

Sex
M

Country of Birth
SINGAPORE



REPUBLIC OF SINGAPORE DRIVING LICENCE

Licence Number **S1217253B**

Name
LIM ONG MENG

Birth Date **27 Dec 1955**

Issue Date **03 Jul 2003**




1927398



NRIC No: S1217253B 48427



Blood Group: B+ Date of issue: 22-04-1994


APT BLK 57 TEBAN GARDENS ROAD #06-471
SINGAPORE 600057

NRIC No: S1217253B Date: 18/10/2016

YOU ARE LICENSED TO DRIVE VEHICLES IN THE FOLLOWING CLASSES

Class	Description	PASS DATE
Class 3	Motor Cars and Motor Tractors the weight of which unladen does not exceed 2500 kilograms	30 Sep 1981

NP 428A



Land Transport Authority


VOCATIONAL LICENCE

Licence No: **S1217253B**

Name: **LIM ONG MENG**

Issue Date: **18/4/2011**

Please visit www.lta.gov.sg to check the status of this vocational licence



PREMIER AUTOMOTIVE SERVICES PTE LTD
23 Changi South Ave 2
#01-02, Singapore 486443

Assessment Number: MSIG0041
Version: PREMIERA/1

Assessor Report
Printed: 12/09/2018

Summary Information

Claim

Claim Reference:	SHB8491H	Insured:	
Policy Number:		Third Party:	
Date of Decision:	12/09/2018	Able to Authorise Repairs:	TBA
Repairer:		Repairs Authorised?	TBA
Estimated Repair Time (Working Days):	0.0		

Insured's Liability

Excess:	TBA
Customer Contribution:	\$0.00 (excl GST)

Vehicle Details

Vehicle

Registration:	SHB8491H	VIN/Chassis Number:	
Manufacturer:	KIA	Model:	Optima
Registration Month:	October	Registration Year:	2013
Odometer:	Not Known	Colour:	
Build Date:			
Model Specs	FROM 10/2013 WHEEL COVER 16 INCH PREPARE OFF VEHICLE BASECOAT CLEAR		

Vehicle Condition

Vehicle Status

Date of Incident:	09/09/2018	Market Value:	Unknown
Pre-Accident Condition:		Salvage Value:	Unknown
Pre-Accident Damage:		Date of Inspection:	12/09/2018
Steering Rim Ply:		Place of Inspection:	
Brake Pedal Travel:			
Vehicle Status:			
Damage Severity:			

Tyres Condition:

Tread Depth LHF:		Tread Depth RHF:	
Tread Depth LHR:		Tread Depth RHR:	

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$50.00/HR
Price/Dent = \$50.00/HR

Repair /

Guide Number	Repair Details	WU	Cost Price (\$)
87602R00	R + R RIGHT MIRROR	2.0	10.00
59700R00)	R/HAND BRAKE CABLE REMOVE + REFIT	1.0	5.00
59700R0B)	R + R HANDBRAKE CABLE/S ADD/WORK	1.0	5.00
52951R00)	R + R RIGHT REAR WHEEL	1.0	5.00
52951R0B)	R + R REAR WHEEL/WHEELS ADD WORK	1.0	5.00
52723R00)	R + R R/R STEERING KNUCKLE (WHEEL REMOVED)	1.0	5.00
	INCLUDES: ENG S-ABSORB, REAR TRAIL ARM		

PREMIER AUTOMOTIVE SERVICES PTE LTD

23 Changi South Ave 2
#01-02, Singapore 486443

Assessment Number: MSIG0041

Assessor Report

Version: PREMIERA/1

Printed: 12/09/2018

52723R00)	AND REAR LOWER AXLE RADIUS ARM R + R RENEW R/R STEERING KNUCKLE (REMOVED) INCLUDES: BRAKE DISC, BRAKE BACK PLATE, WHEEL HUB AND RR UPP AXLE STEERING R + R	5.0	25.00
55310R00)	DIS + ASS L/R AND R/R SPRING STRUT (REM)	5.0	25.00
55201R0B)	DETACH + REFIT REAR LOWER CONTROL ARM	4.0	20.00
55250R00)	R + R RIGHT REAR CONTROL ARM FRONT	1.0	5.00
55100R0B)	DETACH-REFIT RR UPPER CONTROL ARM	2.0	10.00
52910R00)	R + R R/R TYRE (WHEEL REMOVED) INCLUDES: BALANCE WHEEL	1.0	5.00
52910R0C)	R + R TYRE/WHEEL (ADD/WORK)	1.0	5.00
56800A00	ALIGN REAR TOE	4.0	20.00
1482	REPAIR RIGHT FRONT DOOR	X 10.0*	50.00
1782	REPAIR R/R DOOR	X 10.0*	50.00
2583	REPAIR REAR BUMPER	10.0*	50.00
3486	REPAIR R/R OUTER SIDE PANEL	20.0*	100.00

LABOUR COST

Total Work Units	80.0	
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	8.0HRS	\$400.00
Paint Labour	10.1HRS	\$505.00
Total Labour	18.1HRS	\$905.00

PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$50.00/HR

Guide Number	Description	WU	Cost Price (\$)
	- PREPARE OFF VEHICLE		
	- BASECOAT CLEAR		
1738	R/DOOR MIRROR NEW PART PAINT K1R	3.0	
1482	RIGHT FRONT DOOR REPAIR PAINTING <50%	17.0	
1782	R/R DOOR REPAIR PAINTING <50%	15.0	
2583	REAR BUMPER REPAIR PAINT PLASTIC	17.0	
3486	R/R OUTER SIDE PANEL REPAIR PAINTING <50%	16.0	

LABOUR COST - PAINT

TIME (PAINT)	68.0	
Preparation Main Work Plastic	8.0	
Preparation Main Work Metal	25.0	
Preparation Work Multi Layer Paint	0.0	
Total Work Units (10WU/HR)	101.0	
Total Paintwork Labour	10.1HRS	\$505.00

MATERIAL COST - PAINT

		Cost Price
New Part Painting - Plastic K1R		\$2.46
Material-Constant Main Work Metal		\$28.60
Repair Painting		\$79.13
Repair Painting Plastic		\$57.92
Material-Const Main Work Plastic		\$12.70
Total Excluding Pearlescent Uplift		\$180.81
Pearlescent Uplift @ 0.0%		\$0.00

PREMIER AUTOMOTIVE SERVICES PTE LTD

23 Changi South Ave 2
#01-02, Singapore 486443

Assessment Number: MSIG0041
Version: PREMIERA/1

Assessor Report
Printed: 12/09/2018

Total Paint Material Cost

\$180.81

PARTS

Price Valid: 01/06/2015

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
1738	1	R/DOOR MIRROR	876202T940		0%	590.00 *CRA
9392	1	R/F CONTROL ARM FRT	552503R000		0%	64.00 *TA
9316	1	R/R CONTROL ARM	552802T100		0%	159.00 *TA
9386	1	R/R LWR CONTROL ARM	552203S050		0%	351.00 *TA
9202	1	R/R SHOCK ABSORBER	553112T230		0%	313.00 *TA
9306	1	R/R STRG KNUCKLE	527202T010		0%	525.00 *TA
9394	1	R/R UPP CONTROL ARM	551003R050		0%	79.00 *TA
9552	1	R/R WHEEL	529102T100		0%	246.00 *TA
9560	1	R/R WHEEL COVER	529602T100		0%	116.00 *DC
f: OEM Parts			Sub Total			\$2,443.00
g: Original			Deduction from RRP (35 %)			-\$855.05
h: Secondhand			Total Parts			\$1,587.95
p: Parallel						
x: Exchange						

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Specialist	Betterment	Price
REAR FENDER STICKER	SPECIALIST	0%	\$60.00
O/S DOOR STICKER	SPECIALIST		\$100.00
TYRES	SPECIALIST	0%	\$200.00
Total Extras			\$360.00

Final Calculation

Total Parts		\$1,587.95
Labour		
Total Panel/Mechanical		
Total Paintwork		
Total Labour		\$905.00
Additional Costs		
Corr Prot Materials External		\$0.00
Corr Prot Materials Internal		\$0.00
Cost of Specialist		\$360.00
Total of Additional Costs		\$360.00
Total Paint/Material Costs		\$180.81
Grand Total Excludes GST		\$3,033.76
GST @ 7 %		\$212.36
Grand Total Includes GST		\$3,246.12

Handwritten notes:
KASUL
HP 90010068
4 days
HS
12/09/18 @ 1045

Assessment Notes

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer
Signature:
Date:

51 Ubi Avenue 1, #01-25
Paya Ubi Industrial Park
Singapore
408933

Claim Reference: SHB8491H
Assessment Number: MSIG0041
Version: LKKAUTOC/2
Date Calculated: 12/10/2018 10:33

Full Report - V1
Registration: SHB8491H
Printed: 12/10/2018 17:34

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	LKK AUTO	Date of Incident:	09/09/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	MSIG Insurance (Singapore) Pte	Repairs Authorised:	TBA
Claim Reference:	SHB8491H	Estimated Repair Time:	
Policy Number:		Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	KIA
Model:	Optima
Sub Model:	BASE MODEL
Model Sheet Number:	2836 01
Registration:	SHB8491H
Registration Month:	October
Registration Year:	2013
VIN Number:	
Odometer:	Not Known
Colour:	
Engine Number:	
Fuel Level:	%

Model Specs

FROM 10/2013	WHEEL COVER 16 INCH
PREPARE OFF VEHICLE	BASECOAT CLEAR



Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on Inspection:	
Brakes Pedal Travel:	Date of Inspection:	12/09/2018
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:	Tread Depth RHF:	
Tread Depth LHF:	Tread Depth RHR:	
Tread Depth LHR:	Direction of Impact:	
Damage Areas:		

Claim Reference: SHB8491H
 Assessment Number: MSIG0041
 Version: LKKAUTOC/2
 Date Calculated: 12/10/2018 10:33

Full Report - V1
 Registration: SHB8491H
 Printed: 12/10/2018 17:34

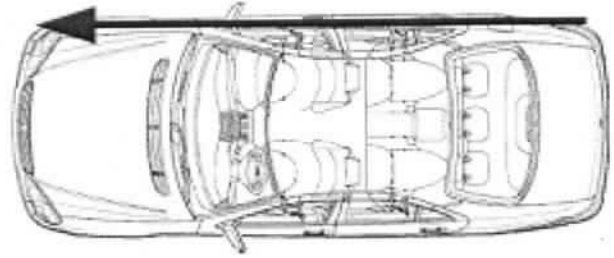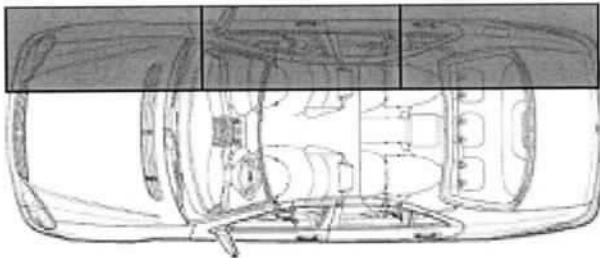

Addresses

Cost Summary

Total Labour	\$645.00
Total Paint/Material	\$127.84
Total Parts	\$1,587.95
Total of Additional Costs	\$200.00
Excess:	TBA
Grand Total Exc GST:	\$2,560.79
7 % GST:	\$179.26
Grand Total Inc GST:	\$2,740.05

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price/CL 1 = \$50.00/HR
 Price/Dent = \$50.00/HR

Repair /

Guide Number	Repair Details	WU	Cost Price (\$)
87602R00	R + R RIGHT MIRROR	2.0	10.00
59700R00)	R/HAND BRAKE CABLE REMOVE + REFIT	1.0	5.00
59700R0B)	R + R HANDBRAKE CABLE/S ADD/WORK	1.0	5.00
52951R00)	R + R RIGHT REAR WHEEL	1.0	5.00
52951R0B)	R + R REAR WHEEL/WHEELS ADD WORK	1.0	5.00
52723R00)	R + R R/R STEERING KNUCKLE (WHEEL REMOVED)	1.0	5.00
	INCLUDES: ENG S-ABSORB, REAR TRAIL ARM AND REAR LOWER AXLE RADIUS ARM R + R		
52723R00)	RENEW R/R STEERING KNUCKLE (REMOVED)	5.0	25.00
	INCLUDES: BRAKE DISC, BRAKE BACK PLATE, WHEEL HUB AND RR UPP AXLE STEERING R + R		
55310R00)	DIS + ASS L/R AND R/R SPRING STRUT (REM)	5.0	25.00
55201R0B)	DETACH + REFIT REAR LOWER CONTROL ARM	4.0	20.00
55250R00)	R + R RIGHT REAR CONTROL ARM FRONT	1.0	5.00
55100R0B)	DETACH-REFIT RR UPPER CONTROL ARM	2.0	10.00
52910R00)	R + R R/R TYRE (WHEEL REMOVED)	1.0	5.00
	INCLUDES: BALANCE WHEEL		
52910R0C)	R + R TYRE/WHEEL (ADD/WORK)	1.0	5.00
56800A00	ALIGN REAR TOE	4.0	20.00
2583	REPAIR REAR BUMPER	10.0*	50.00
3486	REPAIR R/R OUTER SIDE PANEL	20.0*	100.00
LABOUR COST			
	Total Work Units	60.0	
	Corrosion Protection External Labour	0.0HRS	0.00
	Corrosion Protection Internal Labour	0.0HRS	0.00
	Sub Total	6.0HRS	\$300.00

51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference: SHB8491H
Assessment Number: MSIG0041
Version: LKKAUTOC/2
Date Calculated: 12/10/2018 10:33

Full Report - V1
Registration: SHB8491H
Printed: 12/10/2018 17:34

Paint Labour	6.9HRS	\$345.00
Total Labour	12.9HRS	\$645.00

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$50.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- PREPARE OFF VEHICLE		
	- BASECOAT CLEAR		
1738	R/DOOR MIRROR NEW PART PAINT K1R	3.0	
2583	REAR BUMPER REPAIR PAINT PLASTIC	17.0	
3486	R/R OUTER SIDE PANELREPAIR PAINTING <50%	16.0	
LABOUR COST - PAINT			
	TIME(PAINT)	36.0	
	Preparation Main Work Plastic	8.0	
	Preparation Main Work Metal	25.0	
	Preparation Work Multi Layer Paint	0.0	
	Total Work Units (10WU/HR)	69.0	
	Total Paintwork Labour	6.9HRS	\$345.00
MATERIAL COST - PAINT			Cost Price
	New Part Painting - Plastic K1R		\$2.46
	Material-Constant Main Work Metal		\$28.60
	Repair Painting		\$26.16
	Repair Painting Plastic		\$57.92
	Material-Const Main Work Plastic		\$12.70
	Total Excluding Pearlescent Uplift		\$127.84
	Pearlescent Uplift @ 0.0%		\$0.00
	Total Paint Material Cost		\$127.84

PARTS				Price Valid: 01/06/2015		
Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
1738	1	R/DOOR MIRROR	876202T940		0%	590.00*
9392	1	R/F CONTROL ARM FRT	552503R000		0%	64.00*
9316	1	R/R CONTROL ARM	552802T100		0%	159.00*
9386	1	R/R LWR CONTROL ARM	552203S050		0%	351.00*
9202	1	R/R SHOCK ABSORBER	553112T230		0%	313.00*
9306	1	R/R STRG KNUCKLE	527202T010		0%	525.00*
9394	1	R/R UPP CONTROL ARM	551003R050		0%	79.00*
9552	1	R/R WHEEL	529102T100		0%	246.00*
9560	1	R/R WHEEL COVER	529602T100		0%	116.00*
f: OEM Parts			Sub Total			\$2,443.00
g: Original			Deduction from RRP (35 %)			-\$855.05
h: Secondhand			Total Parts			\$1,587.95
p: Parallel						
x: Exchange						

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras			
Description		Betterment	Price
REAR FENDER	SPECIALIST	0%	\$60.00
STICKER			
TYRES	SPECIALIST		\$140.00
		Total Extras	\$200.00

Final Calculation

Total Parts		\$1,587.95
Labour		
Total Panel/Mechanical	\$300.00	
Total Paintwork	\$345.00	
Total Labour		\$645.00
Additional Costs		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$200.00	
Total of Additional Costs		\$200.00
Total Paint/Material Costs		\$127.84
Grand Total Excludes GST		\$2,560.79
GST @ 7 %		\$179.26
Grand Total Includes GST		\$2,740.05

Assessment Notes

...CLAIM SUBFOLDER...(Pending for Survey Report)

CLAIM SUBFOLDER TRACKING							
Case	Notified	Est Submitted	Adj Assigned	Adj Rpt	Adj Submitted	Ins Auth'ed	Status
Main	10 Sep 2018		11 Sep 2018 16:06 Edit Adj Rpt	S\$2,560.79 Edit Estimates	S\$2,560.79 View Rpt		Pending for Survey Report Cancel Case

Main	Reference	Claim Details	Documents	Show All					
CLAIM SUBFOLDER DETAILS [Created by insurer]									
Insured:	TAN TZE HOW , ID: S7121188F								
Main Claimant:	PREMIER TAXIS PTE LTD , Co. Reg. No.: 200304975H								
Vehicle Reg. No.:	SHB8491H	Date of Loss:	09/09/2018 10:00 - :59 [59 Months From LTA Reg Date (Man Yr)]						
Claim Type:	TP / 569784	Policy/Cover Note No.:	80454195QMX (Comprehensive) Coverage: 06/03/2018 - 05/03/2019						
Vehicle Reg. No. (Insured):	SKX2098Z	Policy No. (Claimant):							
		Excess:							
Repairer:	Premier Taxis Pte Ltd - Changi (HQ) 23 Changi South Ave 2 #03-02, 486443 Changi - Tel:								
Handling Insurer:	MSIG Insurance (Singapore) Pte. Ltd. (HQ) - Tel: +65 6827 7888 ... [Handled by Monica Chung Pei Zhen - 6594 2552]								
Adjuster:	LKK Auto Consultants Pte Ltd (HQ) - Tel: 6256-3561 ... [Handled by MOHD RASUL] ... [Final Rpt due 11/10/2018]								
Driver/Custodian (Insured):	TAN YI, DARYL (), NRIC: S9627299E, Tel: +6581681913								
Adj Asg. Remarks:	SJE AGREE LKK - KALVIN ANG. LIAB 100%. VEHICLE AVAILABLE FOR SURVEY. PLS CONTACT 65446676 / 65446689								
ASSOCIATED MAIL RECEIVED View All Compose Case Mail									
There are no mail for this case.									
ALL ASSOCIATED TASKS View All Search Tasks Create New Task Complete									
Due Date	Priority	Type	Task Group	Subject	Handler	Assigned By	Completed On	Created On	Done?
No results.									

Claim Documents

***SHB8491H (569784)**
[SKX2098Z]
TP
PREMIER TAXIS PTE LTD
Sep 9 2018 10:00AM
[TAN TZE HOW]
Premier Taxis Pte Ltd - Changi

Upload Documents Upload Photos Compose New Letter			View	View in Browser
Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On		Thumbnail	Print
1	11/09/18 09:46	MSIG Insurance (Singapore) Pte. Ltd. (HQ) Accident Statement <small>From: SC - Reg. No: SKX2098Z, Claimant: TAN TZE HOW</small>	1 Load HTM	<input type="checkbox"/>
1	26/09/18 11:48	LKK Auto Consultants Pte Ltd (HQ) Adjuster Immediate Advice	1 Load HTM	<input type="checkbox"/>
Photos/Images			3 per page	<input checked="" type="checkbox"/>
No	Relabel/Reorder	LKK Auto Consultants Pte Ltd (HQ)	Thumbnail	Print
1	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
2	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
3	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
4	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
5	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
6	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
7	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
8	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
9	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
10	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
11	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
12	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
13	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
14	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
15	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
16	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
17	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
18	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
19	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
20	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
21	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
22	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
23	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
24	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
25	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
26	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
27	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
28	15/10/18 09:15	General View	1 Load JPG	<input checked="" type="checkbox"/>
29	15/10/18 09:15	Reinspection Photo	1 Load JPG	<input checked="" type="checkbox"/>
30	15/10/18 09:15	Reinspection Photo	1 Load JPG	<input checked="" type="checkbox"/>
31	15/10/18 09:15	Reinspection Photo	1 Load JPG	<input checked="" type="checkbox"/>
32	15/10/18 09:15	Reinspection Photo	1 Load JPG	<input type="checkbox"/>

Assessment Reports			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)		Thumbnail Print
				<input checked="" type="checkbox"/>
33	15/10/18 09:15	Reinspection Photo		Load JPG <input checked="" type="checkbox"/>
34	15/10/18 09:15	Reinspection Photo		Load JPG <input checked="" type="checkbox"/>
35	15/10/18 09:15	Reinspection Photo		Load JPG <input checked="" type="checkbox"/>
36	15/10/18 09:15	Reinspection Photo		Load JPG <input checked="" type="checkbox"/>
37	15/10/18 09:15	Reinspection Photo		Load JPG <input checked="" type="checkbox"/>
38	15/10/18 09:15	Reinspection Photo		Load JPG <input checked="" type="checkbox"/>
39	15/10/18 09:15	Reinspection Photo		Load JPG <input checked="" type="checkbox"/>
40	15/10/18 09:15	Reinspection Photo		Load JPG <input checked="" type="checkbox"/>
41	15/10/18 09:15	Reinspection Photo		Load JPG <input checked="" type="checkbox"/>
42	15/10/18 09:15	Reinspection Photo		Load JPG <input checked="" type="checkbox"/>

Documentation			1 per page	<input checked="" type="checkbox"/>
No	Finalized On	MSIG Insurance (Singapore) Pte. Ltd. (HQ)		Thumbnail Print
1	11/09/18 09:46	PRI From: SC - Reg. No: SKX2098Z, Claimant: TAN TZE HOW		Load PDF <input type="checkbox"/>
2	11/09/18 09:46	Third Party Accident Report From: SC - Reg. No: SKX2098Z, Claimant: TAN TZE HOW		Load PDF <input type="checkbox"/>
3	11/09/18 10:23	SJE AGREE LKK - KALVIN ANG		Load PDF <input type="checkbox"/>

Documents Checklist

DOCUMENTS CHECKLIST	Reset	Save	Print
There are no document checklists configured.			

Our Checklist Remarks - LKK Auto Consultants Pte Ltd (HQ)
<div style="border: 1px solid black; height: 40px; width: 100%;"></div>
Show Remarks To: <input type="checkbox"/> Handling Insurer Note: Remarks are private unless you show it to other parties.

LKK Auto Consultants Pte Ltd

(Co.Reg.No:199607198R)
51 Ubi Ave 1 #01-25, Paya Ubi Industrial Park
Singapore 408933

Tel: 6256-3561 Fax: 6844-8805 Email: sur@lkkauto.com;assignments@lkkauto.com

VEHICLE DAMAGE INSPECTION REPORT

Our File No: CS/MSG18016573/R1TD3E2
Date: 15/10/2018

REFERENCE

Handling Insurer: MSIG Insurance (Singapore) Pte. Ltd.	Policy No:	80454195QMX
Claimant Vehicle No : SHB8491H	Insured Vehicle No :	SKX2098Z
Date of Loss: 09/09/2018	Nature of Claim:	TP
		Claim No: 569784

DESCRIPTION & IDENTIFICATION OF VEHICLE

Reg No:	SHB8491H	Engine No:	D4FDDH308156
Make & Model:	KIA OPTIMA, 1.7 D (A)	Chassis No:	KNAGM414ME5446967
Reg. Date:	09/10/2013 (Man. Year: 2013)	Odometer:	486399 km
Colour:	Grey		
Engine Capacity:	1685 cc		
Market Value/New Car Price:	N/A		
Sum Insured (S\$):	Market Value/New Car Price		

CONDITION OF VEHICLE AT THE TIME OF SURVEY

General Condition:	Steering (Serviceable):	Yes	Footbrake (Serviceable):	Yes
Handbrake (Serviceable):	Yes	Engine Modification:	No	Pre-accident Condition:

CONDITION OF TYRES

Front Tyre Size:	185/65 R16	Rear Tyre Size:	185/65 R16
Front Left Side:	Hankook 5 mm	Rear Left Side:	Hankook 5 mm
Front Right Side:	Hankook 5 mm	Rear Right Side:	Hankook 5 mm

The above values represent the remaining tyre treads depth

COST OF CLAIMS	Repairer's	Adjuster's	Difference	Diff %
Parts	1,947.95	1,787.95	160.00	8.21
Miscellaneous Items	0.00	0.00	0.00	
Labour	1,085.81	772.84	312.97	28.82
Paintwork Labour	0.00	0.00	0.00	
Towing	0.00	0.00	0.00	
Gross Total (S\$)	3,033.76	2,560.79	472.97	15.59
+ GST 7.00/7.00% (S\$)	212.36	179.26	33.10	15.59
Nett Amount (S\$)	3,246.12	2,740.05	506.07	15.59

INSPECTION

Date of Assignment:	11/09/2018	
Date Inspected:	12/09/2018	Inspected At: Premier Taxis Pte Ltd - Changi (HQ) 23 Changi South Ave 2 #03-02 Singapore 486443
Estimated Period of Repair:	4.0 days	

Adjuster: MOHD RASUL

Manager: DENISE TAY KWEE CHENG

NOTE: This report represents our findings at the time and place of inspection stated herein. Such inspection has been carried out to the best of our knowledge and ability but any other liability under any other circumstances is hereby expressly excluded.

REPAIR DETAILS

Reference	
Part Source: MRM-SG	Version: 1.0 (Last Synchronised: 15 Oct 2018)
Parts: 143	KIA OPTIMA 1.7 D (A) (Catalogue:Merimen Singapore 1.0)
Labour: Repairer's	(Price-denominated Standard List)
Print Code: (Unsubmitted, no print-code for SHB8491H)	
Validity: These estimates are valid only if they contain the print code (above) on all estimate pages, running page numbers with the END OF ESTIMATES marker on the last estimate page	
Further Info: Items/values not in reference catalogue are prefixed with an asterisk *.	

Recommended Parts

No.	Qty	Part No.	Particulars	Condition	Repairer's	Amount
1	1		*R/DOOR MIRROR	Cracked	590.00 FL	*590.00 FL
2	1		*R/F CONTROL ARM FRT	Bent	64.00 FL	*64.00 FL
3	1		*R/R CONTROL ARM	Bent	159.00 FL	*159.00 FL
4	1		*R/R LWR CONTROL ARM	Bent	351.00 FL	*351.00 FL
5	1		*R/R SHOCK ABSORBER	Bent	313.00 FL	*313.00 FL
6	1		*R/R STRG KNUCKLE	Bent	525.00 FL	*525.00 FL
7	1		*R/R UPP CONTROL ARM	Bent	79.00 FL	*79.00 FL
8	1		*R/R WHEEL	Bent	246.00 FL	*246.00 FL
9	1		*R/R WHEEL COVER	Deformed	116.00 FL	*116.00 FL
10	1		*REAR FENDER STICKER	Necessary	60.00 FS	*60.00 FS
11	1		*O/S DOOR STICKER	Not Necessary	100.00 FS	*- FS
12	1		*TYRES (70%)	Cut	200.00 FS	*140.00 FS

F=Franchise part. S=SpcNett. L=ListItemDisc.

Sub Total (\$\$)	2,803.00	2,643.00
- List Item Discount on L Items 35.00/35.00% (\$\$)	855.05	855.05
Total Parts (\$\$)	1,947.95	1,787.95

Report was unsubmitted during this print-out.

Recommended Miscellaneous Items

There are no new miscellaneous items selected.

Recommended Labour

No	Particulars	Lab.Type	Repairer's	Amount
<u>Labour Items</u>				
1	TOTAL PANEL / MECHANICAL	New	400.00	300.00
2	TOTAL PAINTWORK	New	505.00	345.00
3	TOTAL PAINT / MATERIAL COSTS	New	180.81	127.84
			Gross Labour Cost (\$\$)	772.84

Report was unsubmitted during this print-out.

< END OF ESTIMATES >