

ASS. REC. BY:

REF:

CS/ASM18017668 / ASD321

Special Instruction:

Surveyor:

Adrian

ASSIGNMENT (Office)

From (Person):

Kitty Teo

of

ASM (AXA)

Date/Time:

28/09/2018

Estimated Cost:

Bill to:

①

TP/WS/TP RES / OD RES / EVA / INV / MV / CS

To Inspect Vehicle No:

SKH G943S

Insured:

at Workshop m/s

Progressive Automotive

Tel:

6741 5336

of

Blk 3022A, Ubi Rd 1 #01-45

Policy No:

Claim No:

S8M00X61

Sum Insured:

Excess:

NIL

Make of Veh:

D.O.A.

26/09/18

(Client's Record)

②

CA / REV / REP. / REV 24 HRS

H.O.D. Endorsement:

Date/Time:

3:25pm 28/9/18

Person Contacted:

pei wen

Vehicle IN/OUT

Date/Time

Action/Instruction

(✓)

Estimate

SKH G934S - X

01/10/13

@ 17:24 p.m. revised IA to Kitty Teo via smart claim.

07/11/13

Confirmed t/p \$2,268.50 @ 3 days with Adrian.
(\$1,072.50 Red - 36%)

REF:

ASSIGNMENT

From: _____ Date: _____
 Estimated Cost: _____
OD / TP / WS / TP RES / OD RES / EVA / INV / MV
 To Inspect Vehicle No: _____
 at Workshop m/s _____
 of _____
 Insured: _____
 Policy No _____
 Claims No _____
 Sum Insured: _____ Excess: _____
 (Client's Record)
 Make of Veh: _____

(Policy Condition)

Remark: The veh had commenced its
 repair at the time of inspection.

N/S	O/S

Bal. or Market Value: _____
 IDAC Accident Rpt: _____ Consistent?: Yes or No
 GIA / PR Seen: _____ Consistent?: Yes or No
 Est. Repairs: _____ days Res.: Yes or No
 Lum Sum: _____ % 3 Val: Yes or No

CA / REV / REP. / 24 HRS

Vehicle: IN / OUT

Date: _____ Person Contacted: _____

Veh No: SKH6943S. Yr Regn: 2013 Jun.
 Type: M. Car / M. Cycle / Bus / Van / Lorry / Taxi / Prime Mover /
 Truck / Trailer or _____
 Make: Volkswagen Tiguan. cc 1984.
 Colour: Brown. A/C: Insured / Std / NI / NA
 Sp. Reading: 152832 Tr/Radio: Insured / Std / NI / NA
 Eng/No: _____
 C/No: WVG2225A ZDW043183
 Gen. Cond: Good / Fair / Poor / Burnt
 Steering: In order / Jammed / Leaked / Burnt or
 Brake: In order / Jammed / Leaked / Burnt or
 Modi: Nil / S/Rim / STD A/Rim or
 Tyre Size: F: 235/55 R19.
 R: 235/55 R19.
 BS / DUN / EXNOVA / GY / FS / LIZA / MIC / OHTSU / PIR / SUMI /
 TOYO / YOKO or Continental.
 Front: _____ Rear: _____
 R/Bal: 06 mm R/Bal: 06 mm
 L/Bal: 06 mm L/Bal: 06 mm
 D.O.A. _____ D.O.I. 28/09/18.
 Survey held at: Progressive (ubi)
 Des. of Damages: Frt / Rear / O/S / N/S / U/C / Rooftop or

The U/C / Chassis frame / Body Structure affected due to collision

Date / Time Action / Instruction

DDAYA.

RECEIVED 09 NOV 2018

MV: 63K
 RV: 565K
 Net: 6.5K

Date/Time, File Pass to?

09/11/18

Type: st

Date/Time, File Return to?

2)

☐ : Prel. Report
☒ : Final Report

Days Of Repair: 3Resurvey No. of Trip: 1

Survey Fee

Transportation

S + RS: \$

Photos

Others

Add Fee: ☐ Site Insp (\$)☐ Interview (\$)☐ Tech. Invs (\$)☐ Weekend (\$)

Report Format :

Lump Sum / I.B.I: (\$ 2,268.50 p/p)

TOTAL

190



Service Request Details

Claim

S8M00X6I

Reference

None

Loss Date

September 26, 2018

Request Date

September 28, 2018

Due Date

October 5, 2018

Vendor Name

LKK AUTO CONSULTANTS PTE LTD (OD)

Type of Loss

Own Damage

Services

Accelerated survey and authorize

Actions

Next Step

Agree to perform service

Decline Work

Accept Work

Vehicle Information

Incident Vehicle Registration #

SKH6943S

Make

VOLKSWAGEN



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

AXA INSURANCE PTE LTD

Ref : CS/ASM18017668/Asd3

8 SHENTON WAY #24-01
AXA TOWERS SINGAPORE 068811

Date : 28-09-2018



Code : ASM

1. Policy Particulars :- OWN DAMAGE

Insured Veh.	Veh. Inspected	SKH 6943S
Policy No.	Coverage (\$)	0.00
Claim No. S8M00X61	Excess (\$)	0.00
Assign From SMARTCLAIM (KITTY TEO)	Assign Date	28/09/2018

2. Vehicle Particulars & Condition

Make & Model	c.c	0
Engine No. HIDDEN	Year of Reg.	
Chassis No.	Colour	
Odometer -	Steering	
Brakes	Modification	
General		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre			mm
L/H Front Tyre			mm
R/H Rear Tyre			mm
L/H Rear Tyre			mm

4. Description of Damages

--

5. General Information

Accident Date 26/09/2018	Inspection Date 28/09/2018
Survey held at PROGRESSIVE AUTOMOTIVE PTE LTD BLK 3022A UBI ROAD 1 #01-45/46, SINGAPORE 048716	

5a. Remarks

A) THE MARKET VALUE IS S\$----- (EST. AVERAGE) B) IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE AUTHORISED REPAIRS.
--

> Back to OneMotoring

Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	3600Z
Vehicle Details	
Vehicle No.:	SKH6943S
Vehicle to be Exported:	Yes
Intended Deregistration Date:	28 Sep 2018
Vehicle Make:	VOLKSWAGEN
Vehicle Model:	TIGUAN 2.0 TSI AT 5N22T3
Primary Colour:	Brown
Manufacturing Year:	2012
Engine No.:	CAW158855
Chassis No.:	WVGZZZ5NZDW043183
Maximum Power Output:	125.0 kW (167 bhp)
Open Market Value:	\$26,738.00
Original Registration Date:	03 Jan 2013
First Registration Date:	03 Jan 2013
Transfer Count:	0
Actual ARF Paid:	\$26,738.00
Intended PARF/COE Rebate Amount	
PARF Eligibility:	Yes
PARF Eligibility Expiry Date:	02 Jan 2023
PARF Rebate Amount:	\$18,716.00
Intended COE/COE Rebate Amount	
COE Expiry Date:	02 Jan 2023
COE Category:	B - Car (1601cc & above)
COE Period(Years):	10
QP Paid:	\$88,500.00
COE Rebate Amount:	\$37,731.00
Total Rebate Amount:	\$56,447.00

The information contained herein is correct as at 28 Sep 2018

OK



ANNOUNCING Autotruster Traders Pte Ltd
as sgCarMart Premium Dealer for the 2nd Consecutive Year

Autotruster Traders Pte Ltd



Post an Advertisement
Sell it yourself! Advertise it at just
\$58 until it's SOLD!

[Post an Ad](#) [Advertiser Login](#) [3 Ways of Selling](#)

Sept 2018 Offer, \$0 Down-payment/ Can Overloan Up To



Sept 2018 Offer, \$0 Down-payment/ Overloan Up To \$4K
For COE Car Owner...call Now
StarAd



AutoInn
An Inspiration For Car Report

click here to view
our **PRISTINE USED CARS**
at **GREAT PRICES**

Browse by Category [Save Search](#) [Print](#) Sort by Date Posted 20 results/page

6 vehicles		Search Tiguan		Advanced Search		Search		View All									
Make		Model		Price		Depreciation		Reg Date		Eng Cap		Mileage		Veh Type		Status	
Search Selection		Tiguan		Any		Any		2013		Any		Any		Any		Available	



☐ **Volkswagen Tiguan 1.4A TSI BMT** **\$71,800** **\$12,400 /yr** **28-Mar-2013** **1,390 cc** **81,800 km** **SUV** **Available**

1 Careful Owner, Well Maintained, Full Accessories Options (eg. Navigation, Bluetooth) For A Comfortable Drive. Call Now To Arrange A Viewing!

Posted: 11-Aug-2018 [Tiguan: 2013 Volkswagen Tiguan, 2013 Volkswagen Tiguan, Volkswagen Tiguan, Volkswagen Tiguan, Volkswagen Tiguan, Tiguan, Tiguan, Used Volkswagen](#)



☐ **Volkswagen Tiguan 2.0A TSI** **\$66,000** **\$11,230 /yr** **24-Apr-2013** **1,984 cc** **110,000 km** **SUV** **Available**

Cheapest On The Market, With Low Interest Rates Available! Meticulous Owner, Very Well Taken Care, Original Condition, No Touch Up Needed, Excellent Handling. New Pirelli Tyre Changed On April 18. Bre...

Posted: 25-Sep-2018 [Tiguan: 2013 Volkswagen Tiguan, 2013 Volkswagen Tiguan, Volkswagen Tiguan, Volkswagen Tiguan, Volkswagen Tiguan, Tiguan, Tiguan, Used Volkswagen](#)



☐ **Volkswagen Tiguan 1.4A TSI BMT** **\$78,900** **\$14,120 /yr** **25-Apr-2013** **1,390 cc** **106,000 km** **SUV** **Available**

Consignment Unit, 1 Careful Owner, One Of The Most Popular SUV With Panoramic Roof, Good Condition, Free 1 Servicing Coupon, View To Believe, Bank/In House Finance Available, Trade In Welcome.

Posted: 25-Sep-2018 [Tiguan: 2013 Volkswagen Tiguan, 2013 Volkswagen Tiguan, Volkswagen Tiguan, Volkswagen Tiguan, Volkswagen Tiguan, Tiguan, Tiguan, Used Volkswagen](#)



☐ **Volkswagen Tiguan 2.0A TSI R-Line** **\$78,888** **\$11,990 /yr** **07-Aug-2013** **1,984 cc** **71,000 km** **SUV** **Available**

Fully Serviced By VW (Servicing Logs Available), Yearly Ceramic Paint Protection, Low Mileage Done, Very Well Maintained In Pristine Condition, Auto Parking Assist With All Round Sensors. No Deal Er P...

Posted: 06-Aug-2018 [Tiguan: 2013 Volkswagen Tiguan, 2013 Volkswagen Tiguan, Volkswagen Tiguan, Volkswagen Tiguan, Volkswagen Tiguan, Tiguan, Tiguan, Used Volkswagen](#)



Force BBK Big 6 Pot Brake Kit

FORCE Big 6 Pot BBK for VW Golf

[More info about this product](#)



☐ **Volkswagen Tiguan 1.4A TSI BMT** **\$71,800** **\$11,230 /yr** **12-Sep-2013** **1,390 cc** **90,000 km** **SUV** **Available**

Up To 95% Loan, Immed Approved, FULL Agent Service. LED Daytime Lights, Reverse Camera And More! Best Buy!Flexible Financing Package And Trade In Available, Price Negotiable, Call To View The Car Toda...

Posted: 26-Sep-2018 [Tiguan: 2013 Volkswagen Tiguan, 2013 Volkswagen Tiguan, Volkswagen Tiguan, Volkswagen Tiguan, Volkswagen Tiguan, Tiguan, Tiguan, Used Volkswagen](#)



☐ **Volkswagen Tiguan 1.4A TSI BMT** **\$76,800** **\$11,570 /yr** **26-Dec-2013** **1,390 cc** **65,000 km** **SUV** **Available**

Graded B by **STP**

1.98% Financing Rate + Free Titan x + 2 Years Warranty! 14,000km Yearly Usage Only! 1 Owner Unit With Panoramic Roof, Led Daytime Lights, Reverse Camera And More! Best Buy! Low Mileage Done! Flexible ...

Supreme Cars Pte Ltd

Posted: 16-Sep-2018 [Tiguan: 2013 Volkswagen Tiguan, 2013 Volkswagen Tiguan, Volkswagen Tiguan, Volkswagen Tiguan, Volkswagen Tiguan, Tiguan, Tiguan, Used Volkswagen](#)

UNPUBLISHED HISTORY

[Compare](#)

Save this search criteria, to get email alerts whenever a match is found.

[Save Search](#)

[> Back to OneMotoring](#)

Enquire Transfer Fee

Vehicle Details

Vehicle No.:	SKH6943S
Vehicle Type:	P11 - Passenger Station Wagon/Jeep/Land Rover
Vehicle Attachment 1:	No Attachment
Vehicle Scheme:	Normal
Vehicle Make:	VOLKSWAGEN
Vehicle Model:	TIGUAN 2.0 TSI AT 5N22T3
Chassis No.:	WVGZZZ5NZDW043183
Propellant:	Petrol
Engine No.:	CAW158855
Engine Capacity:	1984 cc
Maximum Power Output:	125.0 kW (167 bhp)
Maximum Laden Weight:	2220 kg
Unladen Weight:	1593 kg
Year Of Manufacture:	2012
Original Registration Date:	03 Jan 2013
Lifespan Expiry Date:	-
COE Category:	B - Car (1601cc & above)
Quota Premium:	\$88,500.00
COE Expiry Date:	02 Jan 2023
Road Tax Expiry Date:	02 Jan 2019
PARF Eligibility Expiry Date:	02 Jan 2023
Inspection Due Date:	02 Jan 2020
Intended Transfer Date:	27 Sep 2018
CO2 Emission:	234.00 (g/km)
CEV/VES Rebate Utilised Amount:	-
CO Emission:	-
HC Emission:	-
NOx Emission:	-
PM Emission:	-

Late renewal fee(s) will be imposed if road tax / lay up has expired. Please use Enquire Road Tax Payable for fee(s) payable.

Road tax, including Over Payment (if any), of a vehicle will follow the vehicle to the new registered owner when its ownership is being transferred.

Amount Payable

	Amount Before GST (S\$)	GST Amount (S\$)	Amount After GST (S\$)
Transfer Fee:	25.00	-	25.00
Total Amount Payable:			25.00

You may print this page for reference.

[OK](#)
[Print](#)

Shirley Hiew (LKK Auto)

From: Shirley Hiew (LKK Auto) <ShirleyHiew@lkkauto.com>
Sent: Friday, 9 November 2018 2:52 PM
To: 'Ray'
Cc: 'sur@lkkauto.com'
Subject: RE: SKH6943S - TO FINALIZE

Hi Ray,

Confirmed final fig of \$ 2,268.50 (part by part) @ 3 days of repairs before excess \$0/- & GST.

Final invoice and all supporting documents sent over to AXA Insurance Pte Ltd.

Thank you.

Best Regards,

Shirley Hiew | Case Handler

LKK Auto Consultants Pte Ltd

Phone: 6256-3561 | email: Sur@lkkauto.com | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

From: Ray [mailto:ray@procarcare.com.sg]
Sent: Friday, 2 November 2018 2:50 PM
To: sur@lkkauto.com
Subject: FW: SKH6943S - TO FINALIZE

Hi Sir,

Resend.

Regards,

Ray LIN

Damage Assessment

Progressive Automotive Pte Ltd

Blk 3022A Ubi Road 1 #01-45/46 Singapore 408716

T: +65 6741 5336 | F: +65 6741 7208

E: claims@procarcare.com.sg

W: www.procarcare.com.sg

With effect from 1 Sep 2018, **Progressive Automotive Pte Ltd will be rebranded as **Progressive Car Care Pte Ltd**. You may now reach us at our new email addresses (@procarcare.com.sg) and our old email addresses (@progauto.com.sg) shall cease to function with effect from 1 Sep 2018. We look forward to your continued support.*

From: Ray
Sent: Friday, October 26, 2018 11:17 AM
To: Adrian Ling (LKKAuto)
Cc: Wayne; Dawn; Peiwen
Subject: SKH6943S - TO FINALIZE

Hi Adrian,

Please refer to finalize, final amount is \$2268.50

Regards,

Ray LIN

Damage Assessment

Progressive Automotive Pte Ltd

Blk 3022A Ubi Road 1 #01-45/46 Singapore 408716

T: +65 6741 5336 | F: +65 6741 7208

E: claims@procarcare.com.sg

W: www.procarcare.com.sg

With effect from 1 Sep 2018, **Progressive Automotive Pte Ltd will be rebranded as **Progressive Car Care Pte Ltd**.
You may now reach us at our new email addresses (@procarcare.com.sg) and our old email addresses
(@progauto.com.sg) shall cease to function with effect from 1 Sep 2018. We look forward to your continued support.*



Re:RE: Finalisation

Type

🔗 Question

Message

Hi Shirley, Noted, please proceed.

Reply



RE: Finalisation

Type

🔔 Question

Message

Hi Kitty, IA updated & uploaded. Damages consistent, repair cost economical. We have authorised repair.
Kindly inform supplementary amount is \$ 111.50. Thanks. From : Shirley Hiew

Reply



RE: PLEASE ADVISE IA - VERY URGENT

Type

🔗 Question

Message

Hi Kitty, IA uploaded. Thank you. From : Shirley Hiew

Reply



PLEASE ADVISE IA - VERY URGENT

Type

🔗 Question

Message

Hi Workshop has informed us that repairs is authorised but we have not receive update from you. Please let us have your IA urgently.

Reply



Auto
Consultants
Pte Ltd

Company Registration No. 109607100R

51 UBI AVE 1, #02-28 PAVA UBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (665) 62563361 FAX : (665) 62563315

Immediate Advice

To : AXA Insurance Pte Ltd

Date: 08/11/2018

Survey Details:

Date of loss	26-Sep-18
Date of appointment	28-Sep-18
Date of survey	28-Sep-18
Location of survey	BLK 3022A UBI ROAD 1 #01-45/46, SINGAPORE 048716

Vehicle Details:

Claim Type:	Own Damage
Vehicle number	SKH 6943S
Make and Model	VOLKSWAGEN TIGUAN 2.0 TSI
Date of registration	3/1/2013
Excess	NIL
Market Value	\$63,000
Part Rebate	\$56,447
Nett Loss	\$6,553

Repair details:

Initial Estimate	3,541.00 (inclusive supplementary)
------------------	------------------------------------

Proposed/Revised repair cost:

Parts	\$1,904.00 (inclusive supplementary)
Check items (estimate)	
Labour	\$364.50 (inclusive supplementary)
Total	\$2,268.50
Lump Sum(if applicable)	\$

Number of days for repair	<u>3 DAYS</u>
---------------------------	---------------



Auto
Consultants
Pte Ltd

Company Registration No. 199607196R

11, CURTAYE I, #02-25 PAYA LEBI INDUSTRIAL PARK, SINGAPORE 408933 TEL : (065) 62563061 FAX : (065) 62564333

Remarks:

DAMAGES CONSISTENT, REPAIR COST ECONOMICAL.
WE HAD AUTHORISED REPAIR. KINDLY INFORM
SUPPLEMENTARY AMOUNT IS \$ 111.50.

Mandate:

Liability(TP)	%	
Proposed repair cost	\$	
Loss of use	\$	no. of days
Loss of rental	\$	no. of days
Loss of income	\$	no. of days
LTA search fees	\$	
Others	\$	
Proposed Total	#VALUE!	



Auto
Consultants
Pte Ltd

Company Registration No. 199607198R

51 UBI AVE 1, #02-28 PAVIA UBI INDUSTRIAL PARK, SINGAPORE 408033 TEL : (65) 62563561 FAX : (65) 62564315

Immediate Advice

To : AXA Insurance Pte Ltd

Date: 01/10/2018

Survey Details:

Date of loss	26-Sep-18
Date of appointment	28-Sep-18
Date of survey	28-Sep-18
Location of survey	BLK 3022A UBI ROAD 1 #01-45/46, SINGAPORE 048716

Vehicle Details:

Claim Type:	Own Damage
Vehicle number	SKH 6943S
Make and Model	VOLKSWAGEN TIGUAN 2.0 TSI
Date of registration	3/1/2013
Excess	NIL
Market Value	\$63,000
Part Rebate	\$56,447
Nett Loss	\$6,553

Repair details:

Initial Estimate	3,509.50
------------------	----------

Proposed/Revised repair cost:

Parts	\$1,034.00
Check items (estimate)	\$1,986.00
Labour	\$489.50
Total	\$3,509.50
Lump Sum(if applicable)	\$

Number of days for repair	<u>3 DAYS</u>
---------------------------	---------------



Auto
Consultants
Pte Ltd

Company Registration No: 198607188R

81 UBI AVE 1, #02-25 PAVA UBI INDUSTRIAL PARK, SINGAPORE 400933 TEL : (065) 62561161 FAX : (065) 62564333

Remarks:

DAMAGES CONSISTENT, REPAIR COST ECONOMICAL. WE
HAD AUTHORISED REPAIR.

Mandate:

Liability(TP)	%	
Proposed repair cost	\$	
Loss of use	\$	no. of days
Loss of rental	\$	no. of days
Loss of income	\$	no. of days
LTA search fees	\$	
Others	\$	
Proposed Total	#VALUE!	

SINGAPORE ACCIDENT STATEMENT

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy ability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

ACCIDENT STATEMENT

Date Of Report	27/09/2018 13:10
Date Of Accident	26/09/2018 22:30
Exact Location Of Accident	OXLEY ROAD TOWARDS ORCHARD ROAD
Country/State of Loss	SINGAPORE

DETAILS OF OWN VEHICLE

Vehicle Registration Number	SKH6943S
Insured/Policyholder	
Name Of Registered Owner	CHUNG ENG KIAT (ZHUANG YONGJIE)
NRIC No	S7133600Z
Email Address	EKICHUNG@GMAIL.COM
Mobile Phone No	(LOCAL) +65-85000707
Alternative Phone No	OTHERS-85000707

Vehicle Particulars

Manufacturer	VOLKSWAGEN
Model	TIGUAN-2.0 TSI (A)

Exact Purpose for which vehicle was being used at time of accident

Are you claiming under your own insurance policy for repair to your vehicle? YES

If No, Please state action to be taken.

Vehicle Category	PRIVATE CAR
------------------	-------------

Insurance Company

Name of Insurance Company	AXA INSURANCE PTE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	P1879912
Cover Note Number	

Driver

Name of Driver	CHUNG ENG KIAT (ZHUANG YONGJIE)
NRIC No	S7133600Z
Date Of Birth	18/09/1971
Occupation	INDOOR
Date Of Driving Pass	04/10/1993
Driving Experience	24 YEARS AND 11 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-85000707
Fax Number	
Contact Number	OTHERS-85000707
Email Address	EKICHUNG@GMAIL.COM

Address BLK 312A ANCHORVALE LANE #15-52
SINGAPORE

Postcode 541312

Was driver an employee of the Insured's Company NO

If No, Relationship of the Driver with the Insured OWNER

Vehicle Registration Number of Driver's Own Vehicle -
-
-

Insurance Company of Driver's Own Vehicle -
-
-

General Information of the Accident

Type Of Accident COLLISION - MAJOR/MINOR RD

Weather Conditions CLEAR

Road Surface DRY

Other Information

Was any foreign vehicle involved in this accident? NO

Number of vehicles involved in the accident 2

Was any body injured in the Accident? NO

Was any injured conveyed to hospital by ambulance? NO

Was any other material or property damaged? YES

I have been approached by unknown person(s) soliciting/offering accident claims assistance. NO

Number of Passengers (Including Driver) 2

Passenger 1 NAME: : CHIN KIEN CHAN
GENDER: : MALE

Details of Police Action

Was the accident reported to the police? NO

If Yes, Please state which Police Station

Was notice of intended Prosecution given? NO

If Yes, against whom?

Circumstances of Accident

REFER TO THE ATTACH STATEMENT RECORDED BY PEI WEN - PROGRESSIVE CAR CARE PTE LTD TEL 6741 5336

Attachment(s)

Are accident photos available for attachment? YES

Was there any video captured by Car Camera? NO

Was there any audio recorded? NO

DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number SGF59S

Vehicle Make/Model/Colour

Details Of Properties

Vehicle Category PRIVATE CAR

Name of Driver

NRIC/Passport Number

Contact Number

Address

Postcode

Insurance Company Name

Nature Of Damage

No. Of Passenger (Including Driver)

Sketch Plan

SKETCH PLAN

IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [Form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "insurer(s)"), the insurer's lawyer/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
 - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
 - (ii) investigating the accident and/or my claims;
 - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
 - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/trial packages); and/or
 - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims collectively the "Purposes";
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyer/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the insurer(s) and/or GIA to their third party service providers or agents (including their lawyer/law firms), which may be situated outside of Singapore, for one or more of the above Purposes;
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management (present and all future claims);
- (e) the information so collected under (a) above may be shared / disclosed:
 - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated; or
 - (ii) for complying with requirements under any regulations, need to court orders;

Policyholder's Signature

Date & Time:

1:26pm
21/1/18

Driver's Signature

(If driver is not the policyholder)

Date & Time:

Reporting Centre Personnel's Signature

Name:

NRIC/PR No.:

plwlm

Sketch Plan #2

SKETCH PLAN

Orchard Road		Vehicle A - 5KH69435 B - 56JF595	

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

On 26 Sept, around 10:30pm, I was driving along Cuting Road, (5KH69435) and planning to turn right into Orchard Road. I waited at the junction before the yellow box as the traffic was quite busy. A white inter. the traffic cleared up and I decided to turn right into the right most lane. I spotted a car in the rightmost lane along Orchard Road that was more than 40m away, and it's safe for me to turn right. After my vehicle (5KH69435) turned right and entered straightaway in the right most lane, vehicle B (56JF595) driven by Paul (mobile 9111 301) hit into my vehicle. The right front bumper of Vehicle B hit into the tyre of vehicle A. Some camera light was captured after the accident on the right side of the motor lamp.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Please be advised that your insurer may have a fourteen (14) days clause whereby the claim against your policy must be made within the stipulated timeframe from the day of occurrence. Kindly check your policy for more details.

Policyholder's Signature

Date & Time:

27/10/18
1:26pm

Driver's Signature

(If driver is not the policyholder)

Date & Time:

Reporting Centre Personnel's Signature

Name:

NIC/VIN No.:

PERMAN

Common Statement

ACCIDENT STATEMENT (Part I)

This is NOT an admission of blame / liability, but a summary of identities and facts which will speed up the settlement of claims.

1 Date of accident 26/4/18 1030		2 Exact location of accident Olney Road towards Orchard road		3 Ins signed by BOTH drivers 3 Injuries even if slight No ☒ Yes ☐	
4 Material damage To vehicles other than vehicles A and B No ☒ Yes ☐		To objects other than vehicles No ☒ Yes ☐		5 Witness' names, address and tel nos. (to be underlined if feasible in passenger in vehicle A or vehicle B) Vehicle Value Camera Available No ☒ Yes ☐	

Registration No. (VEHICLE A) **SKH 6993 S**

☒ Insured (policyholder (see insurance opt))
 Name: **Chung Eng Kiat**
 (capt of team) **(Training Yung Jia)**

Address: _____

NRIC / Passport no. **971336002**

Tel no. (Hong Kong cell phone)
 No. **2500 0707**

☒ Vehicle
 Make, type **VW 1.4 16V 2.0 TSI**
AT

☒ Insurance company
AXA ☒ IC ☐ IP ☐ IPO

Does the policy cover damage to vehicle? ☒ Yes ☐ No

Police No. **P1877412**

☒ Driver ☒ Rider ☐ Other

Name: _____
 (capt of team)

NRIC / Passport no. **3**

Chief of team _____

GP _____

Gender: Male ☒ Female ☐

[illegible]

↓ Registration No. **88F 593**
(VEHICLE B)
[X] Insured / policyholder (see insurance card)
B Name _____
(capital letters)
Address _____
MBC / Transport no. _____
Tel no. (from Spain 34 9xxx) _____
Age _____
[X] Vehicle
Make, type _____
[X] Insurance company
_____ [] C [] TPT [] FPA
Does the policy cover damage to vehicle B?
No [] Yes []
Policy No. if available _____
[X] Driver (see driving license)
(if different from insured B above)
Name **OLIVIA**
(capital letters)
MBC / Transport no. _____
Cost of license _____
Age **9111650**
Gender: Male [X] Female []

End users have proved
of limited impact with
no access (in)

Sketch of accident scene impact occurred

1. View of the road - 2. the direction of vehicle A and B with arrows
3. their positions at the time of impact - 4. the road signs - 5. names of the people in road

REFER TO ATTACHED

1.1 **Ustavno sodišče in volitve 1.**

1.2 **Pravna pomoč**

118		Signatures of delivery		120		121		122		123		124		125		126		127		128		129		130		131		132		133		134		135		136		137		138		139		140		141		142		143		144		145		146		147		148		149		150		151		152		153		154		155		156		157		158		159		160		161		162		163		164		165		166		167		168		169		170		171		172		173		174		175		176		177		178		179		180		181		182		183		184		185		186		187		188		189		190		191		192		193		194		195		196		197		198		199		200		201		202		203		204		205		206		207		208		209		210		211		212		213		214		215		216		217		218		219		220		221		222		223		224		225		226		227		228		229		230		231		232		233		234		235		236		237		238		239		240		241		242		243		244		245		246		247		248		249		250		251		252		253		254		255		256		257		258		259		260		261		262		263		264		265		266		267		268		269		270		271		272		273		274		275		276		277		278		279		280		281		282		283		284		285		286		287		288		289		290		291		292		293		294		295		296		297		298		299		300		301		302		303		304		305		306		307		308		309		310		311		312		313		314		315		316		317		318		319		320		321		322		323		324		325		326		327		328		329		330		331		332		333		334		335		336		337		338		339		340		341		342		343		344		345		346		347		348		349		350		351		352		353		354		355		356		357		358		359		360		361		362		363		364		365		366		367		368		369		370		371		372		373		374		375		376		377		378		379		380		381		382		383		384		385		386		387		388		389		390		391		392		393		394		395		396		397		398		399		400		401		402		403		404		405		406		407		408		409		410		411		412		413		414		415		416		417		418		419		420		421		422		423		424		425		426		427		428		429		430		431		432		433		434		435		436		437		438		439		440		441		442		443		444		445		446		447		448		449		450		451		452		453		454		455		456		457	
-----	--	------------------------	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--	-----	--

[illegible]

⁴ In the event of a dispute as to the extent of copyright owned by either class in articles A and B, pre-information is needed!

Don't ever smiling in his statement after saying
Sincerely, and from about 1980 on

For current's Individual Statements
(Part II) see overview →

Individual Statement

INDIVIDUAL STATEMENT (Part II)		Over Workshop Track / Use (if any)		
To be completed and submitted within 24 hours to your insurer or Telok or appointed workshop (Use a separate sheet of paper where necessary)				
Insured	1. Occupation (if more than one, state all)		Email: <u>ekichung@swm1.com</u>	
	2. Vehicle registration no.	C.C.	If commercial vehicle, state permissible carrying capacity	
	3. Is driver the owner? ☒ Yes ☐ No ☐ If no, state relationship of driver with owner		State the vehicle number and name of insurer of driver's own vehicle (where applicable)	
	4. Exact purpose for which vehicle was being used at time of accident ☐ Private use ☐ Commercial use ☐ Hire & reward ☐ Private hire ☐ Others - please specify			
	5. Is the vehicle still in use? ☒ Yes ☐ No ☐ If no, state where it is at present Tel no. _____			
	6. Are you claiming under your own insurance policy for repair to your vehicle? ☒ Yes ☐ No ☐ If no, state action to be taken ☐ Third Party ☒ Reporting Only ☐ Third Party (Own Workshop)			
Driver or person in charge of vehicle at the time of accident (including insured)	7. Date of birth	Occupation	Date of license test	
	18/07/91	Indoor	Outdoor	4/10/93
	8. Give details of any pre-existing impairment of sight or hearing and of any other disability			
	9. Full details of all driving convictions including pending prosecutions in the last 36 months			
Insured person	10. Name(s), address(es) and approval type(s)	Is/are sustained	If vehicle not covered, state in which vehicle	
			Were you/they being used?	
			Was injured conveyed to hospital by ambulance?	
Damage to property & vehicles (Other than vehicle A and B)	11. Name(s) and address(es) of owner(s)	Vehicle registration no. or details of property	Insurer's name and address (if known)	
Police action	12. Was the accident reported to the Police? ☐ Yes ☒ No ☐ If yes, please state which Police station			
	13. Was notice of intended prosecution given? ☐ Yes ☒ No ☐ If yes, against whom?			
Accident details	14. Weather conditions	☒ Clear ☐ Rainy ☐ Other		
	15. Road surface	☒ Wet ☐ Dry ☐ Other		
	16. Speed of vehicle	A ☐ km/hr B ☐ km/hr		
	17. What warnings were given by driver or other party?			
	18. Were street lights illuminated? ☐ Yes ☐ No ☐			
	19. What lights were displayed on your vehicle/the other vehicle(s)?			
	20. If your vehicle is commercial, state weight of load carried at time of accident			
	21. State how accident happened, width of road, speed limits, etc. (refer to attached)			
Declaration	22. State number of passengers (including driver) <u>5</u> <u>Chin Kien Chan (M)</u>			
	I/We declare the foregoing particulars are true in every respect			
Policyholder's signature		Date <u>27/9/18 105pm</u>		
Driver's signature (if driver is not the policyholder)		Date		



TEL 6741 4646



COMPUTERIZED ALIGNMENT SPECIALISTS

CUSTOMER	PROGRESSIVE	DATE	Sep 29, 2018 3:30:08 PM
LICENSE NO.	SKH 6943 S		
MILEAGE	152837		
REFERENCE	CUSTOM	MODEL	VOLKSWAGEN TIGUAN

Front Wheel	SPECS				DIAGNOSIS				ADJUSTMENT			
	min	prv	max	Δ	L	total	R	Δ	L	total	R	Δ
TOTAL TOE	-1.00	0.00	1.00			-0.40				0.10		
PARTIAL TOE	-0.50	0.00	0.50		0.10		-0.50		0.00		0.00	
SET BACK	---	---	---			-0°08"				-0°08"		
CAMBER	-1°10"	-0°24"	0°18"		-0°20"		-1°02" 0°42"		-0°36"		-0°52" 0°14"	
CASTER	6°18"	7°18"	8°18"		7°06"		6°46" 0°18"		7°06"		6°46" 0°18"	
KING-PIN	---	---	---		14°28"		14°22" 0°04"		14°28"		14°22" 0°04"	
INCL ANGLE	---	---	---		14°08"		13°20"		13°52"		13°30"	
Toe-out on turns	---	---	---		---		---		---		---	
STEERING IN	---	---	---		---		---		---		---	
STEERING OUT	---	---	---		---		---		---		---	

Rear Wheel	SPECS				DIAGNOSIS				ADJUSTMENT			
	min	prv	max	Δ	L	total	R	Δ	L	total	R	Δ
TOTAL TOE	0.00	1.00	2.10			-1.90				1.50		
PARTIAL TOE	0.00	0.50	1.00		-0.90		-0.90		0.70		0.70	
SET BACK	---	---	---			0°02"				0°02"		
CAMBER	-1°44"	-1°00"	-0°14"		-1°30"		-1°36" 0°06"		-1°32"		-1°40" 0°06"	
THRUST ANGLE	-0°08"	0.00	0°08"			0°00"				0°00"		



TEL 6741 4646



COMPUTERIZED ALIGNMENT SPECIALISTS

CUSTOMER	PROGRESSIVE	DATE	Sep 29, 2018 2:56:28 PM
LICENSE NO.	SKH 6943 S		
MILEAGE	152538		
REFERENCE	CUSTOM	MODEL	VOLKSWAGEN TIGUAN

Front Wheel

SPECS

DIAGNOSIS

ADJUSTMENT

	min	prv	max	Δ	L	total	R	Δ	L	total	R	Δ
TOTAL TOE	-1.00	0.00	1.00			3.10				0.00		
PARTIAL TOE	-0.50	0.00	0.50		1.40		1.60		0.00		0.00	
SET BACK	---	---	---			4°12'				4°12'		
CAMBER	-1°10'	-0°24'	0°18'		-0°20'		-0°56' 0°36'		-0°18'		-0°54' 0°36'	
CASTER	6°18'	7°18'	8°18'		7°06'		6°40' 0°26'		7°06'		6°40' 0°26'	
KING-PIN	---	---	---		14°36'		14°20' 0°16'		14°36'		14°20' 0°16'	
INCL ANGLE	---	---	---		14°16'		13°22'		14°18'		13°26'	
Toe-out on turns	---	---	---		---		---		---		---	
STEERING IN	---	---	---		---		---		---		---	
STEERING OUT	---	---	---		---		---		---		---	

Rear Wheel

SPECS

DIAGNOSIS

ADJUSTMENT

	min	prv	max	Δ	L	total	R	Δ	L	total	R	Δ
TOTAL TOE	0.00	1.00	2.10			4.40				1.00		
PARTIAL TOE	0.00	0.50	1.00		2.40		2.00		0.50		0.50	
SET BACK	---	---	---			4°02'				4°02'		
CAMBER	-1°44'	-1°00'	-0°14'		-1°26'		-1°32' 0°04'		-1°22'		-1°24' 0°02'	
THRUST ANGLE	-0°08'	0.00	0°08'			0°02'				0°00'		

**PROGRESSIVE CAR CARE
PTE LTD
BLK 3022A UBI ROAD 1
#01-45/46
SINGAPORE 408716
Email: progauto@procarcar
e.com.sg**

**Claim Reference: OD 0918 - 6679
Assessment Number: PA001673
Version: PROGRESS/1
Date Calculated: 28/09/2018 04:08**

**Full Report - V1
Registration: SKH6943S
Printed: 28/09/2018 11:08**

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	Wayne Lim	Date of Incident:	26/09/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	AXA Insurance S'pore Pte Ltd	Repairs Authorised:	TBA
Claim Reference:	OD 0918 - 6679	Estimated Repair Time:	
Policy Number:		Quote Due Date:	
Other Reference:	OD 0918 - 6679	Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	VOLKSWAGEN
Model:	Tiguan
Sub Model:	SPORT & STYLE
Model Sheet Number:	6C3 04
Registration:	SKH6943S
Registration Month:	January
Registration Year:	2013
VIN Number:	WVGZZZ5NZDW043183
Manufacture Year:	2012
Odometer:	Not Known
Colour:	
Engine Number:	CAW158855
Fuel Level:	%

Model Specs

FROM 09/2012	TYRES 235/55 VR 17
CLIMATRONIC	DOOR MIRROR W/MEMORY
RAIN SENSOR	LIGHT/COMING HOME
SIDE WINDOW/RR SCRNR	AUTO DIPPING MIRROR
8 SPEAKER	RADIO RCD 310
FOG LAMPS	KEYLESS ENTRY
HEIGHT ADJ PASS SEAT	ROOF CONSOLE
STRG WHEEL LEATHER	CLOTH/LEATHER TRIM
FRONT SEAT DRAWER	FRONT LUMBAR SUPPORT
VARIABLE LOAD FLOOR	OIL LEVEL SENSOR
FRT SEAT FOLD TABLE	FRONT CENTRE ARMREST
SMOKER EQUIPMENT	FRT FOLDING BACKREST
HD COOLING	2.0 LTR 125 KW
4MOTION (ALL WHEEL)	AUTOMATIC 6-SPEED
DROWSINESS DETECTION	WHEELS 7J X 17 ALLOY
SPACE SAVER SP-WHEEL	CHROME PACKAGE
TYRE PRESSURE CHECK	BUMPER COMFORT
ROOF RAILS	EXCLUSIVE
TWO COAT METALLIC	PREPARE OFF VEHICLE

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:
Steering:	Vehicle Status on
	Inspection:
Brakes Pedal Travel:	Date of Inspection:
Place of Inspection:	27/09/2018
Pre-Accident Damage:	

PROGRESSIVE CAR CARE PTE LTD**Claim Reference: OD 0918 - 6679****Assessment Number: PA001673****Version: PROGRESS/1****Date Calculated: 28/09/2018 04:08****Full Report - V1****Registration: SKH6943S****Printed: 28/09/2018 11:08**

Tyres Condition:

Tread Depth LHF:

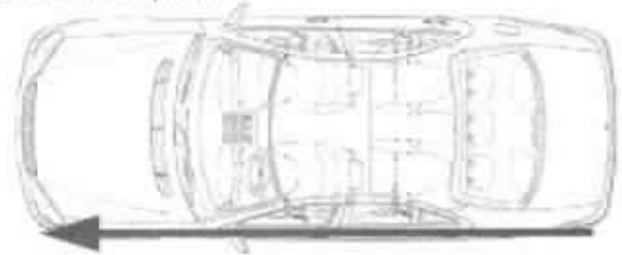
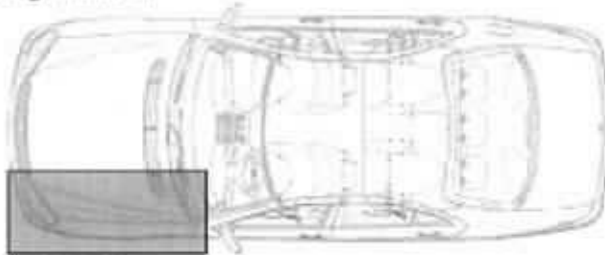
Tread Depth LHR:

Damage Areas:

Tread Depth RHF:

Tread Depth RHR:

Direction of Impact:

**Addresses****Repairer**

Name : PROGRESSIVE

Address :

Post Code :

Cost Summary

Total Labour	\$409.50
Total Parts	\$2,640.00
Total of Additional Costs	\$380.00
Excess:	TBA
Grand Total Exc GST:	\$3,429.50
7 % GST:	\$240.07
Grand Total Inc GST:	\$3,669.57

Repair Information**LABOUR****Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR****Price/Dent = \$45.00/HR****Repair /****Guide Number Repair Details**

		WU	Cost Price (\$)
10 82 19 00	R + R SOUND INSULATION PAN	3.0 ✓	13.50
97 85 19 00	DETACH + REFIT BATTERY	2.0 X	9.00
27 06 19 00)	R + R BATTERY	1.0 X	4.50
	(BATTERY DETACHED)		
50 84 19 50)	R + R BATTERY CONSOLE	1.0 X	4.50
	(AIR FILTER AND BATTERY REMOVED)		
44 05 19 00	R + R FRONT WHEEL (WHEELS)	2.0 ✓	9.00
NO NUMBER	R + R WATER BOX INSULATION	2.0 ✓	9.00
24 25 19 40	R + R AIR FILTER CPL	4.0 X	18.00
34 41 19 50	R + R PENDULUM SUPPORT	2.0 ✓	9.00
48 35 19 00)	R + R POWER STEERING GEAR	7.0 ✓	31.50
	(WHEELS, PENDULUM SUPPORT AND SOUND PROTECTION PAN REMOVED)		
	INCLUDES: DETACH + REFIT ASSEMBLIES CARRIER		
	DOES NOT INCLUDE: ALIGN FRONT AND REAR VEHICLE		
40 07 19 02)	R + R ASSEMBLY CARRIER	8.0 X	36.00
	(SOUND PROTECTION PAN REMOVED)		
	INCLUDES: DETACH + REFIT STEERING GEAR		

PROGRESSIVE CAR CARE PTE LTD

Claim Reference: OD 0918 - 6679

Assessment Number: PA001673

Version: PROGRESS/1

Date Calculated: 28/09/2018 04:08

Full Report - V1

Registration: SKH6943S

Printed: 28/09/2018 11:08

	AND STABILIZER		
44 10 55 50	DOES NOT INCLUDE: ALIGN FRONT AND REAR R + R L/F WHEEL/TYRE (WHEEL REMOVED) INCLUDES: R + R TYRE, FIT VALVE, BALANCE WHEEL	3.0 ✓	13.50
40 85 19 00)	R + R L/F SPRING STRUT (WHEEL REMOVED)	9.0 ✓	40.50
40 90 19 50	DOES NOT INCLUDE: ALIGN FRONT AND REAR R + R LEFT FRONT SHOCK ABSORBER (SPRING STRUT REMOVED)	2.0 ✓	9.00
40 50 19 00)	INCLUDES: R + R SPRING STRUT MOUNT AND COIL SPRING R + R L/F WHEEL BEARING HOUSING (WHEEL REMOVED)	9.0 ✓	40.50
	INCLUDES: R + R SPEED SENSOR AND BRAKE DISC, DETACH + REFIT DRIVE SHAFT		
40 50 55 50	DOES NOT INCLUDE: ALIGN FRONT AND REAR RENEW L/F WHEEL BEARING HOUSING (WHEEL BEARING HOUSING REMOVED)	3.0 ✓	13.50
	INCLUDES: R + R WHEEL BEARING AND WHEEL HUB		
40 07 55 50	RENEW AGGREGATE CARRIER (REMOVED)	1.0 X	4.50
40 41 19 00)	R + R L/F DRIVE SHAFT	2.0 ✓	9.00
40 17 09 00)	DETACH + REFIT R/F LOWER SUSPENSION ARM	2.0 ✓	9.00
01 50 00 ZAX	GFS / GUIDED FUNCTION (READ AND DELETE ERROR MEMORY AFTER REPAIR)	5.0 ✓	22.50
44 95 03 00	ALIGN FRONT AND REAR VEHICLE INCLUDES: CHECK TOE AND CAMBER, R + R BRACKET AND ALIGNMENT SENSOR	9.0 ✓	40.50
	DOES NOT INCLUDE: ADJUSTMENT		
44 94 15 50	REAR WHEEL CAMBER ALIGNMENT (COMPOSITE WORK)	2.0 ✓	9.00
44 93 15 50	(FRONT AND REAR VEHICLE ALIGNMENT) REAR WHEEL TOE ALIGNMENT (COMPOSITE WORK)	2.0 ✓	9.00
44 89 15 50	(VEHICLE FRONT AND REAR ALIGNMENT) ADJUST FRONT CAMBER (COMPOSITE WORK) (FRONT AND REAR ALIGNMENT)	3.0 ✓	13.50
	INCLUDES: DETACH + REFIT ASSEMBLIES CARRIER		
44 80 15 50	ADJUST CASTOR	5.0 ✓	22.50
44 88 15 50	INCLUDES: ALIGN FRONT AND REAR FRONT WHEEL TOE ALIGNMENT (COMPOSITE WORK)	2.0 ✓	9.00
	(VEHICLE FRONT AND REAR ALIGNMENT)		
LABOUR COST			
Total Work Units		91.0	
Panel / Mechanical Labour		6.8HRS	\$306.00

PROGRESSIVE CAR CARE PTE LTD

Claim Reference: OD 0918 - 6679
 Assessment Number: PA001673
 Version: PROGRESS/1
 Date Calculated: 28/09/2018 04:08

Full Report - V1
 Registration: SKH6943S
 Printed: 28/09/2018 11:08

Visual Alignment Labour	2.3HRS	\$103.50
Corrosion Protection External Labour	0.0HRS	0.00
Corrosion Protection Internal Labour	0.0HRS	0.00
Sub Total	9.1HRS <i>9.3</i>	\$409.50 <i>441</i>
Total Labour	9.1HRS <i>9.3</i>	\$409.50 <i>441</i>

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$45.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- TWO COAT METALLIC		
	- PREPARE OFF VEHICLE		
LABOUR COST - PAINT			
TIME(PAINT)		0.0	
Total Work Units (10WU/HR)		0.0	
Total Paintwork Labour		0.0HRS	\$0.00
MATERIAL COST - PAINT			Cost Price
Total Excluding Pearlescent Uplift			\$0.00
Pearlescent Uplift @ 0.0%			\$0.00
Total Paint Material Cost			\$0.00

PARTS

Guide No.		Qty	Description	Part Number	Supplier	Bet.	Price (\$)
7011	1		ASSEMBLY CARRIER <i>Here</i>	3C0 199 313 BB		0%	680.00*
7047	1		L/F TRACK CONT ARM <i>Best</i>	5N0 407 151		0%	260.00*
7061	1		L/F GUIDE JOINT <i>Best</i>	1K0 407 365 C		0%	60.00*
7081	1		L/WHEEL BEARING HSG <i>and</i>	1K0 407 255 AA		0%	280.00*
7087	1		L/F SHOCK ABSORBER <i>Best</i>	5N0 413 031 AL		0%	170.00*
7101	1		L/BUFFER <i>Best</i>	1K0 412 303 M		0%	50.00*
7131	1		L/F WHEEL HUB/BRG <i>Best</i>	5K0 498 621		0%	220.00*
7201	1		L/F WHEEL <i>Best</i>	5N0 601 025 AJ <i>SN</i>		0%	680.00*
			<i>cut</i>	828			
f: OEM Parts				Sub Total			\$2,400.00
g: Original				Mark Up From Cost (10 %)			\$240.00
h: Secondhand				Sundry Parts (Fixed)			\$0.00
p: Parallel				Total Parts			\$2,640.00
x: Exchange							

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
TYRES <i>700 All</i> SPECIALIST	0%	\$380.00*
Total Extras		\$380.00

Final Calculation

Total Parts	\$2,640.00
Labour	
Total Panel/Mechanical	\$306.00 <i>261</i>
Total Paintwork	\$0.00
Total Visual Alignment work	\$103.50
Total Labour	\$409.50 <i>441</i>
Additional Costs	
Corr Prot Materials External	\$0.00
Corr Prot Materials Internal	\$0.00

PROGRESSIVE CAR CARE PTE LTD

Claim Reference: OD 0918 - 6679

Assessment Number: PA001673

Version: PROGRESS/1

Date Calculated: 28/09/2018 04:08

Full Report - V1

Registration: SKH6943S

Printed: 28/09/2018 11:08

Cost of Specialist	\$380.00	
Total of Additional Costs		\$380.00
Total Paint/Material Costs		\$0.00
Grand Total Excludes GST	3541	\$3,429.50
GST @ 7 %		\$240.07
Grand Total Includes GST		\$3,669.57

Assessment Notes

Adrian King -
R/P 28/09/18
Authorised Repairs, 03 Days
Excess : NIL

LKK Auto Consultants hence notify
the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and
is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

PEOPLE'S AUTO TRADING

BLK 3007 UBI ROAD 1 #01-400 SINGAPORE 408701

Tel No. : 67414646 Fax No. : 67489194

E-Mail : peoplevehicle@gmail.com

GST Reg. No. : M9-0001895-E Buss. Reg. No. : 52861999C

PROGRESSIVE CAR CARE PTE LTD

BLK 3022A UBI ROAD 1 #01-4548

S408716

Contact : 67415336 Fax No. : 67417208

080918-6679

Tax Invoice : PA183881

Invoice Date : 29/09/2018

Vehicle Num. : SKH 6943 S

Make/Model : VOLKSWAGEN TIGUAN

Mileage(Km) : 152837

POW/RO# :

Ref/Remark : 235-55-17 CSC2

S/N	Quantity	Particular	Unit Price	Amount S\$
1.	1SER	CROSS MEMBER TO SYMMETRICAL SPECIFICATIONS	80.00	80.00 ✓

Adrian Lim
H.S.

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer

Signature:

Date:

Eighty-Five & Cents Sixty Only

E & O E

Total S\$: 80.00
GST @ 7% S\$: 5.60
Amount Due S\$: 85.60

Terms : 30

Customer's Signature/Co. Stamp

PEOPLE'S AUTO TRADING

No official receipt will be issued. Goods sold are not refundable.
Thank you for being our customer.

51 Ubi Avenue 1, #01-25
Paya Ubi Industrial Park
Singapore
408933

Claim Reference: OD 0918 - 6679
Assessment Number: PA001673
Version: LKKAUTOC/4
Date Calculated: 08/11/2018 00:45

Full Report - V1
Registration: SKH6943S
Printed: 08/11/2018 08:47

Summary Information

Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	LKK AUTO	Date of Incident:	26/09/2018
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	AXA Insurance S'pore Pte Ltd	Repairs Authorised:	TBA
Claim Reference:	OD 0918 - 6679	Estimated Repair Time:	
Policy Number:		Quote Due Date:	
Other Reference:	OD 0918 - 6679	Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

Vehicle Details

Vehicle

Manufacturer:	VOLKSWAGEN
Model:	Tiguan
Sub Model:	SPORT & STYLE
Model Sheet Number:	6C3 04
Registration:	SKH6943S
Registration Month:	January
Registration Year:	2013
VIN Number:	WVGZZZ5NZDW043183
Manufacture Year:	2012
Odometer:	Not Known
Colour:	
Engine Number:	CAW158855
Fuel Level:	%

Model Specs

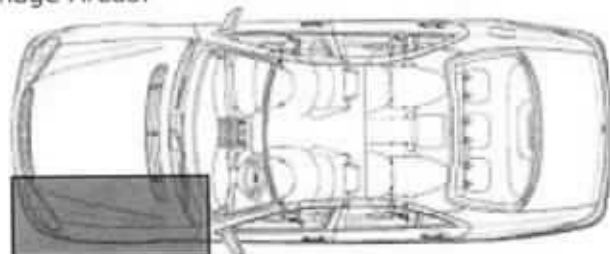
FROM 09/2012	TYRES 235/55 VR 17
CLIMATRONIC	DOOR MIRROR W/MEMORY
RAIN SENSOR	LIGHT/COMING HOME
SIDE WINDOW/RR SCRNR	AUTO DIPPING MIRROR
8 SPEAKER	RADIO RCD 310
FOG LAMPS	KEYLESS ENTRY
HEIGHT ADJ PASS SEAT	ROOF CONSOLE
STRG WHEEL LEATHER	CLOTH/LEATHER TRIM
FRONT SEAT DRAWER	FRONT LUMBAR SUPPORT
VARIABLE LOAD FLOOR	OIL LEVEL SENSOR
FRT SEAT FOLD TABLE	FRONT CENTRE ARMREST
SMOKER EQUIPMENT	FRT FOLDING BACKREST
HD COOLING	2.0 LTR 125 KW
4MOTION (ALL WHEEL)	AUTOMATIC 6-SPEED
DROWSINESS DETECTION	WHEELS 7J X 17 ALLOY
SPACE SAVER SP-WHEEL	CHROME PACKAGE
TYRE PRESSURE CHECK	BUMPER COMFORT
ROOF RAILS	EXCLUSIVE
TWO COAT METALLIC	PREPARE OFF VEHICLE

Vehicle Condition

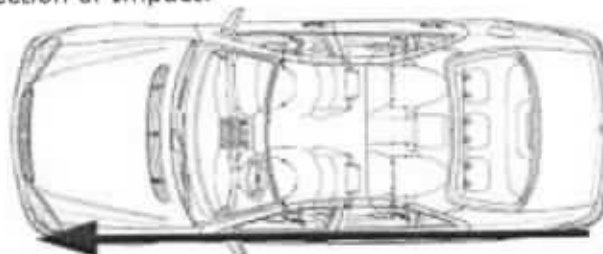
Vehicle Status

Pre-Accident Condition:	Severity of Impact:
Steering:	Vehicle Status on Inspection:
Brakes Pedal Travel:	Date of Inspection:
Place of Inspection:	27/09/2018
Pre-Accident Damage:	
Tyres Condition:	
Tread Depth LHF:	Tread Depth RHF:
Tread Depth LHR:	Tread Depth RHR:

Damage Areas:



Direction of Impact:

**Addresses****Repairer**

Name : PROGRESSIVE

Address :

Post Code :

Cost Summary

Total Labour	\$364.50
Total Parts	\$1,144.00
Total of Additional Costs	\$760.00
Excess:	TBA
Grand Total Exc GST:	\$2,268.50
7 % GST:	\$158.80
Grand Total Inc GST:	\$2,427.30

Repair Information**LABOUR**

Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR

Price/Dent = \$45.00/HR

Repair /**Guide Number Repair Details**

		WU	Cost Price (\$)
10 82 19 00	R + R SOUND INSULATION PAN	3.0	13.50
97 85 09 50	DETACH + REFIT BATTERY EARTH STRAP	1.0	4.50
NO NUMBER	R + R WATER BOX INSULATION	2.0	9.00
34 41 19 50	R + R PENDULUM SUPPORT	2.0	9.00
48 40 09 00)	DETACH + REFIT POWER STEERING GEAR	4.0	18.00
48 35 19 00)	R + R POWER STEERING GEAR	7.0	31.50
	(WHEELS, PENDULUM SUPPORT AND SOUND PROTECTION PAN REMOVED)		
	INCLUDES: DETACH + REFIT ASSEMBLIES CARRIER		
	DOES NOT INCLUDE: ALIGN FRONT AND REAR VEHICLE		
44 05 19 00	R + R FRONT WHEEL (WHEELS)	2.0	9.00
44 10 55 50	R + R L/F WHEEL/TYRE	3.0	13.50
	(WHEEL REMOVED)		
	INCLUDES: R + R TYRE, FIT VALVE, BALANCE WHEEL		
40 85 19 00)	R + R L/F SPRING STRUT	9.0	40.50
	(WHEEL REMOVED)		
	DOES NOT INCLUDE: ALIGN FRONT AND REAR		
40 90 19 50	R + R LEFT FRONT SHOCK ABSORBER	2.0	9.00
	(SPRING STRUT REMOVED)		
	INCLUDES: R + R SPRING STRUT MOUNT AND		

40 50 19 00)	COIL SPRING		
	R + R L/F WHEEL BEARING HOUSING	9.0	40.50
	(WHEEL REMOVED)		
	INCLUDES: R + R SPEED SENSOR AND BRAKE DISC,		
	DETACH + REFIT DRIVE SHAFT		
	DOES NOT INCLUDE: ALIGN FRONT AND REAR		
40 50 55 50	RENEW L/F WHEEL BEARING HOUSING	3.0	13.50
	(WHEEL BEARING HOUSING REMOVED)		
	INCLUDES: R + R WHEEL BEARING AND WHEEL HUB		
40 17 19 03)	R + R L/FR/LOWER CONTROL ARM	2.0	9.00
40 41 19 00)	R + R L/F DRIVE SHAFT	2.0	9.00
40 17 09 00)	DETACH + REFIT R/F LOWER SUSPENSION ARM	2.0	9.00
01 50 00 ZAX	GFS / GUIDED FUNCTION	5.0	22.50
	(READ AND DELETE ERROR MEMORY AFTER REPAIR)		
44 95 03 00	ALIGN FRONT AND REAR VEHICLE	9.0	40.50
	INCLUDES: CHECK TOE AND CAMBER, R + R BRACKET AND ALIGNMENT SENSOR		
	DOES NOT INCLUDE: ADJUSTMENT		
44 94 15 50	REAR WHEEL CAMBER ALIGNMENT	2.0	9.00
	(COMPOSITE WORK)		
	(FRONT AND REAR VEHICLE ALIGNMENT)		
44 93 15 50	REAR WHEEL TOE ALIGNMENT	2.0	9.00
	(COMPOSITE WORK)		
	(VEHICLE FRONT AND REAR ALIGNMENT)		
44 89 15 50	ADJUST FRONT CAMBER (COMPOSITE WORK)	3.0	13.50
	(FRONT AND REAR ALIGNMENT)		
	INCLUDES: DETACH + REFIT ASSEMBLIES CARRIER		
44 80 15 50	ADJUST CASTOR	5.0	22.50
	INCLUDES: ALIGN FRONT AND REAR		
44 88 15 50	FRONT WHEEL TOE ALIGNMENT	2.0	9.00
	(COMPOSITE WORK)		
	(VEHICLE FRONT AND REAR ALIGNMENT)		
LABOUR COST			
	Total Work Units	81.0	
	Panel / Mechanical Labour	5.8HRS	\$261.00
	Visual Alignment Labour	2.3HRS	\$103.50
	Corrosion Protection External Labour	0.0HRS	0.00
	Corrosion Protection Internal Labour	0.0HRS	0.00
	Sub Total	8.1HRS	\$364.50
	Total Labour	8.1HRS	\$364.50

PAINT WORK

Time Basis 10 WU = 1 HR. Price = \$45.00/HR

Guide Number Description

WU

Cost Price (\$)

- TWO COAT METALLIC
- PREPARE OFF VEHICLE

LABOUR COST - PAINT**TIME(PAINT)****0.0**

Total Work Units (10WU/HR)	0.0	
Total Paintwork Labour	0.0HRS	\$0.00
MATERIAL COST - PAINT		Cost Price
Total Excluding Pearlescent Uplift		\$0.00
Pearlescent Uplift @ 0.0%		\$0.00
Total Paint Material Cost		\$0.00

PARTS

				Price Valid: 01/06/2015	
Guide No.	Qty	Description	Part Number	Supplier	Bet. Price (\$)
7101	1	L/BUFFER	1K0 412 303 M		0% 50.00*
7061	1	L/F GUIDE JOINT	1K0 407 365 C		0% 60.00*
7087	1	L/F SHOCK ABSORBER	5N0 413 031 AL		0% 170.00*
7047	1	L/F TRACK CONT ARM	5N0 407 151		0% 260.00*
7201	1	L/F WHEEL	5N0 601 025 AJ		0% 0.00F
			8Z8		
7131	1	L/F WHEEL HUB/BRG	5K0 498 621		0% 220.00*
7081	1	L/WHEEL BEARING HSG	1K0 407 255 AA		0% 280.00*
f: OEM Parts			Saving		\$446.00
g: Original			Sub Total		\$1,040.00
h: Secondhand			Mark Up From Cost (10 %)		\$104.00
p: Parallel			Sundry Parts (Fixed)		\$0.00
x: Exchange			Total Parts		\$1,144.00

THIS ASSESSMENT CONTAINS UNPRICED PARTS
 NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
L/F WHEEL SPECIALIST	0%	\$680.00
ADJUSTER SPECIALIST		\$80.00
CROSSMEMBER		
Total Extras		\$760.00

Final Calculation

Total Parts		\$1,144.00
Labour		
Total Panel/Mechanical	\$261.00	
Total Paintwork	\$0.00	
Total Visual Alignment work	\$103.50	
Total Labour		\$364.50
Additional Costs		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$760.00	
Total of Additional Costs		\$760.00
Total Paint/Material Costs		\$0.00
Grand Total Excludes GST		\$2,268.50
GST @ 7 %		\$158.80
Grand Total Includes GST		\$2,427.30

Assessment Notes

51 Ubi Avenue 1, #01-25 Paya Ubi Industrial Park Singapore

Claim Reference: OD 0918 - 6679

Full Report - V1

Assessment Number: PA001673

Registration: SKH6943S

Version: LKKAUTOC/4

Printed: 08/11/2018 08:47

Date Calculated: 08/11/2018 00:45



日美汽車私人有限公司

JAE AUTO PTE LTD

Blk 3018 UBI ROAD 1 #01-121 SINGAPORE 408710
TEL: 67453833 FAX: 67454442, 67450616 (Account)

WAREHOUSE:

48A SUNGEI KADUT AVE SINGAPORE 729672

TEL: 6365 1255 FAX: 6365 2580

Email: jaeauto@pacific.net.sg

GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M

WINDSCREEN GLASS
Dept Direct: 6417 0201 / 0745 0229

Arrange by

Univer *FRM*



Dept Direct: 6300 0010

Dept Direct: 6300 0011

Dept Direct: 6417 0702



Dept Direct: 6417 0704

Dept Direct: 6417 0705

Dept Direct: 6417 0706

Dept Direct: 6417 0707

Wiper blades: HWB (Nippon Wiper blades), Sipsip (Made in Korea),

Ford (Made in Germany)

Spark plug: Nippon Denso, NGK (Made in Japan)

PROGRESSIVE CAR CARE PTE LTD

BLOCK 3022A #01-45/46

UBI ROAD 1

BUTTON 92712711

SINGAPORE 408716

TEL : 67415336 FAX : 67417208 LILY / 68444802 WENDY

ATTN : WENDY

WVGZZZ5NZDW043183

TAX INVOICE : AR201809-14808

DATE : 29/09/2018

CUSTOMER ID : PRO005

VEH REG. NO. : SKH6943S

TERMS : 30 days

PO NO. :

PAGE NO. : Page 1 of 1

CURR : SGD

SQ	STOCKID	DESCRIPTION	StkLoc	QTY	U/PRICE	AMOUNT
1.	5N0413031AH/AL	FRT ABSORBER LH	CC CC5-G-070	1	170.00	170.00 -
2.	1K0412331C	FRT ABSORBER MTG	CC CC5-G-08AB	1	50.00	50.00 -
3.	5N0407151	FRT LOWER ARM LH	CC CC5-G-070	1	260.00	260.00 -
4.	1K0407255AA	FRT KNUCKLE ARMLH	CC CC5-C-01A	1	280.00	280.00 -
5.	5K0498621/1T0498621/8J05 98625	FRT WHEEL BEARING HUB	CC CC5-F-01A	1	220.00	220.00 -

SUB-TOTAL : 980.00

ADD GST 7.00 % 68.60

E & O E

TOTAL AMOUNT SGD : 1,048.60

[P] 29/09/2018 9:17:54AM

[E] 29/09/2018 9:11:07AM

Goods Sold are not refundable for Cash.

Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

JAE Auto Pte. Ltd.

Sales Executive: WENWEI

This is computer generated document.

No signature is required.



ORIGINAL

Goods Received in Good Order

Signature / Co Stamp / Date

SUMMARY REPORT

ENTRY DATE FROM 27/12/2004 TO 27/12/2004

05/01/2005

Reference	Vehicle No.	Entry Date	Accident Date	Closed Date
AIC/006889/04XA1	PB 3668D	27/12/2004	29/10/2004	
AIC/006991/04BQ1	SCM 3843K	27/12/2004	06/11/2004	
AIC/008167/04ZA	GV 9866K	27/12/2004	25/12/2004	
AIC/008174/04ZA	GV 9866K	27/12/2004	26/12/2004	
AIC/008176/04CA	SBL 2745J	27/12/2004	25/12/2004	
AIC/008180/04FQ	GU 4146T	27/12/2004	26/12/2004	
AIC/008188/04FK	SDT 2455E	27/12/2004	26/12/2004	
AIC/M008203/04ZR	SDY 750P	27/12/2004	25/12/2004	
AIG/008182/04PMK	SDS 264H	27/12/2004	25/12/2004	
AIG/008186/04BQ	EY 5916J	27/12/2004	25/12/2004	
AIS/006941/04XK1	SDR 7435R	27/12/2004	03/11/2004	
AIS/008179/04ZQ	SDE 9976B	27/12/2004	24/12/2004	
AIS/008184/04ZQ	SFM 1449T	27/12/2004	27/12/2004	
AVI/006894/04ER1	SDY 9118G	27/12/2004	03/11/2004	
AVI/006954/04EQ1	SBW 9206U	27/12/2004	04/11/2004	
AVI/008170/04CQ	SCW 248X	27/12/2004	25/12/2004	
AXA/008193/04CQ	SDG 8194L	27/12/2004	27/12/2004	
AXA/M008201/04FR	SDY 8197J	27/12/2004	23/12/2004	
CAI/006679/04BR1	SDB 9590X	27/12/2004	25/10/2004	
CAI/006881/04AQ1	SDB 543S	27/12/2004	02/11/2004	
CAI/008181/04BX	GP 1840T	27/12/2004	25/12/2004	
HSB/008185/04CQ	SFL 9785A	27/12/2004	24/12/2004	
III/006842/04PGR1	SCV 319E	27/12/2004	01/11/2004	
INC/008166/04CQ	SDW 2368H	27/12/2004	24/12/2004	
INC/008171/04CQ	GV 965S	27/12/2004	25/12/2004	
INC/008175/04ZQ	SCR 9474B	27/12/2004	26/12/2004	
INC/008177/04BA	SFC 1168G	27/12/2004	25/12/2004	
INC/008183/04ZX	SBC 7574A	27/12/2004	26/12/2004	
INC/008187/04FQ	SH 3234E	27/12/2004	27/12/2004	
INC/008190/04PMA	SFG 5620U	27/12/2004	26/12/2004	
INC/008191/04BA	SFJ 7254P	27/12/2004	27/12/2004	
INC/008194/04PMQ	FQ 1026J	27/12/2004	01/12/2004	
INC/008196/04FR	GT 1541K	27/12/2004	25/12/2004	
INC/008197/04PMA	SDV 9104L	27/12/2004	27/12/2004	
INC/008199/04ZQ	SDH 7071J	27/12/2004	27/11/2004	
INC/M008202/04FR	SFH 5544B	27/12/2004	25/12/2004	
INC/P008192/04K	SBL 7461U	27/12/2004		03/01/2005
INC/S008165/04PS.PS	SHB 5301T	27/12/2004		
ING/S008168/04PSPS	SHB 1044L	27/12/2004	27/12/2004	
INC/S008169/04PSPS	SHB 1157U	27/12/2004	25/12/2004	
INC/S008178/04PS.PS	SHB 1538D	27/12/2004	24/12/2004	
INC/S008198/04PS.PS	SHB 5456E	27/12/2004		
LIP/008189/04CA	SDH 7525S	27/12/2004	24/12/2004	
LIP/008200/04FR	SFB 3070X	27/12/2004	27/12/2004	
MSI/008173/04BK	SDW 5087Z	27/12/2004	25/12/2004	
NIC/006886/04PGK1	SDD 9019U	27/12/2004	02/11/2004	
NIC/006893/04PGK1	SCX 790R	27/12/2004	01/11/2004	



日美汽車私人有限公司

JAE AUTO PTE LTD

Blk 3018 UBI ROAD 1 #01-121 SINGAPORE 408710
TEL: 67453833 FAX: 67454442, 67450816 (Account)

WAREHOUSE:

48A SUNGEI KADUT AVE SINGAPORE 729672

TEL: 6365 1255 FAX: 6365 2580

Email: jaeauto@pacific.net.sg

GST REG. NO.: M2-0119201-3 CO. REG. NO.: 199307741M

WINDSCREEN GLASS
Dept Direct: 6417 0151 / 6749 0029



Dept Direct: 6417 0151

Dept Direct: 6417 0152

Dept Direct: 6417 0153

Dept Direct: 6417 0153

Wiper blade: HWB (Nippon Viper blade), Siper (Made in Korea)
Forch (Made in Germany)
Spark plug: Nippon Denso, NGK (Made in Japan)

PROGRESSIVE CAR CARE PTE LTD
BLOCK 3022A #01-45/46
UBI ROAD 1
BUTTON 92712711
SINGAPORE 408716
TEL: 67415336 FAX: 67417208 LILY / 68444802 WENDY
ATTN: WENDY
WVGZZZ5NZDW043183

00 6679

TAX INVOICE : AR201809-14813
DATE : 29/09/2018
CUSTOMER ID : PRO005
VEH REG. NO. : SKH6943S
TERMS : 30 days
PO NO. :
PAGE NO. : Page 1 of 1
CURR. : SGD

SQ STOCKID	DESCRIPTION	StkLoc	QTY	U/PRICE	AMOUNT
1. 1K0407365C	FRONT BALL JOINT LH	U1 2A15-C	1	60.00	60.00

SUB-TOTAL : 60.00
ADD GST 7.00 % 4.20

E. & O.E TOTAL AMOUNT SGD : 64.20

[P] 29/09/2018 9:15:41AM

[E] 29/09/2018 9:13:23AM

Goods Sold are not refundable for Cash.

Interest Rate of 1.5% per month will be imposed on OverDue Account(s).

JAE Auto Pte. Ltd.

Sales Executive : WENWEI



* AR201809-14813 *

This is computer generated document.

No signature is required.

ORIGINAL

Goods Received in Good Order

Y

Signature / Co Stamp / Date

SUMMARY REPORT

ENTRY DATE FROM 27/12/2004 TO 27/12/2004

05/01/2005

Reference	Vehicle No.	Entry Date	Accident Date	Closed Date
NIC/008172/04BQ	SDL 3942B	27/12/2004	27/12/2004	
NIC/008195/04ZQ	SCR 2987J	27/12/2004	27/12/2004	
Total Reports:				49



LKK Auto Consultants Pte Ltd

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Affiliated to Federation Internationale Des Experts En Automobile

AXA INSURANCE PTE LTD

Ref : CS/ASM18017668/Asd3e2

8 SHENTON WAY #24-01
AXA TOWERSINGAPORE 068811

Date : 05-12-2018



ATTN : KITTY TEO

Code : ASM

1. Policy Particulars :- OWN DAMAGE

Insured Veh.		Veh. Inspected	SKH 6943S
Policy No.	P1879912	Coverage (\$)	0.00
Claim No.	S8M00X61	Excess (\$)	0.00
Assign From	KITTY TEO	Assign Date	28/09/2018

2. Vehicle Particulars & Condition

Make & Model	VOLKSWAGEN TIGUAN	c.c	1984
Engine No.	HIDDEN	Year of Reg.	2013
Chassis No.	WVGZZZ5NZDW043183	Colour	BROWN
Odometer	152832	Steering	IN ORDER
Brakes	IN ORDER	Modification	SPORTS RIM
General	GOOD		

3. Conditions of Tyres

	Size	Make	Balance
R/H Front Tyre	235/55 R19	CONTINENTAL	6 mm
L/H Front Tyre	235/55 R19	CONTINENTAL	6 mm
R/H Rear Tyre	235/55 R19	CONTINENTAL	6 mm
L/H Rear Tyre	235/55 R19	CONTINENTAL	6 mm

4. Description of Damages

THE VEHICLE SUSTAINED DAMAGES AT THE UNDERCARRIAGE PORTION. DAMAGES SEE DETAILS.

5. General Information

Accident Date	26/09/2018	Inspection Date	28/09/2018
Survey held at	PROGRESSIVE AUTOMOTIVE PTE LTD BLK 3022A UBI ROAD 1 #01-45/46, SINGAPORE 048716		

5a. Remarks

A)THE MARKET VALUE IS S\$63,000.00(EST. AVERAGE) B)IN ACCORDANCE TO YOUR INSTRUCTIONS, WE HAVE AUTHORISED REPAIRS.

5b. Estimate Days of Repair

ESTIMATED NORMAL PERIOD FOR REPAIR:	3 Working Days
-------------------------------------	----------------

**LKK Auto Consultants Pte Ltd**

51 Ubi Ave 1 #01-25 Paya Ubi Industrial Park, Singapore 408933

TEL: 6256 3561 FAX: 6256 4315

Reg. No: 199607198R GST Reg. No. 19-9607198-R

Page No.:1 of 1

ADJUSTMENT ON REPAIR COST FOR VEHICLE NO. SKH 6943S

Qty	Description of Parts	Condition	Estimate By Workshop (\$)	Our Adjusted (\$)
	<u>REPLACEMENT OF PARTS</u>			
1	ASSEMBLY CARRIER (WCP) (CONSISTENT)	NOT NECESSARY	680.00	-
1	L/F TRACK CONT ARM (WCP) (CONSISTENT)	BENT	260.00	260.00
1	L/F GUIDE JOINT (WCP) (CONSISTENT)	BENT	60.00	60.00
1	L/WHEEL BEARING HSG (WCP) (CONSISTENT)	DAMAGED	280.00	280.00
1	L/F SHOCK ABSORBER (WCP) (CONSISTENT)	BENT	170.00	170.00
1	L/BUFFER (WCP) (CONSISTENT)	DAMAGED	50.00	50.00
1	L/F WHEEL HUB/BRG (WCP) (CONSISTENT)	DAMAGED	220.00	220.00
	COST PLUS 10%		172.00	104.00
			1,892.00	1,144.00
1	L/F WHEEL (WCP) (SN) (CONSISTENT)	CUT	680.00	680.00
	COST PLUS 10%		68.00	-
			748.00	680.00
	<u>SPECIAL NETT ITEMS</u>			
1	TYRES (SN) (CONSISTENT)	NOT NECESSARY	380.00	-
			380.00	-
	<u>LABOUR</u>			
	TOTAL PANEL / MECHANICAL		306.00	261.00
	TOTAL VISUAL ALIGNMENT WORK		103.50	103.50
	CROSS MEMBER TO SYMMETRICAL SPECIFICATIONS. (ADDITIONAL)		80.00	80.00
			489.50	444.50
	GRAND TOTAL		3,509.50	2,268.50
	RECOMMENDED COST OF REPAIRS			2,268.50

Report Ref No. CS/ASM18017668/Asd3e2

ADRIAN LING WAI PING

B.Eng,AMSOE,AMIRTE,AMSAE-A,M.MATAI

Licensed Appraiser

DISCLAIMER OF LIABILITY TO THIRD PARTIES:- This Report is made solely for the use and benefit of the Client named on the front page of this Report.

No liability of responsibility whatsoever, in contract or tort, is accepted to any third party who may rely on the Report wholly or in part. Any third party acting or relying on this Report, in whole or in part, does so at his or her own risk.