

ASS. REC. BY:

REF: CSLASM18018537 / Ktd302 Special Instruction:

Surveyor: Kenneth ASSIGNMENT (Office)From (Person): Lynnkhong of ASM (AXA) Date/Time: 12/10/2018

Estimated Cost: \_\_\_\_\_ Bill to: \_\_\_\_\_

 OD / TP / WS / TP RES / OD RES / EVA / INV / MV / CSTo Inspect Vehicle No: SJJ 7331C Insured: \_\_\_\_\_at Workshop tm/s K. Kim Hin Tel: 6452 7018of 160 Sin Ming Drive #02-20Policy No: \_\_\_\_\_ Claim No: S8M00YZASum Insured: \_\_\_\_\_ Excess: \$600.00Make of Veh: \_\_\_\_\_ D.O.A. 11/10/2018  
(Client's Record) CA / REV / REP. / REV 24 HRS

H.O.D. Endorsement: \_\_\_\_\_

Date/Time: 10:16am @ 12/10/18 Person Contacted: Jhumein Vehicle: OUT

Date/Time	Action/Instruction (✓) Estimate
	<u>SJJ 7331C - X</u>
<u>12/10/18</u>	<u>Revised via. merimen Revised</u>
	<u>Part by part finalise \$5,313.91 cred. 2634.74 : 33%</u>

ASS. REC. BY:

REF:

AAA / CS / ASM18018537 / KFD3

Kenneth

ASSIGNMENT

From: \_\_\_\_\_ Date: \_\_\_\_\_

Estimated Cost: \_\_\_\_\_

OD /  TP /  WS /  TP RES /  OD RES /  EVA /  INV /  MV

To inspect Vehicle No: \_\_\_\_\_

at Workshop m/s: 10101111

of \_\_\_\_\_

Insured: \_\_\_\_\_

Policy No. \_\_\_\_\_

Claims No. \_\_\_\_\_

Sum Insured: \_\_\_\_\_ Excess: Good

(Client's Record)

Make of Veh: \_\_\_\_\_

(Policy Condition)

Remark: The veh had commenced its repair at the time of inspection.

N/S	O/S

Bal. or Market Value: 836k

IDAC Accident Rpt: \_\_\_\_\_ Consistent? : Yes or No

GIA / PR Seen: \_\_\_\_\_ Consistent? : Yes or No

Est. Repairs: 05 days Res.: Yes or No

Lum Sum: 9123 1.31 % 3 Val.: Yes or No

REV / REP. / 24 HRS

Date: \_\_\_\_\_ Person Contacted: \_\_\_\_\_ Vehicle: IN / OUT

Veh No: PESTT 73310 Yr Regn: 09, 08

Type:  M.Car /  M.Cycle /  Bus /  Van /  Lorry /  Taxi /  Prime Mover /

Truck / Traller or

Make: MIT Lancer c.c. 1998

Colour: Black A/C:  Insured /  Std /  NI /  NA

Sp. Reading: 9952P T/Radio:  Insured /  Std /  NI /  NA

Eng/No: \_\_\_\_\_

C/No: JMYSTC 44A9U000369

Gen. Cond:  Good /  Fair /  Poor /  Burnt

Steering:  In order /  Jammed /  Leaked /  Burnt or

Brake:  In order /  Jammed /  Leaked /  Burnt or

Modi:  Nil /  S/Rim /  STD A/Bim or

Tyre Size: F: 215/50R17  
R: \_\_\_\_\_

BS /  DUN /  EXNOVA /  GY /  FS /  LIZA /  MIC /  OHTSU /  PIR /  SUMI /  TOYO /  YOKO or

Front

R/Bal. 6 mm

L/Bal. 6 mm

D.O.A. 11/10/18

Survey held at \_\_\_\_\_

Rear

R/Bal. 7 mm

L/Bal. 7 mm

D.O.I. 12/10/18

Des. of Damages:  Frt /  Rear /  O/S /  N/S /  UIC /  Rooftop or

The UIC / Chassis frame / Body Structure affected due to collision.

Date / Time Action / Instruction  
15/10 File pass to Catherine

RECEIVED 03 APR 2019

Date/Time, File Pass to?

11/2/14 TYPST

Date/Time, File Return to?

Prel. Report

Final Report

Days Of Repair: 5

Resurvey No. of Trip: 1

Survey Fee:

Transportation:

S - RS - SI

Fuels

Others

Add Fee:  Site Insp (\$)

Interview (\$)

Tech Invs (\$)

Weekend (\$)

TOTAL

200

Report Format: OP

Lump Sum / I.B.I: (\$ 5343.91)

## Denise Tay (LKKAuto)

---

**From:** survey@kkimhin.com.sg  
**Sent:** Saturday, 30 March 2019 9:24 AM  
**To:** Denise Tay (LKKAuto)  
**Subject:** RE: STATUS FOR AXA OWN DAMAGE CASE SJJ7331C OD-AXA FINALISATION

Hi Denise,

Confirm you figure P/P=\$5,343.91  
Thank you.

Regard  
Meng Huat  
K.Kim Hin Auto

---

**From:** Denise Tay (LKKAuto) <denisetay@lkkauto.com>  
**Sent:** Friday, 29 March 2019 1:12 PM  
**To:** survey@kkimhin.com.sg  
**Subject:** RE: STATUS FOR AXA OWN DAMAGE CASE SJJ7331C OD-AXA FINALISATION  
**Importance:** High

Dear Meng Huat,

According to Kenneth this item cannot be given

Guide No. 1000 – RH HEADLAMP BACK CVR \$18

Therefore the total is \$5,343.91, 5days

Please check and confirm

Best Regards,

**Denise Tay** | Case Handler

**LKK Auto Consultants Pte Ltd**

Phone: 6256-3561 | email: [denisetay@lkkauto.com](mailto:denisetay@lkkauto.com) | fax: 6256-4315

Blk 51, Paya Ubi Industrial Park, Ubi Avenue 1, #02-25 | S(408933)

---

**From:** Denise Tay (LKKAuto)  
**Sent:** Thursday, 28 March 2019 2:38 PM  
**To:** 'survey@kkimhin.com.sg' <[survey@kkimhin.com.sg](mailto:survey@kkimhin.com.sg)>  
**Subject:** RE: STATUS FOR AXA OWN DAMAGE CASE SJJ7331C OD-AXA FINALISATION

Dear Meng Huat,

According to Kenneth this item cannot be given

Guide No. 1000 – RH HEADLAMP BACK CVR \$18

Therefore the total is \$5,343.91, 5days

## ◀ Service Request Details

**Claim**

S8M00YZA

**Reference**None **Loss Date**

October 11, 2018

**Request Date**

October 12, 2018

**Due Date**

October 19, 2018

**Vendor Name**

LKK AUTO CONSULTANTS PTE LTD (OD)

**Type of Loss**

Own Damage

**Services**

Accelerated survey and authorize

### Actions

---

**Next Step**

Agree to perform service

### Vehicle Information

---

**Incident Vehicle Registration #**

SJJ7331C

**Make**

MITSUBISHI

Model

LANCER 2.0

---

**Service Address**

---

160 Sin Ming Drive, #. . . 575722

---

**Primary Contact/Insured**

---

LOW KEAN FONG

BLK 273 YISHUN STREET 22, #09-94, 760273, Singapore

96702553

LOUISLOW@LIVE.COM.SG

---

**Claim Handler**

---

KHONG Lynn

68804892

lynn.khong@axa.com.sg

Additional Instructions

K KIM HIN OD EXCESS \$600

[Messages](#)[Invoices](#)[History](#)[Documents](#)[Assessment](#)[Metrics](#)[Notes](#)[New Message](#)

> **Back to OneMotoring**

### Enquire PARF/COE Rebate for Registered Vehicle

<b>Vehicle Owner Particulars</b>	
Owner ID Type:	Singapore NRIC
Owner ID:	0529C
<b>Vehicle Details</b>	
Vehicle No.:	SJJ7331C
Vehicle to be Exported:	No
Intended Deregistration Date:	11 Oct 2018
Vehicle Make:	MITSUBISHI
Vehicle Model:	LANCER 2.0L MIVEC GLS 6-CVT
Primary Colour:	Black
Manufacturing Year:	2008
Engine No.:	4B11CA2580
Chassis No.:	JMYSTCY4A9U000369
Maximum Power Output:	114.0 kW (152 bhp)
Open Market Value:	\$19,104.00
Original Registration Date:	24 Sep 2008
First Registration Date:	24 Sep 2008
Transfer Count:	1
Actual ARF Paid:	\$19,104.00
<b>Intended PARF Rebate Details</b>	
PARF Eligibility:	Forfeited
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00
<b>Intended COE Rebate Details</b>	
COE Expiry Date:	23 Sep 2023
COE Category:	B - Car (1601cc & above)
COE Period(Years):	5
PQP Paid:	\$16,689.00
COE Rebate Amount:	\$16,522.00
<b>Total Rebate Amount:</b>	<b>\$16,522.00</b>
<b>Message</b>	
Please note that the 5-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.	

The information contained herein is correct as at 11 Oct 2018

OK

> [Back to OneMotoring](#)

### Enquire PARF/COE Rebate for Registered Vehicle

Vehicle Owner Particulars	
Owner ID Type:	Singapore NRIC
Owner ID:	0529C
Vehicle Details	
Vehicle No.:	SJJ7331C
Vehicle to be Exported:	No
Intended Deregistration Date:	12 Oct 2018
Vehicle Make:	MITSUBISHI
Vehicle Model:	LANCER 2.0L MIVEC GLS 6-CVT
Primary Colour:	Black
Manufacturing Year:	2008
Engine No.:	4B11CA2580
Chassis No.:	JMYSTCY4A9U000369
Maximum Power Output:	114.0 kW (152 bhp)
Open Market Value:	\$19,104.00
Original Registration Date:	24 Sep 2008
First Registration Date:	24 Sep 2008
Transfer Count:	1
Actual ARF Paid:	\$19,104.00
Intended PARF Rebate Details	
PARF Eligibility:	Forfeited
PARF Eligibility Expiry Date:	-
PARF Rebate Amount:	\$0.00
Intended COE Rebate Details	
COE Expiry Date:	23 Sep 2023
COE Category:	B - Car (1601cc & above)
COE Period(Years):	5
PQP Paid:	\$16,689.00
COE Rebate Amount:	\$16,512.00
<b>Total Rebate Amount:</b>	<b>\$16,512.00</b>
Message	
Please note that the 5-year COE for this vehicle cannot be further renewed. The vehicle must be de-registered upon COE expiry or when the vehicle reaches its statutory lifespan (if applicable), whichever is earlier.	

The information contained herein is correct as at 12 Oct 2018

OK

## SINGAPORE ACCIDENT STATEMENT

### IMPORTANT NOTICE

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver.
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. **Any false reporting may be referred to the Police for investigation.**
6. This report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will, for a fee, be made available upon application by interested parties.
7. By the lodgement of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.

### ACCIDENT STATEMENT

Date Of Report	11/10/2018 11:59
Date Of Accident	11/10/2018 07:30
Exact Location Of Accident	LENTOR AVE TWDS ANG MO KIO (NEAR BRIDGE)
Country/State of Loss	SINGAPORE

### DETAILS OF OWN VEHICLE

Vehicle Registration Number	SJJ7331C
<b>Insured/Policyholder</b>	
Name Of Registered Owner	LOW KEAN FONG
NRIC No	S7630529C
Email Address	LOUISLOW@LIVE.COM.SG
Mobile Phone No	(LOCAL) +65-96702553
Alternative Phone No	OFFICE-96702553

### Vehicle Particulars

Manufacturer	MITSUBISHI
Model	LANCER-2.0 L MIVEC GLS6-CVT (A)
Exact Purpose for which vehicle was being used at time of accident	
Are you claiming under your own insurance policy for repair to your vehicle?	YES
If No, Please state action to be taken	
Vehicle Category	PRIVATE CAR

### Insurance Company

Name of Insurance Company	AXA INSURANCE PTE LTD
Type Of Coverage	COMPREHENSIVE
Fleet Policy	NO
Policy Number	GA403445
Cover Note Number	

### Driver

Name of Driver	LOW KEAN FONG
NRIC No	S7630529C
Date Of Birth	07/10/1976
Occupation	INDOOR
Date Of Driving Pass	13/12/2006
Driving Experience	11 YEARS AND 9 MONTHS
Gender	MALE
Mobile Number	(LOCAL) +65-96702553
Fax Number	
Contact Number	OFFICE-96702553
EEmail Address	LOUISLOW@LIVE.COM.SG

Address	BLK 273 YISHUN ST 22 #09-94
Postcode	760273
Was driver an employee of the Insured's Company	NO
If No, Relationship of the Driver with the Insured	OWNER
Vehicle Registration Number of Driver's Own Vehicle	-
	-
	-
Insurance Company of Driver's Own Vehicle	-
	-
	-

#### General Information of the Accident

Type Of Accident	SIDE SWIPE
Weather Conditions	CLEAR
Road Surface	SLIGHT WET

#### Other Information

Was any foreign vehicle involved in this accident?	NO
Number of vehicles involved in the accident	
Was any body injured in the Accident?	NO
Was any injured conveyed to hospital by ambulance?	NO
Was any other material or property damaged?	YES
I have been approached by unknown person(s) soliciting/offering accident claims assistance.	NO
Number of Passengers (Including Driver)	1

#### Details of Police Action

Was the accident reported to the police?	NO
If Yes, Please state which Police Station	
Was notice of intended Prosecution given?	NO
If Yes, against whom?	

#### Circumstances of Accident

PLEASE REFER TO SKETCH PLAN.

#### Attachment(s)

Are accident photos available for attachment?	YES
Was there any video captured by Car Camera?	NO
Was there any audio recorded?	NO

#### DETAILS OF OTHER VEHICLE PROPERTY 1

Vehicle Registration Number	SJU8785L
Vehicle Make/Model/Colour	CHEVROLET
Details Of Properties	
Vehicle Category	PRIVATE CAR
Name of Driver	GOH NAI LEONG, AARON
NRIC/Passport Number	S7330520I
Contact Number	90011383
Address	
Postcode	
Insurance Company Name	
Nature Of Damage	
No. Of Passenger (Including Driver)	

**SKETCH PLAN**

**IMPORTANT NOTICE**

1. Please report correctly the details of the accident to speed up the claims process.
2. This Form must be completed by the Policyholder and/or the Authorised Driver
3. Information provided must be as truthful and accurate as possible. Any wilful misrepresentation or withholding of material facts may allow insurance companies to repudiate policy liability.
4. The issue and acceptance of this Form by insurance companies is not an admission of policy liability on the part of the insurance companies.
5. Any false reporting may be referred to the Police for investigation.
6. The report will be forwarded by the insurers of the GIA Records Management Centre established by the General Insurance Association of Singapore (GIA) for archiving and that copies of this report will for a fee be made available upon application by interested parties.
7. By the lodgment of this report to the insurers, you hereby consent to the archiving of this report at the centre and to copies of the report being made available aforesaid.
8. **Consent under the Personal Data Protection Act (PDPA)**

I understand, acknowledge, agree and consent that:

- (a) My insurer, my workshop and the General Insurance Association of Singapore ("GIA") may/are permitted to collect, use, disclose and/or process my personal data/personal information set out in this [form] and any other personal information provided by me or possessed by my insurer (collectively the "Personal Information") and disclose and transfer such Personal Information to all insurer(s) who have insured vehicle(s) involved in this accident (all insurer(s) who have insured vehicle(s) involved in this accident shall be collectively referred to as the "Insurers"), the Insurers' lawyers/law firms, the Monetary Authority of Singapore and any relevant government agency/authority (such as the police), for the purpose(s) of:
  - (i) processing, handling and/or dealing with my claims including the settlement of the claims and any necessary investigations relating to the claims;
  - (ii) investigating the accident and/or my claims;
  - (iii) carrying out and/or dealing with my instructions or responding to any enquiries by me;
  - (iv) administering my claims (including the mailing of correspondence, statements, invoices, reports or notices to me, which could involve disclosure of certain personal data about me to bring about delivery of the same as well as on the external cover of envelopes/mail packages); and/or
  - (v) complying with applicable law in administering, processing, handling and/or dealing with my claims, (collectively the "Purposes")
- (b) all insurer(s) who have insured vehicle(s) involved in this accident and the insurers' lawyers/law firms, may/are permitted to collect, use, disclose and/or process my Personal Information for one or more of the above Purposes; and
- (c) my Personal Information may/can be disclosed by any of the insurers and/or GIA to their third party service providers or agents (including their lawyers/law firms), which may be sited outside of Singapore, for one or more of the above Purposes.
- (d) my Personal Information will also be collected and used to compile claims history for the purpose of fraud detection, investigation and management in present and all future claims.
- (e) the information so collected under (d) above may be shared / disclosed:
  - (i) to all insurers and/or any other third parties that assist in evaluating, investigating, controlling or managing fraud, regulators, law enforcement and government agencies as reasonably required for the purposes stated, or
  - (ii) for complying with requirements under any regulations, laws or court orders.

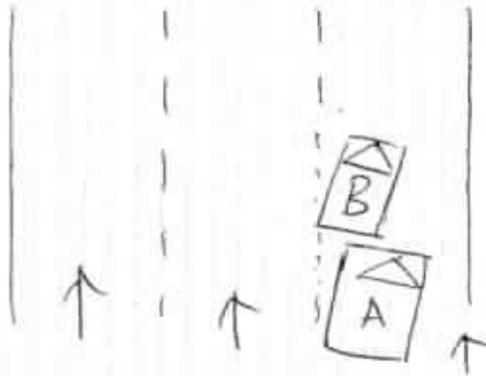
  
 Policyholder's Signature  
 Date & Time: 2018-10-11 08:56 AM

Driver's Signature  
 (If driver is not the policyholder)  
 Date & Time:

  
  
 Reporting Centre Personnel's Signature  
 Name: 11/10/18 @9A  
 NRIC/FIN No.:

SKETCH PLAN

Letter Are to AMR



B = SJU 8785L  
 A = SJ7331C (ME)

DESCRIBE CIRCUMSTANCES OF THE ACCIDENT

(centre right from centre)

I was filtering to right lane, and was speeding up when white chevrolet cut into my lane, hard brake applied but can't avoid collision.

DECLARATION

I/We declare the foregoing particulars are true in every respect.

Policyholder's Signature  
 Date & Time: 2018-10-11 08:56  
 Company Chop (if applicable)

Driver's Signature  
 (If driver is not the policyholder)  
 Date & Time:

Reporting Centre Personnel's Signature  
 Name: Shuman  
 NRIC/FIN No.: 11/10/18 @ 7.55 AM



**K.KIM HIN AUTO PTE LTD**  
**160 Sin Ming Drive**  
**#02-20 Sin Ming AutoCity**  
**Singapore 575722**

**Claim Reference:**  
**Assessment Number: KKHA0041**  
**Version: K.KIMHIN/1**  
**Date Calculated: 11/10/2018 07:58**

**Full Report - V1**  
**Registration: SJJ7331C**  
**Printed: 11/10/2018 14:59**

### Summary Information

#### Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	SANDRA KHONG	Date of Incident:	
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	AXA Insurance S'pore Pte Ltd	Repairs Authorised:	TBA

Claim Reference:	Estimated Repair Time:
Policy Number:	Quote Due Date:
Other Reference:	Actual Repair Days:
Third Party:	Parts Ordered Date:
Insured Amount:	Hire Car Start:
Under Warranty:	Hire Car End:
Warranty Expired:	Vehicle Collected:

#### Vehicle Details

##### Vehicle

Manufacturer:	mitsubishi
Model:	Lancer
Sub Model:	EX
Model Sheet Number:	G39 57
Registration:	SJJ7331C
Registration Month:	September
Registration Year:	2008
VIN Number:	JMYSTCY4A9U000369
Manufacture Year:	2008
Odometer:	Not Known
Colour:	
Engine Number:	4B11CA2580
Fuel Level:	%

##### Model Specs

FROM 06/2008	AIR CONDITIONING
2.0 LTR 110-118KW	DOUBLE FAN
4-DOOR SALOON	PREPARE OFF VEHICLE
TWO COAT PEARL/MICA	



*Authorised*  
*Presume B4 paint*

*5 days*

#### Vehicle Condition

##### Vehicle Status

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on Inspection:	
Brakes Pedal Travel:	Date of Inspection:	11/10/2018
Place of Inspection:		
Pre-Accident Damage:		

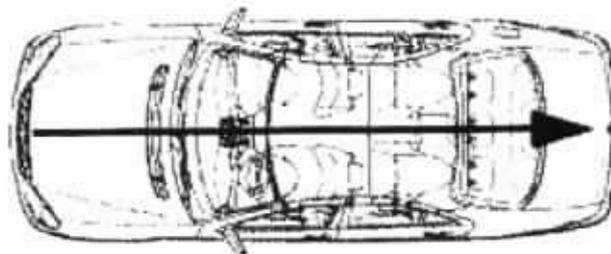
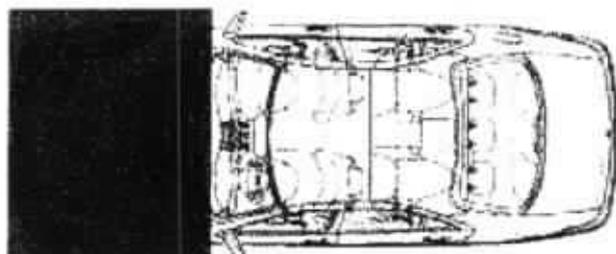
##### Tyres Condition:

Tread Depth LHF:	Tread Depth RHF:
Tread Depth LHR:	Tread Depth RHR:
Damage Areas:	Direction of Impact:

**K.KIM HIN AUTO PTE LTD**

**Claim Reference:**  
**Assessment Number: KKHA0041**  
**Version: K.KIMHIN/1**  
**Date Calculated: 11/10/2018 07:58**

**Full Report - V1**  
**Registration: SJJ7331C**  
**Printed: 11/10/2018 14:59**

**Addresses****Cost Summary**

Total Labour	\$1,404.00
Total Paint/Material	\$231.05
Total Parts	\$6,135.80
Total of Additional Costs	\$188.00
Excess:	TBA
Grand Total Exc GST:	\$7,958.85
7 % GST:	\$557.12
Grand Total Inc GST:	\$8,515.97

**Repair Information****LABOUR**

**Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR**  
**Price/Dent = \$0.00/HR**

**Repair /****Guide Number Repair Details**

		<b>WU</b>	<b>Cost Price (\$)</b>
GROUP42B	PREPARATION TIME PER JOB	2.0	9.00
NO NUMBER	ADD/TIME VEHICLE WITH AIR CONDITIONING	2.0	9.00
514121 10)	R + R ATTACHED PARTS OF THE BUMPER	10.0	45.00
NO NUMBER	R + R FRONT BUMPER REINFORCEMENT (BUMPER REMOVED)	3.0	13.50
425111 10)	RENEW BONNET (REMOVED)	2.0	9.00
	INCLUDES: R + R ATTACHED PARTS, ALIGN BONNET		
425113 10)	R + R LEFT BONNET HINGE (BONNET REMOVED)	1.0	4.50
425113 10)	R + R RIGHT BONNET HINGE (BONNET REMOVED)	1.0	4.50
NO NUMBER	ADJUST HEADLAMPS	2.0	9.00
421020 YE	RENEW FRONT PANEL CPL INCLUDES: R + R BUMPER, FRONT WINGS, SPLASH SHIELD, BONNET, HEADLAMPS, RADIATOR AND ATTACHED PARTS IN THE REPAIR SECTION	99.0	445.50
NO NUMBER	DRAIN + REFILL COOLANT	4.0	18.00
553210 10)	R + R CONDENSER INCLUDES: REFILL AIR CONDITIONING	6.0	27.00
0245	ADDITIONAL WORK PULLING FRONT PANELS	20.0* ?	90.00
0741	REPAIR L/F WING	10 20.0*	90.00
0742	REPAIR R/F WING	20.0* X	90.00
<b>LABOUR COST</b>			
<b>Total Work Units</b>		<b>192.0</b>	
<b>Corrosion Protection External Labour</b>		<b>0.0HRS</b>	<b>0.00</b>

**K.KIM HIN AUTO PTE LTD**

**Claim Reference:**  
**Assessment Number: KKHA0041**  
**Version: K.KIMHIN/1**  
**Date Calculated: 11/10/2018 07:58**

**Full Report - V1**  
**Registration: S7J7331C**  
**Printed: 11/10/2018 14:59**

Corrosion Protection Internal Labour	0.0HRS	0.00
<b>Sub Total</b>	<b>19.2HRS</b>	<b>\$864.00</b>
<b>Paint Labour</b>	<b>12.0HRS</b>	<b>\$540.00</b>
<b>Total Labour</b>	<b>31.2HRS</b>	<b>\$1,404.00</b>

<b>PAINT WORK</b>		<b>Time Basis 10 WU = 1 HR. Price = \$45.00/HR</b>	
<b>Guide Number</b>	<b>Description</b>	<b>WU</b>	<b>Cost Price (\$)</b>
	- PREPARE OFF VEHICLE		
	- TWO COAT PEARL/MICA		
340	FRT BUMPER REINF SURFACE PAINT	4.0	
341	FRT BUMPER SUPPORT SURFACE PAINT	4.0	
471	BONNET NEW PART PAINTING	24.0	
1010	FRT LWR CROSSMEMBER SURFACE PAINT	5.0	
1017	FRT UPP LOCK CARRIERSURFACE PAINT	4.0	
1019	L/F PANEL SURFACE PAINT	4.0	
1020	R/F PANEL SURFACE PAINT	4.0	
1187	L/F OUT S-MEMBER PNLSURFACE PAINT	4.0	
1188	R/F OUT S-MEMBER PNLSURFACE PAINT	4.0	
283	FRONT BUMPER COVER NEW PART PAINT K1R	13.0	
393	L/F SPOILER NEW PART PAINT K1R	4.0	
394	R/F SPOILER NEW PART PAINT K1R	4.0	
741	L/F WING SURFACE PAINT	6.0	
742	R/F WING SURFACE PAINT	6.0	
<b>LABOUR COST - PAINT</b>			
<b>TIME(PAINT)</b>		<b>90.0</b>	
Preparation Main Work Plastic		5.0	
Preparation Main Work Metal		25.0	
Preparation Work Multi Layer Paint		0.0	
<b>Total Work Units (10WU/HR)</b>		<b>120.0</b>	
<b>Total Paintwork Labour</b>		<b>12.0HRS</b>	<b>\$540.00</b>
<b>MATERIAL COST - PAINT</b>			<b>Cost Price</b>
New Part Painting			\$76.88
New Part Painting - Plastic K1R			\$78.72
Material-Constant Main Work Metal			\$28.60
Surface-/Blend Paint			\$37.85
Material-Const Main Work Plastic			\$9.00
<b>Total Excluding Pearlescent Uplift</b>			<b>\$231.05</b>
Pearlescent Uplift @ 0.0%			\$0.00
<b>Total Paint Material Cost</b>			<b>\$231.05</b>

**PARTS**

<b>Guide No.</b>	<b>Qty</b>	<b>Description</b>	<b>Part Number</b>	<b>Supplier</b>	<b>Price Valid: 01/06/2015</b>
					<b>Bet. Price (\$)</b>
257	1	FRONT NUMBER PLATE	KNPL3		0% <input checked="" type="checkbox"/> <b>18.00</b> U
283	1	FRONT BUMPER COVER	6400D159		0% <input checked="" type="checkbox"/> <b>350.00</b> * U
313	1	LWR RADIATOR GRILLE	6400A827		0% <input checked="" type="checkbox"/> <b>75.00</b> * U
340	1	FRT BUMPER REINF	6400A832		0% <input checked="" type="checkbox"/> <b>55.00</b> * U
341	1	FRT BUMPER SUPPORT	6400C005		0% <input checked="" type="checkbox"/> <b>190.00</b> * U
350	6	FRT BUMPER CLAMP KIT	MS452397		0% <input checked="" type="checkbox"/> <b>10.00</b> * U
351	1	L/LOWER AIR GRILLE	7450A223		0% <input checked="" type="checkbox"/> <b>35.00</b> * U
355	1	L/F BUMPER BRACKET	6400F549		0% <input checked="" type="checkbox"/> <b>18.00</b> * 7
356	1	R/F BUMPER BRACKET	6400F550		0% <input checked="" type="checkbox"/> <b>18.00</b> * 2

**K.KIM HIN AUTO PTE LTD**

**Claim Reference:**  
**Assessment Number: KKHA0041**  
**Version: K.KIMHIN/1**  
**Date Calculated: 11/10/2018 07:58**

**Full Report - V1**  
**Registration: SJJ7331C**  
**Printed: 11/10/2018 14:59**

QTY	Part Description	Part No	Rate	Notes	Price
393	L/F SPOILER	6512A163BA	0%	Sm	160.00* X
394	R/F SPOILER	6512A164BA	0%	Sm	160.00* X
410	GRILLE	7450A095	0%	✓ P/L	130.00* ✓
471	BONNET	5900A209	0%	✓ Bu	350.00* ✓
475	LEFT BONNET HINGE	5905A089	0%	R	45.00* X
476	RIGHT BONNET HINGE	5905A090	0%	R	45.00* X
493	BONNET LOCK	5908A009	0%	✓ D/I	45.00* ✓
524	BONNET FRONT SEAL	5902A021	0%	✓ DM Sm	25.00* X
561	L/F HEADLAMP CPL	8301C337	0%	mg/cm	580.00* ✓
562	R/F HEADLAMP CPL	8301C338	0%	mg/cm	580.00* ✓
1010	FRT LWR CROSSMEMBER	5256B113	0%	✓ R	230.00* ✓
1017	FRT UPP LOCK CARRIER	5256A607	0%	✓ Bu	150.00* ✓
1019	L/F PANEL	5256A599	0%	R	65.00* X
1020	R/F PANEL	5256A600	0%	R	65.00* X
1187	L/F OUT S-MEMBER PNL	5220C481	0%	R	30.00* X
1188	R/F OUT S-MEMBER PNL	5220C482	0%	R	30.00* X
4465	CONDENSER	7812A204	0%	✓ B/L P/L	480.00* ✓
7761	RADIATOR	MN156092	0%	✓ P/L	480.00* ✓
7767	RADIATOR SHROUD	1355A146	0%	Sm	150.00* X
7793	L/BLOWER FAN	1355A095	0%	Sm	50.00* X
7794	R/BLOWER FAN	MR312899	0%	Sm	50.00* X
7797	L/FAN MOTOR	1355A093	0%	Sm	250.00* X
7798	R/FAN MOTOR	1355A131	0%	Sm	250.00* X
8777	INN UPP FR PANELLING	5230A813	0%	✓ D/I	55.00* ✓
9645	LOW TONE HORN	8211A213	0%	✓ Sm	55.00* X
1000	FRT BUMPER RIVETS	12PCS X\$1.00	0%	✓ R	12.00* ✓
1000	L/F BUMP SUP BRKT	Renew	0%	R	12.00* X
1000	R/F BUMP SUP BRKT	Renew	0%	R	12.00* X
1000	F/BUMP TOP SEAL CLIP	8PCS X\$1.00	0%	✓ R	8.00* ✓
1000	L/F FOG LAMP	Renew	0%	Sm	200.00* X
1000	BONNET INSULATOR CLP	10PCS X\$1.50	0%	✓ R	15.00* ✓
1000	L/F LWR CTR GRLL CVR	Renew	0%	mis	5.00* X
1000	R/F LWR CTR GRLL CVR	Renew	0%	mit	5.00* X
1000	RAD TOP GAR CLIP	10PCS X \$1.00	0%	✓ R	10.00* ✓
1000	L/ RAD LWR BRKT	Renew	0%	R	10.00* X
1000	R/RAD LWR BRKT	Renew	0%	R	10.00* X

f: OEM Parts  
g: Original  
h: Secondhand  
p: Parallel  
x: Exchange

Sub Total		\$5,578.00
Mark Up From Cost (10 %)		\$557.80
Sundry Parts (Fixed)		\$0.00
<b>Total Parts</b>		<b>\$6,135.80</b>

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

**Extras**

Description	Betterment	Price
FRT NUMBER PLATE SPECIALIST	0%	✓ Bu \$40.00 ✓
ANTIFREEZE 4 LTR SPECIALIST		✓ R \$48.00 ✓
TOP UP AIRCON GAS SPECIALIST	0%	✓ R \$100.00 ✓
<b>Total Extras</b>		<b>\$188.00</b>

**Final Calculation**

<b>Total Parts</b>		<b>\$6,135.80</b>
<b>Labour</b>		

Total Panel/Mechanical

\$864.00

**K.KIM HIN AUTO PTE LTD**

**Claim Reference:**  
**Assessment Number: KKHA0041**  
**Version: K.KIMHIN/1**  
**Date Calculated: 11/10/2018 07:58**

**Full Report - V1**  
**Registration: SJJ7331C**  
**Printed: 11/10/2018 14:59**

Total Paintwork	\$540.00	
<b>Total Labour</b>		<b>\$1,404.00</b>
<b>Additional Costs</b>		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$188.00	
<b>Total of Additional Costs</b>		<b>\$188.00</b>
<b>Total Paint/Material Costs</b>		<b>\$231.05</b>
<b>Grand Total Excludes GST</b>		<b>\$7,958.85</b>
GST @ 7 %		<b>\$557.12</b>
<b>Grand Total Includes GST</b>		<b>\$8,515.97</b>

**Assessment Notes**

7978 65

**Claim Reference:**  
**Assessment Number: KKHA0041**  
**Version: K.KIMHIN/1**  
**Date Calculated: 11/10/2018 07:58**

**Full Report - V1**  
**Registration: SJJ7331C**  
**Printed: 11/10/2018 14:59**

**Summary Information**

<b>Claim</b>			
Location:	Singapore (SG)	Currency:	SGD
Printed by:	SANDRA KHONG	Date of Incident:	
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	AXA Insurance S'pore Pte Ltd	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:		Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

**Vehicle Details**

<b>Vehicle</b>		<b>Model Specs</b>	
Manufacturer:	MITSUBISHI	FROM 06/2008	AIR CONDITIONING
Model:	Lancer	2.0 LTR 110-118KW	DOUBLE FAN
Sub Model:	EX	4-DOOR SALOON	PREPARE OFF VEHICLE
Model Sheet Number:	G39 57	TWO COAT PEARL/MICA	
Registration:	SJJ7331C		
Registration Month:	September		
Registration Year:	2008		
VIN Number:	JMYSTCY4A9U000369		
Manufacture Year:	2008		
Odometer:	Not Known		
Colour:			
Engine Number:	4B11CA2580		
Fuel Level:	%		

*Authorised*  
*Resurvey B4 paint*  
*5 days*

**Vehicle Condition**

<b>Vehicle Status</b>		<b>Severity of Impact:</b>	
Pre-Accident Condition:		Vehicle Status on	
Steering:		Inspection:	
Brakes Pedal Travel:		Date of Inspection:	11/10/2018
Place of Inspection:			
Pre-Accident Damage:			
Tyres Condition:		Tread Depth RHF:	
Tread Depth LHF:		Tread Depth RHR:	
Tread Depth LHR:		Direction of Impact:	
Damage Areas:			

LKK Auto Consultants hence notify the Repairer of the following:

- To resurvey before/after spray painting
- To display damaged part(s) during resurvey
- Parts prices are subject to confirmation
- Third party survey is on a "Without Prejudice" basis
- No illegal modification(s) is allowed
- Supplementary item(s) must be resurveyed and is subject to final approval from Insurance Company

Acknowledged by Repairer  
Signature:  
Date:

**K.KIM HIN AUTO PTE LTD**

**Claim Reference:**  
**Assessment Number: KKHA0041**  
**Version: K.KIMHIN/1**  
**Date Calculated: 11/10/2018 07:58**

**Full Report - V1**  
**Registration: SJJ7331C**  
**Printed: 11/10/2018 14:59**

<b>Corrosion Protection Internal Labour</b>	<b>0.0HRS</b>	<b>0.00</b>
<b>Sub Total</b>	<b>19.2HRS</b>	<b>\$864.00</b>
<b>Paint Labour</b>	<b>12.0HRS</b>	<b>\$540.00</b>
<b>Total Labour</b>	<b>31.2HRS</b>	<b>\$1,404.00</b>

<b>PAINT WORK</b>		<b>Time Basis 10 WU = 1 HR. Price = \$45.00/HR</b>	
<b>Guide Number</b>	<b>Description</b>	<b>WU</b>	<b>Cost Price (\$)</b>
	- PREPARE OFF VEHICLE		
	- TWO COAT PEARL/MICA		
340	FRT BUMPER REINF SURFACE PAINT	4.0	
341	FRT BUMPER SUPPORT SURFACE PAINT	4.0	
471	BONNET NEW PART PAINTING	24.0	
1010	FRT LWR CROSSMEMBER SURFACE PAINT	5.0	
1017	FRT UPP LOCK CARRIERSURFACE PAINT	4.0	
1019	L/F PANEL SURFACE PAINT	4.0	
1020	R/F PANEL SURFACE PAINT	4.0	
1187	L/F OUT S-MEMBER PNLSURFACE PAINT	4.0	
1188	R/F OUT S-MEMBER PNLSURFACE PAINT	4.0	
283	FRONT BUMPER COVER NEW PART PAINT K1R	13.0	
393	L/F SPOILER NEW PART PAINT K1R	4.0	
394	R/F SPOILER NEW PART PAINT K1R	4.0	
741	L/F WING SURFACE PAINT	6.0	
742	R/F WING SURFACE PAINT	6.0	
<b>LABOUR COST - PAINT</b>			
	<b>TIME(PAINT)</b>	<b>90.0</b>	
	<b>Preparation Main Work Plastic</b>	<b>5.0</b>	
	<b>Preparation Main Work Metal</b>	<b>25.0</b>	
	<b>Preparation Work Multi Layer Paint</b>	<b>0.0</b>	
	<b>Total Work Units (10WU/HR)</b>	<b>120.0</b>	
	<b>Total Paintwork Labour</b>	<b>12.0HRS</b>	<b>\$540.00</b>
<b>MATERIAL COST - PAINT</b>			<b>Cost Price</b>
	<b>New Part Painting</b>		<b>\$76.88</b>
	<b>New Part Painting - Plastic K1R</b>		<b>\$78.72</b>
	<b>Material-Constant Main Work Metal</b>		<b>\$28.60</b>
	<b>Surface-/Blend Paint</b>		<b>\$37.85</b>
	<b>Material-Const Main Work Plastic</b>		<b>\$9.00</b>
	<b>Total Excluding Pearlescent Uplift</b>		<b>\$231.05</b>
	<b>Pearlescent Uplift @ 0.0%</b>		<b>\$0.00</b>
	<b>Total Paint Material Cost</b>		<b>\$231.05</b>

<b>PARTS</b>				Price Valid: 01/06/2015		
<b>Guide No.</b>	<b>Qty</b>	<b>Description</b>	<b>Part Number</b>	<b>Supplier</b>	<b>Bet.</b>	<b>Price (\$)</b>
257	1	FRONT NUMBER PLATE	KNPL3		0%	18.00 U L
283	1	FRONT BUMPER COVER	6400D159		0%	350.00* L
313	1	LWR RADIATOR GRILLE	6400A827		0%	75.00* L
340	1	FRT BUMPER REINF	6400A832		0%	55.00* L
341	1	FRT BUMPER SUPPORT	6400C005		0%	190.00* L
350	6	FRT BUMPER CLAMP KIT	MS452397		0%	10.00* L
351	1	L/LOWER AIR GRILLE	7450A223		0%	35.00* L
355	1	L/F BUMPER BRACKET	6400F549		0%	18.00* 7
356	1	R/F BUMPER BRACKET	6400F550		0%	18.00* 7

**K.KIM HIN AUTO PTE LTD**

**Claim Reference:**  
**Assessment Number: KKHA0041**  
**Version: K.KIMHIN/1**  
**Date Calculated: 11/10/2018 07:58**

**Full Report - V1**  
**Registration: SJJ7331C**  
**Printed: 11/10/2018 14:59**

---

Total Paintwork	\$540.00	
<b>Total Labour</b>		<b>\$1,404.00</b>
<b>Additional Costs</b>		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$188.00	
<b>Total of Additional Costs</b>		<b>\$188.00</b>
<b>Total Paint/Material Costs</b>		<b>\$231.05</b>
<b>Grand Total Excludes GST</b>		<b>\$7,958.85</b>
GST @ 7 %		<b>\$557.12</b>
<b>Grand Total Includes GST</b>		<b>\$8,515.97</b>

---

**Assessment Notes**

---

51 Ubi Avenue 1, #01-25  
Paya Ubi Industrial Park  
Singapore  
408933

Claim Reference:  
Assessment Number: KKHA0041  
Version: LKKAUTOC/3  
Date Calculated: 28/03/2019 06:15

Full Report - V1  
Registration: SJJ7331C  
Printed: 28/03/2019 14:19

## Summary Information

### Claim

Location:	Singapore (SG)	Currency:	SGD
Printed by:	LKK AUTO	Date of Incident:	
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	AXA Insurance S'pore Pte Ltd	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:		Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

### Vehicle Details

#### Vehicle

Manufacturer:	mitsubishi
Model:	Lancer
Sub Model:	EX
Model Sheet Number:	G39 57
Registration:	SJJ7331C
Registration Month:	September
Registration Year:	2008
VIN Number:	JMYSTCY4A9U000369
Manufacture Year:	2008
Odometer:	Not Known
Colour:	
Engine Number:	4B11CA2580
Fuel Level:	%

#### Model Specs

FROM 06/2008	AIR CONDITIONING
2.0 LTR 110-118KW	DOUBLE FAN
4-DOOR SALOON	PREPARE OFF VEHICLE
TWO COAT PEARL/MICA	

### Vehicle Condition

#### Vehicle Status

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on Inspection:	
Brakes Pedal Travel:	Date of Inspection:	11/10/2018
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:	Tread Depth RHF:	
Tread Depth LHF:	Tread Depth RHR:	
Tread Depth LHR:	Direction of Impact:	
Damage Areas:		

Claim Reference:

Full Report - V1

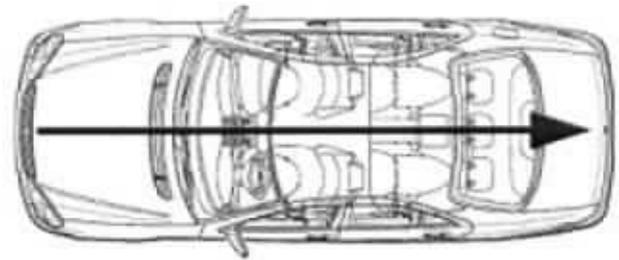
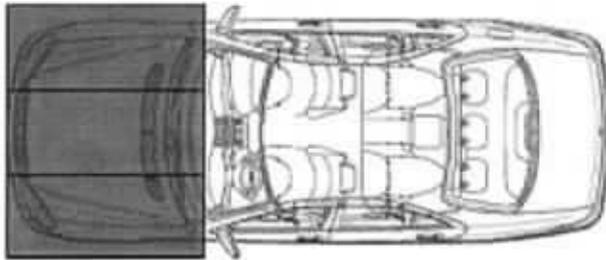
Assessment Number: KKHA0041

Registration: SJJ7331C

Version: LKKAUTOC/3

Printed: 28/03/2019 14:19

Date Calculated: 28/03/2019 06:15

**Addresses****Cost Summary**

Total Labour	\$859.50
Total Paint/Material	\$227.51
Total Parts	\$4,068.90
Total of Additional Costs	\$188.00
Excess:	TBA
Grand Total Exc GST:	\$5,343.91
7 % GST:	\$374.07
Grand Total Inc GST:	\$5,717.98

**Repair Information****LABOUR**

Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR  
Price/Dent = \$0.00/HR

**Repair /****Guide Number Repair Details**

		WU	Cost Price (\$)
GROUP42B	PREPARATION TIME PER JOB	2.0	9.00
514110 10	R + R FRONT BUMPER	8.0	36.00
514121 10)	R + R ATTACHED PARTS OF THE BUMPER	10.0	45.00
NO NUMBER	R + R FRONT BUMPER REINFORCEMENT (BUMPER REMOVED)	3.0	13.50
541011 10)	R + R LEFT HEADLAMP UNIT	1.0	4.50
541011 10)	R + R RIGHT HEADLAMP UNIT	1.0	4.50
425110 00	R + R BONNET	4.0	18.00
425111 10)	RENEW BONNET (REMOVED)	2.0	9.00
	INCLUDES: R + R ATTACHED PARTS, ALIGN BONNET		
NO NUMBER	ADJUST HEADLAMPS	2.0	9.00
NO NUMBER	R + R FRONT UPPER LOCK CARRIER	2.0	9.00
NO NUMBER	R + R FRONT PANEL COVERING	1.0	4.50
544011 80ZAX	R + R LEFT HORN	3.0	13.50
NO NUMBER	DRAIN + REFILL COOLANT	4.0	18.00
145010 10	R + R RADIATOR CPL	12.0	54.00
	INCLUDES: DRAIN + REFILL COOLANT, R + R RADIATOR FRAME AND ELECTRIC FAN		
553210 10)	R + R CONDENSER	6.0	27.00
	INCLUDES: REFILL AIR CONDITIONING		
0741	REPAIR L/F WING	10.0*	45.00
	<b>LABOUR COST</b>		
	<b>Total Work Units</b>	<b>71.0</b>	
	<b>Corrosion Protection External Labour</b>	<b>0.0HRS</b>	<b>0.00</b>
	<b>Corrosion Protection Internal Labour</b>	<b>0.0HRS</b>	<b>0.00</b>
	<b>Sub Total</b>	<b>7.1HRS</b>	<b>\$319.50</b>

Claim Reference:

Full Report - V1

Assessment Number: KKHA0041

Registration: SJJ7331C

Version: LKKAUTOC/3

Printed: 28/03/2019 14:19

Date Calculated: 28/03/2019 06:15

Paint Labour	12.0HRS	\$540.00
<u>Total Labour</u>	<u>19.1HRS</u>	<u>\$859.50</u>

PAINT WORK		Time Basis 10 WU = 1 HR. Price = \$45.00/HR	
Guide Number	Description	WU	Cost Price (\$)
	- PREPARE OFF VEHICLE		
	- TWO COAT PEARL/MICA		
340	FRT BUMPER REINF SURFACE PAINT	4.0	
341	FRT BUMPER SUPPORT SURFACE PAINT	4.0	
471	BONNET NEW PART PAINTING	24.0	
1017	FRT UPP LOCK CARRIERSURFACE PAINT	4.0	
283	FRONT BUMPER COVER NEW PART PAINT K1R	13.0	
393	L/F SPOILER SURFACE PAINT PLAST.	4.0	
394	R/F SPOILER SURFACE PAINT PLAST.	4.0	
741	L/F WING SURFACE PAINT	6.0	
742	R/F WING SURFACE PAINT	6.0	
1010	FRT LWR CROSSMEMBER SURFACE PAINT	5.0	
1019	L/F PANEL SURFACE PAINT	4.0	
1020	R/F PANEL SURFACE PAINT	4.0	
1187	L/F OUT S-MEMBER PNLSURFACE PAINT	4.0	
1188	R/F OUT S-MEMBER PNLSURFACE PAINT	4.0	
<b>LABOUR COST - PAINT</b>			
<b>TIME(PAINT)</b>		<b>90.0</b>	
Preparation Main Work Plastic		5.0	
Preparation Main Work Metal		25.0	
Preparation Work Multi Layer Paint		0.0	
Total Work Units (10WU/HR)		120.0	
Total Paintwork Labour		12.0HRS	\$540.00
<b>MATERIAL COST - PAINT</b>			<b>Cost Price</b>
New Part Painting			\$76.88
New Part Painting - Plastic K1R			\$64.94
Material-Constant Main Work Metal			\$28.60
Surface-/Blend Paint			\$37.85
Surface Paint Plastic			\$10.24
Material-Const Main Work Plastic			\$9.00
Total Excluding Pearlescent Uplift			\$227.51
Pearlescent Uplift @ 0.0%			\$0.00
Total Paint Material Cost			\$227.51

**PARTS**

Guide No.	Qty	Description	Part Number	Supplier	Bet.	Price (\$)
471	1	BONNET	5900A209		0%	350.00*
524	1	BONNET FRONT SEAL	5902A021		0%	25.00*
1000	1	BONNET INSULATOR CLP	10PCS X\$1.50		0%	15.00*
493	1	BONNET LOCK	5908A009		0%	45.00*
4465	1	CONDENSER	7812A204		0%	480.00*
1000	1	F/BUMP TOP SEAL CLIP	8PCS X\$1.00		0%	8.00*
283	1	FRONT BUMPER COVER	6400D159		0%	350.00*
350	6	FRT BUMPER CLAMP KIT	MS452397		0%	10.00*
340	1	FRT BUMPER REINF	6400A832		0%	55.00*
1000	1	FRT BUMPER RIVETS	12PCS X\$1.00		0%	12.00*

Price Valid: 01/06/2015

Claim Reference:

Full Report - V1

Assessment Number: KKHA0041

Registration: SJJ7331C

Version: LKKAUTOC/3

Printed: 28/03/2019 14:19

Date Calculated: 28/03/2019 06:15

341	1	FRT BUMPER SUPPORT	6400C005	0%		190.00*
1017	1	FRT UPP LOCK CARRIER	5256A607	0%		150.00*
410	1	GRILLE	7450A095	0%		130.00*
8777	1	INN UPP FR PANELLING	5230A813	0%		55.00*
355	1	L/F BUMPER BRACKET	6400F549	0%		18.00*
561	1	L/F HEADLAMP CPL	8301C337	0%		580.00*
1000	1	L/F LWR CTR GRLL CVR	Renew	0%		5.00*
351	1	L/LOWER AIR GRILLE	7450A223	0%		35.00*
1000	1	LH HEADLAMP BACK CVR	Renew	0%	Dd	18.00* ✓
313	1	LWR RADIATOR GRILLE	6400A827	0%		75.00*
356	1	R/F BUMPER BRACKET	6400F550	0%		18.00*
562	1	R/F HEADLAMP CPL	8301C338	0%		580.00*
1000	1	R/F LWR CTR GRLL CVR	Renew	0%		5.00*
1000	1	RAD TOP GAR CLIP	10PCS X \$1.00	0%		10.00*
7761	1	RADIATOR	MN156092	0%		480.00*
f: OEM Parts			Sub Total			\$3,699.00
g: Original			Mark Up From Cost	(10 %)		\$369.90
h: Secondhand			Sundry Parts	(Fixed)		\$0.00
p: Parallel			<b>Total Parts</b>			<b>\$4,068.90</b>
x: Exchange						

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

**Extras**

Description	Betterment	Price
FRT NUMBER PLATE SPECIALIST	0%	\$40.00
ANTIFREEZE 4 LTR SPECIALIST		\$48.00
TOP UP AIRCON GAS SPECIALIST	0%	\$100.00
<b>Total Extras</b>		<b>\$188.00</b>

**Final Calculation**

<b>Total Parts</b>		<b>\$4,068.90</b>
<b>Labour</b>		
Total Panel/Mechanical	\$319.50	
Total Paintwork	\$540.00	
<b>Total Labour</b>		<b>\$859.50</b>
<b>Additional Costs</b>		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$188.00	
<b>Total of Additional Costs</b>		<b>\$188.00</b>
<b>Total Paint/Material Costs</b>		<b>\$227.51</b>
<b>Grand Total Excludes GST</b>		<b>\$5,343.91</b>
GST @ 7 %		\$374.07
<b>Grand Total Includes GST</b>		<b>\$5,717.98</b>

**Assessment Notes**

**K.KIM HIN AUTO PTE LTD**  
**160 Sin Ming Drive**  
**#02-20 Sin Ming AutoCity**  
**Singapore 575722**

**Claim Reference:**  
**Assessment Number: KKHA0041**  
**Version: K.KIMHIN/1**  
**Date Calculated: 27/03/2019 06:31**

**Full Report - V1**  
**Registration: SJJ7331C**  
**Printed: 27/03/2019 15:22**

**Summary Information**

**Claim**

Location:	Singapore (SG)	Currency:	SGD
Printed by:	SANDRA KHONG	Date of Incident:	
Authorisation Status:	Interim	Able to Authorise Repairs:	TBA
Work Provider:	AXA Insurance S'pore Pte Ltd	Repairs Authorised:	TBA
Claim Reference:		Estimated Repair Time:	
Policy Number:		Quote Due Date:	
Other Reference:		Actual Repair Days:	
Third Party:		Parts Ordered Date:	
Insured Amount:		Hire Car Start:	
Under Warranty:		Hire Car End:	
Warranty Expired:		Vehicle Collected:	

**Vehicle Details**

**Vehicle**

Manufacturer:	MITSUBISHI
Model:	Lancer
Sub Model:	EX
Model Sheet Number:	G39 57
Registration:	SJJ7331C
Registration Month:	September
Registration Year:	2008
VIN Number:	JMYSTCY4A9U000369
Manufacture Year:	2008
Odometer:	Not Known
Colour:	
Engine Number:	4B11CA2580
Fuel Level:	%

**Model Specs**

FROM 06/2008	AIR CONDITIONING
2.0 LTR 110-118KW	DOUBLE FAN
4-DOOR SALOON	PREPARE OFF VEHICLE
TWO COAT PEARL/MICA	

**Vehicle Condition**

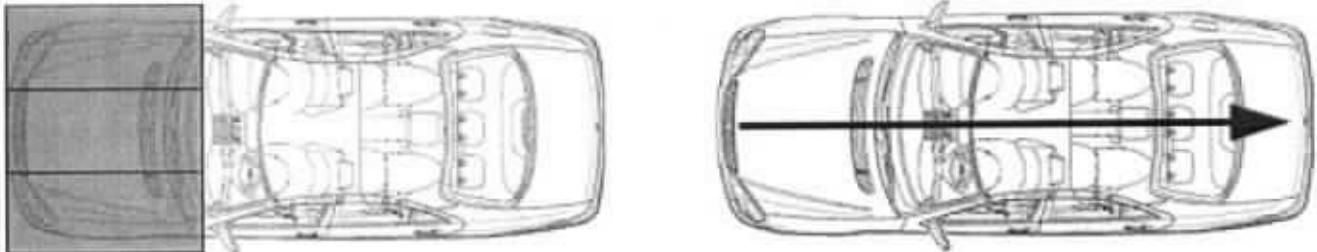
**Vehicle Status**

Pre-Accident Condition:	Severity of Impact:	
Steering:	Vehicle Status on Inspection:	
Brakes Pedal Travel:	Date of Inspection:	11/10/2018
Place of Inspection:		
Pre-Accident Damage:		
Tyres Condition:	Tread Depth RHF:	
Tread Depth LHF:	Tread Depth RHR:	
Tread Depth LHR:	Direction of Impact:	
Damage Areas:		

**K.KIM HIN AUTO PTE LTD**

**Claim Reference:**  
**Assessment Number: KKHA0041**  
**Version: K.KIMHIN/1**  
**Date Calculated: 27/03/2019 06:31**

**Full Report - V1**  
**Registration: SJJ7331C**  
**Printed: 27/03/2019 15:22**



**Addresses**

**Cost Summary**

Total Labour	\$859.50
Total Paint/Material	\$227.51
Total Parts	\$4,088.70
Total of Additional Costs	\$188.00
Excess:	TBA
Grand Total Exc GST:	\$5,363.71
7 % GST:	\$375.46
Grand Total Inc GST:	\$5,739.17

**Repair Information**

**LABOUR**

**Time Basis 10 WU = 1 HR. Price/CL 1 = \$45.00/HR**  
**Price/Dent = \$0.00/HR**

**Repair /**

<b>Guide Number</b>	<b>Repair Details</b>	<b>WU</b>	<b>Cost Price (\$)</b>
GROUP42B	PREPARATION TIME PER JOB	2.0	9.00
514110 10	R + R FRONT BUMPER	8.0	36.00
514121 10)	R + R ATTACHED PARTS OF THE BUMPER	10.0	45.00
NO NUMBER	R + R FRONT BUMPER REINFORCEMENT (BUMPER REMOVED)	3.0	13.50
541011 10)	R + R LEFT HEADLAMP UNIT	1.0	4.50
541011 10)	R + R RIGHT HEADLAMP UNIT	1.0	4.50
425110 00	R + R BONNET	4.0	18.00
425111 10)	RENEW BONNET (REMOVED)	2.0	9.00
	INCLUDES: R + R ATTACHED PARTS, ALIGN BONNET		
NO NUMBER	ADJUST HEADLAMPS	2.0	9.00
NO NUMBER	R + R FRONT UPPER LOCK CARRIER	2.0	9.00
NO NUMBER	R + R FRONT PANEL COVERING	1.0	4.50
544011 80ZAX	R + R LEFT HORN	3.0	13.50
NO NUMBER	DRAIN + REFILL COOLANT	4.0	18.00
145010 10	R + R RADIATOR CPL	12.0	54.00
	INCLUDES: DRAIN + REFILL COOLANT, R + R RADIATOR FRAME AND ELECTRIC FAN		
553210 10)	R + R CONDENSER	6.0	27.00
	INCLUDES: REFILL AIR CONDITIONING		
0741	REPAIR L/F WING	10.0*	45.00
<b>LABOUR COST</b>			
	<b>Total Work Units</b>	<b>71.0</b>	
	<b>Corrosion Protection External Labour</b>	<b>0.0HRS</b>	<b>0.00</b>
	<b>Corrosion Protection Internal Labour</b>	<b>0.0HRS</b>	<b>0.00</b>
	<b>Sub Total</b>	<b>7.1HRS</b>	<b>\$319.50</b>

**K.KIM HIN AUTO PTE LTD**

**Claim Reference:**  
**Assessment Number: KKHA0041**  
**Version: K.KIMHIN/1**  
**Date Calculated: 27/03/2019 06:31**

**Full Report - V1**  
**Registration: SJJ7331C**  
**Printed: 27/03/2019 15:22**

<b>Paint Labour</b>	<b>12.0HRS</b>	<b>\$540.00</b>
<b>Total Labour</b>	<b>19.1HRS</b>	<b>\$859.50</b>

**PAINT WORK** Time Basis 10 WU = 1 HR. Price = \$45.00/HR  
**Guide Number Description** WU Cost Price (\$)

	- PREPARE OFF VEHICLE		
	- TWO COAT PEARL/MICA		
340	FRT BUMPER REINF SURFACE PAINT	4.0	
341	FRT BUMPER SUPPORT SURFACE PAINT	4.0	
471	BONNET NEW PART PAINTING	24.0	
1017	FRT UPP LOCK CARRIERSURFACE PAINT	4.0	
283	FRONT BUMPER COVER NEW PART PAINT K1R	13.0	
393	L/F SPOILER SURFACE PAINT PLAST.	4.0	
394	R/F SPOILER SURFACE PAINT PLAST.	4.0	
741	L/F WING SURFACE PAINT	6.0	
742	R/F WING SURFACE PAINT	6.0	
1010	FRT LWR CROSSMEMBER SURFACE PAINT	5.0	
1019	L/F PANEL SURFACE PAINT	4.0	
1020	R/F PANEL SURFACE PAINT	4.0	
1187	L/F OUT S-MEMBER PNLSURFACE PAINT	4.0	
1188	R/F OUT S-MEMBER PNLSURFACE PAINT	4.0	

<b>LABOUR COST - PAINT</b>		
<b>TIME(PAINT)</b>	<b>90.0</b>	
Preparation Main Work Plastic	5.0	
Preparation Main Work Metal	25.0	
Preparation Work Multi Layer Paint	0.0	
<b>Total Work Units (10WU/HR)</b>	<b>120.0</b>	
<b>Total Paintwork Labour</b>	<b>12.0HRS</b>	<b>\$540.00</b>

<b>MATERIAL COST - PAINT</b>		<b>Cost Price</b>
New Part Painting		\$76.88
New Part Painting - Plastic K1R		\$64.94
Material-Constant Main Work Metal		\$28.60
Surface-/Blend Paint		\$37.85
Surface Paint Plastic		\$10.24
Material-Const Main Work Plastic		\$9.00
<b>Total Excluding Pearlescent Uplift</b>		<b>\$227.51</b>
<b>Pearlescent Uplift @ 0.0%</b>		<b>\$0.00</b>
<b>Total Paint Material Cost</b>		<b>\$227.51</b>

**PARTS**

					Price Valid: 01/06/2015	
<b>Guide No.</b>	<b>Qty</b>	<b>Description</b>	<b>Part Number</b>	<b>Supplier</b>	<b>Bet.</b>	<b>Price (\$)</b>
283	1	FRONT BUMPER COVER	6400D159		0%	350.00*
313	1	LWR RADIATOR GRILLE	6400A827		0%	75.00*
340	1	FRT BUMPER REINF	6400A832		0%	55.00*
341	1	FRT BUMPER SUPPORT	6400C005		0%	190.00*
350	6	FRT BUMPER CLAMP KIT	MS452397		0%	10.00*
351	1	L/LOWER AIR GRILLE	7450A223		0%	35.00*
355	1	L/F BUMPER BRACKET	6400F549		0%	18.00*
356	1	R/F BUMPER BRACKET	6400F550		0%	18.00*
410	1	GRILLE	7450A095		0%	130.00*
471	1	BONNET	5900A209		0%	350.00*

**K.KIM HIN AUTO PTE LTD**

**Claim Reference:**  
**Assessment Number: KKHA0041**  
**Version: K.KIMHIN/1**  
**Date Calculated: 27/03/2019 06:31**

**Full Report - V1**  
**Registration: SJJ7331C**  
**Printed: 27/03/2019 15:22**

493	1	BONNET LOCK	5908A009	0%	45.00*
524	1	BONNET FRONT SEAL	5902A021	0%	25.00*
561	1	L/F HEADLAMP CPL	8301C337	0%	580.00*
562	1	R/F HEADLAMP CPL	8301C338	0%	580.00*
1017	1	FRT UPP LOCK CARRIER	5256A607	0%	150.00*
4465	1	CONDENSER	7812A204	0%	480.00*
7761	1	RADIATOR	MN156092	0%	480.00*
8777	1	INN UPP FR PANELLING	5230A813	0%	55.00*
1000	1	FRT BUMPER RIVETS	12PCS X\$1.00	0%	12.00*
1000	1	F/BUMP TOP SEAL CLIP	8PCS X\$1.00	0%	8.00*
1000	1	BONNET INSULATOR CLP	10PCS X\$1.50	0%	15.00*
1000	1	L/F LWR CTR GRLL CVR	Renew	0%	5.00*
1000	1	R/F LWR CTR GRLL CVR	Renew	0%	5.00*
1000	1	RAD TOP GAR CLIP	10PCS X \$1.00	0%	10.00*
1000	1	LH HEADLAMP BACK CVR	Renew	0%	18.00*
1000	1	RH HEADLAMP BACK CVR	Renew	0%	18.00*
f: OEM Parts				Sub Total	\$3,717.00
g: Original				Mark Up From Cost (10 %)	\$371.70
h: Secondhand				Sundry Parts (Fixed)	\$0.00
p: Parallel				<b>Total Parts</b>	<b>\$4,088.70</b>
x: Exchange					

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

**Extras**

Description	Betterment	Price
FRT NUMBER PLATE SPECIALIST	0%	\$40.00
ANTIFREEZE 4 LTR SPECIALIST		\$48.00
TOP UP AIRCON GAS SPECIALIST	0%	\$100.00
<b>Total Extras</b>		<b>\$188.00</b>

**Final Calculation**

<b>Total Parts</b>		<b>\$4,088.70</b>
<b>Labour</b>		
Total Panel/Mechanical	\$319.50	
Total Paintwork	\$540.00	
<b>Total Labour</b>		<b>\$859.50</b>
<b>Additional Costs</b>		
Corr Prot Materials External	\$0.00	
Corr Prot Materials Internal	\$0.00	
Cost of Specialist	\$188.00	
<b>Total of Additional Costs</b>		<b>\$188.00</b>
<b>Total Paint/Material Costs</b>		<b>\$227.51</b>
<b>Grand Total Excludes GST</b>		<b>\$5,363.71</b>
GST @ 7 %		<b>\$375.46</b>
<b>Grand Total Includes GST</b>		<b>\$5,739.17</b>

**Assessment Notes**



友興汽車零件私人有限公司  
YEW HENG AUTO PARTS PTE LTD

BLK 3017 UBI ROAD 1 #04-129 SINGAPORE 408708  
TEL: 6743 9858 A/C: 6392 0830 FAX: 6749 0858  
Email: yewheng@yewhengauto.sg  
Co. Reg. No.: 201130046W GST Reg. No.: 201130046W

**TAX INVOICE**

M/S : K.KIM HIN AUTO PTE LTD

160 SIN MING DRIVE #02-18/19/20/21  
SIN MING AUTOCITY  
SINGAPORE 575722

NO: YLI1213202  
PAGE: 1  
DATE: 12/10/2018  
A/C CODE: LYKKH001  
TERMS: 60 DAYS

Part No	Description	Location	Qty	Unit Price		Amount
				SIN	SIN	SIN
J6400D159	FACE KIT,FR BUMPER;JJ6400B914	YDS	1	350.00		350.00
2 J6400F550 ✓	BRACKET,FR BUMPER,SIDE RH	1T104	1	18.00		18.00
3 J6400F549 ✓	BRACKET,FR BUMPER,SIDE LH	1T104	1	18.00		18.00
4 JMR200300 ✓	CLIP,FR BUMPER	1AA4	10	1.00		10.00
5 J6400A832 ✓	REINFORCEMENT,FR BUMPER,UPR	1J-1B	1	55.00		55.00
6 J6400A827	GRILLE,FR BUMPER	YDS	1	75.00		75.00
7 JMU001319	RIVET,FR BUMPER	1A10	12	1.00		12.00
8 J8321A089 ✓	GARNISH,FR BUMPER,LH	1AA90	1	35.00		35.00
9 J6400B998	REINFORCEMENT,FR BUMPER	A1Q3	1	190.00		190.00
10 JMU487004	CLIP,HOOD	1A10	8	1.00		8.00
11 J7450A093 ✓	GRILLE,RADIATOR (*)	2T57	1	130.00		130.00
J5900A209	HOOD (*)	SCK047	1	350.00		350.00
13 JMU001282	CLIP,HOOD INSULATOR	1YY	10	1.50		15.00
14 J5908A056 ✓	LATCH,HOOD	1T55	1	45.00		45.00
15 J8301C389 ✓	BODY,HEADLAMP,LH	2T48	1	580.00		580.00
16 J8301C390 ✓	BODY,HEADLAMP,RH	2T48	1	580.00		580.00
17 J6400B906 ✓	COVER,FR BUMPER GRILLE,LH	MS77	1	5.00		5.00
18 J6400B907 ✓	COVER,FR BUMPER GRILLE,RH	MS77	1	5.00		5.00
19 J5256A607	PANEL,HEADLAMP SUPPORT,UPR	AIM4	1	150.00		150.00

Reprint: 1 / TCY / 12/10/2018 4:10:08 PM

...Conf'd





友興汽車零件私人有限公司  
**YEW HENG AUTO PARTS PTE LTD**

BLK 3017 UBI ROAD 1 #04-129 SINGAPORE 406708  
 TEL: 6743 9858 A/C: 6392 0830 FAX: 6749 0858  
 Email: yewheng@yewhengauto.sg  
 Co. Reg. No.: 201130046W GST Reg. No.: 201130046W

YHAP  
 A/c 1280

**TAX INVOICE**

M/S : K.KIM HIN AUTO PTE LTD

NO: YLI1213202  
 PAGE: 2

12/10/18

Part No	Description	Location	Qty	Unit Price	Amount
20	J6400A831 ✓ COVER_HEADLAMP SUPT PANEL	2A61	1	SIN 55.00	SIN 55.00
21	JMR200300 ✓ CLIP,FR BUMPER	1AA4	10	1.00	10.00
22	J7812A204 CONDENSER,A/C REFRIGERANT (C99)	2T8	1	480.00	480.00
23	JMN156092 ✓ RADIATOR ASSY	2T7	1	480.00	480.00
TOTAL QUANTITY:			68	TOTAL	SIN 3,656.00
				ADD GST @ 7%	255.92
				GRAND TOTAL	<u>SIN 3,911.92</u>

SJJ7331C  
 ATTN:MR SIMON

*[Handwritten signature]*  
 CM

Case 180669 RD  
 Quote 30/07  
 11.10.18 AXA

Reprint: 1 / TCY / 12/10/2018 4:10:08 PM  
 SALESMAN: TCY

This document is computer generated. No signature required.

GOODS SOLD ARE NOT RETURNABLE





友興汽車零件私人有限公司  
**YEW HENG AUTO PARTS PTE LTD**

BLK 3017 UBI ROAD 1 #04-129 SINGAPORE 408708  
 TEL: 6743 9858 A/C: 6392 0830 FAX: 6749 0658  
 Email: yewheng@yewhengauto.sg  
 Co. Reg. No.: 201130046W GST Reg. No.: 201130046W

**TAX INVOICE**

M/S : **K.KIM HIN AUTO PTE LTD**

160 SIN MING DRIVE #02-18/19/20/21  
 SIN MING AUTOCITY  
 SINGAPORE 575722

NO: **YL11213243**  
 PAGE: **1**  
 DATE: **15/10/2018**  
 A/C CODE: **LYKKH001**  
 TERMS: **60 DAYS**

YHAP  
 A/c 12.00

Part No	Description	Location	Qty	Unit Price	Amount	
				SIN	SIN	
1	J8301C502	COVER_HEADLAMP BULB SOCKET	1T88	2 18.00	36.00	
2	J5902A021	WEATHERSTRIP_HOOD,FR	1V122	1 25.00	25.00	
TOTAL QUANTITY:			3	TOTAL	SIN 61.00	
					ADD GST @ 7%	4.27
					<b>GRAND TOTAL</b>	<b>SIN 65.27</b>

DELIVERY  
 ATTN:MR SIMON  
 SJJ7331C

CM

Q

*[Signature]*

case 1806690D  
 date 30/07  
 11.10.18 AXA

Print / TCY / 15/10/2018 9:05:11 AM  
 SALESMAN: TCY

This document is computer generated. No signature required.

GOODS SOLD ARE NOT RETURNABLE

